

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

PHONE: 301-269-4969/4505

LER NO.	83-14/3L
DOCKET NO.	50-317
LICENSE NO	DPR 53
EVENT DATE	03-11-83
REPORT DATE	04-08-83
<u>ATTACHMENT</u>	

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (CONT'D)

13 charging pump (Armco model No. J-531-M6DF) packing failed due to overfilling of the crankcase with oil. Oil leaked into the plunger cavity which became filled due to the drain being clogged. This resulted in oil entering the packing area. 13 charging pump's plunger cavity drain was opened to allow drainage of the oil, the packing was replaced, and oil level restored to proper level. In the future, the charging pumps will be secured and oil level checked prior to any oil addition. This will prevent any overfilling of oil to the charging pumps. The plunger cavity drain piping will be modified to ensure a more immediate fluid run off. A follow up report will be submitted after this modification has been completed.