

CONTROL BLOCK:

--	--	--	--	--	--	--

 (1)

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

0	1	M	A	P	P	S	1	2	0	0	-	0	0	0	0	0	0	0	3	4	1	1	1	1	4			5		
7	8	LICENSEE CODE						14	15	LICENSE NUMBER										25	26	LICENSE TYPE					30	57	CAT	58

CON'T

REPORT SOURCE: 0 1 7 8

DOCKET NUMBER: L 6 0 5 0 - 0 2 9 3 7 0 4 0 3 8 3 8 0 4 1 3 8 3 9

EVENT DATE: 60 61 68 69 74 75

REPORT DATE: 80

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)

0 2 On 4/3/83, during shutdown conditions the field breaker for the "B" recirc. pump

0 3 M/G set did not trip while being removed from service for maintenance. This

0 4 breaker is part of the ATWS System and had it been activated while in the run

0 5 mode, it might not have provided its intended function. This event created no

0 6 threat to the public health and safety. The NRC was notified via ENS. The

0 7 breaker is a GE type AK-F-2-25 No. 224A3510-43.

08																				80			
SYSTEM CODE		CAUSE CODE		CAUSE SUBCODE		COMPONENT CODE						COMP. SUBCODE		VALVE SUBCODE									
C	B	E	A	C	K	T	B	R	K	Z	Z												
11		12		13		14						15		16									
EVENT YEAR		SEQUENTIAL REPORT NO.		OCCURRENCE CODE		REPORT TYPE		REVISION NO.															
8	3	0	1	3	0	1	T	0															
21		22		23		24		25		26		27		28		29		30		31		32	
ACTION TAKEN		FUTURE ACTION		EFFECT ON PLANT		SHUTDOWN METHOD		HOURS		ATTACHMENT SUBMITTED		NPRD-4 FORM SUB.		PRIME COMP. SUPPLIER		COMPONENT MANUFACTURER							
D	X	C	Z	0	0	0	0	0	Y	N	N	G	0	8	0								
18		19		20		21		22		23		24		25		26							
33		34		35		36		37		40		41		43		46							

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

1 0 | The cause was a bound up mechanism preventing the breaker from opening. The "b"
1 1 | contact did not open which kept the trip coil energized and caused its failure. The
1 2 | breaker was removed, the linkages lubricated with a non-greasy lubricant, both of
1 3 | the coils were replaced (the second due to its close proximity to the failed coil)
1 4 | and, after NRC concurrence with actions taken, returned to service.

FACILITY STATUS		% POWER		OTHER STATUS		METHOD OF DISCOVERY		DISCOVERY DESCRIPTION	
1	5	G	28	0	0	0	29	N/A	30
ACTIVITY RELEASED		CONTENT OF RELEASE		AMOUNT OF ACTIVITY		LOCATION OF RELEASE			
1	6	Z	33	Z	34	N/A	35	N/A	36
PERSONNEL EXPOSURES		NUMBER		TYPE		DESCRIPTION			
1	7	0	0	0	37	Z	38	N/A	39
PERSONNEL INJURIES		NUMBER		DESCRIPTION					
1	8	0	0	0	40	N/A	41		
LOSS OF OR DAMAGE TO FACILITY		TYPE		DESCRIPTION					
1	9	Z	42	N/A	43				
PUBLICITY ISSUED		DESCRIPTION							
2	0	N	44	N/A	45				

NAME OF PREPARER G. G. Whitney

PHONE: (617) 746-7900