

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

0	1	T	N	S	N	P	2	2	0	0	-	0	0	0	0	0	-	0	0	3	4	1	1	1	1	4		5				
7	8	9	LICENSEE CODE					14	15	LICENSE NUMBER										25	26	LICENSE TYPE					30	CAT NO				

CON'T

REPORT SOURCE L 6 0 5 0 0 0 3 2 8 7 0 4 1 3 8 3 8 0 5 0 6 8 3 9

2 8 60 61 68 69 74 75 80

DOCKET NUMBER EVENT DATE REPORT DATE

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)

0 2 | With unit 2 in mode 1 (98% Rx power) at 0730 CST on 04/13/83, one control rod

0 3 | (D-8) failed to move with the rest of the bank upon demand and became misaligned

0 4 | by more than 12 steps. This event required entry into action statement 'c' of

0 5 | LCO 3.1.3.1. There was no effect upon public health and safety. Previous

0 6 | occurrences -- none.

0 7 |

0 8 |

09		SYSTEM CODE R B 11		CAUSE CODE E 12		CAUSE SUBCODE A 13		COMPONENT CODE C K T B R K 14				COMP. SUBCODE B 15		VALVE SUBCODE Z 16			
17		LEAD/NO REPORT NUMBER 8 3		EVENT YEAR 21 22		SEQUENTIAL REPORT NO. 0 5 10		OCCURRENCE CODE 0 3		REPORT TYPE L		REVISION NO. 0					
ACTION TAKEN X 18		FUTURE ACTION X 19		EFFECT ON PLANT Z 20		SHUTDOWN METHOD Z 21		HOURS 22 0 0 0 0		ATTACHMENT SUBMITTED N 23		NPRD.4 FORM SUB. N 24		PRIME COMP. SUPPLIER L 25		COMPONENT MANUFACTURER W 1 2 3	

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

1 0 Troubleshooting indicated the problem to be in the control wiring. - The lift coil
1 1 was found inoperable due to an open connection at the vessel head. Since the head
1 2 is inaccessible with the unit at power, plans are being made to repair the open
1 3 connection at the next unit 2 outage. The unit will continue to comply with the
1 4 action statement until repairs have been made.

FACILITY STATUS: 1 5 E 28 10 9 8 29 NA 30
 % POWER: 10 9 8 29
 OTHER STATUS: NA 30
 METHOD OF DISCOVERY: B 31 Operator observation 32
 DISCOVERY DESCRIPTION: 32
 ACTIVITY CONTENT: 1 6 Z 33 10 Z 34 NA 35
 RELEASED OF RELEASE: 10 Z 34
 AMOUNT OF ACTIVITY: NA 35
 LOCATION OF RELEASE: 36
 PERSONNEL EXPOSURES: 1 7 0 0 0 37 Z 38 NA 39
 NUMBER: 0 0 0 37
 TYPE: Z 38
 DESCRIPTION: NA 39
 PERSONNEL INJURIES: 1 8 0 0 0 40 NA 41
 NUMBER: 0 0 0 40
 DESCRIPTION: NA 41
 LOSS OF OR DAMAGE TO FACILITY: 1 9 Z 42 NA 43
 TYPE: Z 42
 DESCRIPTION: NA 43
 PUBLICITY: 2 0 N 44 NA 45
 ISSUED: N 44
 DESCRIPTION: NA 45
 8305110419 830506
 PDR ADOCK 05000328
 S PDR
 NRC USE ONLY