

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

PHONE 714/492-7700

ATTACHMENT TO LER 83-037
SOUTHERN CALIFORNIA EDISON COMPANY
SAN ONOFRE NUCLEAR GENERATING COMPANY
UNIT No. 3, DOCKET NO. 50-362

SUPPLEMENTAL INFORMATION FOR CAUSE DESCRIPTION AND CORRECTIVE ACTION

This one volt increase caused the trip setpoint to be 300 psid higher than the correct value. The Unit 3 setpoint calculations were rechecked and it was discovered that they contained the same error. C-E has reviewed the setpoint calculation to assure that the High Steam Generator Delta Pressure trip is the only application where this type of error could exist.

The affected setpoints have now been correctly installed in the PPS and the system presently functions as described in the Safety Analysis Report. No further corrective actions are required.