

CONTROL BLOCK

PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION

01 N C M G S 1 2 0 0 - 0 0 0 0 0 - 0 0 3 4 1 1 1 1 4 5
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

CONT

01 REPORT SOURCE L 0 5 0 0 0 3 6 9 7 0 7 1 6 8 3 0 8 1 7 8 3 9
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)

02 While in Mode 1, on 7/15/83 and again on 7/21/83, reactor coolant loop B overtem-
03 perature delta T instrument loop was declared inoperable when the control room
04 indicator was found reading higher than other channels during routine surveillance.
05 This violates T.S.3.3.1 which is reportable per T.S.6.9.1.11(b) and similar to
06 RO's 369/81-125 and 82-18. The failure mode of loop B of delta T was conservative
07 (high) and this channel would have tripped earlier than the others in any event.
08 Other channels were operable. The channel was placed in the tripped condition per
09 the action statement. Health and safety of the public were unaffected.

09 I A 11 E 12 X 13 I N S T R U 14 X 15 Z 16
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

17 LEN/RO REPORT NUMBER 8 3 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

ACTION TAKEN FUTURE ACTION EFFECT ON PLANT SHUTDOWN METHOD HOURS ATTACHMENT SUBMITTED NPRO-4 FORM SUB PRIME COMP. SUPPLIER COMPONENT MANUFACTURER
X 18 X 19 Z 20 Z 21 0 0 0 0 N 23 N 24 L 25 W 1 2 0 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

10 The cabinet containing the circuitry was hot during increases in control room tem-
11 perature due to chiller problems (see RO-369/83-56). Problem attributed to heat
12 sensitive circuit cards in the 7300 process control system even though control room
13 temperature did not exceed limits. Indicator returned to normal upon cooling pre-
14 venting identification of defective card. Methodology to identify and correct card
15 in event of of another malfunction established.

15 E 28 1 0 0 29 N/A B 31 Routine Surveillance
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

16 Z 33 Z 34 N/A N/A
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

17 0 0 0 37 Z 38 N/A
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

18 0 0 0 40 N/A
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

19 Z 42 N/A
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

20 N 44 N/A
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

NAME OF PREPARER Phillip B. Nardoci

PHONE (704) 373-7432

JE 27

DUKE POWER COMPANY
P.O. BOX 33189
CHARLOTTE, N.C. 28242

HAL B. TUCKER
VICE PRESIDENT
NUCLEAR PRODUCTION

TELEPHONE
(704) 373-4531

83 AUG 23 9:48
August 17, 1983

Mr. James P. O'Reilly, Regional Administrator
U. S. Nuclear Regulatory Commission
Region II
101 Marietta Street NW, Suite 2900
Atlanta, Georgia 30303

Subject: McGuire Nuclear Station Unit 1
Docket No. 50-369
LER/RO-369/83-57

Dear Mr. O'Reilly:

Please find attached Reportable Occurrence Report RO-369/83-57. This report concerns T.S. 3.3.1, "As a minimum, the reactor trip system instrumentation channels and interlocks of Table 3.3-1 shall be operable...". This incident was considered to be of no significance with respect to the health and safety of the public.

Very truly yours,

H.B. Tucker / BT

Hal B. Tucker

PBN:jfw
Attachment

cc: Document Control Desk
U. S. Nuclear Regulatory Commission
Washington, D. C. 20555

Mr. W. T. Orders
NRC Resident Inspector
McGuire Nuclear Station

Records Center
Institute of Nuclear Power Operations
1100 Circle 75 Parkway, Suite 1500
Atlanta, Georgia 30339

OFFICIAL COPY

TE 22 11