

CONTROL BLOCK

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

01 N C M G S I 000-000000-000 41111 4 5  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

CONT

01 REPORT SOURCE L 050000369 07071783 081783 9  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

## EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)

02 While in Mode 1, Channel III reactor coolant loop C flow instrumentation was de-  
03 clared inoperable when routine surveillance found the channel to be reading lower  
04 than other channels on NC loop C. This violates T.S.3.3.1 which is reportable per  
05 T.S.6.9.1.11(a) and similar to RO's 369/81-156, 81-169, 82-49, and 82-82. The  
06 channel was placed in the tripped condition per the action statement. This mal-  
07 function was in the conservative direction, channels I and II were operational,  
08 and the allowable setpoint for low reactor coolant flow was not violated. Health  
09 and safety of the public were unaffected.

09 I A 11 E 12 E 13 I N S T R U 14 T 15 Z 16  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

## CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

10 The flow transmitter (Westinghouse Veritrak Model 59DP4E99-7050) was out of tol-  
11 erance. This transmitter had experienced a slight drift problem in November 1982  
12 (See RO-369/82-82) and had been recalibrated. The transmitter was replaced with  
13 a calibrated transmitter of the same type, and the loop returned to service.

14  
15 E 28 100 29 N/A B 31 Routine Surveillance 32  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

16 Z 33 Z 34 N/A 35  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

17 000 37 Z 38 N/A 39  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

18 000 40 N/A 41  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

19 Z 42 N/A 43  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

20 N 44 N/A 45  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

NAME OF PREPARER Phillip B. Nardoci PHONE (704) 373-7432

USNRC REGION II  
DUKE POWER COMPANY  
P.O. BOX 33189  
CHARLOTTE, N.C. 28242

HAL B. TUCKER  
VICE PRESIDENT  
NUCLEAR PRODUCTION

TELEPHONE  
(704) 373-4531

82 AUG 23, 1983 48

Mr. James P. O'Reilly, Regional Administrator  
U. S. Nuclear Regulatory Commission  
Region II  
101 Marietta Street NW, Suite 2900  
Atlanta, Georgia 30303

Subject: McGuire Nuclear Station Unit 1  
Docket No. 50-369  
LER/RO-369/83-58

Dear Mr. O'Reilly:

Please find attached Reportable Occurrence Report RO-369/83-58. This report concerns T.S. 3.3.1, "As a minimum, the reactor trip system instrumentation channels and interlocks of Table 3.3-1 shall be operable...". This incident was considered to be of no significance with respect to the health and safety of the public.

Very truly yours,

*H.B. Tucker / BT*

Hal B. Tucker

PBN:jfw  
Attachment

cc: Document Control Desk  
U. S. Nuclear Regulatory Commission  
Washington, D. C. 20555

Mr. W. T. Orders  
NRC Resident Inspector  
McGuire Nuclear Station

Records Center  
Institute of Nuclear Power Operations  
1100 Circle 75 Parkway, Suite 1500  
Atlanta, Georgia 30339

OFFICIAL COPY

IE 22 11