

CONTROL BLOCK: | | | | | | | (1) (PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

SCNT
3 1
7 3

REPORT SOURCE L 6 0 5 0 0 0 3 1 6 7 0 6 2 3 8 3 3 0 7 1 4 8 3 9
60 61 DOCKET NUMBER 66 69 EVENT DATE 74 75 REPORT DATE 80

2 | 2 | DURING NORMAL OPERATIONS, FIRE DOOR #386 BETWEEN QUAD 2 AND THE NESW VALVE GALLERY,

513 | WOULD NOT LATCH PROPERLY ON TWO OCCASIONS, (6/23/83, 7/1/83). THIS CONSTITUTED AN

514 | INOPERABLE PENETRATION FIRE BARRIER, NON-CONSERVATIVE WITH RESPECT TO T.S. 3.7.10.

215 | ACTION REQUIREMENTS WERE MET. PUBLIC HEALTH AND SAFETY WERE NOT AFFECTED.

216 | PREVIOUS OCCURRENCE: 050-316; 83-037.

37

0-3

SYSTEM CODE A B 11		CAUSE CODE E 12		CAUSE SUBCODE B 13		COMPONENT CODE X X X X X X 14						COMP. SUBCODE Z 15		VALVE SUBCODE Z 16			
EVENT YEAR 8 3 21 22		SEQUENTIAL REPORT NO. 0 5 4 24 25		OCCURRENCE CODE 0 3 28 29		REPORT TYPE L 30		REVISION NO. 0 32									
ACTION TAKEN B 18		FUTURE ACTION Z 19		EFFECT ON PLANT Z 20		SHUTDOWN METHOD Z 21		HOURS 0 0 0 0 22 37 40		ATTACHMENT SUBMITTED N 23 41		NPRO-4 FORM SUB. N 24 42		PRIME COMP. SUPPLIER A 25 43		COMPONENT MANUFACTURER X 9 9 9 26 44 47	

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

113 ON 6/23/83, THE DOOR KNOB RETURN SPRING BECAME DETACHED AND THE DOOR WOULD NOT LATCH.

THE RETURN SPRING WAS REATTACHED AND THE DOOR KNOB PROPERLY ADJUSTED. ON 7/1/83, THE

LATCH PLATE WAS FOUND TO BE BENT. THE PLATE WAS REMOVED, STRAIGHTENED, AND

REINSTALLED. IN BOTH CASES THE DOOR WOULD CLOSE BUT NOT LATCH. IN EACH CASE THE

DOOR WAS TESTED PER 12 MHP 4030.STP.027 AND OPERATED SATISFACTORILY.

FACILITY STATUS (28) E (29) 1 0 0 (30) NA (31) B (32) OPERATOR OBSERVATION
 ACTIVITY CONTENT RELEASED OF RELEASE (33) Z (34) Z (35) NA (36) LOCATION OF RELEASE
 PERSONNEL EXPOSURES NUMBER TYPE DESCRIPTION (39) NA
 PERSONNEL INJURIES NUMBER DESCRIPTION (41) NA
 LOSS OF OR DAMAGE TO FACILITY TYPE DESCRIPTION (43) NA
 PUBLICITY ISSUED DESCRIPTION (45) N (46) S (47) PDR
 NAME OF PREPARER PAUL CARTEAUX
 NRC USE ONLY
 PHONE 616-465-5901