

LICENSEE EVENT REPORT

CONTROL BLOCK: (PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

01 M I P A I I 1 2 0 0 - 0 0 0 0 0 0 - 0 0 3 4 1 1 1 1 4 5
7 8 9 LICENSEE CODE 14 15 LICENSE NUMBER 25 26 LICENSE TYPE 30 31 CAT 58 59

CON'T
01 REPORT SOURCE L 6 0 5 0 0 0 0 2 5 5 7 1 1 1 2 1 8 3 8 1 2 0 2 8 3 9
7 8 9 DOCKET NUMBER 60 61 EVENT DATE 74 75 REPORT DATE 80

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)

02 During review of the Fire Protection System and the associated T.S. Surveil-
03 lance Procedure for fire detector instrumentation, it was discovered that the
04 T.S. Surveillance Procedure (SO-6) tests only one(1) of the three (3) water
05 flow switch detectors required by T.S. Table 3.22.1 for Switchgear Room 1-D.
06 Hourly fire watch tours were already being maintained in the area per T.S.
07 3.22.5.1 The two flow switches in question were subsequently tested and their
08 operability verified. Condition reportable per T.S. 3.22.1.1 and 6.9.2a(6).
7 8 9

09 SYSTEM CODE A B 11 CAUSE CODE D 12 CAUSE SUBCODE Z 13 COMPONENT CODE Z Z Z Z Z Z Z 14 COMP. SUBCODE Z 15 VALVE SUBCODE Z 16
7 8 9
17 LER/RO REPORT NUMBER 8 3 21 EVENT YEAR 8 3 22 SEQUENTIAL REPORT NO. 0 7 3 24 OCCURRENCE CODE 0 1 28 REPORT TYPE T 30 REVISION NO. 0 32
ACTION TAKEN X 18 FUTURE ACTION X 19 EFFECT ON PLANT Z 20 SHUTDOWN METHOD Z 21 HOURS 0 0 0 0 22 ATTACHMENT SUBMITTED N 23 NRC-4 FORM SUB. N 24 PRIME COMP. SUPPLIER Z 25 COMPONENT MANUFACTURER Z 9 9 1 0 26
33 34 35 36 37 38 39 40 41 42 43 44 45 46 47

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

10 Cause attributed to procedural inadequacy resulting from a misleading state-
11 ment in the procedure's basis document which implies that the T.S. require-
12 ment is for the alarm rather than the individual detectors. The T.S. surveil-
13 lance Procedure (SO-6) will be revised to incorporate the omitted require-
14 ments of T.S. Table 3.22.1. (SO-6) will be re-performed prior to start-up.
7 8 9

15 FACILITY STATUS H 28 % POWER 0 0 0 0 29 OTHER STATUS NA 30 METHOD OF DISCOVERY A 31 DISCOVERY DESCRIPTION Review of Surveillance Procedure 32
7 8 9
16 ACTIVITY CONTENT RELEASED OF RELEASE Z 33 AMOUNT OF ACTIVITY NA 35 LOCATION OF RELEASE NA 36
7 8 9
17 PERSONNEL EXPOSURES NUMBER 0 0 0 37 TYPE Z 38 DESCRIPTION NA 39
7 8 9
18 PERSONNEL INJURIES NUMBER 0 0 0 40 DESCRIPTION NA 41
7 8 9
19 LOSS OF OR DAMAGE TO FACILITY TYPE Z 42 DESCRIPTION NA 43
7 8 9
20 PUBLICITY ISSUED N 44 DESCRIPTION NA 45
7 8 9
NRC USE ONLY
68 69 70



Consumers
Power
Company

General Offices: 1945 West Parnall Road, Jackson, MI 49201 • (517) 788-1638

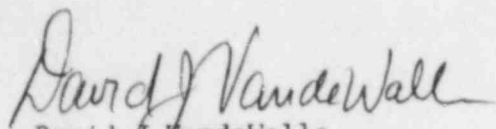
DMB
David J VandeWalle
Director of
Nuclear Licensing

December 2, 1983

James G Keppler, Administrator
Region III
US Nuclear Regulatory Commission
799 Roosevelt Road
Glen Ellyn, IL 60137

DOCKET 50-255 - LICENSE DPR-20-
PALISADES PLANT - LICENSEE EVENT REPORT 83-073 -
FIRE PROTECTION SYSTEM

On the reverse side is Licensee Event Report (LER) 83-073, (Fire Protection System). Reportability is based on Technical Specification 6.9.2a(6).


David J VandeWalle
Director, Nuclear Licensing

CC Director, Office of Nuclear Reactor Regulation
Director, Office of Inspection and Enforcement
NRC Resident Inspector-Big Rock Point

oc1283-0303a142

DEC -5 1983

IE22 1/0