

LICENSEE EVENT REPORT

CONTROL BLOCK: 1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

0 1 C T M N S 2 0 0 - 0 0 0 0 0 - 0 0 3 4 1 1 1 1 4 5
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

CON'T

0 1 REPORT SOURCE L 0 5 0 0 0 3 3 6 7 0 4 0 2 8 2 8 0 4 0 2 8 4 9
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES

0 2 The plant was in steady state operation at 95% power. During the monthly surveillance
0 3 testing, the setpoint for the Reactor Coolant Pump Speed Sensing Bistable Trip, on
0 4 Channel B, was found to be out of specification in a non-conservative direction. The
0 5 plant was operated in accordance with action statement 2 of Technical Specification
0 6 4.3.1.1.1. Similar occurrences: The following LER's all dealt with instrument drift
0 7 within the General Atomic Bistable trip units, 76-48, 78-24, 79-24, 81-16.
0 8
0 9

0 9 SYSTEM CODE I A 11 CAUSE CODE E 12 CAUSE SUBCODE G 13 COMPONENT CODE I N S T R U 14 COMP. SUBCODE X 15 VALVE SUBCODE Z 16
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

17 LER NO. REPORT NUMBER 8 2 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

18 ACTION TAKEN E 19 FUTURE ACTION A 20 EFFECT ON PLANT Z 21 SHUTDOWN METHOD Z 22 HOURS 0 0 0 0 23 ATTACHMENT SUBMITTED N 24 NPD-4 FORM SUB Y 25 PRIME COMP. SUPPLIER N 26 COMPONENT MANUFACTURER G 0 6 3 26

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS

1 0 The cause of the out of specification setpoint was instrument drift within the Gulf
1 1 Atomic bistable trip unit, Model EID-240. The bistable was immediately adjusted to
1 2 trip within the allowable tolerances. The bistable trip unit was replaced during
1 3 the 1984 refuel outage. The new bistable trip unit (Electro-Mechanics, Model 34860)
1 4 will enhance the reliability of the auctioneered process loop signals.
1 5
1 6
1 7
1 8
1 9
2 0

1 5 FACILITY STATUS E 28 % POWER 0 9 5 29 OTHER STATUS NA 30 METHOD OF DISCOVERY B 31 DISCOVERY DESCRIPTION Surveillance Testing 32
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

1 6 ACTIVITY CONTENT RELEASED OF RELEASE Z 33 Z 34 AMOUNT OF ACTIVITY NA 35 LOCATION OF RELEASE NA 36
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

1 7 PERSONNEL EXPOSURES NUMBER 0 0 0 37 TYPE Z 38 DESCRIPTION NA 39
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

1 8 PERSONNEL INJURIES NUMBER 0 0 0 40 DESCRIPTION NA 41
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

1 9 LOSS OF OR DAMAGE TO FACILITY TYPE Z 42 DESCRIPTION NA 43
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

2 0 PUBLICITY ISSUED N 44 DESCRIPTION NA 45
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

8404240029 840402
PDR ADOCK 05000336
S PDR

NRC USE ONLY

NAME OF PREPARER

Keith D. Deslandes

PHONE 447-1791 X4421

NORTHEAST UTILITIES



THE CONNECTICUT LIGHT AND POWER COMPANY
WESTERN MASSACHUSETTS ELECTRIC COMPANY
HOLYOKE WATER POWER COMPANY
NORTHEAST UTILITIES SERVICE COMPANY
NORTHEAST NUCLEAR ENERGY COMPANY

General Offices • Selden Street, Berlin, Connecticut

P.O. BOX 270
HARTFORD, CONNECTICUT 06141-0270
(203) 666-6911

April 2, 1984
MP-5917

Dr. Thomas E. Murley
Regional Administrator, Region 1
U. S. Nuclear Regulatory Commission
631 Park Avenue
King of Prussia, PA. 19406

Reference: Provisional License DPR-65
Docket No. 50-336
Reportable Occurrence RO 50-336/82-08/3X-1

Dear Dr. Murley:

This letter forwards the updated Licensee Event Report for Reportable Occurrence RO 82-08/3X-1. An additional three copies of the report are enclosed.

Yours truly,

NORTHEAST NUCLEAR ENERGY COMPANY

A handwritten signature in cursive script, appearing to read 'E. J. Mroczka'.

E. J. Mroczka

Station Superintendent
Millstone Nuclear Power Station

EJM/KDD:mo

Attachment: LER RO 50-336/82-08/3X-1

cc: Director, Office of Inspection and Enforcement, Washington, D. C. (30)
Director, Office of Management Information and Program Control,
Washington, D. C. (3)
U. S. Nuclear Regulatory Commission, c/o Document Management Branch,
Washington, D. C. 20555

Handwritten notes in the bottom right corner: 'I E22' and '1/1'.