

Consolidated Edison Company of New York, Inc.  
4 Irving Place, New York, NY 10003

January 21, 1974

Re: Indian Point Unit No. 2  
AEC Docket No. 50-247  
Operating License DPR-26  
A.O.-4-2-3

Mr. James P. O'Reilly, Director  
Regulatory Operations, Region I  
U. S. Atomic Energy Commission  
631 Park Avenue  
King of Prussia, Pennsylvania 19406

Dear Mr. O'Reilly,

In accordance with the requirements of Section 6.12.2a of the Technical Specifications of Facility Operating License No. DPR-26, the following report is submitted.

Following completion of repairs associated with the November 13, 1973 feedwater line break incident, an inspection of all Bergen-Paterson hydraulic shock and sway arrestors (snubbers) located in the vapor containment was performed. This inspection was completed on January 18, 1974 and of the approximately 350 snubbers in the containment two (2) did not meet the established criterion for operability; that is, the accumulator oil level plunger was more than one inch below the "EXT" mark.

One of the above two snubbers (SR-1040) is located on the component cooling return line (Line No. 14) from upper bearing cooler of No. 23 reactor coolant pump and the other (SR-48-SR3) is located on the secondary blowdown line (Line No. 48) from No. 24 steam generator. Both snubbers have been replaced with spares. The two defective snubbers will be disassembled for inspection in an effort to determine the cause of failure.

Mr. Don Caphton of your office was notified of this occurrence by Mr. John Makepeace on January 18, 1974.

Very truly yours,

*Warren R. Cobean, Jr.*

Warren R. Cobean, Jr., Manager  
Nuclear Power Generation

8304050060 740201  
PDR ADDCK 05000247  
S PDR

cc: Mr. John F. O'Leary

COPY SENT REGION I