

LICENSEE NAME										LICENSE NUMBER										LICENSE TYPE					EVENT TYPE	
01	I	L	D	R	S	2	0	0	-	0	0	0	0	0	-	0	0	4	1	1	1	1	0	3		
7	8	9				14	15										25	26				30	31	32		

CATEGORY		REPORT TYPE	REPORT SOURCE	DOCKET NUMBER										EVENT DATE					REPORT DATE				
01	CONT	L	L	0	5	0	-	0	2	3	7	1	0	0	3	7	6	0	3	0	3	7	
7	8	9	57	58	59	60	61					65	66				74	75					

EVENT DESCRIPTION

During normal operation, radiation protection personnel reported that stack gas sample pump flow appeared to be abnormally low. An operator confirmed that 2/3 "A" pump flow was 2.6 SCFM; 2/3 "B" pump flow was 0.0 SCFM (flow greater than 2.9 SCFM is considered normal). Tech Spec section 3.8.A.1 requires continuous chimney monitoring, but states that during plateout tests, when both pumps must

(Continued)

SYSTEM CODE	CAUSE CODE	COMPONENT CODE					PRIME COMPONENT SUPPLIER	COMPONENT MANUFACTURER			VIOLATION	
B	A	Z	Z	Z	Z	Z	Z	Z	9	9	9	Y
7	8	9	10	11	12	17	43	44			47	48

CAUSE DESCRIPTION

Normal wear products from the carbon impeller vanes collected in the sample lines, pump cavity, and filter of the 2/3 "A" pump, resulting in reduced pump efficiency and flow. The zero-flow condition on the 2/3 "B" pump was caused

(Continued)

FACILITY STATUS	% POWER	OTHER STATUS		METHOD OF DISCOVERY		DISCOVERY DESCRIPTION		
E	0	9	7	NA	A	NA		
7	8	9	10	12	13	44	45	46

FORM OF ACTIVITY RELEASED	CONTENT OF RELEASE	AMOUNT OF ACTIVITY		LOCATION OF RELEASE		
Z	Z	NA		NA		
7	8	9	10	11	44	45

PERSONNEL EXPOSURES

NUMBER	TYPE	DESCRIPTION			
0	0	0	Z	NA	
7	8	9	11	12	13

PERSONNEL INJURIES

NUMBER	DESCRIPTION			
0	0	0	NA	
7	8	9	11	12

OFFSITE CONSEQUENCES

NA

LOSS OR DAMAGE TO FACILITY

TYPE	DESCRIPTION		
Z	NA		
7	8	9	10

PUBLICITY

NA

ADDITIONAL FACTORS

NA

8304050157 770303
PDR ADOCK 05000237
S PDR

NAME: Randolph C. Weidner

PHONE: Ext. 265

EVENT DESCRIPTION (Continued)

be out of service, the steam jet air ejector monitors may be used to satisfy the plant chimney monitoring requirements if the reactor is operating at a steady-state power level. Although a plateout test was not being performed when both pumps were forced out of service, the reactor had been operating in the steady-state condition for 13 hours, and both steam jet air ejector monitors were operable. During the period from 1725 to 1930 hours, while the 2/3 "A" sample pump and suction filter were being replaced to provide rapid compliance with Tech Spec requirements, the steady-state operation of the unit and the static response of the SJAE monitors ensured that no unacceptable releases occurred. Because the cause of failure could not be readily identified on the 2/3 "B" sample pump, it was decided to first restore the operability of the "A" sample pump by simply replacing the pump and suction filter. Personnel errors resulting in stack gas sample pump problems have occurred occasionally in the past. (50-237/1976-63)

CAUSE DESCRIPTION (Continued)

by an improper valve lineup.

As stated above, the 2/3 "A" sample pump and suction filter were replaced. The 2/3 "B" sample pump was returned to service at 1125 hours on 10/4/76, after the valving error was discovered.

Reevaluation of the events related to the temporary loss of stack gas sampling capability on October 3, 1976, has resulted in the following conclusions:

1. The proximate cause of the event was personnel error (cause code A). This conclusion is based on the fact that, at the time of the event, the operator was unable to establish flow in the standby sample train even though no equipment malfunction existed.
2. The root cause of the event was the inadequacy of the system description in the applicable operating procedure -- DOP 1700-4. Had a piping and valve diagram been included in the procedure, the operator would certainly have been able to readily perform the valving required to place the standby sample train in service.

To avoid recurrence, procedure DOP 1700-4, Off-Gas Vent (Stack) Radiation Monitoring System, was revised, and a valve and piping diagram and isometric drawing were added. Additionally, a copy of the new valve and piping diagram has been posted in the sample pump area.




Commonwealth Edison
One First National Plaza, Chicago, Illinois
Address Reply to: Post Office Box 767
Chicago, Illinois 60690

BBS Ltr. #77-176

1E FILE COPY

March 7, 1977

Mr. James G. Keppler, Regional Director
Directorate of Regulatory Operations - Region III
U. S. Nuclear Regulatory Commission
799 Roosevelt Road
Glen Ellyn, Illinois 60137

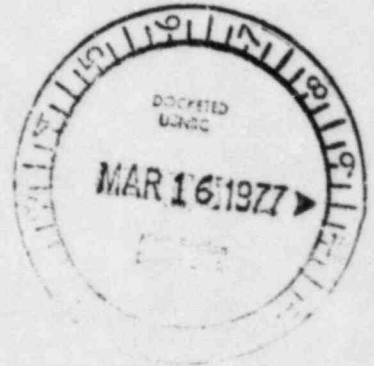

REFERENCES: Docket Number 50-237
Docket Number 50-249

Enclosed please find an update report to Reportable Occurrence report number 50-237/1976-63. This report is being submitted to your office in accordance with the Dresden Nuclear Power Station Technical Specifications, Section 6.6.B.

B. B. Stephenson
Station Superintendent
Dresden Nuclear Power Station

BBS:jo

Enclosure

cc: Director of Inspection & Enforcement
Director of Management Information & Program Control
File/NRC

770760/50