



Telegram

DEB840 SSA136

1971 DEC 30 AM 9 35

DE JLA006 ZO PD=TDJL MORRIS ILL 30 835A CST= 50-237
BOYCE GRIER US ATOMIC ENERGY COMMISSION=
REGION 3 COMPLIANCE 799 ROOSEVELT RD GLEN ELLYN ILL=
DPR-19 DRESDEN NUCLEAR POWER STATION UNIT 2:=THIS WILL
CONFIRM A CONVERSATION AT 14:15 HOURS THIS DATE WITH H
DANCE REGARDING THE FAILURE OF A MAIN STEAM LINE FLOW
SWITCH WHICH WAS DISCOVERED DURING ROUTINE SURVEILLANCE
ON 12/29/71 AT 11:00HOURS. MOISTURE LEAKED INTO A JUNCTION
BOX AND TRAVELLED THROUGH A CONDUIT INTO THE SWITCH. THIS
CAUSED THE SWITCH TO BE IMMOBILIZED BY RUST. THE ISOLATION
CHANNEL WHICH WAS OPERATED BY THE SWITCH WAS PUT IN THE

WU 1201 (R 5-69)

TRIP CONDITION DURING THE REPAIRS. THE SWITCH WAS
REPLACED AND THE JUNCTION BOX WAS SEALED AGAINST MOISTURE=
H K HOYT SUPT DRESDEN NUCLEAR POWER STATION
MORRIS ILL.=

Incident?
TELEPHONE NO. 858-2660
TELEPHONED TO *Person*
TIME DELIVERED *945*
BY *W* TO BE *med*

=DPR-19 2 14:15 12/29/71 11:00.1

1 5404

B304080040 711119
PDR ADOCK 05000237
G PDR

Copy sent PDR