

MGMWSHB WSH

2-055322B191-001 07/10/73

ICS SOTOIPF MLTN

SUSPECTED DUPLICATE 2-080887E191 ICS IPMMTZZ CSP

8033321351 MGM TDMT HARTSVILLE S 152 07-10 0340P EST

ZIP 20545




western union Mailgram



50-261

JOHN F OLEARY
DIRECTORATE OF LICENSING USAEC
WASHINGTON DC 20545

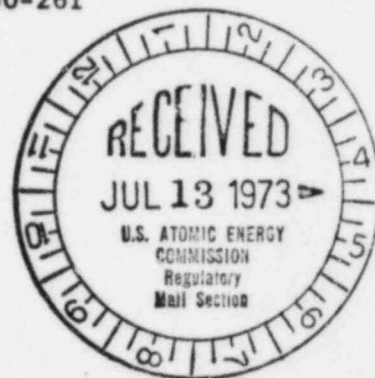

IN ACCORDANCE WITH SECTION 6.6.2 OF THE TECHNICAL SPECIFICATIONS THE FOLLOWING ABNORMAL OCCURRENCE IS REPORTED AT 0830 ON JULY 10 WHILE ROUTINELY PUTTING CONTAINMENT FOR COOLER NUMBER TWO IN SERVICE, THE CIRCUIT BREAKER FOR THIS FAN TRIPPED. INVESTIGATION REVEALED THAT THE TRIP WAS INITIATED BY INSTANTANEOUSLY OVER OCCURRENCE CAUSED BY THE MISALIGNMENT OF THE INSTANTANEOUSLY CALIBRATION SPRING IN THE OVER CURRENT TRIP DEVICE. THE DEVICE WAS REMOVED, THE SPRING REALIGNED AND THE COOLING UNIT PUT IN SERVICE SATISFACTORILY AT 1007. TO PREVENT THE RECURRENCE OF THIS TRIP, ALL NEWLY INSTALLED TRIP DEVICES ARE BEING VISUALLY INSPECTED FOR PROPER SPRING ALIGNMENT. THIS UNIT HAD OPERATED SATISFACTORILY FOLLOWING THE INSTALLATION OF THE NEW TRIP DEVICE. THIS WAS REPORTED TO MR HERB WHITTNER IN PERSON ON JULY 10, 1973.

BENNY J FURR MANAGER H B ROBINSON SEG PLANT PO BOX 790 HARTSVILLE SC 29550

2041 EST

MGMWSHB WSH

Handwritten: 50-261

5438

8307200324 730717
PDR ADOCK 05000261
S PDR

COPY SENT REGION