

LICENSEE EVENT REPORT (LER)

FACILITY NAME (1)
LaSalle County Station Unit 2DOCKET NUMBER (2)
0 5 0 0 0 3 7 4 1 OF 0 3TITLE (4)
RHR - Shutdown Cooling Isolation

| EVENT DATE (5) | | | LER NUMBER (8) | | | REPORT DATE (7) | | | OTHER FACILITIES INVOLVED (6) | | |
|----------------|-----|------|----------------|-------------------|-----------------|-----------------|-----|------|-------------------------------|------------------|--|
| MONTH | DAY | YEAR | YEAR | SEQUENTIAL NUMBER | REVISION NUMBER | MONTH | DAY | YEAR | FACILITY NAMES | DOCKET NUMBER(S) | |
| 03 | 08 | 84 | 84 | 009 | 000 | 03 | 13 | 84 | N/A | 0 5 0 0 0 | |
| | | | | | | | | | | 0 5 0 0 0 | |

| OPERATING MODE (9) | THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CFR 50. (Check one or more of the following) (11) | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
|--------------------|--|-----------|---------------------|--|-----------------|----------|-----------------|-------------|--|----------------|----------|------------------|-------------|--|-----------------|--|-------------------|----------------|--|---------------------|--|------------------|-----------------|--|---------------------|--|-----------------|------------------|--|-------------------|--|------------------|-----------------|--|-----------------|--|
| 4 | <table border="1"><tr><td>20.402(b)</td><td>20.405(a)</td><td>X</td><td>50.73(a)(2)(iv)</td><td>73.71(b)</td></tr><tr><td>20.405(a)(1)(i)</td><td>50.36(a)(1)</td><td></td><td>50.73(a)(2)(v)</td><td>73.71(a)</td></tr><tr><td>20.405(a)(1)(ii)</td><td>50.36(a)(2)</td><td></td><td>50.73(a)(2)(vi)</td><td>OTHER (Specify in Abstract below and in Text, NRC Form 305A)</td></tr><tr><td>20.405(a)(1)(iii)</td><td>50.73(a)(2)(i)</td><td></td><td>50.73(a)(2)(vii)(A)</td><td></td></tr><tr><td>20.405(a)(1)(iv)</td><td>50.73(a)(2)(ii)</td><td></td><td>50.73(a)(2)(vii)(B)</td><td></td></tr><tr><td>20.405(a)(1)(v)</td><td>50.73(a)(2)(iii)</td><td></td><td>50.73(a)(2)(viii)</td><td></td></tr><tr><td>20.405(a)(1)(vi)</td><td>50.73(a)(2)(iv)</td><td></td><td>50.73(a)(2)(ix)</td><td></td></tr></table> | 20.402(b) | 20.405(a) | X | 50.73(a)(2)(iv) | 73.71(b) | 20.405(a)(1)(i) | 50.36(a)(1) | | 50.73(a)(2)(v) | 73.71(a) | 20.405(a)(1)(ii) | 50.36(a)(2) | | 50.73(a)(2)(vi) | OTHER (Specify in Abstract below and in Text, NRC Form 305A) | 20.405(a)(1)(iii) | 50.73(a)(2)(i) | | 50.73(a)(2)(vii)(A) | | 20.405(a)(1)(iv) | 50.73(a)(2)(ii) | | 50.73(a)(2)(vii)(B) | | 20.405(a)(1)(v) | 50.73(a)(2)(iii) | | 50.73(a)(2)(viii) | | 20.405(a)(1)(vi) | 50.73(a)(2)(iv) | | 50.73(a)(2)(ix) | |
| 20.402(b) | 20.405(a) | X | 50.73(a)(2)(iv) | 73.71(b) | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 20.405(a)(1)(i) | 50.36(a)(1) | | 50.73(a)(2)(v) | 73.71(a) | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 20.405(a)(1)(ii) | 50.36(a)(2) | | 50.73(a)(2)(vi) | OTHER (Specify in Abstract below and in Text, NRC Form 305A) | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 20.405(a)(1)(iii) | 50.73(a)(2)(i) | | 50.73(a)(2)(vii)(A) | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 20.405(a)(1)(iv) | 50.73(a)(2)(ii) | | 50.73(a)(2)(vii)(B) | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 20.405(a)(1)(v) | 50.73(a)(2)(iii) | | 50.73(a)(2)(viii) | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |
| 20.405(a)(1)(vi) | 50.73(a)(2)(iv) | | 50.73(a)(2)(ix) | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | | |

LICENSEE CONTACT FOR THIS LER (12)
NAME: Mark D. Schaible, extension 469
TELEPHONE NUMBER: 815 315 7167 611

| COMPLETE ONE LINE FOR EACH COMPONENT FAILURE DESCRIBED IN THIS REPORT (13) | | | | | | | | | |
|--|--------|-----------|--------------|-------------------|-------|--------|-----------|--------------|-------------------|
| CAUSE | SYSTEM | COMPONENT | MANUFACTURER | REPORTABLE TO NRC | CAUSE | SYSTEM | COMPONENT | MANUFACTURER | REPORTABLE TO NRC |
| A | B | O | I | S | V | L | 2 | O | N |

SUPPLEMENTAL REPORT EXPECTED (14)
YES (If yes, complete EXPECTED SUBMISSION DATE) ☒ NO ☐
EXPECTED SUBMISSION DATE (15): MONTH DAY YEAR

ABSTRACT (Limit to 1400 spaces, i.e., approximately fifteen single-space typewritten lines) (16)

On March 8, 1984, following the completion of Work Request L34027 on Instrument 2E31N605C, RHR Equipment Area High Temp Switch, an isolation signal was generated causing the 'A' Loop of RHR to isolate. The Shutdown Cooling mode of RHR was in operation on loop 'A' at the time. As designed the injection valve 2E12-F053A closed, but contrary to design, the suction valve 2E12-F008 remained open. This sequence of events placed the 'A' RHR pump at shut off head conditions, and the subsequent opening of the minimum flow valve 2E12-F064A allowed 60 inches of reactor water to be pumped to the suppression pool. Upon receiving a reactor vessel low level alarm, the operator tripped the 'A' RHR pump and thus terminated the level decrease.

The apparent cause of the problem has been determined to be as follows:

- 1) A personnel error was made leaving the breaker for the 2E12-F008 valve in the off position following some previous testing that was performed involving the 2E12-F008 valve. The breaker and valve position was logged in the U-2 NSO's log, however, the NSO involved could not recall the circumstances surrounding the log entry.
- 2) The failure of the Spare Riley alarm and trip module that was installed as a part of Work Request L34027. The spare alarm and trip module were assumed to be a working unit based on the operability check that was performed on the installed spares during the initial calibration and past experiences with using other Unit 2 installed spare modules of the same type with no apparent problems.

8404120093 840313
PDR ADOCK 05000374
S PDR

IE22 111

LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

U.S. NUCLEAR REGULATORY COMMISSION

APPROVED OMB NO. 3150-0104

EXPIRES: 8/31/86

| | | | | | | |
|-------------------|-------------------|----------------|-------------------|-----------------|----------|-------|
| FACILITY NAME (1) | DOCKET NUMBER (2) | LER NUMBER (6) | | | PAGE (3) | |
| | | YEAR | SEQUENTIAL NUMBER | REVISION NUMBER | | |
| | | 05000374 | 84-045 | 00 | 02 | OF 03 |

TEXT (If more space is required, use additional NRC Form 386A's) (17)

I. EVENT DESCRIPTION

On March 8, 1984, following the completion of Work Request L34027 on Instrument 2E31N605C, RHR Equipment Area High Turn Switch (JM), an isolation signal was generated causing the "A" Loop of RHR (B0) to isolate. The Shutdown Cooling mode of RHR was in operation on loop "A" at the time. As designed the injection valve 2E12-F053A closed, but contrary to design, the suction valve 2E12-F008 remained open. This sequence of events placed the "A" RHR Pump at shut off head conditions, and the subsequent opening of the minimum flow valve 2E12-F064A allowed 60 inches of reactor water to be pumped to the suppression pool. Upon receiving a reactor vessel low level alarm, the operator tripped the "A" RHR pump and thus terminated the level decrease. Upon examination, the breaker for motive power to the 2E12-F008 valve was found in the off position. When the breaker was closed-in the F008 valve closed as designed.

II. CAUSE

The apparent cause of the problem has been determined to be as follows:

- 1) A personnel error was made leaving the breaker for the 2E12-F008 valve in the off position following some previous testing that was performed involving the 2E12-F008 valve. The breaker and valve position was logged in the U-2 NSO's log, however, the NSO involved could not recall the circumstances surrounding the log entry.
- 2) The failure of the Spare Riley alarm and trip module that was installed as a part of Work Request L34027. The spare alarm and trip module was assumed to be a working unit based on the operability check that was performed on the installed spares during the initial calibration and past experiences with using other Unit 2 installed spare modules of the same type with no apparent problems.

III. PROBABLE CONSEQUENCES

The probable consequences of this event were mitigated by the fact that the operator secured the running RHR pump "A" upon receipt of the reactor water low level alarm, along with the fact that the redundant suction valve 2E12-F009 was, in fact, energized and fully operational to provide an isolation and terminate the level decrease in the event that reactor water level reached the Level 3 trip point of +12.5 inches.

LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

U.S. NUCLEAR REGULATORY COMMISSION

APPROVED OMB NO. 3150-0104

EXPIRES: 8/31/85

FACILITY NAME (1)

DOCKET NUMBER (2)

LER NUMBER (6)

PAGE (3)

LaSalle County Station Unit 2

0 5 0 0 0 3 7 4

8 4

-

0

4

5

-

0

0

0

3

OF

0

3

TEXT (If more space is required, use additional NRC Form 368A's) (17)

IV. CORRECTIVE ACTION

- 1) Review the incident with the personnel involved to emphasize the seriousness of the event (AIR #01-84-67042).
- 2) Revise LIS-RH-208 to specifically require sign off steps for alarm and relay actuation states (AIR #01-84-67043).
3. Consider the possibility of adding motive power breaker indication for valve 2E12-F008 in the Control Room (AIR #01-84-67044).

V. PREVIOUS OCCURRENCES

None.

VI. NAME AND TELEPHONE NUMBER OF PREPARER

Mark Schaible, (815)357-6761, extension 469.



Commonwealth Edison
LaSalle County Nuclear Station
Rural Route #1, Box 220
Marseilles, Illinois 61341
Telephone 815/357-6761

April 3, 1984

U. S. Nuclear Regulatory Commission
Document Control Desk
Washington, D.C. 20555

Dear Sir:

Reportable Occurrence Report #84-009-00, Docket #050-374 is being submitted to your office in accordance with 10 CFR 50.73.

G. J. Diederich
Superintendent
LaSalle County Station

GJD/MLD/kg

Enclosure

xc: NRC, Regional Director
INPO-Records Center
File/NRC

IE-22
1/1