

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

PHONE: (301) 260-4001

LER NO.	83-14/3X
DOCKET NO.	50-317
LICENSE NO.	DPR 53
EVENT DATE	03-11-83
UPDATE REPORT DATE	04-09-84
ATTACHMENT	

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (CONT'D)

13 charging pump (Armco model No. J-531-M6DF) packing failed due to overfilling of the crankcase with oil. Oil leaked into the plunger cavity which became filled due to the drain being clogged. This resulted in oil entering the packing area. 13 charging pump's plunger cavity drain was opened to allow drainage of the oil, the packing was replaced, and oil level restored to proper level. In the future, the charging pumps will be secured and oil level checked prior to any oil addition. This will prevent any overfilling of oil to the charging pumps. The plunger cavity drain piping has been modified to ensure a more immediate fluid run off.

BALTIMORE GAS AND ELECTRIC COMPANY

P.O. BOX 1475

BALTIMORE, MARYLAND 21203

NUCLEAR POWER DEPARTMENT
CALVERT CLIFFS NUCLEAR POWER PLANT
LUSBY, MARYLAND 20657

April 9, 1984

U. S. Nuclear Regulatory Commission
Document Control Desk
Washington, DC 20555

Docket No. 50-317
License No. DPR 53

Dear Sirs:

The attached revision to LER 83-14/3X is being forwarded to you for your information.

Should you have any questions regarding this report, we would be pleased to discuss them with you.

Very truly yours,

LBR

L. B. Russell
Plant Superintendent

LBR:KAR:mst

cc: Dr. Thomas E. Murley
Director, Office of Management Information
and Program Control
Messrs: A. E. Lundvall, Jr.
J. A. Tiernan

IE22
1/1