



Telegram

THIS CONFIRMS PROMPT NOTIFICATION OF AN OCCURRENCE REPORTABLE PER T.S. 6.9.2.A.2. AT 2320 ON MAY 31, 1983, A CONTROL ROOM OPERATOR OBSERVED THAT THE "AUTO" AND "MANUAL" INDICATION LIGHTS FOR FIC-0737A AND HIC-0737A (CONTROLLERS FOR CV-0737A - AUXILIARY FEEDWATER CV FOR "A" S/G) WERE OUT. IMMEDIATE INVESTIGATION INTO THE PROBLEM WITH THE INDICATING LIGHTS DETERMINED THE CAUSE TO BE A BLOWN FUSE IN THE CONTROL CIRCUITRY. ON JUNE 22, 1983, IT WAS DISCOVERED THAT THE BLOWN FUSE WOULD ALSO PRECLUDE AUTOMATIC AND MANUAL CONTROL OF CV-0737A. WITH THE FUSE BLOWN, CV-0737A FAILED FULL OPEN PER DESIGN. THE RESULTANT MISMATCH IN CONTROL VALVE POSITION BETWEEN CV-0737A AND CV-0736A CREATED THE POTENTIAL INABILITY TO ADEQUATELY FEED THE "B" STEAM GENERATOR WITH THE AUXILIARY FEED PUMPS. THE REQUIREMENTS OF T.S. 3.5 WERE EXCEEDED UNTIL THE FUSE WAS REPLACED AND MANUAL CONTROL WAS ESTABLISHED WITH AN OPERATOR STATIONED IN RADIO CONTACT WITH THE CONTROL ROOM. NOTIFICATION TO THE NRC RESIDENT INSPECTOR WAS MADE ON JUNE 22, 1983

P



Telegram

1-015036C174 06/23/83

ICS IPMMVID MVN

03781 06-23 0251P CDT MVTR

ICS IPMMVID (312-932-2500)

1-013453C174 06/23/83

TLX CONSPower JKN

205 CONSUMERS POWER JACKSON MI 15:07 EDT 06-23

PMS

U S NUCLEAR REGULATORY COMMISSION

PALISADES PLT SECT CHIEF

799 ROOSEVELT AVE

GLEN ELLYN IL 60137

MSG # CBW940

8307050142 830623
PDR ADOCK 05000255
S PDR

TO: U S NUCLEAR REGULATORY COMMISSION
ATTN: PALISADES PLANT SECTION CHIEF
799 ROOSEVELT AVENUE
GLEN ELLYN, ILLINOIS

FROM: R M KRICH, PALISADES

CC: R B DEWITT, P-26-117B, JACKSON
D J VANDEWALLE, P-24-614B, JACKSON

WGM FILE MAIL
CC() TB() LB() NFL() NON-PUB()
PHONE-AC 312
PHONED TO BJ BY HLB
DATE OLD 6-24-83 TIME 10:19
14 TPS

IE29
JUN 27 1983 0/1