

## LICENSEE EVENT REPORT (LER)

Updated report: Initial report dated April 17, 1984

FACILITY NAME (1) Dresden Nuclear Power Station, Unit 3 DOCKET NUMBER (2) 0 5 0 0 0 2 4 9 1 OF 0 2

TITLE (4)

Reactor Scram

EVENT DATE (5)			LER NUMBER (6)			REPORT DATE (7)			OTHER FACILITIES INVOLVED (8)		
MONTH	DAY	YEAR	YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	MONTH	DAY	YEAR	FACILITY NAMES		DOCKET NUMBER(S)
03	23	84	84	001	01	08	09	84	N/A		0 5 0 0 0
									N/A		0 5 0 0 0

OPERATING MODE (9) N

POWER LEVEL (10) 0 1 1 5

THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CFR 5: (Check one or more of the following) (11)

20.402(b)	20.406(a)	X	50.73(a)(2)(iv)	73.71(b)
20.406(a)(1)(i)	50.36(a)(1)		50.73(a)(2)(v)	73.71(c)
20.406(a)(1)(ii)	50.36(a)(2)		50.73(a)(2)(vii)	OTHER (Specify in Abstract below and in Text, NRC Form 366A)
20.406(a)(1)(iii)	50.73(a)(2)(i)		50.73(a)(2)(viii)(A)	
20.406(a)(1)(iv)	50.73(a)(2)(ii)		50.73(a)(2)(viii)(B)	
20.406(a)(1)(v)	50.73(a)(2)(iii)		50.73(a)(2)(ix)	

LICENSEE CONTACT FOR THIS LER (12) NAME Gerald W. Bergan (X-529) TELEPHONE NUMBER 8 1 1 5 9 4 2 1 - 1 2 9 1 2 1 0

COMPLETE ONE LINE FOR EACH COMPONENT FAILURE DESCRIBED IN THIS REPORT (13)										
CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NRC	CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NRC	
D										

SUPPLEMENTAL REPORT EXPECTED (14)		EXPECTED SUBMISSION DATE (15)	MONTH	DAY	YEAR
YES (If yes, complete EXPECTED SUBMISSION DATE)	X NO				

ABSTRACT (Limit to 1400 spaces, i.e., approximately fifteen single-space typewritten lines) (16)

During a reactor startup subsequent to a refueling outage, with Reactor heat up and pressurization under way, reactor water level decreased to the low level alarm point. With the low-flow feedwater regulating valve wide open in response to the low water level, the first reactor feed pump was started. Excessive cold water entering the reactor caused a high neutron flux reactor scram.

8408200519 840809  
PDR ADOCK 05000249  
S PDRIE22  
111

## LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

U.S. NUCLEAR REGULATORY COMMISSION

APPROVED OMB NO. 3150-0104

EXPIRES: 8/31/85

FACILITY NAME (1)	DOCKET NUMBER (2)	LER NUMBER (6)			PAGE (3)		
		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER			
Dresden Nuclear Power Station Unit 3	05000249	84	001	01	02	OF	02

TEXT (If more space is required, use additional NRC Form 366A's) (17)

Following a refueling outage, with Unit 3 reactor in the startup mode, reactor power had increased to the heating range with control rods being notched out to maintain proper heat up rate. A second Nuclear Station Operator (NSO) was assisting in maintaining the appropriate heat up rate by increasing the turbine pressure set. One condensate/booster pump was on and supplying coolant to the reactor vessel. At 310 psig reactor pressure and with two turbine steam bypass valves open, it was noticed by the NSO pulling control rods that the reactor water level was decreasing and the low flow feedwater regulating valve was wide open. After verifying the condensate pump had not tripped, the NSO attempted to open a main feedwater isolation valve. While attempting to open the main feedwater isolation valve, water level continued to drop to the low level alarm point of 20 inches. The NSO then started a first reactor feed pump to recover the loss of coolant inventory. This action introduced excessive cold water in the vessel via a wide open low flow feedwater regulating valve. The reactor scrambled on high neutron flux conditions at 15 percent APRM power while the reactor mode switch was in the startup position. All appropriate protective systems performed as designed.

Coolant loss was compounded by the fact that two bypass valves were open. Surveillances, DOS 250-5, Automatic Blowdown System at Low Pressure and Rated Pressure, and DOS 2300-3, HPCI System Pump Test, require some bypass steam flow as a prerequisite to avoid any reactor pressure and flux transients. The two bypass valves remained open after testing, resulting in a drop in water level which the condensate/booster pump was unable to restore.

Corrective action consisted of submitting permanent revisions to procedures DOS 250-5 and DOS 2300-3, reminding the NSO to close turbine bypass valves when testing is complete.

# SUPPLEMENT TO DVR

DVR NO.			
STA	UNIT	YEAR	NO.
D - 12	- 3	- 84	- 9

PART 1		TITLE OF EVENT		OCCURRED	
		Reactor Scram		3/23/84	1308
				DATE	TIME
REASON FOR SUPPLEMENTAL REPORT					
Update original report to include a cause for this event.					
PART 2					
ACCEPTANCE BY STATION REVIEW		<u>J. Brumma</u>		<u>J.A. Cusla</u>	
DATE		<u>8/13/84</u>		<u>8/13/84</u>	
SUPPLEMENTAL REPORT APPROVED AND AUTHORIZED FOR DISTRIBUTION		<u>Douglas P. Ott</u>		<u>8/14/84</u>	
		STATION SUPERINTENDENT		DATE	



**Commonwealth Edison**

Dresden Nuclear Power Station

R.R. #1

Morris, Illinois 60450

Telephone 815/942-2920

August 9, 1984

DJS Ltr #84-789

U.S. Nuclear Regulatory Commission  
Document Control Desk  
Washington, D.C. 20555

Updated Licensee Event Report #84-001-1, Docket #050-249 is being submitted as required by Technical Specification 6.6, NUREG 1022 and 10 CFR 50.73 (a)(2)(iv). This report specifies a cause for this event. The initial report, dated April 17, 1984, contained no event cause due to a misunderstanding in the use of the new Licensee Event Report form.

D.J. Scott  
Station Superintendent  
Dresden Nuclear Power Station

DJS/kjl

Enclosure

cc: J.G. Keppler, Regional Administrator, Region III  
File/NRC  
File/Numerical

IE22  
11