

Wayne H. Jens  
Vice President  
Nuclear Operations

**Detroit  
Edison**

Fermi-2  
6400 North Dixie Highway  
Newport, Michigan 48166  
(313) 586-4150

August 8, 1984  
EF2-69655

Mr. James G. Keppler  
Regional Administrator  
Region III  
U. S. Nuclear Regulatory Commission  
799 Roosevelt Road  
Glen Ellyn, Illinois 60137

Dear Mr. Keppler:

Reference: (1) Fermi 2  
NRC Docket No. 50-341  
(2) Letter, D. A. Wells to J. G. Keppler,  
dated May 27, 1983, EF2-63505  
Subject: Final Report of 10CFR50.55(e) Item 94  
"Loose Pole Piece Wedges on Four Emergency  
Diesel Generators"

This is Detroit Edison's final report concerning loose pole piece wedges on four emergency diesel generators. This item was originally reported as a potential 10 CFR50.55(e) deficiency on April 29, 1983, and was subsequently documented in Reference 2.

Description of Deficiency

During initial operation, Emergency Diesel Generator #14 exhibited excessive vibration and was shut down. Inspection revealed that one of the generator's salient poles had shifted in the axial direction. The dovetail of the pole projected about 3/4" beyond the end of the dovetail slot in the rotor. The tapered wedges used to lock the dovetail into the slot were loose and could not be tightened. Further inspection of this generator and the three other diesel generators revealed thirteen additional loose wedge pairs which could not be tightened.

8408220209 840808  
PDR ADOCK 05000341  
S PDR

IEA7  
AUG 13 1984 1/0

Mr. James G. Keppler  
August 8, 1984  
EF2-69655  
Page 2

The manufacturer, Beloit Power Systems Division of Litton Industries, identified two probable causes for the loose pole piece dovetail wedges:

1. The wedge material was too soft for the application.
2. The wedges were too short to effectively lock the pole pieces in place.

The Beloit Power Systems Division of Litton Industries notified Detroit Edison on June 13, 1983 that they had filed this deficiency in accordance with 10CFR21.

#### Analysis of Safety Implications

If the loose pole piece dovetail wedges had gone undetected, this condition could have rendered one or more of the Emergency Diesel Generators inoperable.

#### Corrective Action

The dovetail wedges on all four Emergency Diesel Generators were replaced with wedges made from a harder material. The new wedges are longer which permits them to be driven farther into the dovetail slot for a tighter fit. The installation was performed under the direction of the manufacturer's representative.

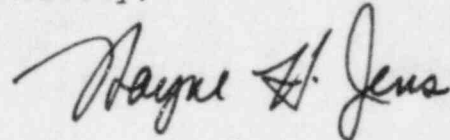
After the installation of the new wedges, an overspeed trip was performed on each Emergency Diesel Generator. All wedges were checked for slippage and were found acceptable.

Dovetail wedge position verification is now part of the preventive maintenance program (6 month cycle) for these generators.

Mr. James G. Keppler  
August 8, 1984  
EF2-69655  
Page 3

This is Detroit Edison's final report on this item. If you have questions concerning this matter, please contact Mr. Lewis P. Bregni, (313) 586-5083.

Sincerely,

A handwritten signature in dark ink, appearing to read "Wayne H. Jens". The signature is fluid and cursive, with a large initial "W" and a stylized "H".

cc: Mr. P. M. Byron  
Mr. R. C. DeYoung  
Mr. R. C. Knop