

NRC Form 368
(9-83)

U.S. NUCLEAR REGULATORY COMMISSION

APPROVED OMB NO. 3150-0104

EXPIRES: 9/31/85

LICENSEE EVENT REPORT (LER)

FACILITY NAME (1)

Grand Gulf Nuclear Station - Unit 1

DOCKET NUMBER (2)

0 5 0 0 0 4 1 6

PAGE (3)

1 OF 0 2

TITLE (4)

Bypass of Leakage Detection System

EVENT DATE (5)			LER NUMBER (6)			REPORT DATE (7)			OTHER FACILITIES INVOLVED (8)															
MONTH	DAY	YEAR	YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	MONTH	DAY	YEAR	FACILITY NAMES	DOCKET NUMBER(S)														
1	0	1	8	4	8	4	0	4	7	0	0	1	1	6	8	4	NA	0	5	0	0	0		

OPERATING MODE (9)		THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CFR §: (Check one or more of the following) (11)															
POWER LEVEL (10)	0 2 0	20.402(b)				20.406(e)				50.73(a)(2)(iv)				73.71(b)			
		20.406(a)(1)(i)				50.36(e)(1)				50.73(a)(2)(v)				73.71(e)			
		20.406(a)(1)(ii)				50.36(e)(2)				50.73(a)(2)(vii)				OTHER (Specify in Abstract below and in Text, NRC Form 365A)			
		20.406(a)(1)(iii)				50.73(a)(2)(i)				50.73(a)(2)(viii)(A)							
		20.406(a)(1)(iv)				50.73(a)(2)(ii)				50.73(a)(2)(viii)(B)							
		20.406(a)(1)(v)				50.73(a)(2)(iii)				50.73(a)(2)(ix)							

LICENSEE CONTACT FOR THIS LER (12)

NAME	TELEPHONE NUMBER
Ronald W. Byrd/Licensing Engineer	6 0 1 4 3 7 1 - 2 1 1 4 1 9

COMPLETE ONE LINE FOR EACH COMPONENT FAILURE DESCRIBED IN THIS REPORT (13)

CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NRC	CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NRC

SUPPLEMENTAL REPORT EXPECTED (14)

YES (If yes, complete EXPECTED SUBMISSION DATE)	NO	EXPECTED SUBMISSION DATE (15)	MONTH	DAY	YEAR
<input checked="" type="checkbox"/>	<input type="checkbox"/>				

ABSTRACT (Limit to 1400 spaces, i.e., approximately fifteen single-space typewritten lines) (16)

On October 18, 1984, the bypass switches of the Leakage Detection System on the Reactor Water Cleanup (RWC), the Residual Heat Removal (RHR), and the Reactor Core Isolation Cooling (RCIC) Systems were placed in bypass for maintenance troubleshooting. This violated Technical Specification 3.3.2 due to exceeding the one hour time limit the switches are allowed to be in bypass.

8411280319 841116
PDR ADOCK 05000416
S PDR

IE 22
111

NRC Form 366A
(9-83)

LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

U.S. NUCLEAR REGULATORY COMMISSION

APPROVED OMB NO. 3150-0104

EXPIRES 8/31/85

FACILITY NAME (1)	DOCKET NUMBER (2)	LER NUMBER (6)			PAGE (3)		
		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER			
Grand Gulf Nuclear Station - Unit 1	0 5 0 0 0 4 1 6	8 4	— 0 4 7	— 0 0	0 2	OF	0 2

TEXT (If more space is required, use additional NRC Form 366A's) (17)

On October 18, 1984, between 0757 hours and 0945 hours, the bypass switches of the Leakage Detection System on the Reactor Water Cleanup, the Residual Heat Removal and the Reactor Core Isolation Cooling Systems were placed in bypass to troubleshoot an inadvertent Reactor Water Cleanup containment isolation which occurred on October 17, 1984.

In order to comply with Technical Specification 3.3.2, the Leak Detection System can only be bypassed for a minimum of one hour without isolating the affected system.

The operator had erroneously assumed that the bypass switches could be placed in bypass for up to two hours according to Technical Specification Table 3.3.2-1 note (b). This only applies if there is another operable channel in the same system to monitor the parameters. Because of the assumption, an action statement entrance was not realized, therefore, an LCO was not written.

The error was corrected immediately upon discovery. A change has been initiated to the Alarm Response Instructions for the bypass alarms of these leak detection switches to make the operator aware of the one hour limit of Technical Specification 3.3.2.



MISSISSIPPI POWER & LIGHT COMPANY

Helping Build Mississippi

P. O. BOX 1640, JACKSON, MISSISSIPPI 39205

November 16, 1984

NUCLEAR LICENSING & SAFETY DEPARTMENT

 
Document Control Desk
U. S. Nuclear Regulatory Commission
Washington, D. C. 20555

Gentlemen:

SUBJECT: Grand Gulf Nuclear Station
Unit 1
Docket No. 50-416
License No. NPF-29
File: 0260/L-835.0
Bypass of Leakage Detection System
LER 84-047-0
AECM-84/0516

Attached is Licensee Event Report (LER) 84-047-0 which is a final report.

Yours truly,


L. F. Dale
Director

EBS/SHH:vog
Attachment

cc: Mr. J. B. Richard (w/a)
Mr. R. B. McGehee (w/a)
Mr. N. S. Reynolds (w/a)
Mr. G. B. Taylor (w/o)

Mr. Richard C. DeYoung, Director (w/a)
Office of Inspection & Enforcement
U. S. Nuclear Regulatory Commission
Washington, D. C. 20555

Mr. J. P. O'Reilly, Regional Administrator (w/a)
U.S. Nuclear Regulatory Commission
Region II
101 Marietta St., N.W., Suite 2900
Atlanta, Georgia 30323