

Commonwealth Edison Company
LaSalle Generating Station
2601 North 21st Road
Marseilles, IL 61341-9757
Tel 815-357-6761



June 11, 1996

United States Nuclear Regulatory Commission
Attention: Document Control Desk
Washington, D.C. 20555

Licensee Event Report #96-006-00, Docket #050-373 is being submitted to your office in accordance with 10 CFR 50.73(a)(2)(iv).

Respectfully,

A handwritten signature in dark ink, appearing to read "D. J. Ray".

D. J. Ray
Station Manager
LaSalle County Station

Enclosure

cc: H. J. Miller, NRC Region III Administrator
P. G. Brochman, NRC Senior Resident Inspector - LaSalle
C. H. Mathews, IDNS Resident Inspector - LaSalle
F. Niziolek, IDNS Senior Reactor Analyst
INPO - Records Center
D. L. Farrar, Nuclear Regulatory Services Manager

9606180224 960611
PDR ADOCK 05000373
S PDR

70045

TE221

NRC FORM 366 (5-92)				U.S. NUCLEAR REGULATORY COMMISSION <div style="text-align: center;"> APPROVED BY OMB NO. 3150-0104 EXPIRES 05/31/95 </div>													
LICENSEE EVENT REPORT (LER)				ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS INFORMATION COLLECTION REQUEST: 50.0 HRS. FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE INFORMATION AND RECORDS MANAGEMENT BRANCH (MNBB 7714), U.S. NUCLEAR REGULATORY COMMISSION, WASHINGTON, DC 20555-0001, AND TO THE PAPERWORK REDUCTION PROJECT (3150-0104), OFFICE OF MANAGEMENT AND BUDGET, WASHINGTON, DC 20503.													
FACILITY NAME (1): LaSalle County Station Unit One				DOCKET NUMBER (2): 05000373		PAGE (3): 1 of 4											
TITLE (4): Unit One Manual Scram Due to High Vibration on Main Turbine Generator Exciter																	
EVENT DATE (5)			LER NUMBER (6)			REPORT DATE (7)			OTHER FACILITIES INVOLVED (8)								
MONTH	DAY	YEAR	YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	MONTH	DAY	YEAR	FACILITY NAME		DOCKET NUMBER						
05	12	96	96	006	00	06	11	96	FACILITY NAME		DOCKET NUMBER						
OPERATING MODE (9):		THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CFR §: (Check one or more) (11)															
POWER LEVEL (10):																	
1																	
68%																	
		<input type="checkbox"/> 20.2201(b)				<input type="checkbox"/> 20.2203(a)(3)(i)				<input type="checkbox"/> 50.73(a)(2)(iii)				<input type="checkbox"/> 73.71(b)			
		<input type="checkbox"/> 20.2203(a)(1)				<input type="checkbox"/> 20.2003(a)(3)(ii)				<input checked="" type="checkbox"/> 50.73(a)(2)(iv)				<input type="checkbox"/> 73.71(c)			
		<input type="checkbox"/> 20.2203(a)(2)(i)				<input type="checkbox"/> 20.2003(a)(4)				<input type="checkbox"/> 50.73(a)(2)(v)				<input type="checkbox"/> OTHER			
		<input type="checkbox"/> 20.2203(a)(2)(ii)				<input type="checkbox"/> 50.36(c)(1)				<input type="checkbox"/> 50.73(a)(2)(vii)				(Specify in Abstract below and in Text, NRC Form 366A)			
		<input type="checkbox"/> 20.2203(a)(2)(iii)				<input type="checkbox"/> 50.36(c)(2)				<input type="checkbox"/> 50.73(a)(2)(viii)(A)							
		<input type="checkbox"/> 20.2203(a)(2)(iv)				<input type="checkbox"/> 50.73(a)(2)(i)				<input type="checkbox"/> 50.73(a)(2)(viii)(B)							
		<input type="checkbox"/> 20.2003(a)(2)(v)				<input type="checkbox"/> 50.73(a)(2)(ii)				<input type="checkbox"/> 50.73(a)(2)(x)							
LICENSEE CONTACT FOR THIS LER (12)																	
NAME: Steven C. Kleinhardt, System Engineer										TELEPHONE NUMBER (Include Area Code): (815) 357-6761 Extension 2245							
COMPLETE ONE LINE FOR EACH COMPONENT FAILURE DESCRIBED IN THIS REPORT (13)																	
CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NPRDS		CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NPRDS							
B	TL	Oil Deflector	GE	Yes													
SUPPLEMENTAL REPORT EXPECTED (14)																	
<input type="checkbox"/> YES (If yes, complete EXPECTED SUBMISSION DATE)					<input checked="" type="checkbox"/> NO					EXPECTED SUBMISSION DATE (15)			MONTH DAY YEAR				

ABSTRACT (Limit to 1400 spaces, i.e., approximately fifteen single-space typewritten lines 16)

At 0107 hours on May 12, 1996, Unit 1 was operating at a steady state power level of 88% when vibration levels on the main turbine-generator alternator exciter bearings increased. Operator actions in correcting the vibrations were unsuccessful and the reactor was manually scrammed. The high vibrations occurred when oil deflectors for the vibration probe assemblies installed at each exciter bearing rubbed the rotor shaft. The oil deflectors were determined to have an insufficient bore to maintain clearance with the rotating shaft to prevent rubbing.

During the event and subsequent reactor scram, all safety systems performed as designed. The operators initiated conservative actions which shut down the turbine-generator prior to vibration levels exceeding the operating range. The safety significance of this event was minimal and posed no threat to the health and safety of the public.

The root cause of this event was that the vendor did not use the correct drawing and manufactured the deflectors with the wrong inner diameter.

LICENSEE EVENT REPORT (LER)
TEXT CONTINUATION

ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS INFORMATION COLLECTION REQUEST: 50.0 HRS. FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE INFORMATION AND RECORDS MANAGEMENT BRANCH (MNBB 7714), U.S. NUCLEAR REGULATORY COMMISSION, WASHINGTON, DC 20555-0001, AND TO THE PAPERWORK REDUCTION PROJECT (3150-0104), OFFICE OF MANAGEMENT AND BUDGET, WASHINGTON, DC 20503.

FACILITY NAME (1)	DOCKET NUMBER (2)	LER NUMBER (6)			PAGE (3)
		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	
LaSalle County Station Unit One	05000373	96	006	00	2 of 4

(If more space is required, use additional copies of NRC Form 366A)(17)

PLANT AND SYSTEM IDENTIFICATION

General Electric - Boiling Water Reactor

Energy Industry Identification System (EIIS) codes are identified in the text as [XX].

A. CONDITION PRIOR TO EVENT

Unit(s): 1 Event Date: 05/12/96 Event Time: 0107 Hours
Reactor Mode(s): 1 Mode(s) Name: Run Power Level(s): 88%

B. DESCRIPTION OF EVENT

At 0107 hours on May 12, 1996, the Unit 1 reactor was manually scrammed when vibration levels on the main turbine-generator alternator exciter (TG) [TL] bearings increased and operator actions in correcting the vibration were unsuccessful. Unit 1 had been operating at a steady state power level of 88% when control room vibration monitors for the two exciter bearings started to indicate an unexpected increase. Shift operators notified engineering personnel and performed an inspection of the exciter. Although the operators found normal lubricating oil flow and oil temperature at the bearings, vibration was apparent at the exciter assembly. All other turbine-generator bearing vibrations were normal. Vibration on one of the exciter bearings soon reached the alarm setpoint of 7 mils and the operators started reducing turbine and reactor power levels in an effort to lower vibration. Bearing vibration increased further and when the vibration level reached 9 mils, the operators took action to manually scram the reactor.

After the scram, reactor vessel water level initially decreased to minus(-) 7 inches due to normal level shrink. The operators entered procedure LGA-01, Reactor Level Control, and restored level using the 1C Motor Driven Feedwater Pump (MDRFP, FW) [SJ]. All safety systems functioned as expected and reactor shutdown and cooldown proceeded satisfactorily.

This event is reportable per 10CFR50.73(a)(2)(iv) due to a manual actuation of an engineered safety feature.

C. CAUSE OF EVENT

The high vibrations occurred when the oil deflectors for the vibration probe assemblies (TS) [IV] installed at each exciter bearing rubbed the rotor shaft. During inspection of these assemblies, hot spots were apparent on the shaft at both the outboard and inboard bearings. The investigation determined that as turbine-generator load increased, rubbing started and created enough local heating to cause a bow to develop in the shaft. This bow eventually resulted in the high vibrations sensed at the two exciter bearings. The oil deflectors were determined to have an insufficient bore to maintain clearance with the rotating shaft to prevent rubbing.

LICENSEE EVENT REPORT (LER)
TEXT CONTINUATION

ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS INFORMATION COLLECTION REQUEST: 50.0 HRS. FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE INFORMATION AND RECORDS MANAGEMENT BRANCH (MNBB 7714), U.S. NUCLEAR REGULATORY COMMISSION, WASHINGTON, DC 20555-0001, AND TO THE PAPERWORK REDUCTION PROJECT (3150-0104), OFFICE OF MANAGEMENT AND BUDGET, WASHINGTON, DC 20503.

FACILITY NAME (1)	DOCKET NUMBER (2)	LER NUMBER (6)			PAGE (3)
		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	
LaSalle County Station Unit One	05000373	96	006	00	3 of 4

(If more space is required, use additional copies of NRC Form 366A)(17)

Improved vibration monitoring assemblies were installed on Unit 1 in the recent refueling outage as part of modification, MO1-1-89-003. This modification provided upgraded turbine supervisory instrumentation (TS) [JJ], including revised vibration detection probes for all bearings. The outer oil deflectors were included in the vibration probe assemblies installed at the exciter bearings. The inner oil deflectors were also replaced during the refueling outage when routine maintenance inspection revealed these deflectors to be out of tolerance. These deflectors were purchased as new but did not conform to the correct tolerance criteria. The clearance was insufficient because the manufacturing drawing was not used to determine the proper inner diameter of the new textolite deflectors. The inner diameter was manufactured to standard clearances for aluminum deflectors based on clearance per inch of shaft diameter and, as a result, the deflectors were manufactured and installed with insufficient clearances.

The exciter was thoroughly inspected to determine whether other failures could have caused or contributed to the bearing vibration. These inspections included verification of the electrical integrity of the stator winding insulation, disassembly and inspection of the exciter bearings and shaft coupling, and verification of exciter alignment. These inspection results were satisfactory verifying that the deflector rubbing caused the vibration and that the exciter incurred no damage as a result.

D. ASSESSMENT OF SAFETY CONSEQUENCES

During the event and subsequent reactor scram, all safety systems performed as designed. The operators initiated conservative actions which shut down the turbine-generator prior to vibration levels exceeding the operating range. The maximum vibration occurred immediately after the reactor scram and was recorded at 11.5 mils for the outboard exciter bearing. Although the exciter bearings do not provide automatic turbine trip on high vibration, vibration trip setpoints for all turbine-generator bearings are set at 12 mils. The safety significance of this event was minimal and posed no threat to the health and safety of the public.

E. CORRECTIVE ACTIONS

1. The oil deflectors were re-bored to obtain the proper clearance with the exciter shaft and reinstalled.
2. Vibration levels were monitored during the turbine startup and subsequent increase in power and were satisfactory.
3. The vendor drawing specifying oil deflector clearances has been corrected and will be incorporated into the modification package for the Unit 2 turbine-generator vibration detectors scheduled for the next refueling outage.

F. PREVIOUS OCCURRENCES

LICENSEE EVENT REPORT (LER)
TEXT CONTINUATION

ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS
INFORMATION COLLECTION REQUEST: 50.0 HRS. FORWARD
COMMENTS REGARDING BURDEN ESTIMATE TO THE INFORMATION
AND RECORDS MANAGEMENT BRANCH (MNBB 7714), U.S. NUCLEAR
REGULATORY COMMISSION, WASHINGTON, DC 20555-0001, AND TO
THE PAPERWORK REDUCTION PROJECT (3150-0104), OFFICE OF
MANAGEMENT AND BUDGET, WASHINGTON, DC 20503.

FACILITY NAME (1)	DOCKET NUMBER (2)	LER NUMBER (6)			PAGE (3)
LaSalle County Station Unit One	05000373	YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	4 of 4
		96	006	00	

(If more space is required, use additional copies of NRC Form 366A)(17)

LER NUMBER

TITLE

None

G. COMPONENT FAILURE DATA

Manufacturer:	General Electric
Nomenclature:	Textolite Oil Deflector
EPN:	None