

LICENSEE EVENT REPORT

CONTROL BLOCK: 1

(PLEASE PRINT OR TYPE L REQUIRED INFORMATION)

3 1 | M | N | P | I | N | 2 2 | 0 | 0 | - | 0 | 0 | 0 | 0 | 0 | - | 0 | 0 | 3 | 4 | 1 | 1 | 1 | 1 | 4 | 5

7 8 9 14 15 25 26 57 58
 LICENSEE CODE LICENSE NUMBER LICENSE TYPE CAT 58

CON'T
0 1 | L | 6 | 0 | 5 | 0 | 0 | 0 | 3 | 0 | 6 | 7 | 1 | 0 | 1 | 1 | 8 | 3 | 8 | 1 | 1 | 1 | 0 | 8 | 3 | 9

60 61 68 69 74 75 80
 REPORT SOURCE DOCKET NUMBER EVENT DATE REPORT DATE

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES 10

0 2 | During surveillance test, CV-31642, Containment Air Sample Inlet Isolation Valve,

0 3 | did not fully close. Recent similar event was RO 83-17. Tech Spec 3.6.A.6 applies.

0 4 | No effect on public health and safety since redundant valve was operable.

0 5 |

0 6 |

0 7 |

0 8 |

0 9 |

9 10 11 12 13 18 19 20
 SYSTEM CODE CAUSE CODE CAUSE SUBCODE COMPONENT CODE COMP. SUBCODE VALVE SUBCODE

1 7 | LER/RO REPORT NUMBER | 8 3 | 0 2 5 | 0 3 | L | 0

21 22 23 24 26 27 28 29 30 31 32
 EVENT YEAR SEQUENTIAL REPORT NO. OCCURRENCE CODE REPORT TYPE REVISION NO.

ACTION TAKEN | E 18 | FUTURE ACTION | Z 19 | EFFECT ON PLANT | Z 20 | SHUTDOWN METHOD | Z 21 | HOURS | 0 0 0 0 | ATTACHMENT SUBMITTED | N 23 | NRPD-4 FORM SUB. | Y 24 | PRIME COMP. SUPPLIER | A 25 | COMPONENT MANUFACTURER | C 6 3 0 26

33 34 35 36 37 40 41 42 43 44 47
 ACTION TAKEN FUTURE ACTION EFFECT ON PLANT SHUTDOWN METHOD HOURS ATTACHMENT SUBMITTED NRPD-4 FORM SUB. PRIME COMP. SUPPLIER COMPONENT MANUFACTURER

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS 27

1 0 | Loose set screw in 1" F.P. SW valve actuator arm allowed actuator arm to rotate and

1 1 | improperly contact the limit switch, preventing full closure of the Contromatics

1 2 | 1" F.P. SW valve. Set screw was tightened and valve tested satisfactorily. Similar

1 3 | installations were inspected.

1 4 |

1 5 | E 28 | 0 9 8 29 | NA | B 31 | Surveillance Test

7 8 9 10 12 13 44 45 46
 FACILITY STATUS % POWER OTHER STATUS METHOD OF DISCOVERY DISCOVERY DESCRIPTION

1 6 | Z 33 | Z 34 | NA | NA | NA

7 8 9 10 11 44 45
 ACTIVITY CONTENT RELEASED OF RELEASE AMOUNT OF ACTIVITY LOCATION OF RELEASE

1 7 | 0 0 0 37 | Z 38 | NA

7 8 9 11 12 13
 PERSONNEL EXPOSURES NUMBER TYPE DESCRIPTION

1 8 | 0 0 0 40 | NA

7 8 9 11 12
 PERSONNEL INJURIES NUMBER DESCRIPTION

1 9 | Z 47 | NA

7 8 9 10
 LOSS OF OR DAMAGE TO FACILITY TYPE DESCRIPTION

2 0 | N 44 | NA

7 8 9 10
 PUBLICITY ISSUED DESCRIPTION

8506170464 831110
 PDR ADOCK 05000306
 S PDR

NAME OF PREPARER A. A. Hunstad

PHONE 612-388-1121

83 RETROFIT IE22 1/1



Northern States Power Company

414 Nicollet Mall
Minneapolis, Minnesota 55401
Telephone (612) 330-5500

November 10, 1983

Regional Administrator
Region III
U S Nuclear Regulatory Commission
799 Roosevelt Road
Glen Ellyn, IL 60137

PRAIRIE ISLAND NUCLEAR GENERATING PLANT
Docket No. 50-306 License No. DPR-60

Failure of a Containment Air Sample
Inlet Isolation Valve To Fully Close

The License Event Report for this occurrence is attached.

This event is reported in compliance with Technical Specification 6.7.B.2.(b), since it represents operation in a degraded mode permitted by a limiting condition for operation.

David A. Musolf for

David Musolf
Manager - Nuclear Support Services

DMM/TAP/bd

c: NRC Document Control Desk (1)
NRC Resident Inspector
MPCA
Attn: J W Ferman

Attachment

8 IE22
1/1
83 RETROFIT

NOV 14 1983