

LICENSEE EVENT REPORT (LER)

FACILITY NAME (1) Palo Verde Unit 1	DOCKET NUMBER (2) 0 5 0 0 0 5 2 8	PAGE (3) 1 OF 0 2
--	--------------------------------------	----------------------

TITLE (4) Failure to Verify Fire Door Position

EVENT DATE (5)			LER NUMBER (6)			REPORT DATE (7)			OTHER FACILITIES INVOLVED (8)													
MONTH	DAY	YEAR	YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	MONTH	DAY	YEAR	FACILITY NAMES		DOCKET NUMBER(S)											
0	4	12	8	5	8	5	0	2	4	0	0	0	5	1	3	8	5	0	5	0	0	0

OPERATING MODE (9) 5	THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CFR 5: (Check one or more of the following) (11)															
	20.402(b)				20.405(c)				50.73(a)(2)(iv)				73.71(b)			
	20.405(a)(1)(i)				50.38(c)(1)				50.73(a)(2)(v)				73.71(c)			
	20.405(a)(1)(ii)				50.38(c)(2)				50.73(a)(2)(vii)				OTHER (Specify in Abstract below and in Text, NRC Form 365A)			
	20.405(a)(1)(iii)				50.73(a)(2)(i)				50.73(a)(2)(viii)(A)							
20.405(a)(1)(iv)				50.73(a)(2)(ii)				50.73(a)(2)(viii)(B)								
20.405(a)(1)(v)				50.73(a)(2)(iii)				50.73(a)(2)(ix)								

LICENSEE CONTACT FOR THIS LER (12)									
NAME W. F. Quinn (extension 4087)									
TELEPHONE NUMBER AREA CODE 6 0 2 9 4 3 - 7 2 0 0									

COMPLETE ONE LINE FOR EACH COMPONENT FAILURE DESCRIBED IN THIS REPORT (13)											
CAUSE	SYSTEM	COMPONENT	MANUFAC- TURER	REPORTABLE TO NPDOS		CAUSE	SYSTEM	COMPONENT	MANUFAC- TURER	REPORTABLE TO NPDOS	

SUPPLEMENTAL REPORT EXPECTED (14)										EXPECTED SUBMISSION DATE (15)		MONTH	DAY	YEAR
YES (If yes, complete EXPECTED SUBMISSION DATE) <input checked="" type="checkbox"/> NO <input type="checkbox"/>														

ABSTRACT (Limit to 1400 spaces, i.e., approximately fifteen single-space typewritten lines) (16)

During the performance of the surveillance procedure (14ST-1ZZ27, Appendix A) for locked Fire Doors it was discovered that there were Fire Doors on the list that were unlocked and required to be inspected every 24 hours instead of every 7 days. When operations noticed the deficiency, a Procedure Change Notice was generated to correct the problem before the next unlocked Fire Door surveillance was due. The procedures have been revised to include the correct doors in the correct procedures. The performance group has been instructed to verify that the doors inspected in the locked procedure are in fact locked doors, not unlocked doors.

8505280196 850513
PDR ADOCK 05000528
S PDR

IE22
1/1

LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

APPROVED OMB NO. 3150-0104

EXPIRES: 8/31/85

FACILITY NAME (1) Palo Verde Unit 1	DOCKET NUMBER (2) 0 5 0 0 0 5 2 8 8 5 — 0 2 4 — 0 0 0 2 OF 0 2	LER NUMBER (6)			PAGE (3)		
		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER			

TEXT (If more space is required, use additional NRC Form 366A's) (17)

On 4/12/85 at 0208 while in Mode 5 at 0% power, during conduct of the surveillance test procedure (14ST-1ZZ27, Appendix A) for locked closed Fire Doors, the performer noted that 16 Fire Doors on the list were closed, but unlocked.

The surveillance interval for locked closed Fire Doors is once per 7 days and once per 24 hours for unlocked Fire Doors per Technical Specification 3.7.12.

After discovering that the doors were in the inappropriate procedure, a Procedure Change Notice was generated to place the involved doors in the procedure for unlocked Fire Doors prior to the next scheduled performance.

During the performance of the surveillance procedure, the doors in question were found closed and there were roving fire watch patrols in both the Control and Auxiliary Building on all levels.

The cause of this incident was that plant personnel were not aware of a need to notify the section responsible for the surveillance test that the condition of locked Fire Doors was being changed.

The procedures have been permanently revised to correct the noted deficiencies, the performance group has been changed and was instructed to verify during each performance that there are no unlocked doors on the locked door procedure. Additional corrective action is that the locksmith has been advised not to change any locks without notifying the Fire Protection Supervisor.



Arizona Nuclear Power Project

P.O. BOX 52034 • PHOENIX, ARIZONA 85072-2034

U.S. Nuclear Regulatory Commission
Document Control Desk
Washington, D.C. 20555

ANPP-32622-EEVB/GEC
May 13, 1985

Subject: Palo Verde Nuclear Generating Station (PVNGS)
Unit 1
Docket No. STN 50-528, License No. NPF-34
Licensee Event Report-Failure to Verify Fire Door Position
File: 85-056-026; G.1.01.10

Dear Sirs:

Attached please find Licensee Event Report (LER) No. 85-024-00 prepared and submitted pursuant to 10 CFR 50.73. This LER addresses a failure to verify fire door position as required by PVNGS Technical Specification 3.7.12. By copy of this letter we are also forwarding a copy of the LER to the Regional Administrator of the Region V Office.

If you have any questions or concerns, please contact me.

Very truly yours,

E E Van Brunt *EBK*

E. E. Van Brunt, Jr.
Executive Vice President
Project Director

EEVB/GEC/das
Attachment

cc: J.B. Martin
R.P. Zimmerman
A.L. Hon
E.A. Licitra
A.C. Gehr
INPO Records Center

EB22
1/1