

LICENSEE EVENT REPORT (LER)

FACILITY NAME (1) Davis-Besse Unit 1										DOCKET NUMBER (2) 0 5 0 0 0 3 4 6										PAGE (3) 1 OF 0 1																		
TITLE (4) Inoperable Fire Barrier Door #318																																						
EVENT DATE (5)						LER NUMBER (6)						REPORT DATE (7)						OTHER FACILITIES INVOLVED (8)																				
MONTH			DAY			YEAR			YEAR			SEQUENTIAL NUMBER			REVISION NUMBER			MONTH			DAY			YEAR			FACILITY NAMES						DOCKET NUMBER(S)					
0 6			0 5			8 5			8 5			0 1 4			0 0 0 7			1 2			8 5									0 5 0 0 0								
OPERATING MODE (9) 1						THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CFR 5: (Check one or more of the following) (11)																																
POWER LEVEL (10) 0 5 0						20.402(f)						20.408(e)						50.73(a)(2)(iv)						73.71(b)														
						20.408(a)(1)(i)						50.38(a)(1)						50.73(a)(2)(v)						73.71(e)														
						20.408(a)(1)(ii)						50.38(a)(2)						50.73(a)(2)(vi)						X OTHER (Specify in Abstract below and in Text, NRC Form 385A)														
						20.408(a)(1)(iii)						50.73(a)(2)(i)						50.73(a)(2)(vii)(A)						Special Report														
						20.408(a)(1)(iv)						50.73(a)(2)(ii)						50.73(a)(2)(vii)(B)																				
						20.408(a)(1)(v)						50.73(a)(2)(iii)						50.73(a)(2)(x)																				
LICENSEE CONTACT FOR THIS LER (12)																																						
NAME Steve Murray																				TELEPHONE NUMBER 4 1 9 2 4 9 - 5 0 0 0																		
COMPLETE ONE LINE FOR EACH COMPONENT FAILURE DESCRIBED IN THIS REPORT (13)																																						
CAUSE		SYSTEM		COMPONENT		MANUFACTURER		REPORTABLE TO NPDOS				CAUSE		SYSTEM		COMPONENT		MANUFACTURER		REPORTABLE TO NPDOS																		
A		N F		D R V		0 7 1		N																														
SUPPLEMENTAL REPORT EXPECTED (14)																																						
YES (If yes, complete EXPECTED SUBMISSION DATE)																				NO																		
																				EXPECTED SUBMISSION DATE (15)																		
																				MONTH DAY YEAR																		
ABSTRACT (Limit to 1400 spaces, i.e., approximately fifteen single-space typewritten lines) (16)																																						
<p>On June 5, 1985, Engineering evaluated the damage to the bottom of Door #318 and determined that the door could no longer be certified as functional. The one hour action statement requirement of Technical Specification 3.7.10 of establishing an hourly fire watch patrol was already being satisfied by an existing patrol which had been previously established due to other Appendix R deficiencies. This Special Report is being submitted per the requirements of Technical Specifications 3.7.10 and 6.9.2 since this fire barrier could not be restored to operable status within 7 days.</p> <p>The door was inoperable due to a modification along the bottom of the door which resulted from installing a temporary water line for a room cooler in Room 320. The room is used as an Equipment Operator study room. There is no safety related equipment in this room although there are conduits for such equipment passing through the room.</p> <p>When it was determined that the door could not be repaired and recertified, a new door was ordered. It is expected to be received and installed by September 30, 1985. Until the new door is installed, the fire watch patrol will be maintained. A Facility Change Request has been initiated to permanently install a water line through the wall. Also, a memo will be issued to all Station personnel cautioning that doors cannot be modified in any way that degrades the original integrity without jeopardizing the door certification.</p>																																						
Report No. NP-33-85-17 DVR No. 85-087																																						
8507220014 850712 PDR ADOCK 05000346 S PDR																																						



July 12, 1985

Log No. K85-1063
File: RR 2 (NP-33-85-17)

Docket No. 50-346
License No. NPF-3

U. S. Nuclear Regulatory Commission
Document Control Desk
Washington, D. C. 20555

Gentlemen:

LER No. 85-014
Davis-Besse Nuclear Power Station Unit 1
Date of Occurrence: June 5, 1985

Enclosed is Licensee Event Report 85-014 which is being submitted in accordance with 10CFR50.73, to provide 30 day written notification of the subject occurrence.

Yours truly,

John M. Quennoz
Plant Manager
Davis-Besse Nuclear Power Station

SMQ/ljk

Enclosure

cc: Mr. James G. Keppler,
Regional Administrator,
USNRC Region III

Mr. Walt Rogers
DB-1 NRC Resident Inspector

JCS/001

IE22
1/1