

## SAFETY INSPECTION REPORT AND COMPLIANCE INSPECTION

## 1. LICENSEE/LOCATION INSPECTED:

DMS Imaging, Inc.  
Maple Grove, Minnesota

## 2. NRC/REGIONAL OFFICE

U.S. Nuclear Regulatory Commission  
Region III  
2443 Warrenville Road  
Lisle, Illinois 60532-4352

REPORT

2006-001

## 3. DOCKET NUMBER(S)

030-36404

## 4. LICENSEE NUMBER(S)

40-32477-01

## 5. DATE(S) OF INSPECTION

2/23/06 &amp; 3/6/06

## LICENSEE:

The inspection was an examination of the activities conducted under your license as they relate to radiation safety and to compliance with the Nuclear Regulatory Commission (NRC) rules and regulations and the conditions of your license. The inspection consisted of selective examinations of procedures and representative records, interviews with personnel, and observations by the inspector. The inspection findings are as follows:



1. Based on the inspection findings, no violations were identified.



2. Previous violation(s) closed.



3. The violation(s), specifically described to you by the inspector as non-cited violations, are not being cited because they were self-identified, non-repetitive, and corrective action was or is being taken, and the remaining criteria in the NRC Enforcement Policy, NUREG-1600, to exercise discretion, were satisfied.

\_\_\_\_ Non-Cited Violation(s) was/were discussed involving the following requirement(s) and Corrective Action(s):



4. During this inspection certain of your activities, as described below and/or attached, were in violation of NRC requirements and are being cited. This form is a NOTICE OF VIOLATION, which may be subject to posting in accordance with 10 CFR 19.11.

(Violations and Corrective Actions)

## Licensee's Statement of Corrective Actions for Item 4, above.

I hereby state that, within 30 days, the actions described by me to the inspector will be taken to correct the violations identified. This statement of corrective actions is made in accordance with the requirements of 10 CFR 2.201 (corrective steps already taken, corrective steps which will be taken, date when full compliance will be achieved). I understand that no further written response to NRC will be required, unless specifically requested.

Title

Printed Name


Signature

Date

LICENSEE'S  
REPRESENTATIVE

NRC INSPECTOR

Michael M LaFranco

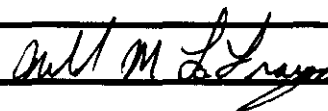

3/6/06

(10-2003)  
10 CFR 2.201**Docket File Information**  
**SAFETY INSPECTION REPORT**  
**AND COMPLIANCE INSPECTION**

1. LICENSEE <b>DMS Imaging, Inc.</b> REPORT NUMBER(S) <b>2006-001</b>		2. NRC/REGIONAL OFFICE <b>Region III</b> <b>2443 Warrenville Road</b> <b>Lisle, IL 60532</b>	
3. DOCKET NUMBER(S) <b>030-36404</b>	4. LICENSE NUMBER(S) <b>40-32477-01</b>	5. DATE(S) OF INSPECTION <b>2/23-3/6/2006</b>	
6. INSPECTION PROCEDURES USED <b>87130</b>	7. INSPECTION FOCUS AREAS <b>03.01-03.07</b>		
<b>SUPPLEMENTAL INSPECTION INFORMATION</b>			
1. PROGRAM CODE(S) <b>02220</b>	2. PRIORITY <b>G3</b>	3. LICENSEE CONTACT <b>Traci Hollingshead - RSO</b>	4. TELEPHONE NUMBER <b>1-800-333-0365</b>
<input type="checkbox"/> Main Office Inspection <input checked="" type="checkbox"/> Field <b>Maple Grove, Minnesota</b> <input type="checkbox"/> Temporary Job Site			
Next Inspection Date: <b>NA - One of Multiple sites</b>			

**PROGRAM SCOPE**

The licensee is authorized to perform activities pursuant to 10 CFR 35.100, 10 CFR 35.200, 10 CFR 35.11 under a mobile medical service and the use of a Cs-137 source for training and calibration of licensee's survey meters and personnel dosimeters. The program out of the Maple Grove, Minnesota facility has not administered licensed material to patients. However, the licensee does possess a small Cs-137 for the daily check of the dose calibrator. The licensee at this facility administers F-18 to patients.

**Performance Observations**

The inspector interviewed the RSO and determined that the individual had adequate knowledge regarding responsibilities for NRC license implementation. The inspector reviewed patient administration records and did not identify any administrations to patients in the last several years using byproduct material. The RSO indicated that activities out of the facility has not administered byproduct material. The inspector noted that the Cs-137 check source was properly secured. The inspector also review inventories, potential storage locations, dose calibrator checks, training of staff, dosimetry records and the licensee's internal audit program. These were reviewed to ensure that when activities start, the licensee has the system in place to ensure proper use and storage of licensed material. The inspector did not identify any issues of non-compliance.