

50-263

NRC DISTRIBUTION FOR PART 50 DOCKET MATERIAL

FILE NUMBER

INCIDENT REPORT

TO: Mr Keppler

FROM: Northern States Pwr Co
Minneapolis, Mn
L O MayerDATE OF DOCUMENT
10-20-76DATE RECEIVED
10-29-76☐ LETTER
☐ ORIGINAL
☐ COPY☐ NOTORIZED
☐ UNCLASSIFIED

PROP

INPUT FORM

NUMBER OF COPIES RECEIVED

1 signed

DESCRIPTION

Ltr advising that M-R0-76-21 which occurred on 10-8-76.....has been determined as non-reportable.....

PLANT NAME: Monticello

ENCLOSURE

DO NOT REPLY

ACKNOWLEDGE

NOTE: IF PERSONNEL EXPOSURE IS INVOLVED
SEND DIRECTLY TO KREGER/J. COLLINS

FOR ACTION/INFORMATION

10-29-76 ehf

BRANCH CHIEF:

Ziemann

W/3 CYS FOR ACTION

LIC. ASST.:

Diss

W/1 CYS

ACRS 1/2 CYS HOLDING/SENT TO LA

INTERNAL DISTRIBUTION

REG FILE

NRC PDR

I & E (2)

MIPC

SCHROEDER/IPPOLITO

HOUSTON

NOVAK/CHECK

GRIMES

CASE

BUTLER

HANAUER

TEDESCO/MACCARY

EISENHUT

BAER

SHAO

VOLLMER/BUNCH

KREGER/J. COLLINS

EXTERNAL DISTRIBUTION

LPDR: Minneapolis, Mn

TIC:

NSIC:

CONTROL NUMBER

10979

NSP

N O R T H E R N S T A T E S P O W E R C O M P A N Y

Monticello Nuclear Generating Plant
Monticello, MN 55362

October 8, 1976

Mr. J. G. Keppler, Director
Region III
Office of Inspection and Enforcement
United States Nuclear Regulatory Commission
799 Roosevelt Road
Glen Ellyn, Illinois 60137

Dear Mr. Keppler:

MONTICELLO NUCLEAR GENERATING PLANT
Docket No. 50-263 License No. DPR-22

During power operation near 100% on October 7, 1976, No. 3 TIP ball valve failed to automatically close properly during routine operation of the TIP System. The valve was cycled manually and it closed successfully. No. 3 TIP is presently held out of service with the ball valve closed pending further investigation.

Yours very truly,


L. R. Eliason
Plant Manager

LRE/sdd

cc: Director, Office of Management Information &
Program Control
G. Charnoff
Minnesota Pollution Control Agency
Attn: J W Ferman
File

Copy sent by telecopier to Keppler.

NSP

NORTHERN STATES POWER COMPANY

MINNEAPOLIS, MINNESOTA 55401

D. Latham
50-262

October 20, 1976



Mr J G Keppler, Director, Region III
Office of Inspection & Enforcement
U S Nuclear Regulatory Commission
799 Roosevelt Road
Glen Ellyn, IL 60137

ATORY DO

Dear Mr Keppler:

On October 8, 1976, it was reported to your office that No. 3
TIP ball valve failed to automatically close during routine
operation of the TIP System and that further investigation would
be made.

Investigation during the period October 11-13, 1976, has con-
firmed that the valve did not fail to close properly, but rather
that cold solder connections on pins in the connecting plug
attached to the valve/switch body resulted in incorrect remote
position indication.

This occurrence is therefore not considered reportable. No
Licensee Event Report will be issued and the Event Number
assigned at the time (M-RO-76-21) will not be re-used.


Yours very truly,

L. O. Mayer

L O Mayer, PE
Manager of Nuclear Support Services

LOM/ak

cc: Director, MIPC, USNRC
G Charnoff
MPCA
Attn: J W Ferman
L R Eliason

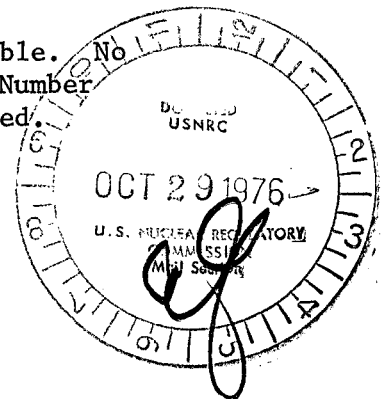

10979

OCT 22 1976