

**AEC DISTRIBUTION FOR PART 50 DOCKET MATERIAL**  
(TEMPORARY FORM)

**ACKNOWLEDGED**

**DO NOT REMOVE**

CONTROL NO: 2786

<b>FROM:</b> Carolina Power & Light Company Raleigh, North Carolina 27602 E. E. Utley	<b>DATE OF DOC:</b> 04-24-73	<b>DATE REC'D</b> 04-30-73	<b>LTR</b> X	<b>MEMO</b>	<b>RPT</b>	<b>OTHER</b>
<b>TO:</b> John F. O'Leary	<b>ORIG</b> 3	<b>CC</b> 37	<b>OTHER</b>	<b>SENT AEC PDR</b> X <b>SENT LOCAL PDR</b> X		
<b>CLASS:</b> <u>U</u> PROP INFO	<b>INPUT</b>	<b>NO CYS REC'D</b> 40	<b>DOCKET NO:</b> 50-261			

**DESCRIPTION:**

Ltr reporting a condition...On 04-10-73 a spill of water from the Refueling Water Storage Tank (RWST) to the plant storm drainage system occurred.....

**ENCLOSURES:**

**PLANT NAMES:** H. B. Robinson, Unit 2

FOR ACTION/INFORMATION 04-30-73 rht

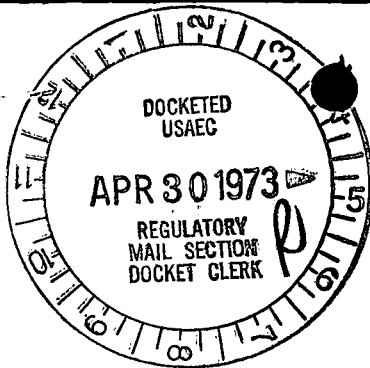
BUTLER(L) W/ Copies	SCHWENCER(L) W/ Copies	ZIEMANN(L) W/ Copies	YOUNGBLOOD(E) W/ Copies
CLARK(L) W/ Copies	STOLZ(L) W/ Copies	ROUSE(FM) W/ Copies	REGAN(E) W/ Copies
GOLLER(L) W/ Copies	VASSALLO(L) W/ Copies	DICKER(E) W/ Copies	W/ Copies
KNIEL(L) W/ Copies	✓ SCHEMEL(L) W/7 Copies	KNIGHTON(E) W/ Copies	W/ Copies

**INTERNAL DISTRIBUTION**

✓ REG FILE	✓ TECH REVIEW	DENTON	F & M	WADE	E
✓ AEC PDR	✓ HENDRIE	GRIMES	SMILEY	BROWN	E
✓ OGC, ROOM P-506A	✓ SCHROEDER	GAMMILL	NUSSBAUMER	G. WILLIAMS	E
✓ MUNTZING/STAFF	✓ MACCARY	KASTNER		SHEPPARD	E
✓ CASE	✓ KNIGHT	BALLARD	LIC ASST.		
GIAMBUSSO	✓ PAWLICKI	SPANGLER	SERVICE	L	A/T IND
BOYD	✓ SHAO		WILSON	L	BRAITMAN
V. MOORE-L(BWR)	✓ STELLO	ENVIRO	GOULBOURNE	L	SALTZMAN
DEYOUNG-L(PWR)	✓ HOUSTON	MULLER	SMITH	L	
✓ SKOVHOLT-L	✓ NOVAK	DICKER	GEARIN	L	PLANS
P. COLLINS	✓ ROSS	KNIGHTON	DIGGS	L	MCDONALD
	✓ IPPOLITO	YOUNGBLOOD	✓ TEETS	L	DUBE
✓ REG OPR	✓ TEDESCO	REGAN	LEE	L	
✓ FILE & REGION(2)	✓ LONG	PROJ LEADER	MAIGRET	L	INFO
✓ MORRIS	✓ LAINAS		SHAFFER	F & M	C. MILES
✓ STEELE	✓ BENAROYA	HARLESS			
	✓ VOLLMER				

**EXTERNAL DISTRIBUTION**

✓ 1-LOCAL PDR Hartville, South Carolina	(1)(2)(9)-NATIONAL LAB'S	1-PDR-SAN/LA/NY
✓ 1-DTIE(ABERNATHY)	1-R. CARROLL-'C, GT-B227	1- GERALD LELLOUCHE
✓ 1-NSIC(BUCHANAN)	1- R. CATLIN,E-256-GT	BROOKHAVEN NAT. LAB
1-ASLB-YORE/SAYRE	1- CONSULTANT'S	1-AGMED(WALTER KOESTER,
WOODWARD/H ST.	NEWMARK/BLUME/AGABIAN	RM C-427, GT)
✓ 16-CYS ACRS (Sent to S. Teets)	1- GERLAD ULRIKSON....ORNL	1- RD...MULLER...F-309GT
04-30-73		

**CP&L**

Carolina Power &amp; Light Company

April 24, 1973

50-261

Regulatory

File Cy.



Mr. John F. O'Leary  
Directorate of Reactor Licensing  
United States Atomic Energy Commission  
Washington, D. C. 20545

Dear Mr. O'Leary:

H. B. ROBINSON UNIT NO. 2  
LICENSE DPR-23  
SPILL TO THE PLANT DRAINAGE SYSTEM

In accordance with paragraph 6.6.2.d, Technical Specifications, it is reported that on April 10, 1973, with the reactor in a refueling shutdown condition, a spill of water from the Refueling Water Storage Tank (RWST) to the plant storm drainage system occurred.

At approximately 1700 hours, while performing Periodic Test No. 2.2 (Safety Injection System Component Test), the levels in the auxiliary building and the refueling building sump tanks were noted to be increasing faster than normal. At the same time, water was observed seeping out of the room which houses the spent fuel pit heat exchanger and filters. Since one safety injection pump was running, this was suspected to be the source of the leakage. The pump was immediately secured and the leakage stopped. It was determined, by visual observation, that a portion of line between the spent fuel cooling system and the safety injection system, had been subjected to above normal pressures, causing leakage to occur through one vent valve and around the body to bonnet flange on another valve. These valves were both diaphragm type valves and, when overpressured, will tend to compress the rubber diaphragm and gasket and leak with no subsequent valve damage. The isolation valve which isolates this system from the safety injection system was closed until a flange could be installed, the area decontaminated, and the SI test completed with no other leakage experienced.

All piping and valves which were subjected to the overpressure have been pressurized to 160 PSIG and no leaks observed. In addition, a tag has been fabricated and attached to the spectacle flange located at Valve SI-896G with the following instructions:

"Before removing this flange, insure that the SI pumps are under administrative control of the Shift Foreman."

The water which was released flowed to the storm drain and subsequently into Black Creek below the lake dam. This release resulted in the discharge of 500 gallons of water which contained 23.5 mCi of gross particulate and 19.5 mCi of tritium activity. Over 95 percent of the

Mr. John F. O'Leary

- 2 -

April 24, 1973

activity was identified as Cobalt-58 ( $9.37 \times 10^{-3}$  microcuries/ml) and Cobalt-60 ( $3.09 \times 10^{-3}$  microcuries/ml). Based on the measured flow in the storm drainage ditch (680 GPM) and in Black Creek ( $1.18 \times 10^{+5}$  GPM), average annual concentrations due to this release are:

Drainage Ditch:	CO-58	$1.31 \times 10^{-8}$ microcuries/ml
	CO-60	$4.33 \times 10^{-9}$ microcuries/ml
Black Creek:	CO-58	$7.53 \times 10^{-11}$ microcuries/ml
	CO-60	$2.49 \times 10^{-11}$ microcuries/ml

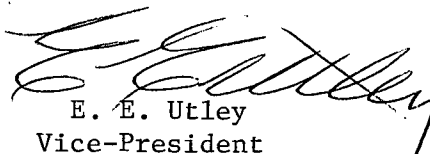
These concentrations are well below the 10 CFR 20 limits of:

CO-58	$9 \times 10^{-5}$ microcuries/ml
CO-60	$3 \times 10^{-5}$ microcuries/ml

The total activity release was 0.26% of the cumulative yearly technical specification limit for radionuclides excluding tritium and  $5.1 \times 10^{-4}$  percent of the yearly limit for tritium.

The Plant Nuclear Safety Committee reviewed this incident in regular session on April 11, 1973, and it was reported to Mr. Herb Whitener of DRO in person and to Mr. Norman C. Moseley of DRO by telegraph on the same date.

Very truly yours,

  
E. E. Utley  
Vice-President  
Bulk Power Supply

JBM:NBB/mp

cc: Mr. C. D. Barham  
Mr. N. B. Bessac  
Mr. B. J. Furr  
Mr. D. V. Menscer

