

CATEGORY 1

REGULATORY INFORMATION DISTRIBUTION SYSTEM (RIDS)

ACCESSION NBR: 9612170037 DOC. DATE: 96/12/09 NOTARIZED: NO
 FACIL: 50-270 Oconee Nuclear Station, Unit 2, Duke Power Co.
 AUTH. NAME AUTHOR AFFILIATION
 WILKIE, L.V. Duke Power Co.
 HAMPTON, J.W. Duke Power Co.
 RECIP. NAME RECIPIENT AFFILIATION

DOCKET #
 05000270

SUBJECT: LER 96-004-01: on 960924, secondary drain line rupture
 resulted in manual reactor trip. Caused by lack of
 understanding of water hammer, inadequate procedures & human
 error. Mod installed & procedures revised. W/961209 ltr.

DISTRIBUTION CODE: IE22T COPIES RECEIVED: LTR 1 ENCL 1 SIZE: 12
 TITLE: 50.73/50.9 Licensee Event Report (LER), Incident Rpt, etc.

NOTES:

	RECIPIENT ID CODE/NAME	COPIES LTTR ENCL	RECIPIENT ID CODE/NAME	COPIES LTTR ENCL
	PD2-2 PD	1 1	LABARGE, D	1 1
INTERNAL:	ACRS	1 1	AEOD/SPD/RAB	2 2
	AEOD/SPD/RRAB	2 2	<u>FILE CENTER</u>	1 1
	NRR/DE/ECGB	1 1	NRR/DE/EELB	1 1
	NRR/DE/EMEB	1 1	NRR/DRCH/HHFB	1 1
	NRR/DRCH/HICB	1 1	NRR/DRCH/HOLB	1 1
	NRR/DRCH/HQMB	1 1	NRR/DRPM/PECB	1 1
	NRR/DSSA/SPLB	1 1	NRR/DSSA/SRXB	1 1
	RES/DET/EIB	1 1	RGN2 FILE 01	1 1
EXTERNAL:	L ST LOBBY WARD	1 1	LITCO BRYCE, J H	1 1
	NOAC MURPHY, G.A	1 1	NOAC POORE, W.	1 1
	NRC PDR	1 1	NUDOCS FULL TXT	1 1

C
A
T
E
G
O
R
Y

1

D
O
C
U
M
E
N
T

NOTE TO ALL "RIDS" RECIPIENTS:
 PLEASE HELP US TO REDUCE WASTE! CONTACT THE DOCUMENT CONTROL DESK,
 ROOM OWFN 5D-5 (EXT. 415-2083) TO ELIMINATE YOUR NAME FROM
 DISTRIBUTION LISTS FOR DOCUMENTS YOU DON'T NEED!

FULL TEXT CONVERSION REQUIRED
 TOTAL NUMBER OF COPIES REQUIRED: LTTR 26 ENCL 26

Duke Power Company
Oconee Nuclear Site
P.O. Box 1132
Seneca, SC 29679

J. W. Hampton
Vice President
(864) 885-3499 Office
(864) 885-3564 Fax



DUKE POWER

December 9, 1996

U.S. Nuclear Regulatory Commission
Document Control Desk
Washington, D.C. 20555

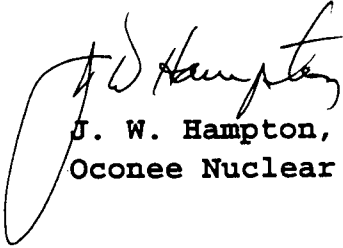
Subject: Oconee Nuclear Station
Docket Nos. 50-269, -270, -287
Licensee Event Report 270/96-04, Revision 1
Problem Investigation Process No.: 2-096-1828

Gentlemen:

Pursuant to 10 CFR 50.73 Sections (a) (1) and (d),
attached is Licensee Event Report 270/96-04, concerning a
secondary drain line rupture resulting in a manual
reactor trip.

This is a supplemental report. It is being submitted in
accordance with 10 CFR 50.73 (a) (2) (iv). This event is
considered to be of no significance with respect to the
health and safety of the public.

Very truly yours,


J. W. Hampton, Vice President
Oconee Nuclear Site

Attachment

9612170037 961209
PDR ADDCK 05000270
S PDR
100001

Document Control Desk
December 9, 1996

cc: Mr. S.D. Ebnetter
Administrator, Region II
U.S. Nuclear Regulatory Commission
101 Marietta St., NW, Suite 2900
Atlanta, GA 30323

Mr. D. E. LaBarge
U.S. Nuclear Regulatory Commission
Office of Nuclear Reactor Regulation
Washington, D.C. 20555

INPO Records Center
700 Galleria Parkway
Atlanta, GA 30339-5957

Mr. M. A. Scott
NRC Resident Inspector
Oconee Nuclear Station

ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS INFORMATION COLLECTION REQUEST: 50.0 HRS. FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE INFORMATION AND RECORDS MANAGEMENT BRANCH (MNBB 7714), U.S. NUCLEAR REGULATORY COMMISSION, WASHINGTON, DC 20555-0001, AND TO THE PAPERWORK REDUCTION PROJECT (3150-0104), OFFICE OF MANAGEMENT AND BUDGET, WASHINGTON, DC 20503.

LICENSEE EVENT REPORT (LER)

FACILITY NAME (1)

Oconee Nuclear Station, Unit 2

DOCKET NUMBER (2)

0 5 0 0 0 270

PAGE (3)

1 0f 10

TITLE (4)

Secondary Drain Line Rupture Results In A Manual Reactor Trip

EVENT DATE (5)			LER NUMBER (6)			REPORT DATE (7)			OTHER FACILITIES INVOLVED (8)	
MONTH	DAY	YEAR	YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	MONTH	DAY	YEAR	FACILITY NAME	DOCKET NUMBER(S)
09	24	96	96	04	01	12	09	96		05000
OPERATING MODE (9)		N	THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CFR (Check one or more of the following) (11)							
POWER LEVEL (10)		60	20.402(b)			20.405(c)		X	50.73(a)(2)(iv)	73.71(b)
			20.405(a)(1)(i)			50.36(c)(1)			50.73(a)(2)(v)	73.71(c)
			20.405(a)(1)(ii)			50.36(c)(2)			50.73(a)(2)(vii)	OTHER (Specify in
			20.405(a)(1)(iii)			50.73(a)(2)(i)			50.73(a)(2)(viii)(A)	Abstract below and
			20.405(a)(1)(iv)			50.73(a)(2)(ii)			50.73(a)(2)(viii)(B)	in Text, NRC Form
			20.405(a)(1)(v)			50.73(a)(2)(iii)			50.73(a)(2)(x)	366A)

LICENSEE CONTACT FOR THIS LER (12)

NAME

Lanny V. Wilkie, Safety Review Manager

TELEPHONE NUMBER

AREA CODE

(864)

885-3518

COMPLETE ONE LINE FOR EACH COMPONENT FAILURE DESCRIBED IN THIS REPORT (13)

CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NPRDS	CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NPRDS
E, D1, A2	SN	PP	UNK	No					

SUPPLEMENTAL REPORT EXPECTED (14)

YES (if yes, complete EXPECTED SUBMISSION DATE)

X

NO

EXPECTED SUBMISSION DATE (15)

MONTH

DAY

YEAR

ABSTRACT (Limit to 1400 spaces, i.e. approximately fifteen single-space typewritten lines) (16)

On September 24, 1996, at approximately 1642 hours, while operating at 60% full power, Unit 2 experienced a drain pipe rupture on the secondary side of the plant. At 1643 hours, the resulting steam release from the pipe rupture was isolated by closing the Main Steam supply block valves to the Second Stage Reheat system and manually tripping the reactor. The pipe rupture was due to a water hammer which was a result of the following three root causes: 1) A lack of a general understanding of the potential consequences of the water hammers experienced in the past resulted in untimely development and implementation of modifications necessary to prevent water hammers, 2) Failure to revise the Moisture Separator Reheater procedure to provide the information and instructions necessary to successfully perform the required task, and 3) A human error of inadequate verbal communication resulted in incomplete and inaccurate instructions being provided to perform the required task. Planned corrective actions include installation of modifications, procedure changes, and personnel training to prevent recurrence of water hammer events.

NRC FORM 366A		U.S. NUCLEAR REGULATORY COMMISSION(4-95)		APPROVED OMB NO. 3150-0104 EXPIRES:4/30/98	
LICENSEE EVENT REPORT (LER) TEXT CONTINUATION				ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS INFORMATION COLLECTION REQUEST: 50.0 HRS. FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE INFORMATION AND RECORDS MANAGEMENT BRANCH (MNB 7714), U.S. NUCLEAR REGULATORY COMMISSION, WASHINGTON, DC 20555-0001, AND TO THE PAPERWORK REDUCTION PROJECT (3150-0104), OFFICE OF MANAGEMENT AND BUDGET, WASHINGTON, DC 20503	
FACILITY NAME (1)		DOCKET NUMBER (2)		LER NUMBER (6)	
Oconee Nuclear Station, Unit 2		270		YEAR 96	SEQUENTIAL NUMBER 04
				REVISION NUMBER 01	PAGE (3) 2 OF 10

BACKGROUND:

Moisture Separator/Reheaters generate large quantities of saturated or near saturated liquid which is routed either to the feedwater heater drain [EIIS:SN] system or to the condenser [EIIS:COND].

Each pair ('A' and 'B') of the Moisture Separator/ Second Stage Reheaters (SSRH) [EIIS:RHTR] drains into an identical SSRH drain system. The drains flow to 'A' and 'B' Second Stage Reheater Drain Tanks (SSRHDT), respectively, which act as a reservoir. Downstream of the SSRHDTs the drain line divides, one branch going to the condenser via dump valves 2HD-25 (SSRH Drain '2A' Dump To Condenser) and 2HD-26 (SSRH Drain '2B' Dump To Condenser). The second branch drains directly to the 2A1 and 2A2 Feedwater Heaters and includes block valves 2HD-91 (2A SSRHDT Level Control Inlet Block) and 2HD-94 (2B SSRHDT Level Control Inlet Block), level control valves 2HD-92 (2A SSRHDT Level Control) and 2HD-95 (2B SSRHDT Level Control), and block valves 2HD-93 (2A SSRHDT Level Control Outlet Block) and 2HD-96 (2B SSRHDT Level Control Outlet Block).

If the route to the Feedwater Heaters is aligned, the drains will be controlled by the low level controller on the drain tank. If this route is isolated, the drain tank level will rise until the high level controller automatically directs the drainage to the condenser.

The purpose of Operations procedure, OP/2/A/1106/14 (Moisture Separator Reheater), is to provide direction for the operation of the Moisture Separator Reheaters. The purpose of OP/2/A/1106/14, Enclosure 3.6 (Abnormal Operating Conditions-First Stage and Second Stage Reheater Drain Operation With First and Second Stage Reheaters In Service) is to provide guidance for the isolation and restoration of the associated drain system, during power operation, in the event that the need arises.

**LICENSEE EVENT REPORT (LER)
TEXT CONTINUATION**

ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS INFORMATION COLLECTION REQUEST: 50.0 HRS. FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE INFORMATION AND RECORDS MANAGEMENT BRANCH (MNBB 7714), U.S. NUCLEAR REGULATORY COMMISSION, WASHINGTON, DC 20555-0001, AND TO THE PAPERWORK REDUCTION PROJECT (3150-0104), OFFICE OF MANAGEMENT AND BUDGET, WASHINGTON, DC 20503

FACILITY NAME (1)	DOCKET NUMBER (2)	LER NUMBER (6)			PAGE (3)
		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	
Oconee Nuclear Station, Unit 2	270	96	04	01	3 OF 10

EVENT DESCRIPTION:

On September 23, 1996, Unit 2 was escalating in power during a forced outage startup. The Moisture Separator Reheater procedure, OP/2/A/1106/14 (Moisture Separator Reheater), Enclosure 3.6 (Abnormal Operating Conditions - First Stage and Second Stage Reheater Drain Operation With First and Second Stage Reheaters In Service) was entered to dump the Second Stage 2A and 2B drains to the condenser. To achieve this configuration, procedure steps 2.3 and 2.4 of Enclosure 3.6 were performed. Step 2.3 required the closing of valves 2HD-91 and 2HD-94. Step 2.4 required verification that valves 2HD-25 and 2HD-26 were open.

On September 24, 1996, the Unit 2 Operations Coordinator verbally reminded the Unit 2 Shift Supervisor to open 2HD-91 and 2HD-94 at approximately 600 Mwe. (See Attachment 1)

At approximately 1448 hours, Unit 2 power escalation was stopped to investigate level control problems with the 2B Second Stage Reheater Drain Tank (SSRHDT). A drain tank high level alarm had been received and 2HD-26 (SSRH Dump Valve) indicated closed.

At approximately 1500 hours, the Operations Shift personnel initiated a work request for the investigation and repair of the SSRHDT level control problems. Further evaluation of the problem by the Operations Shift personnel resulted in resuming the power escalation.

At approximately 1600 hours, the Instrument and Control (I&C) technicians, investigating the SSRHDT level control problems, informed the Operations Shift personnel that level control problems were most likely due to valves 2HD-91 and 2HD-94 being closed. Shortly afterwards, the Control Room Senior Reactor Operator and Unit Supervisor made the decision to begin the Second Stage Reheater 2A and 2B drains feed forward activity by opening valves 2HD-91 and 2HD-94.

**LICENSEE EVENT REPORT (LER)
TEXT CONTINUATION**

ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS INFORMATION COLLECTION REQUEST: 50.0 HRS. FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE INFORMATION AND RECORDS MANAGEMENT BRANCH (MNBB 7714), U.S. NUCLEAR REGULATORY COMMISSION, WASHINGTON, DC 20555-0001, AND TO THE PAPERWORK REDUCTION PROJECT (3150-0104), OFFICE OF MANAGEMENT AND BUDGET, WASHINGTON, DC 20503

FACILITY NAME (1)	DOCKET NUMBER (2)	LER NUMBER (6)			PAGE (3)
		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	
Oconee Nuclear Station, Unit 2	270	96	04	01	4 OF 10

The Operations Shift personnel conducted a pre-job briefing, using Enclosure 3.6 of OP/2/A/1106/14, with the Unit 2 Basement Non-Licensed Operator (NLO) who was assigned to open valves 2HD-91 and 2HD-94. During this briefing, it was emphasized to the NLO to open these valves slowly.

At approximately 1630 hours, the NLOs left the Control Room to begin the feed forward activity.

At approximately 1640 hours, the NLOs began opening valves 2HD-94 and 2HD-91 as instructed during the pre-job briefing.

At approximately 1642 hours, with Unit 2 at approximately 60% full power, a rupture of a SSRH line, downstream of 2HD-94, occurred. The release of steam resulted in burn injuries to seven employees (five NLOs and two I&C technicians). There were no radioactive releases, radioactive exposures to employees, or contamination of employees.

At approximately 1643 hours, the Unit 2 Control Room received an emergency phone call reporting the steam release and personnel injuries. Control Room personnel took immediate action to isolate the steam release by closing Main Steam block valves 2MS-76 (MS to 2A1 and 2A2 SSRHs) and 2MS-79 (MS to 2B1 and 2B2 SSRHs) and then, manually tripping the reactor. All full length control rods fully inserted into the core and the reactor was shutdown.

Valve 2HP-120 (RC Volume Control) automatically opened to provide additional make-up flow to the Pressurizer [EIIS:PZR]. This diverted some of the flow from the Reactor Coolant Pump (RCP) seals. The low seal flow circuit automatically started the 'A' High Pressure Injection (HPI) [EIIS:BG] Pump to provide additional flow to the RCP seals. This is a normal function of the HPI makeup system and is separate from the Engineered Safeguards function.

**LICENSEE EVENT REPORT (LER)
TEXT CONTINUATION**

ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS INFORMATION COLLECTION REQUEST: 50.0 HRS. FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE INFORMATION AND RECORDS MANAGEMENT BRANCH (MNBB 7714), U.S. NUCLEAR REGULATORY COMMISSION, WASHINGTON, DC 20555-0001, AND TO THE PAPERWORK REDUCTION PROJECT (3150-0104), OFFICE OF MANAGEMENT AND BUDGET, WASHINGTON, DC 20503

FACILITY NAME (1)	DOCKET NUMBER (2)	LER NUMBER (6)			PAGE (3)
		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	
Oconee Nuclear Station, Unit 2	270	96	04	01	5 OF 10

Specific post-trip parameters remained within acceptable limits. Reactor Coolant System (RCS) [EIIIS:AB] pressure decreased to 1932 psig after the reactor trip from 2150 psig. RCS pressure then slowly returned to 2151 psig. Pressurizer inventory remained on scale between a high of 220 inches and a low of 111 inches post trip before increasing and stabilizing at 114 inches. RCS average temperature was approximately 579 F before the trip then decreased to approximately 550 F post trip.

Immediately following the trip, the 2A and 2B Steam Generator (SG) pressures reached a post trip high of approximately 1091 and 1087 psig, respectively. The SG pressures then decreased to 905 and 902 psig, respectively.

At approximately 1644 hours, the Medical Emergency Response Team was dispatched to provide medical aid to the injured employees.

At approximately 1653 hours, Site Assembly was conducted to aid in the identification of all injured employees and to help to prevent any further injuries. The Operations Shift Manager requested partial activation of the Emergency Response organization (Technical Support Center and Operational Support Center).

At approximately 1700 hours, a Failure Investigation Process Team was established to determine the root cause(s) for the pipe failure.

At approximately 1704 hours, the first ambulance arrived at the Site and advanced medical care was started.

At approximately 1735 hours, the Technical Support Center and Operational Support Center were fully staffed and declared operational.

An Event Investigation Team was established at the request of the Site VP to provide a non-site perspective as to the cause(s) of the event and lessons learned.

**LICENSEE EVENT REPORT (LER)
TEXT CONTINUATION**

ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS INFORMATION COLLECTION REQUEST: 50.0 HRS. FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE INFORMATION AND RECORDS MANAGEMENT BRANCH (MNBB 7714), U.S. NUCLEAR REGULATORY COMMISSION, WASHINGTON, DC 20555-0001, AND TO THE PAPERWORK REDUCTION PROJECT (3150-0104), OFFICE OF MANAGEMENT AND BUDGET, WASHINGTON, DC 20503

FACILITY NAME (1)	DOCKET NUMBER (2)	LER NUMBER (6)			PAGE (3)
		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	
Oconee Nuclear Station, Unit 2	270	96	04	01	6 OF 10

At approximately 1753 hours, the last injured employee was transported from the Site to Oconee Hospital.

At 2040 hours, a Notification of Unusual Event (NOUE) was declared and terminated. The NOUE was declared as a conservative action after the assessment of the collateral damage to plant equipment adjacent to the steam release area.

CONCLUSIONS:

The manual reactor trip was a proper and conservative response to the pipe rupture.

The Failure Investigation Team's preliminary conclusion was that a severe water hammer was the immediate cause of the pipe rupture. This team also concluded that erosion/corrosion was not a factor in the piping failure.

The Event Investigation Team determined that there were three basic root causes for the water hammer which led to the pipe rupture event. These causes were:

- A lack of a general understanding of the potential consequences of the water hammers experienced in the past resulted in untimely development and implementation of modifications necessary to prevent water hammers. Deficient initial design of the system was considered to be a contributing cause. Required NRC cause codes applicable to these causes are management deficiency (code E) for the root cause and design deficiency, equipment functional design deficiency, mechanical (code B1a), for the contributing cause.
- Failure to revise the Moisture Separator Reheater procedure to provide the information and instructions necessary to successfully perform the required task. The required NRC cause code applicable for this cause is defective procedure, technical deficiency (code D1).

**LICENSEE EVENT REPORT (LER)
TEXT CONTINUATION**

ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS
INFORMATION COLLECTION REQUEST: 50.0 HRS. FORWARD COMMENTS
REGARDING BURDEN ESTIMATE TO THE INFORMATION AND RECORDS
MANAGEMENT BRANCH (MNBB 7714), U.S. NUCLEAR REGULATORY
COMMISSION, WASHINGTON, DC 20555-0001, AND TO THE PAPERWORK
REDUCTION PROJECT (3150-0104), OFFICE OF MANAGEMENT AND
BUDGET, WASHINGTON, DC 20503

FACILITY NAME (1)	DOCKET NUMBER (2)	LER NUMBER (6)			PAGE (3)
		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	
Oconee Nuclear Station, Unit 2	270	96	04	01	7 OF 10

- A human error of inadequate verbal communication resulted in incomplete and inaccurate instructions being provided to perform the required task. The required NRC cause code applicable for this cause is deficient communication (code A2).

Elimination of any one of these three causes would have prevented the event. If the system modifications had been developed and implemented in a timely manner, the proposed procedure changes and the verbal communications would not have been necessary to prevent the water hammer. In the absence of the modifications, if the procedure had been revised to provide the needed instructions, in a proper and timely fashion, the water hammer could have been prevented. An adequate procedure would have eliminated the need to verbally communicate the needed instructions. However, the last barrier of verbal communication could have been effective in preventing this event if the specific guidance provided by engineering had been communicated.

A review of events for the past two years indicates that the manual tripping of a reactor at Oconee Nuclear Station is not a recurring problem.

There were no equipment failures that were NPRDS reportable.

CORRECTIVE ACTIONS:**Immediate:**

- 1) Main Steam block valves, 2MS-76 and 79 were closed and the reactor was manually tripped to isolate the steam supply to the second stage reheat drain system.

Subsequent:

- 1) A Site Assembly was initiated to account for all Site personnel.

**LICENSEE EVENT REPORT (LER)
TEXT CONTINUATION**

ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS INFORMATION COLLECTION REQUEST: 50.0 HRS. FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE INFORMATION AND RECORDS MANAGEMENT BRANCH (MNBB 7714), U.S. NUCLEAR REGULATORY COMMISSION, WASHINGTON, DC 20555-0001, AND TO THE PAPERWORK REDUCTION PROJECT (3150-0104), OFFICE OF MANAGEMENT AND BUDGET, WASHINGTON, DC 20503

FACILITY NAME (1)

DOCKET NUMBER (2)

LER NUMBER (6)

PAGE (3)

Oconee Nuclear Station, Unit 2

270

YEAR

SEQUENTIAL
NUMBERREVISION
NUMBER

96

04

01

8 OF 10

- 2) The Technical Support Center and Operational Support Center were activated to provide additional support to the operating shift.
- 3) A Failure Investigation Process Team was established to investigate the cause(s) of the pipe rupture and inspect for similar conditions.
- 4) An Event Investigation Team was established to evaluate the actions leading up to the pipe rupture and the actions in response to the pipe rupture.

Planned:

- 1) Determine the modifications necessary to prevent this type of water hammer event. These modifications will be implemented prior to unit restart.
- 2) Evaluate and implement effective methods to increase the general understanding of appropriate personnel in operations, engineering, and management concerning water hammer mechanisms and consequences. Consideration will be given to utilizing this event as a case study.
- 3) Assess the current processes for determination of plant modification priorities and schedules to assure proper consideration is given to all the personnel safety aspects of the situation the modification is to correct. Consideration will be given to backfitting this review to all currently outstanding modifications.
- 4) Review and revise as necessary all procedures associated with operation of the moisture separator reheaters and drain systems for all Oconee units to include all the necessary information, instructions, and precautions necessary to successfully operate without preventable water hammers. This will be completed prior to unit restart.

**LICENSEE EVENT REPORT (LER)
TEXT CONTINUATION**

ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS INFORMATION COLLECTION REQUEST: 50.0 HRS. FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE INFORMATION AND RECORDS MANAGEMENT BRANCH (MNBB 7714), U.S. NUCLEAR REGULATORY COMMISSION, WASHINGTON, DC 20555-0001, AND TO THE PAPERWORK REDUCTION PROJECT (3150-0104), OFFICE OF MANAGEMENT AND BUDGET, WASHINGTON, DC 20503

FACILITY NAME (1)	DOCKET NUMBER (2)	LER NUMBER (6)			PAGE (3)
		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	
Oconee Nuclear Station, Unit 2	270	96	04	01	9 OF 10

- 5) Based on this event, review existing guidance and expectations regarding when verbal communications alone are sufficient. Revise guidance as necessary. Existing and/or revised expectations will be reinforced with applicable personnel.
- 6) Appropriate directives and procedures will be revised to clearly specify that when a procedure has been determined to be inadequate for the performance of the intended activity, it shall either be immediately revised or the procedure placed on hold to prevent use.

SAFETY ANALYSIS:

At approximately 1643 hours, the reactor was manually tripped, as a conservative action, to aid in the steam isolation for personnel protection.

Following the reactor trip, plant response was as designed with no safety system actuations. The consequences of a steam line break accident are analyzed in the Updated Final Safety Analysis Report (UFSAR), section 15.13, "Steam Line Break Accident". The UFSAR accident scenario is the double ended rupture of a thirty four inch main steam line between the reactor building and a turbine stop valve with the unit operating at rated power. The rupture that occurred in the heater drain system was well within the bounds of this analysis and did not challenge the plant from a nuclear safety perspective. No equipment important to nuclear safety was affected by the pipe rupture.

Prior to the reactor trip seven employees were injured due to the steam release from the pipe rupture. All seven individuals were transported from the Site, via ambulance, to receive professional medical care. This event did not result in any personnel exposures, contamination, or release of radioactive materials. This event had no impact on the health and safety of the public.

**LICENSEE EVENT REPORT (LER)
TEXT CONTINUATION**

ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS INFORMATION COLLECTION REQUEST: 50.0 HRS. FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE INFORMATION AND RECORDS MANAGEMENT BRANCH (MNBB 7714), U.S. NUCLEAR REGULATORY COMMISSION, WASHINGTON, DC 20555-0001, AND TO THE PAPERWORK REDUCTION PROJECT (3150-0104), OFFICE OF MANAGEMENT AND BUDGET, WASHINGTON, DC 20503

FACILITY NAME (1)

DOCKET NUMBER (2)

LER NUMBER (6)

PAGE (3)

Oconee Nuclear Station, Unit 2

270

YEAR

SEQUENTIAL
NUMBERREVISION
NUMBER

96

04

01

10 OF 10

Attachment 1

