

DUKE POWER COMPANY

POWER BUILDING


422 SOUTH CHURCH STREET, CHARLOTTE, N. C. 28242

WILLIAM O. PARKER, JR.
VICE PRESIDENT
STEAM PRODUCTION

TELEPHONE: AREA 704
373-4083

May 19, 1976

Mr. Norman C. Moseley, Director
U. S. Nuclear Regulatory Commission
Suite 818
230 Peachtree Street, Northwest
Atlanta, Georgia 30303

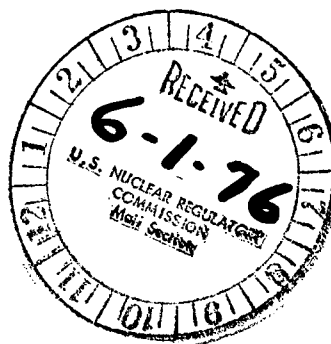

Re: Oconee Unit 3
Docket No. 50-287

Dear Mr. Moseley:

Pursuant to Sections 6.2 and 6.6.2 of the Oconee Nuclear Station Technical Specifications, please find attached Reportable Occurrence Report R0-287/76-3.

Very truly yours,

W.O. Parker Jr.
William O. Parker, Jr. *By AMB*

EDB:mmmb

Attachment

CC Director, Office of Management Information
and Program Control

5442

Duke Power Company
Oconee Unit 3

Report No.: RO-287/76-3

Report Date: May 19, 1976

Occurrence Date: April 19, 1976

Facility: Oconee Unit 3, Seneca, South Carolina

Identification of Occurrence: Inadvertent isolation of 230 KV yellow bus during electrical breaker maintenance.

Conditions Prior to Occurrence: Unit at 80% full power.

Description of Occurrence:

On April 19, 1976, maintenance was being performed on electrical switchyard breakers PCB23 and 24 which had been isolated from the 230 KV yellow bus. At this time, Unit 2 was shutdown, and it was necessary to reset generator lockout relays prior to closing PCB24. These relays were not closed and when breaker PCB24 was closed, a trip signal was generated, causing all breakers connected to the 230 KV yellow bus to trip, isolating the bus.

Apparent Cause of Occurrence:

This incident was apparently caused by an incorrect assumption that the generator lockout relays were reset immediately prior to closing electrical breaker PCB24.

Analysis of Occurrence:

This occurrence did not result in the loss of any emergency sources to Oconee units. Additionally, the 230 KV red bus was still available to supply power from all transmission lines to the startup transformers for all the Oconee units. It is concluded, therefore, that this incident did not affect the health and safety of the public.

Corrective Action:

Maintenance procedures have been revised to assure that generator lockout relays are properly reset prior to the performance of breaker maintenance.

MAY 21 10 20 AM '76

RECEIVED
FBI
MAY 21 1976