

## ACCELERATED DISTRIBUTION DEMONSTRATION SYSTEM

## REGULATORY INFORMATION DISTRIBUTION SYSTEM (RIDS)

ACCESSION NBR: 8903230349 DOC. DATE: 89/03/10 NOTARIZED: NO DOCKET #  
 FACIL: 50-316 Donald C. Cook Nuclear Power Plant, Unit 2, Indiana & 05000316  
 AUTH. NAME AUTHOR AFFILIATION  
 POSTLEWAIT, T.K. Indiana Michigan Power Co. (formerly Indiana & Michigan Ele  
 SMITH, W.G. Indiana Michigan Power Co. (formerly Indiana & Michigan Ele  
 RECIP. NAME RECIPIENT AFFILIATION

SUBJECT: LER 89-004-00: on 890210, pressurizer safety valve lift point  
 due to setpoint drift.

W/8 ltr.

DISTRIBUTION CODE: IE22D COPIES RECEIVED: LTR 1 ENCL 1 SIZE: 5  
 TITLE: 50.73 Licensee Event Report (LER), Incident Rpt, etc.

## NOTES:

RECIPIENT ID CODE/NAME	COPIES LTR ENCL	RECIPIENT ID CODE/NAME	COPIES LTR ENCL
PD3-1 LA	1 1	PD3-1 PD	1 1
STANG, J	1 1		
INTERNAL: ACRS MICHELSON	1 1	ACRS MOELLER	2 2
ACRS WYLIE	1 1	AEOD/DOA	1 1
AEOD/DSP/TPAB	1 1	AEOD/ROAB/DSP	2 2
ARM/DCTS/DAB	1 1	DEDRO	1 1
NRR/DEST/ADE 8H	1 1	NRR/DEST/ADS 7E	1 0
NRR/DEST/CEB 8H	1 1	NRR/DEST/ESB 8D	1 1
NRR/DEST/ICSB 7	1 1	NRR/DEST/MEB 9H	1 1
NRR/DEST/MTB 9H	1 1	NRR/DEST/PSB 8D	1 1
NRR/DEST/RSB 8E	1 1	NRR/DEST/SGB 8D	1 1
NRR/DLPQ/HFB 10	1 1	NRR/DLPQ/QAB 10	1 1
NRR/DOEA/EAB 11	1 1	NRR/DREP/RAB 10	1 1
NRR/DREP/RPB 10	2 2	NRR/DRIS/SIB 9A	1 1
NUDOCS-ABSTRACT	1 1	REG FILE 02	1 1
RES/DSIR/EIB	1 1	RES/DSR/PRAB	1 1
RGN3 FILE 01	1 1		
EXTERNAL: EG&G WILLIAMS, S	4 4	FORD BLDG HOY, A	1 1
H ST LOBBY WARD	1 1	LPDR	1 1
NRC PDR	1 1	NSIC MAYS, G	1 1
NSIC MURPHY, G. A	1 1		

NOTE TO ALL "RIDS" RECIPIENTS:

PLEASE HELP US TO REDUCE WASTE! CONTACT THE DOCUMENT CONTROL DESK,  
 ROOM P1-37 (EXT. 20079) TO ELIMINATE YOUR NAME FROM DISTRIBUTION  
 LISTS FOR DOCUMENTS YOU DON'T NEED!

TOTAL NUMBER OF COPIES REQUIRED: LTR 45 ENCL 44

## LICENSEE EVENT REPORT (LER)

FACILITY NAME (1) D. C. Cook Nuclear Plant - Unit 2										DOCKET NUMBER (2) 0 5 0 0 0 3 1 1 6				PAGE (3) 1 OF 0 4		
TITLE (4) Pressurizer Safety Valve Lift Point Due To Setpoint Drift																
EVENT DATE (5)			LER NUMBER (6)				REPORT DATE (7)			OTHER FACILITIES INVOLVED (8)						
MONTH	DAY	YEAR	YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	MONTH	DAY	YEAR	FACILITY NAMES				DOCKET NUMBER(S)			
0 2	1 0	8 9	8 9	0 0 4	0 0	0 3	1 0	8 9					0 5 0 0 0			
OPERATING MODE (8)		THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CFR §: (Check one or more of the following) (11)														
POWER LEVEL (10) 0 0 0		20.402(b)				20.405(c)				50.73(a)(2)(iv)				73.71(b)		
		20.405(a)(1)(i)				50.36(c)(1)				50.73(a)(2)(v)				73.71(c)		
		20.405(a)(1)(ii)				50.36(c)(2)				50.73(a)(2)(vii)				OTHER (Specify in Abstract below and in Text, NRC Form 366A)		
		20.405(a)(1)(iii)				50.73(a)(2)(i)				50.73(a)(2)(viii)(A)						
		20.405(a)(1)(iv)				50.73(a)(2)(ii)				50.73(a)(2)(vii)(B)						
		20.405(a)(1)(v)				50.73(a)(2)(iii)				50.73(a)(2)(x)						
LICENSEE CONTACT FOR THIS LER (12)																
NAME T. K. Postlewait - Technical Engineering Superintendent										TELEPHONE NUMBER						
										AREA CODE 6 1 6		4 6 5 - 5 9 0 1				
COMPLETE ONE LINE FOR EACH COMPONENT FAILURE DESCRIBED IN THIS REPORT (13)																
CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NPDs		CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NPDs						
X	A B	R V	C 7 1 0	Y												
SUPPLEMENTAL REPORT EXPECTED (14)												EXPECTED SUBMISSION DATE (15)		MONTH	DAY	YEAR
YES (If yes, complete EXPECTED SUBMISSION DATE)												X NO				

ABSTRACT (Limit to 1400 spaces, i.e., approximately fifteen single-space typewritten lines) (16)

On November 24, 1989, during a hydrostatic test of the RCS (Reactor Coolant System), leakage through the pressurizer safety valves (EIS/AB-RV) was detected via temperature and acoustic monitor indications. Since the leak could not be traced to a single valve, two of the three valves that had the potential to contribute to the leakage (2-SV-45B and 2-SV-45C) were removed and sent to Wyle Laboratories for analysis.

On February 10, during Laboratory Bench Testing, it was determined that the initial lift pressure for 2-SV-45B was 2526 psig, 16 psi greater than the maximum setpoint pressure allowed by Technical Specification 3.4.3 (2460 to 2510 psig). 2-SV-45B was subsequently bench tested three more times, and each time it was within the setpoint allowable tolerances (2497 PSIG, 2475 psig, 2495 psig). The as-found lift pressure for 2-SV-45C was within allowable values. 2-SV-45B was last tested in September 1986 and no problems were encountered at that time. There were no additional inoperable components, structures, or systems that contributed to this event. The cause for the setpoint drift could not be determined.

A Safety Evaluation revealed that the RCS safety limit would not have been exceeded. This event did not have any safety consequences and did not represent a significant hazard to the public health or safety.

8903230349 890310  
PDR ADOCK 05000316  
S PIC

IE22-11

## LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

U.S. NUCLEAR REGULATORY COMMISSION

APPROVED OMB NO. 3150-0104

EXPIRES: 8/31/88

FACILITY NAME (1)	DOCKET NUMBER (2)	LER NUMBER (6)			PAGE (3)		
		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER		OF	
D. C. Cook Nuclear Plant Unit - 2	05000316	89	004	00	02		04

TEXT (If more space is required, use additional NRC Form 366A's) (17)

Conditions Prior to Occurrence

Unit 2 in Mode 5 (Cold Shutdown) following Steam Generator replacement, with no fuel in core.

Description of Event

On November 24, 1989, during a hydrostatic test of the RCS (Reactor Coolant System), leakage through the pressurizer safety valves (E11S/AB-RV) was detected via temperature and acoustic monitor indications. Since the leak could not be traced to a single valve, two of the three valves that had the potential to contribute to the leakage (2-SV-45B and 2-SV-45C) were removed and sent to Wyle Laboratories for analysis.

On February 10, during Laboratory Bench Testing, it was determined that the initial lift pressure for 2-SV-45B was 2526 psig, 16 psi greater than the maximum setpoint pressure allowed by Technical Specification 3.4.3 (2460 to 2510 psig). 2-SV-45B was subsequently bench tested three more times, and each time it was within the setpoint allowable tolerances (2497 PSIG, 2475 psig, 2495 psig). The as-found lift pressure for 2-SV-45C was within allowable values. 2-SV-45B was last tested in September 1986 and no problems were encountered at that time.

There were no additional inoperable components, structures or systems that contributed to this event.

Cause of Event

This event is attributed to setpoint drift. The cause for the setpoint drift could not be determined. A factory representative inspected the valve and could not identify any problems which would have caused the valve to lift out of tolerance.

## LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

APPROVED OMB NO. 3150-0104  
EXPIRES: 8/31/88

FACILITY NAME (1)	DOCKET NUMBER (2)	LER NUMBER (6)			PAGE (3)		
		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER			
D. C. Cook Nuclear Plant Unit - 2	0 5 0 0 0 3 1 6	8 9	- 0 0 4	- 0 0	0 3	OF	0 4

TEXT (If more space is required, use additional NRC Form 366A's) (17)

Analysis of Event

In Technical Specification 2.1.2, A Reactor Coolant System Pressure Safety Limit of 2735 psig is stipulated. The corresponding Basis explains that the reactor vessel and the pressurizer were designed to ASME B&PV Section III, which permits a maximum transient pressure of 2735 psig (110 percent of the design pressure of 2485 psig.) In addition, the RCS piping, valves and fittings, are designed to ANSI B 31.1, 1967 edition, which permits a maximum transient pressure of 2985 psig (120 percent of 2485 psig.) The Basis also states that the entire RCS is hydrotested at 3107 psig (125 percent of 2485 psig.)

During operation, all pressurizer code safety valves must be operable to prevent the RCS from being pressurized above its safety limit of 2735 psig. The Basis for Technical Specification 3.4.3 explains that the combined relief capacity of the three code safety valves is greater than the maximum surge rate resulting from a complete loss of load, assuming no reactor trip until the first Reactor Protection System trip setpoint is reached. No credit is taken for a direct reactor trip on the loss of load, and assuming no operation of either power operated relief valves or the steam dump valves. In the instance of high set point deviation (2526 psig), the RCS pressure could have reached a value of 2602 psig (2526 psig plus 3 percent code allowable accumulation for a valve to attain its rated lift.)

An assessment of the safety consequences and implications revealed that this event did not have any safety significance. The safety limit of 2735 psig would not have been exceeded under any circumstances since the two remaining code safety valves were operable, and within allowable tolerances. Their lift setpoints were 2510 psig or less, and the third safety valve would have lifted at 2602 psig in the worst case.

In conclusion, this event did not have any safety consequences and it did not represent a significant hazard to the public health or safety.

## LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

U.S. NUCLEAR REGULATORY COMMISSION

APPROVED OMB NO. 3150-0104

EXPIRES: 8/31/88

FACILITY NAME (1)	DOCKET NUMBER (2)	LER NUMBER (6)			PAGE (3)		
		YEAR	SEQUENTIAL NUMBER	PREVIOUS NUMBER			
D. C. Cook Nuclear Plant Unit - 2	0 5 0 0 0 3 1 6	8 9	— 0 0 4	— 0 0	0 4	OF	0 4

TEXT (If more space is required, use additional NRC Form 366A's) (17)

Corrective Actions

## Safety Valve Refurbishment:

1. A Crosby Valve Co. serviceman inspected 2-SV-45B and could not determine the cause for 2-SV-45B to lift out of tolerance. The Serviceman lapped and polished the disc and seat and verified that the disc and seat measurements were within allowable tolerances.
2. 2-SV-45C had the same work performed on it as was performed on 2-SV-45B. The disc and seat were within allowable tolerances and the valve is in acceptable condition.

Failed Component Identification

Manufacturer: Crosby Valve Co  
Model No: HB-86-BP  
EIIIS Code: AB-RV

Previous Similar Events

None

Indiana Michigan  
Power Company  
Cook Nuclear Plant  
P.O. Box 458  
Bloomington, IN 47406  
317 465 5901



March 10, 1989

United States Nuclear Regulatory Commission  
Document Control Desk  
Washington, D.C. 20555

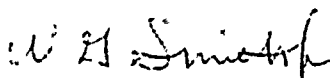
Operating License DPR-74  
Docket No. 50-316

Document Control Manager:

In accordance with the criteria established by 10 CFR 50.73  
entitled Licensee Event Reporting System, the following  
report is being submitted:

89-004-00

Sincerely,

  
W. G. Smith, Jr.  
Plant Manager

WGS:clw

Attachment

cc: D. H. Williams, Jr.  
A. B. Davis, Region III  
M. P. Alexich  
P. A. Barrett  
J. E. Borggren  
R. F. Kroeger  
NRC Resident Inspector  
Wayne Scott, NRC  
R. C. Callen  
G. Charnoff, Esq.  
Dottie Sherman, ANI Library  
D. Hahn  
INPO  
PNSRC  
A. A. Blind  
S. J. Brewer/B. P. Lauzau

*IE22*  
*11*