

## ACCELERATED DISTRIBUTION DEMONSTRATION SYSTEM

## REGULATORY INFORMATION DISTRIBUTION SYSTEM (RIDS)

ACCESSION NBR: 8908220230 DOC. DATE: 89/08/14 NOTARIZED: NO DOCKET #  
 FACIL: 50-251 Turkey Point Plant, Unit 4, Florida Power and Light C 05000251  
 AUTH. NAME AUTHOR AFFILIATION  
 HERRIN, D.W. Florida Power & Light Co.  
 WOODY, C.O. Florida Power & Light Co.  
 RECIP. NAME RECIPIENT AFFILIATION

SUBJECT: LER 89-006-00: on 890713, degraded intake cooling water flow condition, to component cooling water heat exchangers.  
 W/8 Ltr.

DISTRIBUTION CODE: IE22T COPIES RECEIVED: LTR 1 ENCL 1 SIZE: 6  
 TITLE: 50.73/50.9 Licensee: Event Report (LER), Incident Rpt, etc.

## NOTES:

RECIPIENT ID CODE/NAME	COPIES LTR ENCL	RECIPIENT ID CODE/NAME	COPIES LTR ENCL
PD2-2 LA	1 1	PD2-2 PD	1 1
EDISON, G	1 1		
INTERNAL: ACRS MICHELSON	1 1	ACRS MOELLER	2 2
ACRS WYLIE	1 1	AEOD/DOA	1 1
AEOD/DSP/TPAB	1 1	AEOD/ROAB/DSP	2 2
DEDRO	1 1	IRM/DCTS/DAB	1 1
NRR/DEST/CEB 8H	1 1	NRR/DEST/ESB 8D	1 1
NRR/DEST/ICSB 7	1 1	NRR/DEST/MEB 9H	1 1
NRR/DEST/MTB 9H	1 1	NRR/DEST/PSB 8D	1 1
NRR/DEST/RSB 8E	1 1	NRR/DEST/SGB 8D	1 1
NRR/DLPQ/HFB 10	1 1	NRR/DLPQ/PEB 10	1 1
NRR/DOEA/EAB 11	1 1	NRR/DREP/RPB 10	2 2
NUDOCS-ABSTRACT	1 1	REG FILE 02	1 1
RES/DSIR/EIB	1 1	RGN2 FILE 01	1 1
EXTERNAL: EG&G WILLIAMS, S	4 4	FORD BLDG HOY, A	1 1
L ST LOBBY WARD	1 1	LPDR	1 1
NRC PDR	1 1	NSIC MAYS, G	1 1
NSIC MURPHY, G.A	1 1		

FULL TEXT CONVERSION REQUIRED  
 TOTAL NUMBER OF COPIES REQUIRED: LTR 40 ENCL 40

A10-4  
 [Signature]

R  
I  
D  
S  
/  
A  
D  
D  
S  
  
R  
I  
D  
S  
/  
A  
D  
D  
S



FPL

P.O. Box 14000, Juno Beach, FL 33408-0420

AUGUST 14 1989

L-89-280  
10 CFR 50.73

U. S. Nuclear Regulatory Commission  
Attn: Document Control Desk  
Washington, D. C. 20555

Gentlemen:

Re: Turkey Point Unit 4  
Docket No. 50-251  
Reportable Event: 89-06  
Date of Event: July 13, 1989  
Degraded Intake Cooling Water Flow Condition to Component  
Cooling Water Heat Exchangers and Unit Shutdown Required  
by Technical Specifications due to Valve Failure

The attached Licensee Event Report is being submitted pursuant to the requirements of 10 CFR 50.73 to provide notification of the subject event.

Very truly yours,

*C. O. Woody*

C. O. Woody  
Acting Senior Vice President - Nuclear

COW/JRH/cm

Attachment

cc: Stewart D. Ebnetter, Regional Administrator, Region II, USNRC  
Senior Resident Inspector, USNRC, Turkey Point Plant

8908220230 890814  
PDR ADOCK 05000251  
S FDC

## LICENSEE EVENT REPORT (LER)

FACILITY NAME (1) Turkey Point Unit 4										DOCKET NUMBER (2) 0 5 0 0 0 2 5 1 1										PAGE (3) OF 0 5	
TITLE (4) Degraded Intake Cooling Water Flow Condition to Component Cooling Water Heat Exchangers and Unit Shutdown Required by Technical Specifications due to Valve Failure																					
EVENT DATE (5)			LER NUMBER (6)				REPORT DATE (7)			OTHER FACILITIES INVOLVED (8)											
MONTH	DAY	YEAR	YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	MONTH	DAY	YEAR	FACILITY NAMES						DOCKET NUMBER(S)						
0 7	1 3	8 9	8 9	0 0 6	0 0 3	1 4	8 9								0 5 0 0 0						
OPERATING MODE (9)		THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CFR §: (Check one or more of the following) (11)																			
1		20.402(b)				20.408(a)				80.73(a)(2)(iv)				73.71(b)							
POWER LEVEL (10)		0 2 5				20.408(a)(1)(i)				80.73(a)(1)				80.73(a)(2)(v)				73.71(a)			
		20.408(a)(1)(ii)				80.73(a)(2)				80.73(a)(2)(vi)				OTHER (Specify in Abstract below and in Text, NRC Form 356A)							
		20.408(a)(1)(iii)				80.73(a)(2)(i)				80.73(a)(2)(vii)(A)											
		20.408(a)(1)(iv)				80.73(a)(2)(ii)				80.73(a)(2)(vii)(B)											
		20.408(a)(1)(v)				80.73(a)(2)(iii)				80.73(a)(2)(ii)											
LICENSEE CONTACT FOR THIS LER (12)																					
NAME Dennis W. Herrin, Regulation and Compliance Engineer										TELEPHONE NUMBER											
										AREA CODE											
										3 0 5		2 4 6 - 6 7 4 9									
COMPLETE ONE LINE FOR EACH COMPONENT FAILURE DESCRIBED IN THIS REPORT (13)																					
CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NPDOS		CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NPDOS											
X	B S	I S V P	3 4 0	N																	
SUPPLEMENTAL REPORT EXPECTED (14)										EXPECTED SUBMISSION DATE (15)		MONTH		DAY		YEAR					
YES (If yes, complete EXPECTED SUBMISSION DATE)										X NO											

ABSTRACT (Limit to 1400 spaces, i.e., approximately fifteen single-space typewritten lines) (16)

On July 13, 1989, Intake Cooling Water (ICW) flow to the Unit 4 Component Cooling Water (CCW) heat exchangers degraded to below the design basis flow rate for fifteen minutes while backwashing the 4A ICW/CCW basket strainer. ICW flow was restored within five minutes of recognizing the degraded flow condition. On July 15, 1989 the same condition occurred but ICW flow was maintained above the design basis flow. On July 16, 1989, the 4B ICW header was taken out of service for investigation. The cause of these conditions was initially believed to be clogging of the 4B ICW/CCW basket strainer and/or a malfunction of its differential pressure gauge. Subsequent evaluation indicated flow obstruction in or around 4B ICW header isolation valve 4-50-308. Due to the frequency of cleaning ICW/CCW basket strainers, a management decision was made not to continue power operations with only one header of ICW operable. Unit 4 was placed in Mode 3 on July 17, 1989. Valve 4-50-308 was replaced and the 4B ICW header was returned to service on July 20, 1989. The initial degraded ICW flow condition did not affect any other plant equipment.



10  
11  
12

## LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

FACILITY NAME (1)	DOCKET NUMBER (2)	LER NUMBER (8)			PAGE (3)		
		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER			
Turkey Point Unit 4	0 5 0 0 0 2 5 1	8 9	0 0 6	0 0	0 2	OF	0 5

TEXT (if more space is required, use additional NRC Form 368A's) (17)

## Description of the Event

At 1625 on July 13, 1989, with Unit 4 in Mode 1 at 25% power, the 4A Intake Cooling Water (ICW)/Component Cooling Water (CCW) basket strainer (EIS system BI, component: BSKT) was taken out of service for cleaning. (See simplified drawing of the ICW system attached.) At 1635 the Nuclear Operator observed a degraded flow condition on the CCW heat exchangers (EIS System: CC, component: HX) and immediately notified the Control Room operator. The Nuclear Operator was instructed to valve the 4A ICW/CCW basket strainer back in service. At 1640 ICW flow was restored to the CCW heat exchangers. The Operations personnel believed the source of reduced ICW flow to the CCW heat exchangers to be clogging of the 4B ICW/CCW basket strainer. Between 1725 and 2125 the 4B ICW/CCW basket strainer was out of service for cleaning. The basket strainer was found to be more clogged than normal.

At approximately 2200 on July 14, 1989 the onsite Technical Department was directed to perform an evaluation of the ICW degraded flow condition. At 0800 on July 15, 1989, the Technical Department system engineer notified Operations Department personnel that an analysis of the degraded ICW flow condition on July 13, 1989 revealed that the ICW flow to the CCW heat exchangers was below the design basis flow rate from 1625 to 1640 on July 13, 1989.

At 1824 on July 15, 1989, an attempt was made to valve out the 4A ICW/CCW basket strainer for cleaning when ICW flow to the CCW heat exchangers decreased. The strainer was returned to a normal alignment while ICW flow was maintained above 15,400 gpm. Since the 4B ICW/CCW basket strainer had previously been cleaned and showed a differential pressure decrease to approximately 1.0 psid, Operations personnel suspected the strainer to be clogged and the differential pressure gauge to be in error.

At 1425 on July 16, 1989, with Unit 4 in Mode 1 at 100% power, the 4B ICW/CCW basket strainer was taken out of service in accordance with Technical Specification 3.4.5.b.1 for cleaning and to inspect for obstructions. The inspection showed no significant blockage. Subsequent evaluation of the degraded ICW flow condition by the System Engineer indicated probable flow restriction in or around 4B ICW header isolation valve 4-50-308.

Due to the frequency of cleaning ICW/CCW basket strainers, a management decision was made not to continue operation with only one header of ICW operable. Therefore, at 0325 on July 17, 1989, a Unit 4 shutdown was initiated and at 0607 Unit 4 was placed in Mode 3 (hot standby).

Examination and repair of the 4-50-308 valve required isolation of the 4B ICW header. Although no degraded flow conditions were indicated for the 4A ICW/CCW basket strainer, to ensure the maximum flow capability, FPL determined that backwash of the 4A ICW/CCW basket strainer was prudent. However, with the 4B ICW header at reduced flow (approximately 8200 gpm) and therefore,

FACILITY NAME (1)	DOCKET NUMBER (2)	LER NUMBER (6)			PAGE (3)	
		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER		
Turkey Point Unit 4	05000251	89	006	00	03	OF 05

TEXT (If more space is required, use additional NRC Form 365A's) (17)

technically inoperable, NRC approval was required to isolate the 4A ICW/CCW basket strainer. On July 18, 1989, the NRC approved a discretionary enforcement for a period of time not to exceed one hour to perform the requested backwash of the 4A ICW/CCW basket strainer. This operation took place between 2000 and 2100 on July 18, 1989.

Valve 4-50-308 was replaced and the 4B ICW header was returned to service at 1900 on July 20, 1989. Technical Specification Action Statement time requirements associated with the 4B ICW header low flow condition were met.

### Cause of the Event

The cause of the degraded ICW flow to the CCW heat exchangers was due to failure of 4B ICW header isolation valve 4-50-308. Upon disassembly, the valve disc was found to be in the partially opened position and separated from the valve stem. The tapered pins (2) which connect the disc to the valve upper stem failed in the threaded region. Preliminary indications are that the tapered pins experienced fatigue failure due to oscillations set up in the valve internals by turbulent flow conditions.

### Analysis of the Event

The minimum required total flow to the CCW heat exchangers during power operation was less than the design basis flow from 1625 to 1640 on July 13, 1989. During this time, the CCW heat exchanger outlet temperature reached a maximum recorded value of approximately 109 degrees F.

The limiting components in the CCW system from the perspective of operating CCW temperatures are the Reactor Coolant Pumps seals. Based on this limitation, the CCW heat exchanger outlet temperature may exceed 105 degrees F up to 125 degrees F for a maximum period of 2 hours. Since the CCW heat exchanger outlet temperature reached a maximum recorded value of approximately 109 degrees F during the 15 minutes of degraded ICW flow, it may be concluded that this condition had no significant affect on plant equipment.

The degraded ICW flow to the CCW heat exchangers occurred during the backwashing of the 4A ICW/CCW basket strainer. Within 5 minutes of recognizing the degraded ICW flow condition, total ICW flow to the CCW heat exchangers was restored to above 15,400 gpm. Had a Design Basis Accident occurred during this time, ICW flow to the CCW heat exchangers could have been restored in time to accommodate the heat loads generated by a Large Break Loss of Coolant Accident.

During the time the 4B ICW header was out of service to repair valve 4-50-308, ICW total flow to the CCW heat exchangers was maintained above that required to mitigate the consequences of a Design Basis Accident.



1

FACILITY NAME (1)	DOCKET NUMBER (2)	LER NUMBER (6)			PAGE (3)	
		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER		
Turkey Point Unit 4	05000251	89	006	00	04	OF 05

TEXT (if more space is required, use additional NRC Form 368A's) (17)

**Corrective Actions**

- 1) Caution statements have been added to procedures 3/4-OP-019, "Intake Cooling Water System," for operators to ensure that total ICW flow to the CCW heat exchangers does not drop below 15,400 gpm while valving an ICW/CCW basket strainer out of service for backwashing.
- 2) While valve 4-50-308 was removed from the 4B ICW header, a "crawl-through" inspection was conducted to ensure removal of any obstructions to the 4B ICW/CCW basket strainer.
- 3) Valve 4-50-308 was replaced. After ensuring valve integrity and operability, the 4B ICW header was returned to service.
- 4) A disc/stem tapered pin from the 4-50-308 valve has been recovered from the 4B ICW header. This pin will be analyzed to determine its failure mechanism.

**Additional Information**

Valve 4-50-308 is a Model Triton XR-70 36" manual butterfly valve supplied by the Henry Pratt Company. The replacement valve is a Model RIA 36" manual butterfly valve supplied by the Henry Pratt Co.

No similar Licensee Event Reports could be located.



# LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

U.S. NUCLEAR REGULATORY COMMISSION  
APPROVED OMB NO. 3150-0104  
EXPIRES: 8/31/88

FACILITY NAME (1)

DOCKET NUMBER (2)


LER NUMBER (8)

PAGE (3)

Turkey Point Unit-4

0 5 0 0 0 2 1 5 1 8 9 - 0 0 6 - 0 0 0 0 5 1 0 0 1 5

TEXT (If more space is required, use additional NRC Form 366A (1/77))

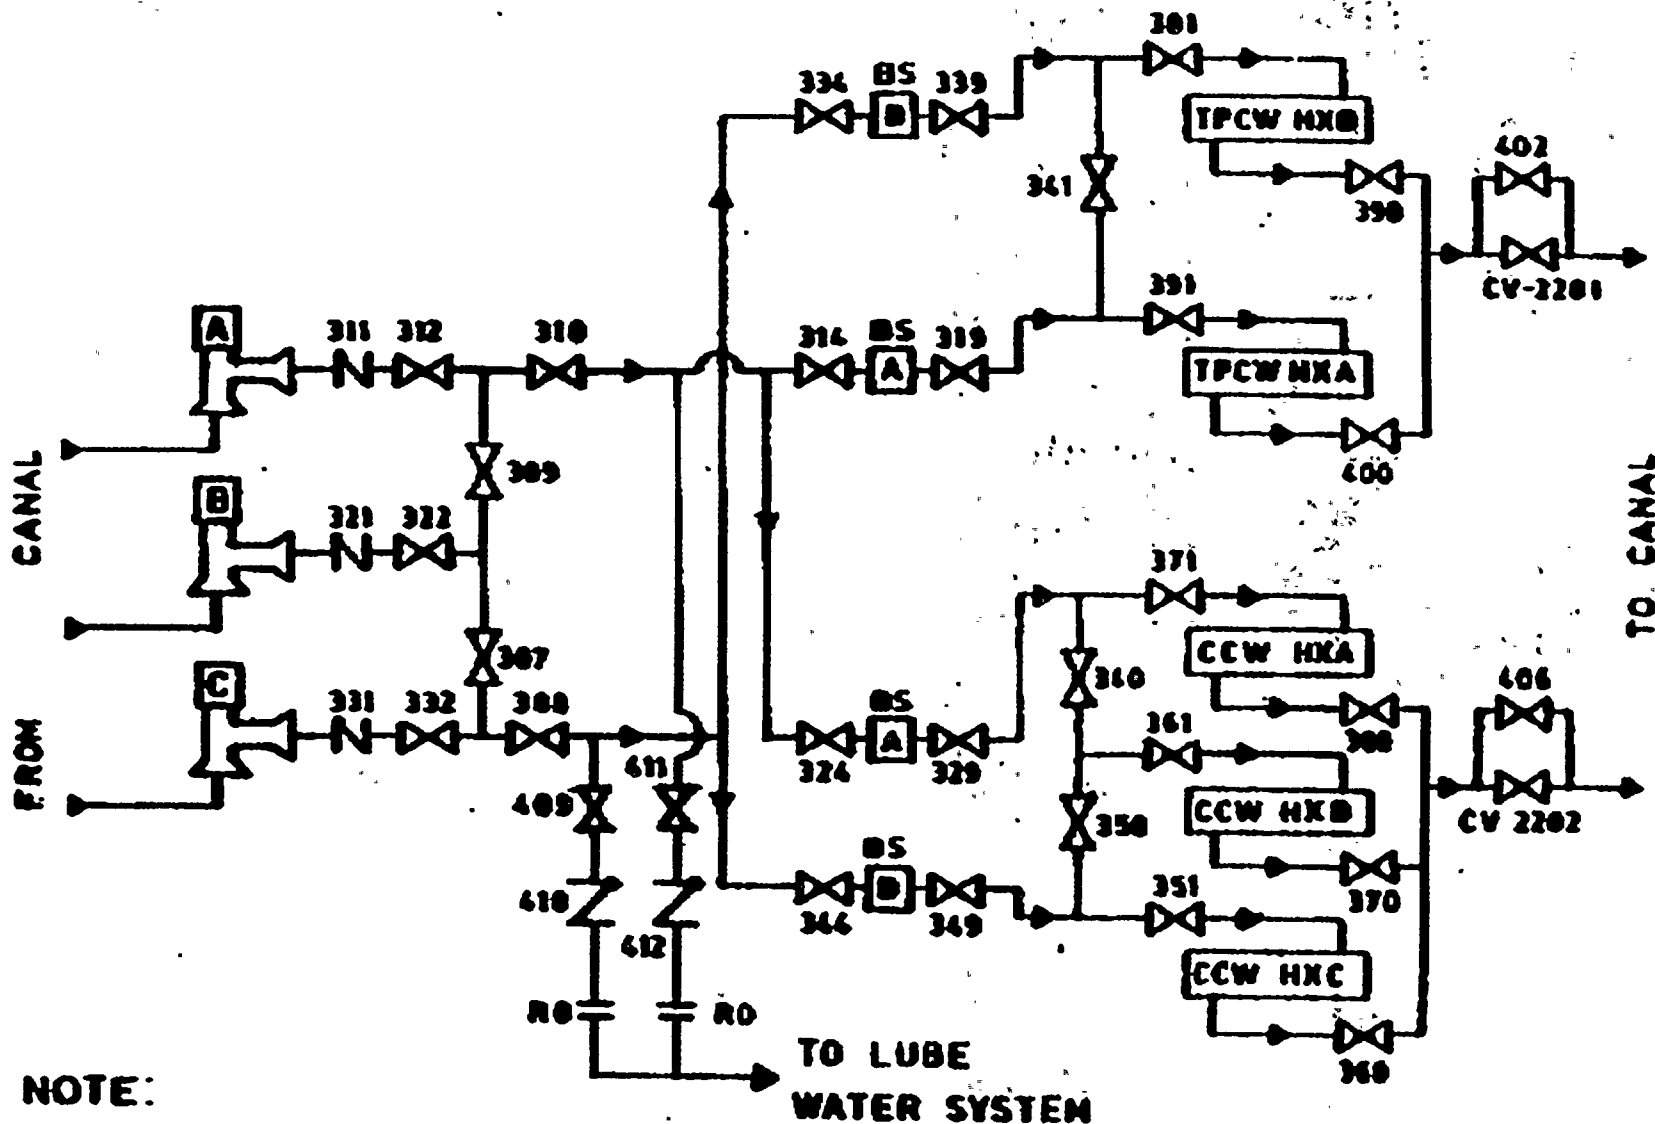

## NOTE:

BLOCK DIAGRAM SHOWN  
FOR UNIT 4. UNIT 3 SUPPLY  
HEADERS TO TPCW HX  
ARE REVERSED.