

SAFETY INSPECTION REPORT AND COMPLIANCE INSPECTION

1. LICENSEE/LOCATION INSPECTED:

Lansing Cardiovascular Consultants, P.C.
3413 Woods Edge Drive
Okemos, Michigan, 48864

REPORT NUMBER(S) 2018001

2. NRC/REGIONAL OFFICE

Region III
U. S. Nuclear Regulatory Commission
2443 Warrenville Road, Suite 210
Lisle, IL 60532-4352

3. DOCKET NUMBER(S)

030-34507

4. LICENSE NUMBER(S)

21-32012-01

5. DATE(S) OF INSPECTION

January 24, 2018

LICENSEE:

The inspection was an examination of the activities conducted under your license as they relate to radiation safety and to compliance with the Nuclear Regulatory Commission (NRC) rules and regulations and the conditions of your license. The inspection consisted of selective examinations of procedures and representative records, interviews with personnel, and observations by the inspector. The inspection findings are as follows:

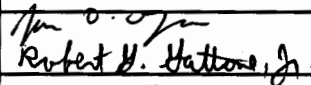
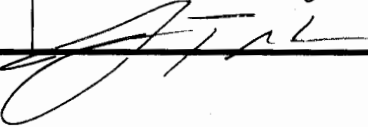
- ☒ 1. Based on the inspection findings, no violations were identified.
- ☐ 2. Previous violation(s) closed.
- ☐ 3. The violation(s), specifically described to you by the inspector as non-cited violations, are not being cited because they were self-identified, non-repetitive, and corrective action was or is being taken, and the remaining criteria in the NRC Enforcement Policy, to exercise discretion, were satisfied.

Non-cited violation(s) were discussed involving the following requirement(s):

- ☐ 4. During this inspection, certain of your activities, as described below and/or attached, were in violation of NRC requirements and are being cited in accordance with NRC Enforcement Policy. This form is a NOTICE OF VIOLATION, which may be subject to posting in accordance with 10 CFR 19.11.
(Violations and Corrective Actions)

Statement of Corrective Actions

I hereby state that, within 30 days, the actions described by me to the Inspector will be taken to correct the violations identified. This statement of corrective actions is made in accordance with the requirements of 10 CFR 2.201 (corrective steps already taken, corrective steps which will be taken, date when full compliance will be achieved). I understand that no further written response to NRC will be required, unless specifically requested.

TITLE	PRINTED NAME	SIGNATURE	DATE
LICENSEE'S REPRESENTATIVE			
NRC INSPECTOR	Jason D. Draper Robert G. Gattone, Jr.	 Robert G. Gattone, Jr.	2/6/18 2/6/18
BRANCH CHIEF	Damon T. McCraw		2/7/18

Docket File Information

SAFETY INSPECTION REPORT AND COMPLIANCE INSPECTION

1. LICENSEE/LOCATION INSPECTED:

Lansing Cardiovascular Consultants, P.C.
3413 Woods Edge Drive
Okemos, Michigan, 48864

REPORT NUMBER(S) 2018001

2. NRC/REGIONAL OFFICE

Region III
U. S. Nuclear Regulatory Commission
2443 Warrenville Road, Suite 210
Lisle, IL 60532-4352

3. DOCKET NUMBER(S)

030-34507

4. LICENSE NUMBER(S)

21-32012-01

5. DATE(S) OF INSPECTION

January 24, 2018

6. INSPECTION PROCEDURES USED

87130

7. INSPECTION FOCUS AREAS

03.01-03.07

SUPPLEMENTAL INSPECTION INFORMATION

1. PROGRAM CODE(S)

02201

2. PRIORITY

5

3. LICENSEE CONTACT

Smruti S. Parikh, M.D., RSO

4. TELEPHONE NUMBER

(517) 349-3303

☐ Main Office Inspection

Next Inspection Date: 01/24/2023

☒ Field Office Inspection Holt, MI

☐ Temporary Job Site Inspection

PROGRAM SCOPE

This was an unannounced, routine inspection of a cardiology clinic authorized to use byproduct material to perform diagnostic administrations of radiopharmaceuticals in Holt, Michigan. The licensee performed approximately 25 administrations per week Monday through Friday. The licensee received unit doses from a radiopharmacy in Lansing, Michigan. The licensee employed one nuclear medicine technologist (NMT), and contracted the services of a medical physics consultant to perform quarterly audits and equipment calibrations. The RSO was unavailable during the onsite inspection, so the inspectors performed a telephonic exit meeting with the RSO on February 1, 2018.

PERFORMANCE OBSERVATIONS

The inspectors observed the licensee's demonstration of package receipt and dose administration. Through these observations, combined with interviews of available staff, licensee personnel demonstrated an adequate level of understanding of emergency and material handling procedures and techniques.

The inspectors observed that licensed material was adequately secured and not readily accessible to members of the public. The licensee possessed a radiation survey meter that was calibrated and operational. Independent radiation measurements by the inspectors did not indicate readings in excess of 10 CFR Part 20 limits in restricted or unrestricted areas. Personal whole body and extremity dosimetry badges were observed being worn by the staff during the inspection.

The inspectors reviewed a selection of licensee records, including quarterly audits, source inventories, equipment calibration records, package receipt logs, training records, and dosimetry with no issues noted.

The licensee stated that principle activities were not performed at their Okemos location since May 10, 2017, and they were unsure of their plans for the clinic going forward. The inspectors reminded the licensee of the requirements of 10 CFR 30.36(d) in case the licensee decides to permanently cease principal activities or if they do not conduct principal activities for a period of 24 months.

No violations of NRC requirements were identified as a result of this inspection.