

LICENSEE EVENT REPORT

CONTROL BLOCK: [] [] [] [] [] (1) (PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

0 1 | F I L T P S 3 | 2 | 0 0 - | 0 0 0 0 0 - 0 0 | 3 | 4 | 1 | 1 | 1 | 1 | 4 | | | 5

7 8 3 14 15 25 26 27 28 29 30 31 32 33

LICENSEE CODE LICENSE NUMBER LICENSE TYPE CAT ID

CON'T

0 1

REPORT SOURCE L S 0 5 0 0 0 2 5 0 7 0 5 1 1 8 2 3 0 7 3 0 8 4 9

30 41 DOCKET NUMBER 58 59 EVENT DATE 74 75 REPORT DATE 80

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)

Self initiated audits revealed inadequate surveillance testing of the Emergency Diesel

Generators (EDG) for tests required by Technical Specification (TS) 4.8.1.a.5. in that

04 the EDGs were not loaded to ≥ 2500 kw within 10 minutes of being started during

performance of operating procedure 4304.1. This is reportable pursuant to

TS 6.9.2.b.3. The health and safety of the public were not affected.

Similar occurrences: LER 250-82-20.

53 _____

SYSTEM CODE CAUSE CODE CAUSE SUBCODE COMPONENT CODE COMP SUBCODE VALVE SUBCODE
 [0] [9] [F] [E] (11) [D] (12) [Z] [Z] [Z] [Z] [Z] [Z] (14) [Z] (15) [Z] (16)

(17) LER/RQ REPORT NUMBER EVENT YEAR
82—
21 22 23

SEQUENTIAL REPORTING NO. —
021—
24 25 26 27

OCCURRENCE CODE —
03
28 29

REPORT TYPE —
L—
30 31

REVISION NO. —
0
32

ACTION TAKEN 13 G 18 19
FUTURE ACTION 24 X 19
EFFECT ON PLANT 35 Z 20
SHUTDOWN METHOD 36 Z 21
HOURS 37 0 0 0 40
ATTACHMENT SUBMITTED 41 Y 23
MPRO-4 FORM 518 42 N 24
PRIME COND SUPPLIER 43 Z 25
COMPONENT MANUFACTURER 44 Z 9 9 9 47

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

10 The root cause stems from an inadequate review of operating procedure 4304.1, EDG.

Periodic Test Load on 4KV Bus with regards to implementation of TS Amendments

82/76, which upgraded EDG surveillance test requirements to verify that the EDG was

loaded to $\geq 2500\text{kw}$ within 10 minutes of starting the EDG. The procedure has been

14 revised to clearly reflect the TS requirements and testing has been completed.

3 9 FACILITY STATUS 1 5 E 13 10 0 0 10 0 10 OTHER STATUS 10 N/A METHOD OF DISCOVERY C 31 DISCOVERY DESCRIPTION 32 Document Review

ACTIVITY CONTENT
RELEASED OF RELEASE

AMOUNT OF ACTIVITY (35)

LOCATION OF RELEASE (35)

1 5 7 33 7 34 N/A

N/A

PERSONNEL EXPOSURES					
NUMBER		TYPE	DESCRIPTION		
1	7	(37)	(38)	N/A	

PERSONNEL INJURIES					
NUMBER		DESCRIPTION			
7	8	9	10	11	12
			(40)	N/A	

1		9		2		10	
7		8		9		10	

LOSS OR OR DAMAGE TO FACILITY (43)
 TYPE DESCRIPTION N/A

ISSUED (44) DESCRIPTION (45) N/A

NAME OF PREPARED Randy D. Hart

PHONE 305-245-2910 EXT 353

8408080230 840730
PDR ADOCK 05000250
S PDR

IE 22
1/1

Additional Cause Description and Corrective Actions

EDG Testing has been satisfactorily completed in accordance with the TS requirements. Corrective actions were covered in LER 250-82-20.



July 30, 1984
PNS-LI-84-262

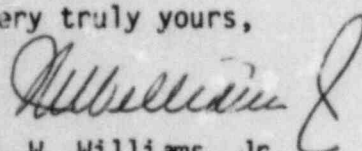
U. S. Nuclear Regulatory Commission
Document Control Desk
Washington, D.C. 20555

Gentlemen:

Re: Reportable Event 84-21
Turkey Point Unit 3
Date of Event: May 11, 1982
Emergency Diesel Generator Surveillance

The attached Licensee Event Report is being submitted pursuant to the requirements of 10 CFR to provide notification of the subject event. This event was not determined to be reportable until June 28, 1984.

Very truly yours,


J. W. Williams, Jr.
Group Vice President
Nuclear Energy

JWW/PLP/js

Attachment

cc: J. P. O'Reilly, Region II, USNRC
Harold F. Reis, Esquire
File 933.1

JE22
11