



Telegram

DUPLICATE OF TELEPHONED TELEGRAM

Just Sent
7/1

143A EDT AUG 24 71 AA167 KA131

K CMA121 MH PD HARTSVILLE SOCAR 24 1055AEDT

JOHN DAVIS, DIRECTOR OF REGION TWO

ATOMIC ENERGY COMMISSION

Suite 818

Mr. Row

A E C DIVN OF COMPLIANCE 230 PEACHTREE ST ATLA

ON AUG 22 1971, THE ACTIVITY OF THE COMPONENT COOLING WAS NOTICED TO HAVE INCREASED SLIGHTLY AND CONTINUED UNTIL A LEAK WAS FOUND AND ISOLATED IN A MAIN COOLANT SAMPLE COOLER, ON AUG 23 THE SAMPLE COOLER TUBE BUNDLE WILL BE REPLACED THIS REPORT IS IN ACCORDANCE WITH TECHNICAL SPECIFICATIONS 6 POINT 6 POINT 1 POINT C PREVIOUSLY REPORTED BY TELEPHONE TO MR D KIRKPATRICK ON AUG 23 1971

G P PEATY, CAROLINA POWER AND LIGHT CO, ROBINSON PLANT HARTSVILLE SOCAR

8403090307 710827
PDR ADDCK 05000261
S PDR

22 1971 23 6 6 1 23 1971


(1111)

IIBNF PS 437P

SF-1201 (RS-69)

Copy sent PDR

5264503
526-11537
NOT A WORK IN G NBR PS 435P
Adm 112 405P Mr. Row

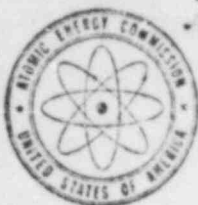

UNITED STATES
ATOMIC ENERGY COMMISSION
DIVISION OF COMPLIANCE
REGION II - SUITE 818
230 PEACHTREE STREET, NORTHWEST
ATLANTA, GEORGIA 30303

TELEPHONE: (404) 526-4503

In Reply Refer To:
CO:II:50-261

December 8, 1971

Carolina Power and Light Company
Attn: Mr. J. A. Jones
Senior Vice President
Engineering and Operating
336 Fayetteville Street
Raleigh, North Carolina 27602

Gentlemen:

Reference is made to the failures of the Westinghouse, type DB-50, reactor scram circuit breakers in your H. B. Robinson No. 2 plant. We recently received information relating to the performance of this type breaker at another reactor. This information is:

Two of the two reactor scram circuit breakers failed to trip on undervoltage during surveillance testing. The failure to trip was attributed to dirt accumulation on exposed linkages. This failure occurred after completion of inspection of the scram breakers to determine the applicability of the problems observed at H. B. Robinson No. 2.

It is requested that you inform this office within ten days, in writing, of the date when each of your reactor scram circuit breakers will be inspected and tested. In addition, it is requested that you inform this office within ten days, in writing, following completion of your inspection and test, of your specific findings, including a description of corrective action taken or planned and the scheduled completion date of planned actions.

Should you have any questions concerning this matter, we will be pleased to discuss them with you.

Sincerely,

John G. Davis
Director

CO:II:JGD

~~8311160425~~

CDB #2 - Carolina Power & Light Company (Robinson 2)

Ltr to Jones fm Davis dtd 12/8/71 (Bulletin)


Ltr to Davis fm Utley dtd 12/21/71 (Reply)

DISTRIBUTION:

J. A. Keppler, RO (5)

L. Kornblith, Jr., RO

R. H. Engelken, RO

RO Files 

OR Central Files