

AEC DISTRIBUTION FOR PART 50 DOCKET MATERIAL
(TEMPORARY FORM)

CONTROL NO: _____

FILE: INCIDENT REPORT

FROM: Northern States Power Co. Monticello, Minn. 55362 C. E. Larson		DATE OF DOC 2-10-75	DATE REC'D 2-12-75	LTR X	TWX	RPT	OTHER
TO: J. G. Keppler		ORIG	CC 1	OTHER	SENT AEC PDR <u>XX</u> SENT LOCAL PDR <u>XX</u>		
CLASS	UNCLASS XXXX	PROP INFO	INPUT	NO CYS REC'D 1	DOCKET NO: 50-263		

DESCRIPTION: Ltr reporting on 2-9-75 of smoke coming from the motor starter for reactor water cleanup discharge isolation valve, MO-2399...

ENCLOSURES:

Do Not Remove

PLANT NAME: Monticello Plant

FOR ACTION/INFORMATION DHL 2-13-75

BUTLER (S) W/ Copies	SCHWENCER (S) W/ Copies	ZIEMANN (S) W/ 4 Copies	REGAN (E) W/ Copies
CLARK (S) W/ Copies	STOLZ (S) W/ Copies	DICKER (E) W/ Copies	LEAR (S) W/ Copies
PARR (S) W/ Copies	VASSALLO (S) W/ Copies	KNIGHTON (E) W/ Copies	SPEIS (S) W/ Copies
KNIEL (S) W/ Copies	PURPLE (S) W/ Copies	YOUNGBLOOD (E) W/ Copies	

INTERNAL DISTRIBUTION

<u>REG FILE</u>	<u>TECH REVIEW</u>	<u>DENTON</u>	<u>LIC. ASST.</u>	<u>A/T IND</u>
✓ AEC PDR	✓ SCHROEDER	GRIMES	✓ DIGGS (S)	BRAITMAN
✓ DGC, ROOM P-506-A	✓ MACCARRY	GAMMILL	GEARIN (S)	SALTZMAN
✓ MUNTZING/STAFF	✓ KNIGHT	✓ KASTNER	GOULBOURNE (S)	B. HURT
✓ CASE	✓ PAWLICKI	BALLARD	KREUTZER (E)	
GIAMBUSSO	✓ SHAO	SPANGLER	LEE (S)	<u>PLANS</u>
BOYD	✓ STELLO		MAIGRET (S)	MCDONALD
MOORE (S) (BWR)	✓ HOUSTON	<u>ENVIRO</u>	REED (E)	CHAPMAN
DEYOUNG (S) (PWR)	✓ NOVAK	MULLER	SERVICE (S)	DUBE w/input
SKOVHOLT (S)	✓ ROSS	DICKER	SHEPPARD (S)	E. COUPE
GOLLER (S)	✓ IPPOLITO	KNIGHTON	SLATER (E)	✓ D. THOMPSON (2)
P. COLLINS	✓ TEDESCO	YOUNGBLOOD	SMITH (S)	✓ KLEGGER
DENISE	✓ LONG	REGAN	TEETS (S)	✓ F. WILLIAMS
REG OPR	✓ LAINAS	PROJECT LDR	WILLIAMS (E)	
✓ FILE & REGION	✓ BENAROYA		WILSON (S)	
✓ T.R. WILSON	✓ STEELE	✓ VOLIMER	INGRAM (S)	
		HARLESS		

EXTERNAL DISTRIBUTION

✓ 1-LOCAL PDR Minneapolis, Minn.	(1) (2) (10) -NATIONAL LABS	1-PDR SAN/LA/NY
✓ 1-TIC (ABERNATHY)	1-W. PENNINGTON, RM E-201 G.T.	1-BROOKHAVEN NAT LAB
✓ 1-NSIC (BUCHANAN)	1-CONSULTANTS	1-G. ULRIKSON, ORNL
1-ASLB	NEWMARK/BLUME/AGBABIAN	1-AGMED (RUTH GUSSMAN) RM B-127 G.T.
1-NEWTON ANDERSON		1-J. RUNKLES, RM E-201 G.T.
✓ 5-ACRS SENT TO LIC. ASST.		
R. Diggs 2-13-75		

NSP


NORTHERN STATES POWER COMPANY

Monticello, Minnesota 55362

February 10, 1975

Regulatory Docket File

Mr. J. G. Keppler, Director
Region III
Office of Inspection and Enforcement
United States Nuclear Regulatory Commission
799 Roosevelt Road
Glen Ellyn, Illinois 60137

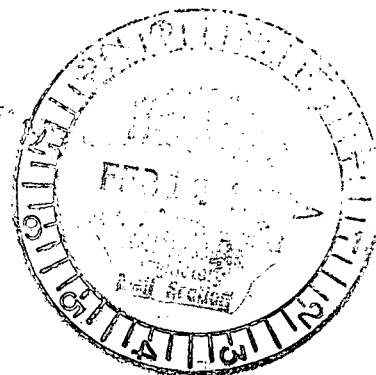

Dear Mr. Keppler:


MONTICELLO NUCLEAR GENERATING PLANT
Docket No. 50-263 License No. DPR-22

On February 9, 1975, smoke was observed coming from the motor starter for reactor water cleanup discharge isolation valve, MO 2399. Investigation revealed that a shorted relay coil resulted in overheating of the control transformer in the motor starter. Failure of the control transformer caused the isolation valve to be inoperable. Neither this valve nor another valve in the discharge line was placed in the closed position as required by Technical Specification 3.7.D.2. The failed relay and motor starter were replaced and the system was returned to normal operation within 6 hours. Further investigation of this occurrence is continuing.

Yours very truly,

C. E. Larson
C. E. Larson
Plant Manager

CEL/mm

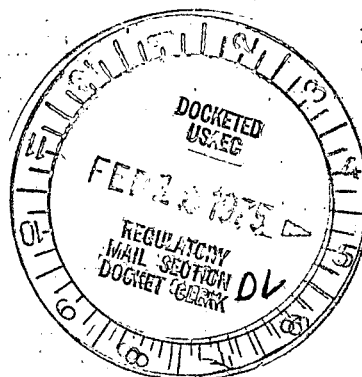

cc: A. Giambusso
G. Charnoff
Minnesota Pollution Control Agency
Attn: E. A. Pryzina
File

1594