

## REGULATORY INFORMATION DISTRIBUTION SYSTEM (RIDS)

AOCESION NBR:8209100098 DOC DATE: 82/09/03 NOTARIZED: NO DOCKET #  
 FACIL:50-389 St. Lucie Plant, Unit 2, Florida Power & Light Co. 05000389  
 AUTH.NAME AUTHOR AFFILIATION  
 UHRIG,R.G. Florida Power & Light Co.  
 RECIP.NAME RECIPIENT AFFILIATION  
 EISENHUT,D.G. Division of Licensing

SUBJECT: Forwards revised response to Question 410.10 re handling of  
 light loads.Probability of unacceptable consequences  
 resulting from drop of light load over open reactor vessel  
 is very low.

DISTRIBUTION CODE: B001S COPIES RECEIVED:LTR 1 ENCL 1 SIZE: 7  
 TITLE: Licensing Submittal: PSAR/FSAR Amdts & Related Correspondence

## NOTES:

RECIPIENT		COPIES		RECIPIENT		COPIES	
ID CODE/NAME		LTTR	ENCL	ID CODE/NAME		LTTR	ENCL
A/D LICENSNG		1	0	LIC BR #3 BC		1	0
LIC BR #3 LA		1	0	NERSES,V. 01		1	1
INTERNAL: ELD/HDS2		1	0	IE FILE		1	1
IE/DEP EPDS 35		1	1	IE/DEP/EPLB 36		3	3
NRR/DE/AEAB		1	0	NRR/DE/CEB 11		1	1
NRR/DE/EQB 13		3	3	NRR/DE/GB 28		2	2
NRR/DE/HGEB 30		2	2	NRR/DE/MEB 18		1	1
NRR/DE/MTEB 17		1	1	NRR/DE/QAB 21		1	1
NRR/DE/SAB 24		1	1	NRR/DE/SEB 25		1	1
NRR/DHFS/HFEB40		1	1	NRR/DHFS/LQB 32		1	1
NRR/DHFS/OLB 34		1	1	NRR/DHFS/PTRB20		1	1
NRR/DSI/AEB 26		1	1	NRR/DSI/ASB 27		1	1
NRR/DSI/CPB 10		1	1	NRR/DSI/CSB 09		1	1
NRR/DSI/ETSB 12		1	1	NRR/DSI/ICSB 16		1	1
NRR/DSI/PSB 19		1	1	NRR/DSI/RAB 22		1	1
NRR/DSI/RSB 23		1	1	NRR/DST/LGB 33		1	1
REG FILE 04		1	1	RGN2		2	2
RM/DDAMI/MIB		1	0				
EXTERNAL: ACRS 41	10	10		BNL(AMDTs ONLY)		1	1
DMB/DSS (AMDTs)		1	1	FEMA-REP DIV 39		1	1
LPDR 03		1	1	NRC PDR 02		1	1
NSIC 05		1	1	NTIS		1	1


TOTAL NUMBER OF COPIES REQUIRED: LTTR 59 ENCL 53

THE UNITED STATES OF AMERICA  
DO hereby certify that  
[Name] is a citizen of the United States of America  
and is entitled to the rights and privileges of citizenship.

Witness my hand and the seal of the United States of America  
this [Date] day of [Month], 19[Year].

\_\_\_\_\_  
[Signature]

NAME		AGE		SEX		RELATIONSHIP	
1	John	25	Male	1	Male	1	Male
2	John	25	Male	1	Male	1	Male
3	John	25	Male	1	Male	1	Male
4	John	25	Male	1	Male	1	Male
5	John	25	Male	1	Male	1	Male
6	John	25	Male	1	Male	1	Male
7	John	25	Male	1	Male	1	Male
8	John	25	Male	1	Male	1	Male
9	John	25	Male	1	Male	1	Male
10	John	25	Male	1	Male	1	Male
11	John	25	Male	1	Male	1	Male
12	John	25	Male	1	Male	1	Male
13	John	25	Male	1	Male	1	Male
14	John	25	Male	1	Male	1	Male
15	John	25	Male	1	Male	1	Male
16	John	25	Male	1	Male	1	Male
17	John	25	Male	1	Male	1	Male
18	John	25	Male	1	Male	1	Male
19	John	25	Male	1	Male	1	Male
20	John	25	Male	1	Male	1	Male
21	John	25	Male	1	Male	1	Male
22	John	25	Male	1	Male	1	Male
23	John	25	Male	1	Male	1	Male
24	John	25	Male	1	Male	1	Male
25	John	25	Male	1	Male	1	Male
26	John	25	Male	1	Male	1	Male
27	John	25	Male	1	Male	1	Male
28	John	25	Male	1	Male	1	Male
29	John	25	Male	1	Male	1	Male
30	John	25	Male	1	Male	1	Male
31	John	25	Male	1	Male	1	Male
32	John	25	Male	1	Male	1	Male
33	John	25	Male	1	Male	1	Male
34	John	25	Male	1	Male	1	Male
35	John	25	Male	1	Male	1	Male
36	John	25	Male	1	Male	1	Male
37	John	25	Male	1	Male	1	Male
38	John	25	Male	1	Male	1	Male
39	John	25	Male	1	Male	1	Male
40	John	25	Male	1	Male	1	Male
41	John	25	Male	1	Male	1	Male
42	John	25	Male	1	Male	1	Male
43	John	25	Male	1	Male	1	Male
44	John	25	Male	1	Male	1	Male
45	John	25	Male	1	Male	1	Male
46	John	25	Male	1	Male	1	Male
47	John	25	Male	1	Male	1	Male
48	John	25	Male	1	Male	1	Male
49	John	25	Male	1	Male	1	Male
50	John	25	Male	1	Male	1	Male
51	John	25	Male	1	Male	1	Male
52	John	25	Male	1	Male	1	Male
53	John	25	Male	1	Male	1	Male
54	John	25	Male	1	Male	1	Male
55	John	25	Male	1	Male	1	Male
56	John	25	Male	1	Male	1	Male
57	John	25	Male	1	Male	1	Male
58	John	25	Male	1	Male	1	Male
59	John	25	Male	1	Male	1	Male
60	John	25	Male	1	Male	1	Male
61	John	25	Male	1	Male	1	Male
62	John	25	Male	1	Male	1	Male
63	John	25	Male	1	Male	1	Male
64	John	25	Male	1	Male	1	Male
65	John	25	Male	1	Male	1	Male
66	John	25	Male	1	Male	1	Male
67	John	25	Male	1	Male	1	Male
68	John	25	Male	1	Male	1	Male
69	John	25	Male	1	Male	1	Male
70	John	25	Male	1	Male	1	Male
71	John	25	Male	1	Male	1	Male
72	John	25	Male	1	Male	1	Male
73	John	25	Male	1	Male	1	Male
74	John	25	Male	1	Male	1	Male
75	John	25	Male	1	Male	1	Male
76	John	25	Male	1	Male	1	Male
77	John	25	Male	1	Male	1	Male
78	John	25	Male	1	Male	1	Male
79	John	25	Male	1	Male	1	Male
80	John	25	Male	1	Male	1	Male
81	John	25	Male	1	Male	1	Male
82	John	25	Male	1	Male	1	Male
83	John	25	Male	1	Male	1	Male
84	John	25	Male	1	Male	1	Male
85	John	25	Male	1	Male	1	Male
86	John	25	Male	1	Male	1	Male
87	John	25	Male	1	Male	1	Male
88	John	25	Male	1	Male	1	Male
89	John	25	Male	1	Male	1	Male
90	John	25	Male	1	Male	1	Male
91	John	25	Male	1	Male	1	Male
92	John	25	Male	1	Male	1	Male
93	John	25	Male	1	Male	1	Male
94	John	25	Male	1	Male	1	Male
95	John	25	Male	1	Male	1	Male
96	John	25	Male	1	Male	1	Male
97	John	25	Male	1	Male	1	Male
98	John	25	Male	1	Male	1	Male
99	John	25	Male	1	Male	1	Male
100	John	25	Male	1	Male	1	Male

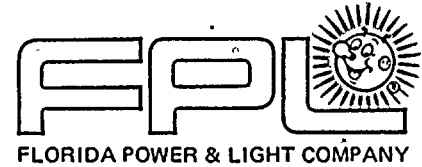

September 3, 1982  
L-82-393

Office of Nuclear Reactor Regulation  
Attn: Mr. Darrell G. Eisenhut, Director  
Division of Licensing  
U. S. Nuclear Regulatory Commission  
Washington, D. C. 20555

Dear Mr. Eisenhut:

Reference: St. Lucie Unit #2  
Docket No. 50-389

Attached please find Florida Power and Light Company's revised response to NRC Question 410.10 regarding the handling of light loads at St. Lucie Unit 2.

If you have any questions, please contact us accordingly.

Sincerely,

Robert E. Uhrig  
Vice President  
Advanced Systems and Technology

REU/cab

Boo!

8209100098 820903  
PDR ADCK 05000389  
A PDR



St. Lucie Unit 2  
Response to NRC Question 410.10  
Light Loads

Question 410.10:

Describe, discuss and verify that the maximum potential kinetic energy contained in all objects of less weight than a spent fuel assembly which will be handled over spent fuel will not exceed the effects of the fuel handling accident in section 15.7.4 of the FSAR.

Response:

FPL has reviewed the potential for an inadvertent drop of light objects onto spent fuel at St. Lucie Unit 2. The objects that were considered were all lighter than a fuel assembly and its associated lifting tool and thus had not been previously considered in the heavy loads analysis. A postulated drop may occur in either of two locations; over the spent fuel pool or over an open reactor vessel. Any object that might be lifted over either area was considered in this review. The conclusions of this review are presented below:

A) Light loads lifted over the spent fuel pool:

All objects that might be lifted over the spent fuel pool were reviewed for a potential drop. Attachment 1 presents the list of items considered in this review. Since each fuel assembly in the spent fuel pool is stored in a separate module of the spent fuel rack (see FSAR section 9.1.2) it is not considered conceivable that more than one fuel assembly could be damaged. Since the analysis contained in section 15.7.4 assumed that all the pins in one full assembly were damaged, and that all the activity in the pin gas gap was released, the drop of a light load would have results that are no more limiting than the previously analyzed accident. A dropped light load in the spent fuel pool cannot impact more than one assembly and the offsite dose cannot be greater than that identified in section 15.7.4.

B) Light loads lifted over the open reactor vessel:

In the process of analyzing this potential accident, the following steps were taken:

- 1) determine what could be dropped.
- 2) determine when these items could impact fuel in the vessel.
- 3) determine the damage associated with each dropped item.
- 4) calculate the consequences of this damage.

The following details each of the steps:

I - Light Loads Identification

The maintenance and operations departments of St. Lucie 1, a near duplicate plant to St. Lucie 2, provided a list of potential items to be considered in this light loads drop review. This list included any item that would be lifted by a load handling system over the reactor vessel. This list of items is shown on attachment 2. Since St. Lucie 1 has been refueled four times, the compiled list has been developed with considerable experience on what may be or has been lifted over open reactor vessels. It should be noted that these items are lifted rarely and do not constitute a significant percentage of lifts within containment.

II - Time of Impact

The time period during which an impact could occur was reviewed. An impact of dropped items with spent fuel in the reactor vessel may only occur when the reactor vessel head and the reactor internals upper guide structure are removed from the vessel. This period only occurs during a refueling of the reactor. Additionally, release from damaged fuel will not result in any appreciable offsite dose unless the containment integrity is not established; that is, the containment equipment hatch must be open to effect appreciable release to the atmosphere. This is never the case during refueling periods when the reactor is open except for extremely limited time intervals when it is essential to move equipment into or out of containment. Core alterations are not allowed when containment integrity is not established. Further, during these periods lifting activities over the open vessel are not normally conducted.

III - Potential Damage

The damage associated with any individually dropped item was considered. Several items were identified as potentially serious contributors to fuel damage. An in depth review of these items indicated that a very sophisticated analysis would be required to determine the extent of any fuel damage.

Rather than embarking on a very lengthy and state-of-the-art calculation to assess the precise damage that might be caused by dropped light loads, a simplified calculation was performed that indicated the number of fuel pins that could be damaged and not cause the site boundary dose to exceed a small part of 10 CFR 100 limits. The number of pins to cause site limits to be reached is dependent on the decay time allowed prior to release. The results of this calculation can be shown in Figure 1. As indicated on the figure, it will take only 6 days of decay to allow a release from one entire assembly without exceeding a small fraction of site limits. The time of decay is quite significant to this light loads concern. First, available gas curie content per pin decreases with time; i.e., the fission gas decay. Second, the minimum time that must pass before the fuel in the reactor is exposed to potential drop damage is several days. To date, the reactor vessel head and upper



guide structure has not been removed in less than 10 days; and this corresponds to decay time of sufficient duration to maintain site boundary limits even if 360 pins are damaged. As can be seen from these values, this corresponds to significant damage to 1.41 fuel assemblies. Therefore, from a qualitative standpoint, it is apparent that a dropped light load would need to cause considerable damage before any site boundary limits are exceeded.

The calculations that have been performed to assess boundary doses conservatively assume that all released fission gases are immediately released from containment. This assumption is very conservative since the actual release path would be out through the containment equipment hatch which is several levels below the refueling canal water level, the level at which the gas is released. In the event of an actual fission gas release from the refueling canal, the fission gases would mix with the containment air in the upper containment atmosphere and allow considerable time to isolate the equipment hatch. It is reasonable to assume that the equipment hatch can be closed in 45 minutes following a gas release. Once the containment hatch is closed, all fission products inside containment will be isolated from the outside atmosphere.

FPL administrative procedures allow cranes to be operated only by trained personnel. Current training programs identify the reactor vessel as an area over which loads should not be handled unless specifically required. There are rare occasions when loads must be handled over the open reactor vessel, however, crane operators are instructed in appropriate procedures (such as ANSI B 30.2-76) to minimize the possibility of accidents. In order to further minimize the adverse consequences of a potential light load drop, FPL will revise its administrative procedures to restrict lifts over the open reactor vessel when the upper guide structure is not in place and containment integrity is not established.

In conclusion, the review of a dropped light load event has lead us to several findings. First, the probability of damage to fuel appears quite low because of the large number of pins that would have to be damaged by a dropped item after a reasonable decay time. Next, the probability is further reduced because containment is usually secured when the reactor vessel is open and therefore an offsite release would not likely occur. Finally, since FPL does not normally lift items over the open vessel, the incidence of a dropped load is extremely remote.

Therefore, FPL feels that the probability of unacceptable consequences resulting from the drop of a light load over an open reactor vessel is very low. With the incorporation of more definitive information in the crane operator training program to further assure against fuel damage it is felt that this probability is acceptably low and further action does not appear warranted.





U.S. GOVERNMENT  
PRINTING OFFICE

Attachment 1  
List of Items that May be Lifted  
Over the Spent Fuel Pool by a Load Handling System

<u>Item</u>	<u>Approximate Weight</u>
Utility Basket	300#
TV camera - portable	20#
CEA removal tool	100#
Removable handrail, 1 section	150#
Transfer canal seal plate	500#

Attachment 2  
List of Items that May be Lifted  
Over the Reactor Vessel by a Load Handling System

<u>Item</u>	<u>Approximate Weight</u>
Incore Instrumentation adapter torque tool	50#
3 Lifting bolt torque tools	50# ea.
2 Extension shaft handling tools	75# ea.
60 CEA extension shaft protective sleeves	40# ea.
Cavity seal ring extension torque wrench	25#
#1 CEA extension shaft	100#
Upper Guide Structure lift rig deck plate(s)	40# ea.
Utility basket	300#
TV Camera - portable	20#
TV Camera console	50#
Upper Guide Structure lift rig tripod	800#
Reactor cavity ladder cage	250#
Reactor cavity upper ladder section	100#
8 Incore detector Bullet noses	25# ea.
CEA removal tool	100#
3 Pressurizer safety valves	300# ea.
2 Power-operated relief valves	150# ea.
2 HEPA filter ventilators	300# ea.
4 RCP seals	1,000# ea.

Figure 1

NUMBER OF FAILED FUEL RODS  
REQUIRED TO YIELD 30 REM  
TO THE THYROID AT THE EAB

NUMBER OF FUEL RODS

100

1 2 3 4 5 6 7 8 9 10 11 12 13 14 15

TIME AFTER SHUTDOWN - DAYS

