

## ACCELERATED DISTRIBUTION DEMONSTRATION SYSTEM

REGULATORY INFORMATION DISTRIBUTION SYSTEM (RIDS)

ACCESSION NBR: 9211090101 DOC. DATE: 92/11/02 NOTARIZED: NO DOCKET #  
 FACIL: STN-50-530 Palo Verde Nuclear Station, Unit 3, Arizona Publi 05000530  
 AUTH. NAME AUTHOR AFFILIATION  
 LEVINE, J.M. Arizona Public Service Co. (formerly Arizona Nuclear Power  
 RECIP. NAME RECIPIENT AFFILIATION  
 Document Control Branch (Document Control Desk)

SUBJECT: Forwards LER 92-004-00 re 921009 invalid control room,  
 containment & fuel bldg ventilation ESF actuations. Addl info  
 provided re 921014 event.

DISTRIBUTION CODE: IE22T COPIES RECEIVED: LTR 1 ENCL 1 SIZE: 249  
 TITLE: 50.73/50.9 Licensee Event Report (LER), Incident Rpt, etc.

NOTES: Standardized plant.

05000530

RECIPIENT ID CODE/NAME	COPIES LTTR ENCL	RECIPIENT ID CODE/NAME	COPIES LTTR ENCL
PD5 LA	1 1	PD5 PD	1 1
TRAMMELL, C	1 1		
INTERNAL: ACNW	2 2	ACRS	2 2
AEOD/DOA	1 1	AEOD/DSP/TPAB	1 1
AEOD/ROAB/DSP	2 2	NRR/DET/EMEB 7E	1 1
NRR/DLPQ/LHFB10	1 1	NRR/DLPQ/LPEB10	1 1
NRR/DOEA/OEAB	1 1	NRR/DREP/PRPB11	2 2
NRR/DST/SELB 8D	1 1	NRR/DST/SICB8H3	1 1
NRR/DST/SPLB8D1	1 1	NRR/DST/SRXB 8E	1 1
REG-FILE 02	1 1	RES/DSIR/EIB	1 1
RGN5 FILE 01	1 1		
EXTERNAL: EG&G BRYCE, J.H	2 2	L ST LOBBY WARD	1 1
NRC PDR	1 1	NSIC MURPHY, G.A	1 1
NSIC POORE, W.	1 1	NUDOCS FULL TXT	1 1

NOTE TO ALL "RIDS" RECIPIENTS:

PLEASE HELP US TO REDUCE WASTE! CONTACT THE DOCUMENT CONTROL DESK.  
 ROOM P1-37 (EXT. 504-2065) TO ELIMINATE YOUR NAME FROM DISTRIBUTION  
 LISTS FOR DOCUMENTS YOU DON'T NEED!

FULL TEXT CONVERSION REQUIRED

TOTAL NUMBER OF COPIES REQUIRED: LTTR 31 ENCL 31



Arizona Public Service Company  
PALO VERDE NUCLEAR GENERATING STATION  
P.O. BOX 52034 • PHOENIX, ARIZONA 85072-2034

JAMES M. LEVINE  
VICE PRESIDENT  
NUCLEAR PRODUCTION

192-00808-JML/TRB/KR  
November 2, 1992

U. S. Nuclear Regulatory Commission  
Attention: Document Control Desk  
Mail Station P1-37  
Washington, D.C. 20555


Dear Sirs:

Subject: Palo Verde Nuclear Generating Station (PVNGS)  
Unit 3  
Docket No. STN 50-530 (License No. NPF-74)  
Licensee Event Report 92-004-00  
File: 92-020-404

Attached please find Licensee Event Report (LER) 92-004-00 prepared and submitted pursuant to 10CFR50.73. This LER reports the October 9, 1992 Unit 3 inadvertent Train A Containment Purge Isolation Actuation System (CPIAS), Train A Control Room Essential Filtration Actuation System (CREFAS), Train A Control Room Ventilation Isolation Actuation System (CRVIAS), and Train A Fuel Building Essential Ventilation Actuation System (FBEVAS) Balance of Plant Engineered Safety Feature Actuation System (BOP ESFAS) (JE) actuations resulting from a loss of power to the Train A BOP ESFAS Cabinet (SAA-C02A) (i.e., relays deenergize to actuate) which occurred when a reactor operator inadvertently deenergized the wrong Train A Class 1E 480V Switchgear Load Center. This LER also provides additional information on the October 14, 1992 Unit 3 inadvertent Train B CPIAS, CREFAS, FBEVAS BOP ESFAS actuations which occurred when a reactor operator did not ensure that the Train B BOP ESFAS relays were placed in bypass. Although the October 14, 1992 event is no longer reportable under new regulations, an event description is provided in Section V. ADDITIONAL INFORMATION due to the similarities and close proximity of both events. In accordance with 10CFR50.73(d), a copy of this LER is being forwarded to the Regional Administrator, NRC Region V.

If you have any questions, please contact T. R. Bradish, Compliance Manager, at (602) 393-5421.

Very truly yours,

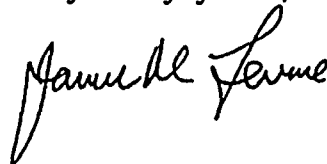

JML/TRB/KR

Attachment

9211090101 921102  
PDR ADDCK 05000530  
S PDR





NRC Document Control Desk  
Page 2

Licensee Event Report 3-92-004-00

cc: W. F. Conway (all with attachment)  
J. B. Martin  
J. A. Sloan  
INPO Records Center

