




**Consumers
Power
Company**

General Offices: 212 West Michigan Avenue, Jackson, Michigan 49201 Code 517 763-0850

August 19, 1976

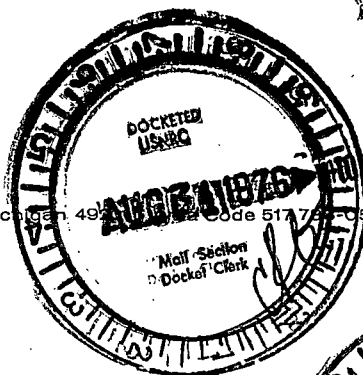

D. Lankford
Docketary
File 57



Mr James G. Keppler
Office of Inspection and Enforcement
Region III
US Nuclear Regulatory Commission
799 Roosevelt Road
Glen Ellyn, IL 60137

DOCKET 50-255, LICENSE DPR-20 -
PALISADES PLANT

Transmitted attached is a Licensee Event Report for the Palisades Plant.

Ralph B. Sewell
Ralph B. Sewell
Nuclear Licensing Administrator

8832

AUG 23 1976

LICENSEE EVENT REPORT

CONTROL BLOCK: 1 6

[PLEASE PRINT ALL REQUIRED INFORMATION]

LICENSEE NAME 01 M I P A L 1	LICENSE NUMBER 0 0 - 0 0 0 0 0 - 0 0	LICENSE TYPE 4 1 1 1 1	EVENT TYPE 0 3
---	---	---	---

REPORT TYPE 01 CONT	REPORT SOURCE L	DOCKET NUMBER 0 5 0 - 0 2 5 5	EVENT DATE 0 7 2 0 7 6	REPORT DATE 0 8 1 9 7 6
--	--	--	---	--

EVENT DESCRIPTION

02 CCW pump P52-C inboard bearing failed while preventative maintenance was being performed on CCW pump P52-A. P52-C was tripped and inspected. Diesel generator 1-2 was test started to verify operability. P52-A was returned to service later the same day. The shaft was metalized to insure proper bearing interference fit. The bearing replaced and the need for changes in maintenance procedure (See 18)

SYSTEM CODE 07 C J	CAUSE CODE Z	COMPONENT CODE P U M P X X	PRIME COMPONENT SUPPLIER A	COMPONENT MANUFACTURER G 1 9 5	VIOLATION N
---	---	---	---	---	--

CAUSE DESCRIPTION

08 Probable cause was either not performing a hot end alignment on pump after repair or because of bearing slippage on shaft.

FACILITY STATUS 11 E	% POWER 0 9 0	OTHER STATUS NA	METHOD OF DISCOVERY a	DISCOVERY DESCRIPTION Observation by Maintenance Personnel
---	--	--	--	---

FORM OF ACTIVITY RELEASED 12 Z	CONTENT OF RELEASE Z	AMOUNT OF ACTIVITY NA	LOCATION OF RELEASE NA
---	---	--	---

PERSONNEL EXPOSURES

NUMBER 13 0 0 0	TYPE Z	DESCRIPTION NA
--	---	---

PERSONNEL INJURIES

NUMBER 14 0 0 0	DESCRIPTION NA
--	---

PROBABLE CONSEQUENCES

15 None

LOSS OR DAMAGE TO FACILITY

TYPE 16 Z	DESCRIPTION NA
--	---

PUBLICITY

17 Copy of this report being distributed to Michigan news media.

ADDITIONAL FACTORS

18 is being reviewed. P52-B pump was available. (76-03)

19