

NRC DISTRIBUTION FOR PART 50 DOCKET (TEMPORARY FORM)

CONTROL NO: 13355

FILE: INCIDENT REPORT FILE

FROM: Met. Edison Co. Reading, Pa. 19603 R.C. Arnold		DATE OF DOC 11-21-75	DATE REC'D 11-25-75	LTR XX	TWX	RPT	OTHER
TO: NRC		ORIG 1 signed	CC	OTHER	SENT AEC PDR XX SENT LOCAL PDR XX		
CLASS	UNCLASS XXX	PROP INFO	INPUT	NO CYS REC'D 1	DOCKET NO: 50-289		

DESCRIPTION: Ltr trans the following:

ENCLOSURES: Non-Routine 10-Day Report 75-07
Report of an unplanned release of radioactive materials occurring on 11-13-75....

(1 cy encl rec'd)

ACKNOWLEDGED

Do Not Remove

PLANT NAME: Three Mile Island Unit 1

FOR ACTION/INFORMATION

DHL 12-2-75

BUTLER (L) W/ Copies	SCHWENCER (L) W/ Copies	ZIEMANN (L) W/ Copies	REGAN (E) W/ Copies
CLARK (L) W/ Copies	STOLZ (L) W/ Copies	DICKER (E) W/ Copies	LEAR (L) W/ Copies
PARR (L) W/ Copies	VASSALLO (L) W/ Copies	KNIGHTON (E) W/ Copies	SPELS W/ Copies
KNIEL (L) W/ Copies	PURPLE (L) W/ Copies	YOUNGBLOOD (E) W/ Copies	RETD W/ Copies

INTERNAL DISTRIBUTION

REG FILE NRC PDR OGC, ROOM P-506A GOSSICK/STAFF CASE	TECH REVIEW SCHROEDER MACCARY KNIGHT PAWLICKI SHAO **STELLO **HOUSTON **NOVAK ROSS IPPOLITO TEDESCO J. COLLINS LAINAS BENAROYA VOLLMER	DENTON GRIMES GAMMILL KASTNER JALLARD SPANGLER ENVIRO MULLER DICKER KNIGHTON YOUNGBLOOD REGAN PROJECT LDR HARLESS	LIC ASST R. DIGGS (L) H. GEARIN (L) E. GOULBOURNE (L) P. KREUTZER (E) J. LEE (L) M. RUSHBROOK (L) S. REED (E) M. SERVICE (L) S. SHEPPARD (L) M. SLATER (E) H. SMITH (L) S. TEETS (L) G. WILLIAMS (E) V. WILSON (L) R. INGRAM (L) M. DUNCAN (E)	A/T IND. BRAITMAN SALTZMAN MELTZ PLANS MCDONALD CHAPMAN DUBE (Ltr) E. COUPE PETERSON HARTFIELD (2) KLECKER EISENHUT WIGGINTON F. WILLIAMS HANAUER
---	---	--	--	--

EXTERNAL DISTRIBUTION

1 - LOCAL PDR Harrisburg, Pa.	1 - NATIONAL LABS	1 - PDR-SAN/LA/NY
1 - TIC (ABERNATHY) (1)(2)(10)	1 - W. PENNINGTON, Rm E-201 GT	1 - BROOKHAVEN NAT LAB
1 - NSIC (BUCHANAN)	1 - CONSULTANTS	1 - G. ULRIKSON, ORNL
1 - ASLB	NEWMARK/BLUME/AGBABIAN	1 - AGMED (RUTH GUSSMAN) Rm B-127 GT
1 - Newton Anderson		1 - J. D. RUNKLES, Rm E-201 GT
16 - ACRS SENT TO LIC ASST R. Ingram 12-2-75		
** SEND ONLY TEN DAY REPORTS		

1476 158

7910240

GT

899

5



Regulatory Docket File

METROPOLITAN EDISON COMPANY


POST OFFICE BOX 542 READING, PENNSYLVANIA 19603

TELEPHONE 215 - 929-3601

November 21, 1975
GQL 1749

Director of Nuclear Reactor Regulation
U.S. Nuclear Regulatory Commission
Washington, D.C. 20555

Dear Sir:

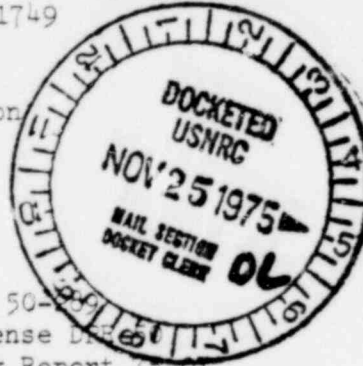


Docket No. 50-549
Operating License Docket
Nonroutine 10-Day Report 75-07

In accordance with Section 6.7.2.a.2 of the Technical Specifications for our Three Mile Island Nuclear Station Unit 1 and 10 CFR 20.405 (a) (2) & (3), enclosed please find Nonroutine 10-Day Report 75-06 that deals with an unplanned release of radioactive material which occurred on November 13, 1975.

We would like to point out that no member of the public and no station or contractor personnel received a radiation dose in excess of the limits stated in 10 CFR 20 as a result of the release. Further, none of the limits given in the Technical Specifications were exceeded.

We trust that this satisfies the reporting requirements referenced above and adequately answers any concerns you may have.

Sincerely,

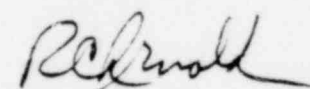
R. C. Arnold
Vice President

RCA:JMC:ilm

File: 20.1.1/7.7.3.12.1

Enclosure: Nonroutine 10-Day Report 75-07

cc: Mr. J. P. O'Reilly (U.S. NRC-Region 1)
Ms. Margaret Reilly (PaDER)

13355

1476 159

NON-ROUTINE 10-DAY REPORT 75-07
REPORT OF AN UNPLANNED RELEASE OF RADIOACTIVE MATERIALS
OCCURRING ON 13 NOVEMBER 1975

11-21-75

Description of Occurrence

On November 13, 1975, Between the hours of 1838 and 2123 (two (2) hours and forty-five (45 minutes)) an inadvertant release of radioactive material occurred while draining the Reactor Coolant System from the pressurizer surge line to the C Reactor Coolant Bleed Tank. The reactor coolant in the pressurizer surge line was at a temperature of 260°F which, when drained to the bleed tank, flashed to steam resulting in an increase in pressure in the bleed tank gas space. The overpressure condition caused the over flow loop seal for the Miscellaneous Waste Storage and Reactor Coolant Bleed Tanks to partially evacuate and release radicactive gas to the Auxiliary Building sump. This gas then was released to the atmosphere by the Auxiliary Building Ventilation Exhaust System. The release was noted by Control Room personnel during routine checking of the Radiation Monitoring System recorders and the transfer of reactor coolant to the bleed tank was terminated. The overflow loop seal was refilled and the release was terminated.

Apparent Cause of the Occurrence

Lack of procedural guidance is the apparent cause of the occurrence in that the procedure restricted draining of the reactor coolant system to periods when the average temperature of the system was less than 150°F. Even though the average temperature at the point of draining was 110°F, the pressurizer surge line temperature was 260°F.

Analysis of the Occurrence

For the following reasons it is believed that the unplanned release of radioactive material on the 13th of November did not endanger either the health or safety of the public.

- a. None of the limits in the TMI-1 Technical Specifications were exceeded.
- b. None of the maximum permissible concentration limits for non-radiation workers as given in 10 CFR 20 were exceeded at the site boundary.
- c. No individual on site at the time of the release received a radiation dose in excess of the limits for radiation workers specified in 10 CFR 20.

1476 160

Corrective Action

Immediate corrective action as described above was taken to terminate the release. Additionally procedural changes will be incorporated to insure that draining of the reactor coolant system from the pressurizer surge line will be accomplished only when the pressurizer temperature is less than 150° F.

Failure Data

Not applicable.

Release Data

Note: In no case did any member of the public or any station or contractor personnel receive a radiation dose near the applicable limits given in 10 CFR 20.

The total release consisted of 6.88 curies of predominantly (>99%) Xe-133 based on Radiation Monitoring System Strip Chart Recordings and samples of the vent header system. The maximum instantaneous noble gas release rate during the two hour and forty-five minute period was $7.86 \times 10^3 \text{ m}^3/\text{sec}$ which is below the Technical Specification limit of $1.2 \times 10^5 \text{ m}^3/\text{sec}$. The average release rate during the period was $2.31 \times 10^3 \text{ m}^3/\text{sec}$. The 24 hour average concentration in the auxiliary building sump was $3.374 \times 10^{-4} \text{ } \mu\text{Ci/cc}$ (based on the design air flow of 500 CFM through the cubicle), which is reportable under Technical Specification 6.7.2.a.2 and 10 CFR 20. There were no personnel exposures involved during the release since there were no personnel in the auxiliary building sump, (a normally unoccupied area).

1476 161