



LOUISIANA
POWER & LIGHT

142 DELARONDE STREET
P. O. BOX 6008 • NEW ORLEANS, LOUISIANA 70174 • (504) 386-2345

May 21, 1982

G. D. McLENDON
Senior Vice President

W3K-82-0294
Q-3-A35.02.01

Mr. G. L. Madsen, Chief,
Reactor Projects Branch, Region IV
U. S. Nuclear Regulatory Commission
611 Ryan Plaza Drive Suite 1000
Arlington, Texas 76012

SUBJECT: Waterford SES Unit 3
USNRC Inspection Report 50-382/Rpt. 82-07

Dear Mr. Madsen:

The following information regarding the violations cited by the USNRC Inspectors in IE Inspection Report No. 50-382/Rpt. 82-07 dated April 13, 1982, is herewith submitted:

Criterion V of 10 CFR 50, Appendix B, states that, "activities affecting quality shall be prescribed by instructions, procedures or drawings of a type appropriate to the circumstances and that these activities shall be accomplished in accordance with these instructions, procedures, or drawings."

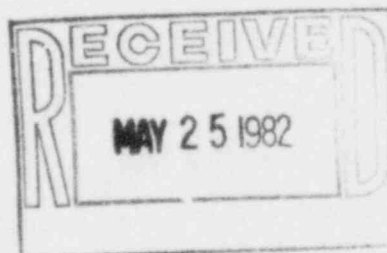
Ebasco Care and Maintenance Instruction CMI #150, "Emergency Diesel Generator and Control Panels," requires that equipment be protected from damage.

Contrary to the above, the NRC inspector observed on March 14, 1982, that the following conditions existed:

1. The following cables entering Emergency Diesel Generator, 3B-S, Generator Control and Relay Panel through a vertical conduit run in the floor of the cabinet appear to have been stepped on, in that, the insulation on the cables was flattened where they exit the conduit. The cables are unprotected from the conduit to the terminal board area on the side of the panel.

32366J-SB
32366G-SB
32366F-SB (2 cables)

This is a Severity Level V Violation



8206140141 820609
PDR ADOCK 05000382
G PDR

Mr. G. L. Madsen
Page 2

The following information is submitted:

Corrective Action Taken and the Results Achieved:

A review of quality control inspection records reveal that at the time of the Fischbach & Moore Quality Control inspection, the cables exiting the vertical conduit were acceptable as per design drawing requirements.

Cables 32366J-SB, 32366G-SB and 32366F-SB have been inspected by LP&L for excessive bend radius, damage to jacketing, and visible damage. There is none. Additionally, a continuity check was made from conductor to ground and conductor-to-conductor. These tests indicate that there is no damage to cables.

Corrective Action Taken to Preclude Repetition:

A visual examination was made in Emergency Diesel Generator 3A-S with no damage being found. LP&L has issued a memorandum cautioning personnel about the potential for damage which could be done when working within control panels.

Date When Corrective Action Will Be Achieved:

Corrective action complete as of this date.

2. Junction box covers were not installed on Emergency Diesel Generator 3B-S Junction Boxes JB-1 and JB-2.

This is a Severity Level V Violation (Supplement II.E.).

The following information is submitted:

Corrective Action Taken and the Results Achieved:

Junction box covers are installed on all junction boxes on Emergency Diesel Generator 3B-5.

Emergency Diesel Generator 3A-S was inspected and covers have been installed.

Corrective Action Taken to Preclude Repetition

Surveillance activities are in effect to identify and correct this type of problem.

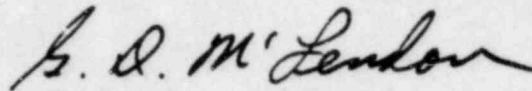
Date When Corrective Action Will Be Achieved

Corrective action complete as of this date.

Mr. G. L. Madsen
Page 3

If you have any questions concerning this response, please advise.

Very truly yours,

A handwritten signature in dark ink, reading "G. D. McLendon". The signature is fluid and cursive, with the first letters of each word being capitalized and prominent.

G. D. McLendon
Senior Vice President

GDMcL:LLB:grf

UNITED STATES OF AMERICA
NUCLEAR REGULATORY COMMISSION


In the Matter of

Louisiana Power & Light Company
Waterford 3 Steam Electric Station

)
)
) Docket No. 50-382
)

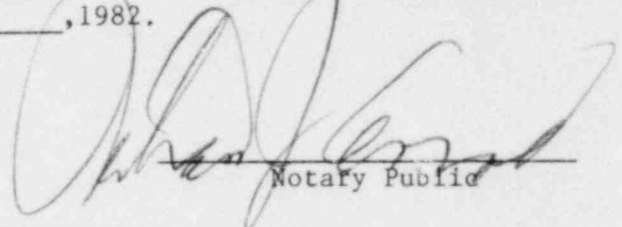
AFFIDAVIT

G. D. McLendon being duly sworn, hereby deposes and says that he is Senior Vice President of Louisiana Power & Light Company; that he is duly authorized to sign and file with the Nuclear Regulatory Commission the attached response (W3K82-0294) to the Notice of Violation identified in NRC Inspection Report 82-07; that he is familiar with the content thereof; and that the matters set forth therein are true and correct to the best of his knowledge, information and belief.


G. D. McLendon
Senior Vice President

STATE OF LOUISIANA)
) ss
PARISH OF ORLEANS)

Subscribed and sworn to before me, a Notary Public in and for the Parish and State above named this 21st day of MAY, 1982.


Notary Public

My Commission expires WITH LTR