

EXHIBIT A

8308260054 830819
PDR ADCK 05000302
S PDR

SUPPLEMENTARY INFORMATION

REPORT NO: 50-302/83-028/03L-0

FACILITY: Crystal River Unit 3

REPORT DATE: August 19, 1983

OCCURRENCE DATE: July 22, 1983

IDENTIFICATION OF OCCURRENCE:

One ECCS subsystem (HPI ES train "B") was determined to be inoperable and reportable under T.S. 3.5.2.

CONDITIONS PRIOR TO OCCURRENCE:

Mode 3 (0% power), Plant Startup.

DESCRIPTION OF OCCURRENCE:

Makeup pump MUP-1C motor burned up, leaving no HPI available for ES train "B" (ECCS).

DESIGNATION OF APPARENT CAUSE:


The cause of this event was an operator inadvertently securing cooling water to MUP-1C while it was operating resulting in the pump motor burning up. The normal makeup pump, MUP-1B, was out-of-service for maintenance. (Either MUP-1B or MUP-1C supplies HPI for ES train "B".) The normal source of closed cycle cooling (CCC) is different for MUP-1B (Nuclear Services - continuous) than for MUP-1C (decay heat - as needed). The decay heat CCC pump, DCP-1B, was secured as part of routine restoration following the secondary plant liquid release just completed prior to this event.

ANALYSIS OF OCCURRENCE:

There was no effect upon public or plant safety as ES train "A" was available had HPI been needed.

CORRECTIVE ACTION:

Precautionary tags have been placed on the Control Board to ensure Operators verify which source of cooling is required for the in-service makeup pump.

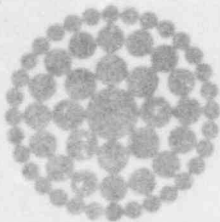

USNRC REGION II
ATLANTA, GEORGIA

83 AUG 23 A9:35

**Florida
Power**
CORPORATION

August 19, 1983
3F-0883-13

Mr. James P. O'Reilly
Regional Administrator, Region II
U.S. Nuclear Regulatory Commission
Office of Inspection & Enforcement
101 Marietta Street N.W., Suite 2900
Atlanta, GA 30303

Subject: Crystal River Unit 3
Docket No. 50-302
Operating License No. DPR-72
Licensee Event Report No. 83-028

Dear Mr. O'Reilly:

Enclosed please find Licensee Event Report No. 83-028, and the attached supplementary information sheet, which are submitted in accordance with Technical Specification 6.9.1.9.b.

Should there be any questions, please contact this office.

Sincerely,

P. Y. Baynard
Assistant to Vice President
Nuclear Operations

AEF/rw

Enclosure

cc: Document Control Desk
U.S. Nuclear Regulatory Commission
Washington, D.C. 20555

OFFICIAL COPY

IE 22
11