

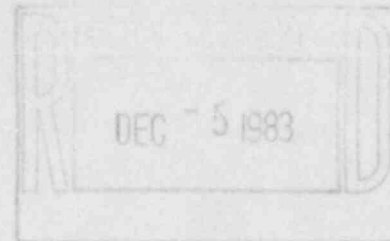


Public Service Company of Colorado

16805 Road 19 1/2, Platteville, Colorado 80651-9298

December 2, 1983
Fort St. Vrain
Unit No. 1
P-83388

50-267



Mr. John T. Collins, Regional Administrator
Region IV
Nuclear Regulatory Commission
611 Ryan Plaza Drive
Suite 1000
Arlington, Texas 76011

Reference: Facility Operating License
No. DPR-34

Docket No. 50-267

Dear Mr. Collins:

Enclosed please find a copy of Reportable Occurrence Report No. 50-267/83-047, and Reportable Occurrence Report No. 50-267/83-048, Finals, submitted per the requirements of Technical Specification AC 7.5.2(b)1 and AC 7.5.2(b)2.

Also, please find enclosed one copy of the Licensee Event Report for Reportable Occurrence Report No. 50-267/83-047 and Reportable Occurrence Report No. 50-267/83-048.

Very truly yours,

Don Warembourg by Milt McBride
Don Warembourg
Manager, Nuclear Production

DW/djm

Enclosures

cc: Director, MIPC

8312150113 831202
PDR ADOCK 05000267
S PDR

11/11/83

REPORTABLE OCCURRENCE DISTRIBUTION

Number of Copies

Department of Energy - - - - - 1 (P Letter)
San Francisco Operations Office
ATTN: California Patent Group
1333 Broadway
Oakland, California 94612

Department of Energy - - - - - 1 (P Letter)
Mr. Glen A. Newby, Chief
HTR Branch
Division of Nuclear Power Development
Mail Station B-107
Washington, D.C. 20545

Department of Energy - - - - - 1 (P Letter)
Project Manager
ATTN: Dr. Beighley
P. O. Box 31608
San Diego, CA 92138

Mr. John T. Collins, Regional Administrator - - - - - 1 (Original of P Letter)
Region IV
Nuclear Regulatory Commission
611 Ryan Plaza Drive
Suite 1000
Arlington, Texas 76011

Mr. Philip C. Wagner, Project Manager - - - - - 1 (P Letter)
Region IV
Nuclear Regulatory Commission
611 Ryan Plaza Drive
Suite 1000
Arlington, Texas 76011

Director - - - - - 1 (P Letter)
Office of Management Information and Program Control
Nuclear Regulatory Commission
Washington, D.C. 20555

INPO Records Center - - - - - 1 (P Letter)
Suite 1500
1100 Circle 75 Parkway
Atlanta, Georgia 30339

Mr. Mike Dolphin, FSV, GA Technologies, Inc. Site Representative - - - - - 1 (P Letter)
General Atomic Technologies, Inc.
16864 Weld County Road 19 1/2
Platteville, Colorado 80651

NRC Resident Site Inspector - - - - - 1 (P Letter)

REPORT DATE: December 2, 1983

REPORTABLE OCCURRENCE 83-047

ISSUE 0

OCCURRENCE DATE: November 2, 1983

Page 1 of 2

FORT ST. VRAIN NUCLEAR GENERATING STATION
PUBLIC SERVICE COMPANY OF COLORADO
16805 WELD COUNTY ROAD 19 1/2
PLATTEVILLE, COLORADO 80651-9298

REPORT NO. 50-257/'83-047/03-L-0

Final

IDENTIFICATION OF
OCCURRENCE:

On November 2, 1983, with the reactor shutdown, one Class I hydraulic shock suppressor (snubber) was found inoperable. Since the reactor had been operated at power since the snubber was last successfully tested, the snubber must be considered to have been inoperable during reactor power operation. This event constitutes operation in a degraded mode of LCO 4.3.10 and is reportable per Fort St. Vrain Technical Specification AC 7.5.2(b)2.

EVENT
DESCRIPTION:

On November 2, 1983, at 1250 hours, hydraulic snubber, BFS-244E, was found inoperable due to no visible oil level in the reservoir.

CAUSE
DESCRIPTION:

Component Failure.

Leaking reservoir gaskets allowed the loss of oil.

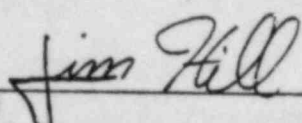
BFS-244E is a one and one-half inch ITT Grinnell, Figure 201 hydraulic snubber.

CORRECTIVE
ACTION:

Hydraulic snubber, BFS-244E, was replaced with a tested, qualified spare. The replacement snubber was installed and declared operable at 1410 hours on November 2, 1983.

No further corrective action is anticipated or required.

Prepared By:


Jim Hill

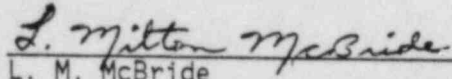
Technical Services Technician

Reviewed By:


Frank J. Novachek

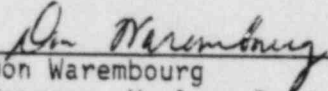
Technical Services Engineering Supervisor

Reviewed By:


L. M. McBride

Station Manager

Approved By:


Don Warembourg

Manager, Nuclear Production