

LICENSEE EVENT REPORT

CONTROL BLOCK: 1

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

01 T N S N P 1 2 0 0 - 0 0 0 0 - 0 0 3 4 1 1 1 1 4 5
7 8 9 14 15 25 26 30 31 32 33 34 35 36 37 38 39 40
LICENSEE CODE LICENSE NUMBER LICENSE TYPE JO CAT 50

CONT 01 REPORT SOURCE L 5 0 5 0 0 0 3 2 7 7 1 1 2 4 8 3 8 1 2 2 8 8 3 9
2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40
DCKET NUMBER EVENT DATE REPORT DATE

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES 10

02 With unit 1 in mode 5 (0% Rx power) at 0900 CST on 11/29/83 during review of
03 SI-70, it was noted that one refueling water storage tank (RWST) level channel
04 was out of technical specification tolerance. The unit complied with action
05 statement "18" of LCO 3.3.2.1. There was no effect upon public health and
05 safety. Previous occurrences - one (SQRO-50-327/82108).
07
08

09 SYSTEM CODE I B 11 CAUSE CODE E 12 CAUSE SUBCODE E 13 COMPONENT CODE I N S T R U 14 COMP. SUBCODE T 15 VALVE SUBCODE Z 16
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40
LER/RO REPORT NUMBER EVENT YEAR SEQUENTIAL REPORT NO. OCCURRENCE CODE REPORT TYPE REVISION NO.
17 8 3 1 7 5 0 3 L 0
21 22 23 24 25 26 27 28 29 30 31 32
ACTION TAKEN FUTURE ACTION EFFECT ON PLANT SHUTDOWN METHOD HOURS ATTACHMENT SUBMITTED NPD-4 FORM SUB. PRIME COMP. SUPPLIER COMPONENT MANUFACTURE
E 18 Z 19 Z 20 Z 21 0 0 0 0 N 22 N 23 L 24 B 10 8
33 34 35 36 37 38 39 40 41 42 43 44

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS 27

10 The review noted that the channel 1-LT-63-50 had been recalibrated on 06/28/83 (and
11 returned to service the same day); however, the "as found" condition failed to be
12 within technical specification limits. Since the transmitter was recalibrated
13 prior to returning it to service on 06/28/83, no further action is planned. The
14 cause for the inoperable channel is considered to be instrument drift.

FACILITY STATUS G 28 % POWER 0 0 0 29 OTHER STATUS NA 30 METHOD OF DISCOVERY B 31 DISCOVERY DESCRIPTION Surveillance review 32
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32
ACTIVITY CONTENT RELEASED OF RELEASE AMOUNT OF ACTIVITY LOCATION OF RELEASE
15 Z 33 Z 34 NA NA 35
3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35
PERSONNEL EXPOSURES NUMBER TYPE DESCRIPTION
16 0 0 0 37 Z 38 NA 39
4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40
PERSONNEL INJURIES NUMBER DESCRIPTION
17 0 0 0 40 NA 41
10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50
LOSS OF OR DAMAGE TO FACILITY TYPE DESCRIPTION
18 Z 42 NA 43
11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50
PUBLICITY ISSUED DESCRIPTION
19 N 44 NA 45
12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50

8401050422 831228
 PDR ADUCK 05000327
 S PDR

NRC USE ONLY

TENNESSEE VALLEY AUTHORITY

CHATTANOOGA, TENNESSEE 37401

1750 Chestnut Street Tower II

December 28, 1983

3 P2:31

Mr. James P. O'Reilly, Director
U.S. Nuclear Regulatory Commission
Suite 2900
101 Marietta Street, NW.
Atlanta, Georgia 30303

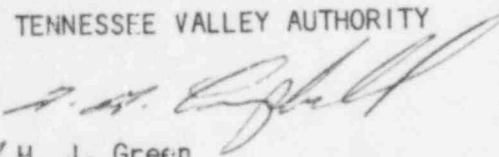
Dear Mr. O'Reilly:

TENNESSEE VALLEY AUTHORITY - SEQUOYAH NUCLEAR PLANT UNIT 1 - DOCKET
NO. 50-327 - FACILITY OPERATING LICENSE DPR-77 - REPORTABLE OCCURRENCE
REPORT SQRO-50-327/83175

The enclosed report provides details concerning the inoperability of one
refueling water storage tank (RWST) level channel. This report is
submitted in accordance with Sequoyah unit 1 Technical Specification
6.9.1.13.b.

Very truly yours,

TENNESSEE VALLEY AUTHORITY


H. J. Green
Director of Nuclear Power

Enclosure

cc (Enclosure):

Document Control Desk
U.S. Nuclear Regulatory Commission
Washington, D.C. 20555

Records Center
Institute of Nuclear Power Operations
Suite 1500
1100 Circle 75 Parkway
Atlanta, Georgia 30339

NRC Inspector, Sequoyah

OFFICIAL COPY

1622
11