

Edison

Consolidated Edison Company of New York, Inc.  
4 Irving Place, New York, NY 10003

December 21, 1973

Re: Indian Point Unit No. 2  
Facility Operating License  
DPR-26  
A.O. 3-2-18

Mr. James P. O'Reilly, Director  
Regulatory Operations, Region I  
U. S. Atomic Energy Commission  
631 Park Avenue  
King of Prussia, Pennsylvania 19406

Dear Mr. O'Reilly,

The following report of Abnormal Occurrence No. 3-2-18 is provided pursuant to the requirements of Section 6.12.2(a) of the Technical Specifications to Facility Operating License No. DPR-26.

On December 19, 1973 an analysis of the results of monthly periodic tests and calibration checks relating to pressurizer pressure indicated that the setting for one of the three bistables associated with low pressurizer pressure safety injection was slightly below that required by Item 3 in Table 3-1 of the Technical Specifications. At the time of these periodic tests and calibration checks the reactor was in the cold shutdown condition for maintenance work associated with repairs to the feedwater piping for No. 22 steam generator.

This particular bistable device is part of a two out of three logic system which provides for a safety injection signal on coincidence of low pressurizer pressure and low pressurizer level. The setpoint was found at 1680 psig instead of  $\geq 1700$  psig as required by the Technical Specifications. The other two bistables of the system were found to be operating correctly. The channel associated with this device was recalibrated and re-tested satisfactorily.

*Handwritten: 10-247*

8304050124 740104  
PDR AD0CK 05000247  
S PDR

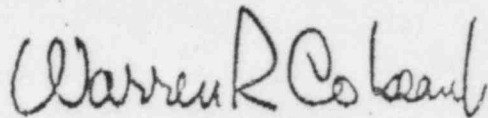
Mr. James P. O'Reilly

- 2 -

December 21, 1973

As indicated in the December 18, 1973 report of Abnormal Occurrence No. 3-2-17, our Engineering Department is performing a detailed analysis relating to instrument drift which we also feel was the cause of this discrepancy. Our report on this occurrence will cover the current status of that analysis. Mr. Bert Davis of your office was notified of this occurrence by Mr. John Makepeace by telephone on December 19, 1973.

Very truly yours,

A handwritten signature in dark ink, appearing to read "Warren R. Cobean, Jr.", written in a cursive style.

Warren R. Cobean, Jr.  
Manager, Nuclear Power  
Generation

cc: Mr. John F. O'Leary