


ROCHESTER GAS AND ELECTRIC CORPORATION • 89 EAST AVENUE, ROCHESTER, N.Y. 14649

LEON D. WHITE, JR.  
VICE PRESIDENT

March 13, 1975

TELEPHONE  
AREA CODE 716 546-2700

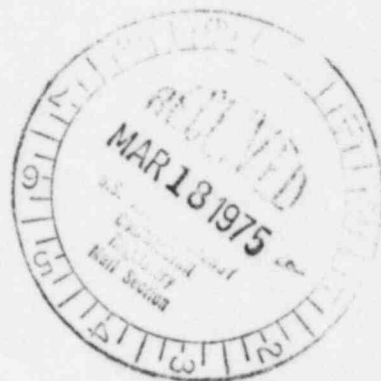

Mr. Karl Goller  
Assistant Director for Operating Reactors  
Office of Nuclear Reactor Regulation  
U. S. Nuclear Regulatory Commission  
Washington, D.C. 20555

Subject: Inspection of Hydraulic Shock Absorbers (Snubbers)  
R. E. Ginna Nuclear Power Plant, Unit No. 1  
Docket No. 50-244

Dear Mr. Goller:

In accordance with Mr. Skovholt's letter of October 1, 1973 concerning periodic inspection of hydraulic shock absorbers (snubbers), the hydraulic snubber units located outside the containment were inspected on February 28, 1975. All units were determined to be operable.

Hydraulic fluid was added to the reservoirs of two of the Bergen-Paterson units outside the containment. One of these units had leakage indicated at the accumulator "tell-tale" rod, indicating piston seal leakage. This is a rebuilt unit with ethylene propylene seals and a rebuilt accumulator supplied by Bergen-Paterson, that was installed last month. This unit will be inspected during the present refueling shutdown. The other unit is scheduled to be rebuilt during the present refueling shutdown with ethylene-propylene seals.

Very truly yours,

*L. D. White, Jr.*

L. D. White, Jr.

8304210258 751223  
PDR ADOCK 05000244  
PDR  
Q

50-244  
inquiry

2872

COPY SENT REGION