



Commonwealth Edison

One First National Plaza, Chicago, Illinois
Address Reply to: Post Office Box 767
Chicago, Illinois 60690

DMB

June 12, 1984

Mr. James G. Keppler
Regional Administrator
U. S. Nuclear Regulatory Commission
Region III
799 Roosevelt Road
Glen Ellyn, IL 60137

Subject: Braidwood Station Units 1 and 2
10 CFR 50.55(e) Updated Final Report
Cracked Battery Cells
NRC Docket Nos. 50-456 and 50-457

Reference (a): E. D. Swartz letter to J. G. Keppler
dated December 2, 1983

Dear Mr. Keppler:

On December 2, 1983, the Commonwealth Edison Company provided Reference (a) to document a deficiency reportable pursuant to 10 CFR 50.55(e). For your tracking purposes, this deficiency was assigned Number 83-14.

The purpose of this letter is to provide updated information relative to the cause of the cracking of the Gould Battery Cells and actions taken by the Commonwealth Edison Company to prevent additional occurrences. Additionally, Reference (a) stated that the defective cells would be replaced. This action has since been completed.

CRACK ANALYSIS

Based on the GNB Batteries Inc. failure analysis, it was determined that the cracking was caused by the use of excessive quantities and/or prolonged exposure to a cleaning fluid. The cleaning fluid contained Trichlorethylene which acts as a stress releasing agent when it comes in contact with plastic materials.

ACTION TAKEN TO PREVENT RECURRENCE

Braidwood site specific Procedure BWHS-4009-002 is being revised to include direction as to the acceptable method of cleaning batteries. No solvents are allowed. Interim directions have been provided to L. K. Comstock and Operating. In addition, periodic battery inspections will require checks for physical defects including cracks.

8406210079 840612
PDR ADOCK. 05000456
S PDR

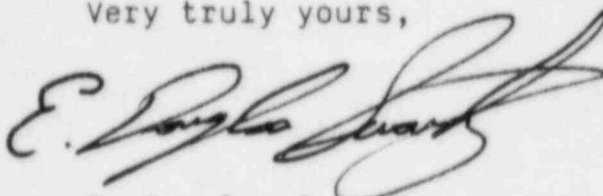
(0658d)

JUN 15 1984

*IE27
110*

Please address any questions that you or your staff may have concerning this matter to this office.

Very truly yours,

A handwritten signature in dark ink, appearing to read "E. Douglas Swartz". The signature is fluid and cursive, with a large, sweeping "S" at the end.

E. Douglas Swartz
Nuclear Licensing Administrator

EDS/rap

cc: RIII Inspector - Braidwood

Director of Inspection and Enforcement
U. S. Nuclear Regulatory Commission
Washington, D.C. 20555

8719N