



GULF STATES UTILITIES COMPANY

POST OFFICE BOX 2951 • BEAUMONT, TEXAS 77704

AREA CODE 713 838-6631

July 16, 1984


RBG- 18228

File Nos. G9.5, G9.25.1.1

Mr. John T. Collins, Regional Administrator
U. S. Nuclear Regulatory Commission
Region IV, Office of Inspection and Enforcement
611 Ryan Plaza Drive, Suite 1000
Arlington, Texas 76011

Dear Mr. Collins:

River Bend Station Unit 1
Docket No. 50-458
Final Report/DR-171

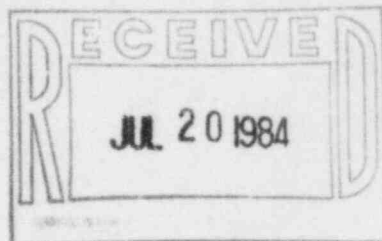

Gulf States Utilities Company (GSU) has completed its evaluation of DR-171 concerning the flow adjustment subassembly on Model Number 1284 Robertshaw thermostatic flow control valves on the jacket water cooling system for standby diesel generators supplied by Transamerica Delaval, Incorporated (TDI). It has been determined that failure of the assembly would cause overcooling of the engine. However, overcooling will not prevent the engine's performance or its ability to carry out its safety function. GSU has concluded the safe operations of the plant would not have been adversely affected, since the valves are failsafe; therefore, this condition is not reportable under 10CFR50.55(e).

Rosemount has since modified the design of the overrun assemblies and TDI recommended that the overrun assemblies be replaced. The replacement parts have been ordered under Purchase Order No. 12210-26637 and replacement will take place when the parts are received.

Sincerely,

J. E. Booker
J. E. Booker
Manager-Engineering,
Nuclear Fuels & Licensing
River Bend Nuclear Group

PJD
JEB/PJD/lp

cc: Director of Inspection & Enforcement
U. S. Nuclear Regulatory Commission
Washington, D. C. 20555

NRC Resident Inspector-Site

8408010012 840716
PDR ADOCK 05000458
S PDR

IE-27 1/0