

LICENSEE EVENT REPORT (LER)

FACILITY NAME (1)
Browns Ferry - Unit 1DOCKET NUMBER (2)
0 5 0 0 0 2 5 9 1 OF 0 2

TITLE (4)

Reactor Core Isolation Cooling Controller Inoperable

EVENT DATE (5)
MONTH DAY YEAR
0 9 2 9 8 4 8 4
LER NUMBER (6)
SEQUENTIAL NUMBER REVISION NUMBER
0 3 6 0 0 1
REPORT DATE (7)
MONTH DAY YEAR
0 2 3 8 4
OTHER FACILITIES INVOLVED (8)
FACILITY NAMES DOCKET NUMBER(S)
0 5 0 0 0 0 0 0OPERATING MODE (9)
N
POWER LEVEL (10)
0 1 8 4
THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CFR § (Check one or more of the following) (11)
20.402(b) 20.405(c) 50.73(a)(2)(iv) 73.71(b)
20.405(a)(1)(i) 50.36(c)(1) X 50.73(a)(2)(v) 73.71(c)
20.405(a)(1)(ii) 50.36(e)(2) 50.73(a)(2)(vii) OTHER (Specify in Abstract below and in Text, NRC Form 365A)
20.405(a)(1)(iii) 50.73(a)(2)(i) 50.73(a)(2)(viii)(A)
20.405(a)(1)(iv) 50.73(a)(2)(ii) 50.73(a)(2)(viii)(B)
20.405(a)(1)(v) 50.73(a)(2)(iii) 50.73(a)(2)(x)LICENSEE CONTACT FOR THIS LER (12)
NAME David Smith
TELEPHONE NUMBER
AREA CODE 2 0 5 7 2 9 - 3 8 6 5COMPLETE ONE LINE FOR EACH COMPONENT FAILURE DESCRIBED IN THIS REPORT (13)
CAUSE SYSTEM COMPONENT MANUFACTURER REPORTABLE TO NPRDS
X B N C N V W 2 9 0 YSUPPLEMENTAL REPORT EXPECTED (14)
YES (If yes, complete EXPECTED SUBMISSION DATE) X NO
EXPECTED SUBMISSION DATE (15)
MONTH DAY YEAR

ABSTRACT (Limit to 1400 spaces, i.e., approximately fifteen single-space typewritten lines) (16)

During performance of surveillance instructions 4.5.F.1.d and e, Reactor Core Isolation Cooling (RCIC) system failed to properly respond to manual control signals, therefore, it was declared inoperable. HPCI testing was immediately initiated. The RCIC ramp generator and signal converter was replaced, RCIC was successfully retested and declared operable. This failure was random with no further corrective action required.

8411060613 841023
PDR ADOCK 05000259
S PDRIE22
11

LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

APPROVED OMB NO. 3150-0104

EXPIRES: 8/31/85

FACILITY NAME (1)	DOCKET NUMBER (2)	LER NUMBER (6)			PAGE (3)		
		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER			
Browns Ferry - Unit 1	0500025984	—	036	—	00	02	OF 02

TEXT (If more space is required, use additional NRC Form 366A's) (17)

During normal operation, unit 1 was operating at 85 percent power. Units 2 and 3 were in refueling outages.

As surveillance test 4.5.F.1.d. & e was being run on the reactor core isolation cooling system (BN), manual control signals failed to cause proper turbine (TRB) responses. The reactor core isolation cooling system was declared inoperable. Technical Specification requirements were immediately initiated.

Within 24 hours, the reactor core isolation cooling system was repaired and successfully retested. The ramp generator and signal converter (CNV) was replaced. Its output signals were erratic. This was the only problem found. Since this was a random failure, no further corrective action is necessary.

With the reactor core isolation cooling system inoperable, adequate emergency core cooling was maintained (per the requirements of the final safety analysis report) by the high pressure coolant injection system (BJ).

Responsible Plant Section - N/A

Previous Similar Events - None

October 23, 1984
BCM:DLS:BDL

TENNESSEE VALLEY AUTHORITY

Browns Ferry Nuclear Plant
P. O. Box 2000
Decatur, Alabama 35602

October 23, 1984

U. S. Nuclear Regulatory Commission
Document Control Desk
Washington, D. C. 20555


Dear Sir:

TENNESSEE VALLEY AUTHORITY - BROWNS FERRY NUCLEAR PLANT (BFN) UNIT 1 -
DOCKET NO. 50-259 - FACILITY OPERATING LICENSE DPR-09 - REPORTABLE
OCCURRENCE REPORT BFRO-50-259/84036

The enclosed report provides details that concern the reactor core
isolation cooling controller inoperability. This report is submitted in
accordance with 10 CFR 50.73 (a)(2)(v).

Very truly yours,

TENNESSEE VALLEY AUTHORITY

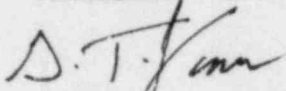

G. T. Jones
Plant Manager
Browns Ferry Nuclear Plant

Enclosure

cc (Enclosure):
Regional Administrator
U. S. Nuclear Regulatory Commission
Office of Inspection and Enforcement
Region II
101 Marietta Street, Suite 2900
Atlanta, Georgia 30303

INPO Records Center
Suite 1500
1100 Circle 75 Parkway
Atlanta, Georgia 30339

NRC Resident Inspector, BFN