

June 5, 1997
G-1151-SJA-97-258

Document Control Desk
United States Nuclear Regulatory Commission
Washington, D.C. 20555

- Reference: a) Boeing Letter G-1151-RSO-92-365 dated August 31, 1992; R. S. Orr to the NRC Operations Center
- b) NRC Letter Docket No. 99901227 dated August 12, 1992; L. J. Norrholm to R. S. Orr; Subject: Response to 10 CFR 21 Inquiry


Dear Sir or Madam:

In accordance with the reference correspondence and 10 CFR 21, Boeing is sending the NRC the attached error notice(s) received from our former software suppliers. Because of unknown current addresses, the following former customers were not notified:

Reactor Controls, Inc.
Echo Energy Consultants, Inc.
Nuclear Applications and Systems Analysis Company (Japan)
Nuclear Power Services

Error notices have been sent to our other former customers.

Very truly yours,

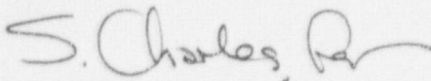


Sandra J. Andrews
Nuclear Administrator
Phone: (206) 865-6248
FAX: (206) 865-4851
Mail Stop: 7A-33, or
e-mail: Sandra.Andrews@PSS.Boeing.com


Enclosure(s): GTSTRUDL Program Report Form No. 97.04

IC20 1/1

100066



L-4-1PT21C



May 29, 1997

JUN 05 1997
CONTRACTS

Attention: Nuclear Administrator
Boeing Information & Support Services
P.O.Box 24346, M/S 7A-33
Seattle, Washington 98124-0346

RE: GT STRUDL

Dear Sir or Madam:

Enclosed please find copies of GTSTRUDL PROGRAM REPORT FORM No. 97.04 and a VENDOR ACKNOWLEDGMENT FORM. Please sign and return the VENDOR ACKNOWLEDGMENT FORM to acknowledge receipt of the GTSTRUDL Program Report.

Thank you for reviewing the Program Report and for returning the Acknowledgment Form.

Best regards,
CASE Center

Lawrence F. Kahn
Director

LFK/tlk
Enclosures

GTSTRUDL Program Report Form

GPRF No.: 97.04

DATE: 5/29/97

FROM: Computer-Aided Structural Engineering Center
Georgia Institute of Technology
Atlanta, Georgia 30332-0355

SEVERITY LEVEL:

- ☒ URGENT Problem results in incorrect answers which may not be apparent or job aborts and cannot be recovered within the session or job.
- ☐ SERIOUS Problem results in incorrect answers which are obvious or problem prevents completion of a particular user's task.
- ☐ MINOR Problem can be worked around or problem poses high frustration factor.
- ☐ INFORMATIVE Documentation error, program usage tip, user inconveniences.

Date Problem Confirmed 5/29/97

Date Notification Sent 5/29/97

Computers All

Operating System All current OS

Version 97.01 and earlier

Target Release for Correction 9702

Robert Abernathy
Signature
R & D Division

Developer
Title

Robert Abernathy
Typed or Printed Name

5/29/97
Date of Signature

David C. Key
Signature
Professional Services Division

Configuration Control Manager
Title

David C. Key
Typed or Printed Name

5/29/97
Date of Signature

GTSTRU DL Program Report Form

(Continued)

GPRF No.: 97.04

DATE: 5/29/97

DESCRIPTION:

If a GTSTRU DL/RC "CHECK FOR COLUMN" command is given with current units of MM and KG, CM and KG, MM and NEWT, or CM and NEWT, an abort will occur.

CHECK commands for beam options (FLEXURE, SHEAR, BOND and DEVELOPMENT) and all CHECK commands with non-metric units (INCHES, FEET, POUNDS, KIPS) are unaffected.

Workaround: Specify units as METER when CHECKing a column with metric units

Reference: Section 7.3 "The CHECK MEMBER command", Volume 4, GTSTRU DL Users Manual.