

NRC DISTRIBUTION FOR PART 50 DOCKET MATERIAL

FILE NUMBER

TO: Mr. D. L. Ziemann

FROM: NSP
Minneapolis, Minn. 55401
L.O. MayerDATE OF DOCUMENT
5-7-76DATE RECEIVED
5-11-76☒ LETTER
☐ ORIGINAL
☒ COPY
☐ NOTORIZED
☒ UNCLASSIFIED

PROP

INPUT FORM

NUMBER OF COPIES RECEIVED
40 cysDESCRIPTION Ltr furn addl info on feedwater
nozzle inspection re our 4-6-76 ltr....

ENCLOSURE

PLANT NAME: Monticello Plant

~~Do Not Remove~~

ACKNOWLEDGED

SAFETY

FOR ACTION/INFORMATION

ENVIRO

DHL 5-12-76

ASSIGNED AD :

ASSIGNED AD :

BRANCH CHIEF :

BRANCH CHIEF :

PROJECT MANAGER:

PROJECT MANAGER :

LIC. ASST. :

LIC. ASST. :

INTERNAL DISTRIBUTION

REG FILE

SYSTEMS SAFETY

PLANT SYSTEMS

ENVIRO TECH

NRC PDR

HEINEMAN

TEDESCO

ERNST

I & E (2)

SCHROEDER

BENAROYA

BALLARD

OELD

LAINAS

SPANGLER

GOSSICK & STAFF

ENGINEERING

IPPOLITO

MIPC

MACCARY

SITE TECH

CASE

KNIGHT

OPERATING REACTORS

GAMMILL

HANAUER

SIHWEIL

STELLO

STEPP

HARLESS

PAWLICKI

HULMAN

PROJECT MANAGEMENT

REACTOR SAFETY

EISENHUT

SITE ANALYSIS

BOYD

ROSS

SHAO

VOLLMER

P. COLLINS

NOVAK

BAER

BUNCH

HOUSTON

ROSZTOCZY

SCHWENCER

J. COLLINS

PETERSON

CHECK

GRIMES

KREGER

MELTZ

HELTEMES

AT & I

SITE SAFETY & ENVIRO

SKOVHOLT

SALTZMAN

ANALYSIS

EXTERNAL DISTRIBUTION

CONTROL NUMBER

LPDR: Minneapolis, Minn.

NATL LAB

BROOKHAVEN NATL LAB

TIC

REG. V-IE

ULRIKSON(ORNL)

NSIC

LA PDR

ASLB

CONSULTANTS

ACRS 16 / SENT

TO L.A.

4730

NORTHERN STATES POWER COMPANY

MINNEAPOLIS, MINNESOTA 55401

May 7, 1976

Mr D L Ziemann, Chief
Operating Reactors Branch #2
Division of Operating Reactors
U S Nuclear Regulatory Commission
Washington, DC 20555

Dear Mr Ziemann:

MONTICELLO NUCLEAR GENERATING PLANT
Docket No. 50-263 License No. DPR-22

Feedwater Nozzle Inspection

This letter is in response to your April 6, 1976 request for information on feedwater nozzle inspections. The requests are repeated below with our responses:

NRC Request # 1

Provide date of next planned inspection.

Response:


An in-service inspection program including the feedwater nozzle internal surfaces using an underwater television camera is planned for the next refueling outage which is currently scheduled for the Fall of 1977.

NRC Request # 2

Provide the number of startup/shutdown cycles to the date of inspection already accomplished, and the number of cycles since such inspection. Provide the estimated number of cycles at the next plant inspection date. A startup/shutdown cycle is defined as a power increase from zero and subsequent return to zero.

Response:

Two cold startup/shutdown cycles have occurred in addition to the 95 cycles reported in the first ten Monticello Semi-Annual Operating Reports for a total of 97 cycles to date. Two of these occurred since

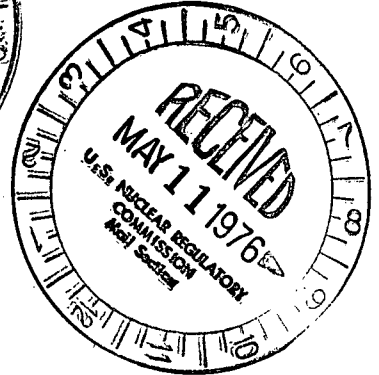

NORTHERN STATES POWER COMPANY

D L Ziemann

-2-

May 7, 1976

the November, 1975 feedwater nozzle inspection; 95 preceeded the inspection. Based on past experience, we estimate three additional cycles between now and the subsequent inspection for accumulated total of 100 cycles at the time of the next inspection.

NRC Request # 3

Describe actions taken or planned to minimize cold, intermittent feedwater flow to the reactor pressure vessel. Include changes in operating procedures and any redesign of feedwater heaters, pumps, flow control valves, piping, etc.

Response:

Three changes have been made which minimize cold, intermittent feedwater flow to the reactor vessel. First, system improvements have been made which improve feedwater flow control and reactor water level control during transient and low power operation. Such improvements include the installation of the lead-lag compensation network in the three element controller (feedwater flow/steam flow/reactor vessel level) and the addition of an automatic controller on the feedwater low flow regulating valve as discussed in Monticello Semi-Annual Operating Report Numbers 6 and 7. Second, the original feedwater spargers have been replaced with a new design having an interference fit with the vessel feedwater nozzle so as to minimize cold feedwater flow over the nozzle blend radius. Third, plant operation is much more stable at this time in history, reducing the number of cold startup/shutdown cycles drastically. (In the past two years, there have been eight cold startup/shutdown cycles, including three refueling outages, for an average of $2\frac{1}{2}$ unplanned cycles per year compared to 20 per year for the preceeding years.)

NRC Request # 4

Describe the reactor pressure vessel pressure-temperature limits for operating conditions and especially for the inservice hydrostatic and leak tests.

Response:

The reactor vessel temperature-pressure limitations are found in Monticello Technical Specification 3.6.B.

Yours very truly,



L O Mayer, PE
Manager, Nuclear Support Services

LOM/deb

cc: J G Keppler
G Charnoff
MPCA--Attn: J W Ferman