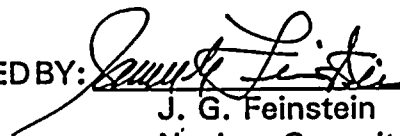



DONALD C. COOK NUCLEAR PLANT
1995 ANNUAL OPERATING REPORT

February 28, 1995

COMPILED BY:


J. G. Feinstein
Nuclear Consultant

REVIEWED BY:


J. R. Sampson
Plant Manager

APPROVED BY:



for E. E. Fitzpatrick
Senior Vice President
Nuclear Generation



TABLE OF CONTENTS

<u>SECTION</u>	<u>SECTION TITLE</u>	<u>PAGE NUMBER</u>
1.0	Introduction	1
1.1	Plant Description	1
1.2	Report Preparation	1
2.0	Personnel Radiation Exposure Summary	2
3.0	Steam Generator In-Service Inspection	4
3.1	Unit 1 Inspection Summary	4
3.2	Unit 2 Inspection Summary	6
4.0	Changes to Procedures	7
4.1	Operations Head Procedures	7
4.1.1	Reactor Coolant system Draindown	7
4.2	Plant Manager Procedures	8
4.2.1	Design Change Control Program	8
4.3	Technical Head Procedures	9
4.3.1	Resin Transfer to Qualified Shipping Container	9
4.4	Plant Engineering Head Procedures	10
4.4.1	Fuel Rod High Mag/Eddy Current Examination	10
4.4.2	Assembly Reconstitution/Fuel Rod Examination	10
4.5	Maintenance Head Procedures	12
4.5.1	Steam Generator Stop Valve Emergency Dump Valves	12

TABLE OF CONTENTS

5.0	Tests or Experiments Not Described in the FSAR	13
6.0	Challenges to Pressurizer Power Operated Relief Valves and Safety Valves	14
7.0	Reactor Coolant Specific Activity	15
8.0	Irradiated Fuel Examinations	16
9.0	Changes to Facility	23
9.1	Design Changes - RFCs	23
9.1.1	CRDM Fan Ductwork Modification	23
9.1.2	Security Computer System Replacement	23
9.1.3	Thermo-Lag Fire Barrier Resolution Modifications	24
9.2	Design Change Packets - DCPs	25
9.2.1	Margin From Saturation (T-sat) Meter Replacement	25
9.2.2	Control Rod Drive Mechanism Timing Modifications	25
9.2.3	Replacement of the Unit One Generator Step-up Transformer	26
9.3	Design Changes - Minor Modifications	27
9.3.1	CVCS Hold-up Tank Recirculation Pump Replacement	27
9.3.2	Replacement of Emergency Diesel Generator "1CD" Auxiliary Jacket Water Heater Motor Starter	27
9.3.3	Addition of a Vent Line to the Safety Injection (SI) Pump Suction Header	28

TABLE OF CONTENTS

9.4	Plant Modifications	29
9.4.1	Increase Speed for the Plant Control Air Compressors	29
9.4.2	New Acid and Caustic Waste System Installation	29
9.4.3	Tie-Ins For The Temporary Essential Service Water/Non-essential Service Water (ESW/NESW) System Chlorination	30
9.5	Temporary Modifications	31
9.5.1	Condensate Chemical Feedpump Controller Temporary Modification	31
9.5.2	Removal of the Subcooling Margin Remote Meter	31
9.5.3	East Auxiliary Building Crane Main Hoist Upper Limit Switch	32
9.5.4	Blockage of Fuel Handling Area Exhaust Charcoal Filter Bypass Circuit	32
9.5.5	Temporary Fuel Assembly Storage Stand in Transfer Canal	33
9.5.6	Removal of Bolts Connecting Reactor Core Barrel to Former Plate	33
9.5.7	Disconnection of Selected Unit 2 Incore Thermocouples	34
9.5.8	Removal of Main Turbine (Unit 2) Moisture Separator High Level Trip	34



1.0 INTRODUCTION

1.1 PLANT DESCRIPTION

The Donald C. Cook Nuclear Plant is owned by Indiana Michigan Power Company and is located five miles north of Bridgman, Michigan. The plant consists of two nuclear power units, each employing a Westinghouse pressurized water reactor nuclear steam supply system. Each reactor unit employs an ice condenser reactor containment system. The American Electric Power Service Corporation was the architect-engineer and constructor.

Units 1 and 2 reactor design power outputs (and licensed rating) are 3250 Mwt and 3411 Mwt, respectively. Unit 1 approximate gross and net electrical outputs are 1056 Mwe and 1020 Mwe, respectively. Unit 2 approximate gross and net electrical outputs are 1100 Mwe and 1060 Mwe, respectively. The main condenser cooling method is open cycle using Lake Michigan water as the cooling source for each unit.

1.2 REPORT PREPARATION

This report was compiled by J. G. Feinstein with the following individuals contributing information as follows:

D. L. Noble	- Personnel Exposure Summary
K. R. Worthington	- Steam Generator ISI Summary
P. W. Monk	
C. C. Savitscus	- Changes to Procedures
R. S. Ptacek	
R. S. Ptacek	- Challenges to Pressurizer PORVs and Safety Valves
C. C. Savitscus	- Tests or Experiments Not Described in the FSAR
R. S. Ptacek	
S. W. McLea	- Reactor Coolant Specific Activity
T. A. Georgantis	- Results of Irradiated Fuel Inspections
L. F. Caso	- Changes to Facility



2.0 PERSONNEL RADIATION EXPOSURE SUMMARY

Table 1 provides a summary of the number of station, utility, and contractor (and others) personnel receiving exposures greater than 100 millirem in 1995. The total record dose for all personnel was 202.518 rem as measured by thermoluminescent dosimetry (TLD) and reported in accordance with Regulatory Guide 1.16.

The values shown in the individual categories (routine maintenance, etc.) represent only the count of the number of people that received 100 millirem in that particular category. The grand total figure represents the total number of people that received 100 millirem, whether in one of the categories or multiple categories. A specific person could receive 100 millirem in two or more categories and still would be counted in the grand total. Therefore, the summation of the totals in the individual categories would not necessarily equal the grand total.

TABLE 1 - ANNUAL OPERATING REPORT - RG 1.16 REPORT
AMERICAN ELECTRIC POWER/COOK NUCLEAR PLANT
Prepared for year 1995

Number of Personnel and Man-Rem By Work and Job Function

	NUMBER OF PERSONNEL >100 Mr			TOTAL MAN-REM		
	Station Employees	Utility Employees	Contractors and Others	Station Employees	Utility Employees	Contractors and Others
<u>Reactor Operations & Surveillance</u>						
-Maintenance	6	0	7	4.866	0.004	4.644
-Operations	18	1	3	6.930	0.134	1.999
-Health Physics	25	0	15	6.342	0.002	5.214
-Supervisory	1	0	0	0.296	0.000	0.018
-Engineering	0	0	0	1.181	0.091	0.243
<u>Routine Maintenance</u>						
-Maintenance	72	0	235	17.280	0.169	89.048
-Operations	19	1	31	7.492	0.277	13.885
-Health Physics	23	0	40	7.681	0.013	12.908
-Supervisory	1	0	2	0.325	0.000	0.359
-Engineering	11	0	2	3.718	0.288	1.423
<u>In-Service Inspection</u>						
-Maintenance	7	0	10	1.725	0.000	6.168
-Operations	3	0	2	0.601	0.020	0.545
-Health Physics	0	0	0	0.138	0.016	0.117
-Supervisory	0	0	0	0.000	0.000	0.025
-Engineering	0	0	1	0.267	0.139	0.243
<u>Special Maintenance</u>						
-Maintenance	1	0	24	0.429	0.000	8.659
-Operations	0	1	0	0.105	0.141	0.027
-Health Physics	0	0	0	0.015	0.016	0.000
-Supervisory	0	0	0	0.000	0.000	0.016
-Engineering	0	4	0	0.445	1.232	0.040
<u>Waste Processing</u>						
-Maintenance	0	0	1	0.016	0.000	0.388
-Operations	0	0	0	0.000	0.000	0.014
-Health Physics	1	0	1	0.133	0.000	0.202
-Supervisory	0	0	0	0.000	0.000	0.000
-Engineering	0	0	0	0.027	0.000	0.021
<u>Refueling</u>						
-Maintenance	4	0	27	1.226	0.000	7.194
-Operations	6	0	8	2.140	0.000	2.133
-Health Physics	1	0	0	0.747	0.000	0.095
-Supervisory	0	0	0	0.005	0.000	0.010
-Engineering	0	0	0	0.089	0.001	0.090
<u>TOTALS</u>						
-Maintenance	99	0	315	25.542	0.173	116.101
-Operations	73	3	43	17.268	0.572	18.603
-Health Physics	37	0	59	15.056	0.046	18.536
-Supervisory	2	0	3	0.626	0.001	0.428
-Engineering	15	4	3	5.723	1.751	2.060
<u>GRAND TOTALS</u>						
	226	7	423	64.215	2.542	155.727

3.0 STEAM GENERATOR INSPECTIONS AND REPAIRS

3.1 Unit 1 Inspection Summary

Unit 1 Steam Generator inspections and repairs were performed from August 15, 1995 to October 11, 1995. In accordance with plant Technical Specifications (T/Ss), all tubes that were in service were inspected. Additionally, plugs were removed from 146 previously plugged tubes which were subsequently inspected. 125 of these tubes were returned to service based on current technical specification requirements. While extensive tube end reroll was performed, no sleeving operations were conducted. Summaries of the inspections performed and the results obtained are detailed below. Listings of the specific tubes are included in Attachment 2.

3.1.1 Number and extent of Unit 1 tubes inspected

Table 1: Steam Generator Status

	SG#11	SG#12	SG#13	SG#14	Total
Unsleeved tubes in service	2164	2904	2690	2727	10485
Sleeved tubes in service	827	180	459	374	1840
Total tubes in service	2991	3084	3149	3101	12325
Recovery tubes	31	24	75	16	146
Total of inspectable tubes	3022	3108	3224	3117	12471



Table 2: Summary of Eddy Current Inspections

	SG#11	SG#12	SG#13	SG#14	Total
Full Length Bobbin	3021	3108	3224	3117	12470
TSH-TEH CECCO5	2195	2928	2765	2743	10631
STH-TEH CECCO5	827	180	459	374	1840
Pre-Roll Combo	250	128	502	109	989
Post-roll Combo	231	117	479	109	936
Post-roll Profile	231	117	479	109	936
3-coil RPC	56	68	58	52	234
U-bend RPC	0	0	0	173	173
TSP's above Sleeve	3	0	0	0	3

Table 3: Augmented Examinations

	SG#11	SG#12	SG#13	SG#14	Total
PI \geq 1.50 Volts	3	5	1	0	9
Dents \geq 5.00 Volts	12	18	26	10	66
Artifact Signals	25	25	25	25	100

Table 4: Summary of Tubes Repaired

	SG#11	SG#12	SG#13	SG#14	Total
Reroll repairs-Tubes in service fuel cycle 14	211	110	407	99	827
Mechanical Plugs Installed	25	26	29	25	105
Reroll recovery tubes	20	7	70	10	107
IPC recovery tubes	6	9	1	3	19

Table 5: Summary of Tubes Plugged-Reasons

	SG#11	SG#12	SG#13	SG#14	Total
TSP ODSCC	0	0	0	0	0
TSP Cold Leg Thinning	11	12	18	16	57
Anti-Vibration Bar Wear	0	0	2	0	2
Tubesheet ODSCC	8	6	4	6	24
Roll Transition PWSCC	0	0	1	0	1
Stuck Plug Top	1	0	0	0	1
Unsuccessful recovery	5	8	4	3	20
Total tubes Plugged	25	26	29	25	105

Table 6: Accumulated Percentage Of Tubes Plugged In Each Steam Generator, Including Sleeve Equivalent Plugs:

Cook Nuclear Plant Plugging and Sleeving Summary Hot Leg						
Steam Generator	27" Sleeve Tubes	30" Sleeve Tubes	Sleeve Equiv. Plugs	Plugged Tubes	Total Equiv. Plugs	Percent Equivalent Plugged
S/G #11	309	517	36	391	427	12.6%
S/G #12	12	168	8	306	314	9.2%
S/G #13	83	376	20	193	213	6.3%
S/G #14	114	260	16	296	312	9.2%
TOTALS	518	1321	80	1186	1266	9.3%

3.2 Unit 2 Inspection Summary

There were no Unit 2 Steam Generator tube inspections and repairs performed in 1995.



4.0 CHANGES TO PROCEDURES

This section contains a brief description of the procedure changes implemented under the provisions of 10CFR50.59 and the associated safety evaluations.

4.1 OPERATIONS HEAD PROCEDURES

4.1.1 Reactor Coolant System (RCS) Draindown

Description of Change:

Revision 17 to **01-OPH 4021.002.005 allows the use of NLI-132, RCS half loop wide-range level indicator, as a backup for NLI-112, RCS half loop wide range level indicator. This substitution could be used whenever the RCS level is between the reactor vessel flange and the top of the reactor coolant system hot legs (elevation 615' ft).

Safety Evaluation Summary:

This change was reviewed and determined that it did not constitute an unreviewed safety question. This conclusion is based on the fact that the use of this substituted instrument does not impact the dilution accident described in section 14.1.5 of the UFSAR; the magnitude of error increase associated with the substitution of this level instrument is insignificant for the application; and in order to follow Generic letter 88-17 the level will be periodically checked and recorded when NLI-132 is used in place of NLI-112.

4.2 PLANT MANAGER PROCEDURES

4.2.1 Design Change Control Program

Description of Change:

This revision to PMI-5040 Rev. 16 incorporates the new design change process. The design changes are to be approved with AEPNO procedure 227000-ADM-2100-05, "Project Acceptance Process" and design changes are to be performed in accordance with AEPNO procedure 227400-STG-5400-03, "Design Changes." Unit 1 has been completed.

Safety Evaluation Summary:

This change was reviewed and determined that it did not constitute an unreviewed safety question. This conclusion is based on the fact that this is an administrative procedure which outlines the general requirements of the design change process, and individual design changes will continue to receive unreviewed safety question determinations in accordance with the requirements of 10 CFR 50.59 and our commitments to the NRC.



4.3 TECHNICAL HEAD PROCEDURES

4.3.1 Resin Transfer to Qualified Shipping Container

Description of Change:

Revision 3 of 12 THP6010 RPP.901 allows setup of resin transfer in places other than the 587' Drumming Room. The procedure and the UFSAR currently recognize only the "Drumming Room" as places where the resin transfer can take place.

Safety Evaluation Summary:

This change was reviewed and determined that it did not constitute an unreviewed safety question. This conclusion is based on the fact that regardless of the physical location of the resin transfer location the transfer will be done with the same precautions; any liquid/solid that is inadvertently spilled in the transfer process will be captured by the auxiliary building drainage system.

4.4 PLANT ENGINEERING HEAD PROCEDURES

4.4.1 Siemens Fuel Rod Hi-Mag/Eddy Current Examination

Description of Change:

An intrusive inspection of failed fuel assemblies is to be performed in accordance with plant procedure 12 EHP SP.069, Rev. 0.

Safety Evaluation Summary:

This change was reviewed and determined that it did not constitute an unreviewed safety question. This conclusion is based on the fact that these activities are not significantly different from those performed previously under safety reviews done on November 22, 1994, for 12 EHP SP.068 Rev. 0 "Fuel Rod Hi-Mag/Eddy Current Examination," and December 28, 1993, for **1 EHP SP.045, Rev. 0 "Ultrasonic Testing of Unit 1 Fuel for Cycle 14 Reload."

4.4.2 Fuel Assembly Reconstitution/Fuel Rod Examination

Description of Change:

Procedure 12 EHP SP.073 Revision 0 was written to provide directions for the inspection and potential reconstitution of failed fuel assemblies. The inspection portion of the procedure encompasses the setup of a temporary inspection elevator and inspection equipment, movement of irradiated fuel from the spent fuel pool to the elevator, removal of a fuel assembly nozzle, removal and handling of fuel rods for inspection, inspection of the fuel rods through use of the inspection equipment, storage of the fuel rod after the inspection, reattachment of the fuel assembly nozzle, movement of the irradiated fuel assembly back to the spent fuel pool, and tear down of the inspection equipment at the end of the inspection campaign. The reconstitution portion of the procedure encompasses the placement of a stainless steel rod in each of the vacated location(s) from where the failed fuel rod(s) were removed.

This procedure change does not address the use of reconstituted fuel assemblies in the reactor core. To date, three fuel assemblies have been reconstituted at the Donald C. Cook Nuclear Plant. However, no



reconstituted fuel has been used in a core design to date. The three fuel assemblies were reconstituted because the three fuel assemblies would be good candidates for reuse and because the effort of insertion of the stainless steel rods in place of the failed fuel rods was small.

Safety Evaluation Summary:

This change was reviewed and it was determined that it did not constitute an unreviewed safety question. This conclusion is based on the fact that all activities under this procedure would be bounded by the analysis of the fuel handling accident, with the exception that it would be permissible to elevate a fuel assembly to a level with a minimum water coverage of six feet, instead of the normal ten feet, while placed in the temporary fuel inspection elevator. This is permissible provided that the fuel assembly has been subcritical for at least ten days. Storage of reconstituted fuel assemblies is also addressed; a reactivity reduction is seen when fuel rods are replaced with stainless steel rods. Also, storage of the failed fuel rod basket is addressed; a reactivity reduction is seen because the maximum number of fuel rods capable of being stored in a rod basket is significantly less than a fuel assembly.

4.5 MAINTENANCE HEAD PROCEDURES

4.5.1 Inspection and Adjustment of Pneumatic/Spring Valve Actuators and Associated Positioners and Limit Switches and Post Maintenance Testing of Steam Generator Stop Valve Emergency Dump Valves.

Description of Change:

Change number six (6) to **12-IHP 6030.IMP.030, Revision 5, proposes to install a mechanical jumper between the process test connections (MPI-211, 212 through 241, 242) on the steam generator main steam isolation valve (MSIV) dump valve lines downstream of the three way motor operated test valve. The purpose of the mechanical jumper is to allow for the pressurization of the steam line downstream of the three way valve to verify that the dump valve is seating properly prior to realigning the steam path from the MSIV to the dump valve following maintenance. Performing post maintenance testing utilizing this method is expected to prevent the inadvertent closure of the MSIV following dump valve maintenance in the event that the dump valve maintenance in the event that the dump valve stroke is not properly set, resulting in dump valve seat leakage.

Safety Evaluation Summary:

This change was reviewed and determined that it did not constitute an unreviewed safety question. This conclusion is based on the fact that the size of the temporary mechanical jumper is too small to be considered in a high energy line break consequence evaluation, and it will not affect the ability of the MSIV to perform its design function (i.e. opening to initiate MSIV closure).

5.0 TESTS OR EXPERIMENTS NOT DESCRIBED IN THE FSAR

Other than the irradiated fuel examinations reported in Section 8 of this report, there were no tests or experiments implemented under the provisions of 10 CFR 50.59 (a) (1) performed on either unit of the Donald C. Cook Nuclear Plant.

6.0 CHALLENGES TO PRESSURIZER POWER OPERATED RELIEF VALVES AND SAFETY VALVES

During 1995, there were no challenges on either Unit 1 or Unit 2 to the pressurizer power operated relief valves (PORV's) or the pressurizer safety valves as a result of the valves being called upon to mitigate an actual overpressure condition.



7.0 REACTOR COOLANT SPECIFIC ACTIVITY

During 1995, Unit 1 exceeded for a brief period of time the specific activity limit of 1.0 uCi/gram Dose Equivalent Iodine 131 for Technical Specification 3.4.8. On July 14, 1995, Unit 1 experienced a Reactor Scram from 100 % RTP due to a loss of Condenser vacuum. This transient resulted in a spike of 1.32 uCi/gram for the Unit 1 Dose Equivalent Iodine 131 concentration. The coolant activity decreased and there was no entry into the action statement.

The spike is attributed to the fuel defects experienced during Cycle 14. During the refueling outage, which started immediately after the forced maintenance outage due to the Unit 1 trip, six (6) fuel assemblies were confirmed to have defects. Ultrasonic testing identified nine (9) suspect leaking fuel pins out of the six (6) fuel assemblies.

On Unit 2, during 1995, there were no instances in which the reactor coolant specific activity exceeded the limits of Technical Specification 3.4.8.

8.0 IRRADIATED FUEL EXAMINATIONS

In January and February 1995, Siemens Nuclear Power Corporation was brought on site to help investigate the root cause of failed Siemens (formerly Exxon Nuclear Company and, after that, Advanced Nuclear Fuels Corporation) fuel at Cook Nuclear Plant. Ultrasonic testing (UT), intrusive underwater video examinations, and single-rod eddy current examinations were performed in support of this effort.

During the 1995 Unit 1 refueling outage, in-mast fuel sipping (IMFS) and UT was performed on irradiated fuel to identify failed fuel. Underwater video and binocular visual examinations were performed to assess fuel assembly structural integrity and to identify the presence of foreign materials lodged in the fuel assemblies. Westinghouse Electric Corporation was contracted to perform these services.

After the 1995 Unit 1 refueling outage, an inspection of the failed fuel found during the refueling outage was performed to determine the root cause of the fuel failures. Unintrusive and intrusive underwater video examinations were performed. Westinghouse was contracted to assist in this investigation.

8.1 SIEMENS FAILED FUEL EXAMINATIONS

The Siemens failed fuel examination conducted during January and February 1995 was a continuation of efforts started in 1994 to determine the root cause of fuel failures that had occurred during previous operating cycles since 1983 at Cook Nuclear Plant. Westinghouse had performed unintrusive and intrusive examinations of Westinghouse fuel assemblies during 1994. In general, Westinghouse found grid-to-rod fretting as the cause of the fuel failures. However, not all fuel inspected was found to be failed; several UT "overcalls" (fuel rods that were identified as failed but were not) were identified.

8.1.1 Siemens UT Examination

Partially to address the potential for overcalls to possibly reduce inspection scope, and partially to test their newly designed UT equipment, Siemens performed a UT examination of all Siemens fuel assemblies identified as failed in previous UT campaigns. Also, 25

Westinghouse fuel assemblies that were not previously tested with UT after their last cycle of operation and two Westinghouse fuel assemblies that were previously tested were examined with Siemens UT to test a hypothesis for root cause of the fuel failures.

UT operates by a probe transceiver sending a high frequency sound wave into a fuel pin and measuring the strength of the returning signal, or "ring back." If there is water present in the fuel rod, the amplitude of the "ring back" will be diminished in relative comparison to fuel rods that do not contain water. If a fuel rod contains water, it is extremely likely that it is a failed fuel rod. The probe transceiver is inserted horizontally into the fuel assembly at an axial location just above the bottom grid strap. The inspection continues for each fuel assembly until the probe is pushed past each fuel rod.

No useful information was obtained from this UT inspection campaign. No meaningful correlation was observed between the results from this campaign and previous campaigns (i.e., several fuel rods that were previously detected as failed were not detected with the new UT equipment, and several fuel rods that were previously identified as not being failed were identified as failed with the new equipment).

8.1.2 Siemens Intrusive Failed Fuel Video / Eddy Current Examinations

After the Siemens UT campaign, an intrusive failed fuel inspection of failed Siemens fuel was performed at Cook Nuclear Plant. This inspection was performed to obtain additional information with regard to the root cause of the occurrence of fuel failures at Cook Nuclear Plant. Fuel rods identified by UT as being failed were inspected. This inspection was contracted to Siemens. Only fuel assemblies manufactured by Siemens were inspected. Unintrusive inspection techniques were not used for this examination because it was discovered that the grid spring forces for irradiated Siemens fuel were not adequate to keep the fuel rod in place after it was lifted to reveal surface areas behind the grid straps for inspection. Also, a fiberscope inspection was not performed due to the small benefit received from using the fiberscope during the 1994 Westinghouse inspection.

During the Siemens inspection, 44 failed and 85 non-failed rods were inspected in 36 fuel assemblies. Selected fuel assemblies, one at a time, were placed in a special inspection elevator installed in the fuel transfer canal specifically for this inspection. The fuel assembly top nozzle was removed, and, one at a time, selected fuel rods were removed for inspection. Each rod was inspected by passing it through a encircling eddy current coil, and then by using a high-magnification video camera. Most non-failed fuel rods were returned to the fuel assembly skeleton to the location from which they came; failed fuel rods and those rods that were previously identified as failed but were not confirmed to be failed by video or eddy current examination were placed in a special rod storage basket that is stored in a spent fuel pool rack storage cell location. Upon completion of the testing plan for each fuel assembly, the top nozzle was reinstalled, and the fuel assembly was returned to its spent fuel pool storage rack cell location. None of these fuel assemblies were reconstituted with stainless steel pins.

Grid-to-rod fretting was observed on most of the failed rods, and on 12 of the non-failed rods that were inspected. One fuel assembly contained fuel failures that were caused by fretting due to the presence of debris. The grid-to-rod fretting indications were through-wall in some locations, and were not through-wall in other locations. No pattern to the occurrence of grid-to-rod fretting has been found, although the preference to its occurrence in fuel assemblies with resident time in the reactor core next to the baffle was observed.

8.2 1995 UNIT 1 REFUELING OUTAGE FUEL INSPECTIONS

8.2.1 In-Mast Fuel Sipping

In-mast fuel sipping (IMFS) was used at Cook Nuclear Plant to detect fuel failures during the 1995 Unit 1 refueling outage. All 193 fuel assemblies discharged from the Cycle 14 core were inspected using IMFS.

To explain how the IMFS system detects fuel failures, during core offload, when a fuel assembly is raised out of the core, the reduction of water pressure due to the change of depth of water allows fission gases in failed fuel rods to expand. When the fuel assembly is raised into the manipulator crane mast to the full up position, a trickle flow of

dry air is pumped through nozzles located at the bottom opening of the mast. This air rises through the mast, stripping any fission gases that may be present on the surface of the fuel rods. After this air reaches the surface of the refueling cavity, still within the mast, this offgas air is directed to a detector that measures radioactivity. Increases in radioactivity above background levels indicate the presence of at least one failed fuel rod in that fuel assembly. IMFS cannot determine which rod is failed, only that the assembly contains at least one or no failed fuel rods.

During the Unit 1 1995 refueling outage, one fuel assembly was identified as containing at least one failed fuel rod each, and two fuel assemblies were suspected of containing at least one failed fuel rod.

8.2.2 Visual Examinations

During the Unit 1 core offload during 1995, all fuel assemblies were inspected per procedure number 12 SHP 4050 QC.002. In accordance with this procedure, each assembly is inspected using binoculars. During the transit of each fuel assembly to the spent fuel pool during core unload, the fuel assembly is inspected on all four sides. The examiner is looking specifically for torn or missing grid straps, missing or damaged fuel rods, excessive clad hydriding, or rod bow to gap closure. This inspection is primarily intended to detect fuel damage caused by mechanical interaction between fuel assemblies or baffle jetting, and is done each refueling. There was no indication of any fuel damage during this inspection in 1995.

8.2.3 Ultrasonic Examinations

Prior to introducing IMFS technology to Cook Nuclear Plant, detection of fuel failures was primarily performed using ultrasonic testing technology. Now that IMFS technology is used at Cook Nuclear Plant, UT is now used as a confirmatory measurement, and to identify which fuel rods in the fuel assembly are failed. Typically, all irradiated fuel assemblies scheduled for reload are examined by UT. Also, any fuel assemblies found to be failed or suspect by IMFS are also examined by UT. UT is performed in the spent fuel pool after core unload and prior to core reload. For a discussion on how UT operates, see Section

8.1.1, above. The goal of the combined use of IMFS and UT technologies is to prevent the reload of leaking fuel into either core at Cook Nuclear Plant. Since inception of the combined use of IMFS and UT technologies, no leaking fuel rods have been reloaded in either Cook Nuclear Plant unit.

During 1995, UT services for the Unit 1 refueling outage were contracted to Westinghouse. During the 1995 Unit 1 refueling outage, 194 fuel assemblies were inspected using UT technology. The results of the Unit 1 UT exam are as follows:

- of the 190 fuel assemblies that were inspected by IMFS and found not to be failed, three leaking fuel rods were found and three suspect fuel rods were found.
- of the two fuel assemblies identified by IMFS to be suspect, one was found to contain a failed fuel rod; in the other fuel assembly, one suspect fuel rod was found.
- of the one fuel assembly identified by IMFS to contain at least one failed fuel rod, one failed rod was found.

8.2.4 Inspections for Debris

After the Unit 1 1995 core unload, a visual inspection of the reactor core lower core plate revealed the presence of a large amount of foreign material. This foreign material was later determined to be portions of flexitallic gasket material from IRV-311 which had inadvertently become entrained in the reactor coolant. Using an underwater video camera, the underside of the bottom nozzles of all fuel assemblies unloaded from the Unit 1 core were inspected. This inspection occurred in parallel with the ultrasonic testing exam (see Section 8.2.3, above). About a dozen fuel assemblies were found to have flexitallic gasket material lodged in the flow holes or otherwise attached to the fuel assembly. Most of this foreign material was retrieved from the fuel using underwater tooling. No fuel with debris was loaded into the core. In addition, in parallel with the core reload, an additional underwater video inspection was performed on each irradiated fuel assembly of the area between the bottom nozzle and the bottom of the fuel rods for the presence of flexitallic gasket material. No foreign objects were found during this inspection.



8.3 WESTINGHOUSE FAILED FUEL EXAMINATION

8.3.1 High-Mag Video Examinations of Peripheral Failed Rods

During December 1995, after the Unit 1 refueling outage, an examination was performed on three fuel assemblies that were identified by UT during the refueling outage to contain failed rods in the outer two rows of the fuel assembly. The purpose of the examination was to obtain information to help determine the root cause of the occurrence of fuel failures at Cook Nuclear Plant.

The inspection was performed using high-magnification video cameras and tooling that would lift or lower, and rotate selected fuel rods within the fuel assembly skeleton envelope. This inspection was contracted to Westinghouse. Three rods in three fuel assemblies were inspected.

The inspection revealed that all of these fuel rods were failed due to debris-fretting. The source of the debris was the flexitallic gasket material as described in Section 8.2.4, above.

8.3.2 Intrusive Failed Fuel Video / Eddy Current Examinations

In December 1995 and January 1996, an intrusive failed fuel inspection of failed fuel was performed at Cook Nuclear Plant. This inspection was a continuation of the failed fuel inspection of fuel assemblies that were found by UT during the refueling outage to contain failed rods or suspect rods identified by UT and located toward the center, not on the periphery, of the fuel assembly. This inspection was contracted to Westinghouse. Only fuel assemblies manufactured by Westinghouse were inspected.

During the Westinghouse inspection, three failed rods and three suspect rods were inspected in three fuel assemblies. Selected fuel assemblies, one at a time, were placed in a special inspection elevator installed in the fuel transfer canal specifically for this inspection. The fuel assembly was inverted in the elevator, the bottom nozzle removed, and, one at a time, selected fuel rods were removed for inspection. Each rod was inspected using a high-magnification video camera. Non-failed fuel rods were returned to the fuel assembly skeleton to the location from which it came; failed fuel rods were placed in a special rod storage basket that is stored in a spent fuel pool rack storage cell location. In one instance, a stainless steel pin was placed in a Unit 1 fuel assembly skeleton location in place of the failed rod. Upon completion of the testing plan for each fuel assembly, the bottom nozzle was reinstalled, the fuel

assembly was reinverted to its upright position and returned to its spent fuel pool storage rack cell location.

Again, the inspection revealed that all of the fuel rods were failed due to debris-fretting. The source of the debris was the flexitallic gasket material as described in Section 8.2.4, above. None of the suspect rods in the one suspect fuel assembly were failed. This fuel assembly was a UT overcall.



9.0 CHANGES TO FACILITY

This section contains a brief description of the design changes implemented under the provisions of 10CFR50.59 (a) (1) and the associated safety evaluations.

9.1 DESIGN CHANGES (RFCs)

9.1.1 CRDM Fan Ductwork Modification

Description of Change:

RFC-DC-12-3093 allowed for changes to the inlet and outlet ductwork of the CRDM fans. This included the addition of flexible connections, the replacement of existing discharge plenum access doors to eliminate large overhangs, the replacement of backdraft dampers, and the addition of supports.

Safety Evaluation Summary:

This change was reviewed and determined not to constitute an unreviewed safety question. This conclusion is based on the fact that the ductwork is not used for accident mitigation and its modification will not initiate an accident; the modification impacts only the CRDM cooling system and it is not degraded by this change; the ductwork modification will not cause any components to malfunction; and there are no T/Ss based on the configuration of the ductwork.

9.1.2 Security Computer System Replacement

Description of Change:

RFC-DC-12-3110 allowed for the upgrade of the security computer system including a new security computer and associated hardware, new system software, new central alarm station and secondary alarm station consoles, and a new access control system. A new inverter, static switch, and reguliner (regulating transformer), were also installed for the security UPS. The secondary station alarm was also renovated and the new computer hardware interfaced with the existing computer system. Also, an addition to the South Gate facility was built under this RFC.

Safety Evaluation Summary:

This change was reviewed and determined not to constitute an unreviewed safety question. This conclusion is based upon the fact that the change did not involve any safety-related system, structure, or component. It does not adversely affect the Technical Specifications or the safety function requirements of the plant. This design change does not decrease the safeguards effectiveness of the Modified Amended Security Plan (MASP).

9.1.3 Thermo-Lag Fire Barrier Resolution Modifications**Description of Change:**

RFC-DC-12-3126, subtask-001, was implemented in response to regulatory concerns associated with the Thermo-Lag 330-1 fire barrier system used at Cook Nuclear Plant to meet NRC requirements for the protection of safe shutdown equipment. Specifically, subtask-001 involved removal of the Thermo-Lag material used to separate the Unit 1 and Unit 2 CCW pumps and modification of the wall's steel frame, adding insulation, and adding gypsum wallboard to each side of the frame. This modification will provide the required UL approved 3-hour protection for the wall.

Safety Evaluation Summary

This change was reviewed in accordance with 10CFR50.59 and it was determined that the change did not constitute an unreviewed safety question since the modification would not impact safe shutdown equipment and would ensure adequate defense-in-depth fire protection. The modification restores the intended passive fire protection features (i.e., a 3-hour fire barrier) necessary to help ensure the survival of safe shutdown equipment during a postulated Appendix R fire scenario. As such, the modification is consistent with NRC guidance and recommendations for implementing the requirements of 10CFR part 50, Appendix R.



9.2 DESIGN CHANGE PACKETS (DCPs).

9.2.1 Margin From Saturation (T-sat) Meter Replacement

Description of Change:

12-DCP-0001 allowed for the replacement of the "Margin From Saturation (T-sat)" meter. Foxboro "SPEC 200" micro control cards are used for the new device. The Foxboro cards are already in use for other applications at the plant. The old meter has been removed and a new LED panel meter installed in its place.

Safety Evaluation Summary:

This change was reviewed and determined not to constitute an unreviewed safety question. The design change installed equipment that is at least as reliable as the equipment that was removed. The saturation meter is not safety related and its design does not increase the probability of a malfunction of any equipment important to safety, nor does its replacement increase the consequences of an equipment malfunction. In fact, the Saturation Monitor will assist the operators in detecting equipment malfunctions. This design change maintains the integrity of the safety related equipment that the new equipment interfaces with and in itself cannot create the possibility of an accident of a different type than any previously evaluated in the UFSAR.

9.2.2 Control Rod Drive Mechanism Timing Modifications

Description of Change:

12-DCP-0003 modified the 15 Rod Control System Logic Cabinet Slave Cycle Decoder Cards and all spare Slave Cycle Decoder Cards per Westinghouse Technical Bulletin NSD-TB-94-05-R0. This change is intended to address some of the concerns addressed in NRC Generic Letter 94-03, "Rod Control System Failure and Withdrawal of Rod Control Cluster Assemblies."

Safety Evaluation Summary:

This change was reviewed and determined not to constitute an unreviewed safety question. This conclusion is based on the fact that this modification reduces the consequences of a single failure or



malfunction in the Rod Control system. By virtue of addressing the concerns in Generic letter 94-03, this design change reduces the probability of an accident different from those previously evaluated in the safety analysis report.

9.2.3 Replacement of the Unit One Generator Step-up Transformer

Description of Change:

01-DCP-0804 allowed for the replacement of the Unit 1 Brown Boveri Corp. 1300 MVA generator step-up transformer (GSU). The replacement GSU is a 950 MVA ASEA step-up transformer.

Safety Evaluation Summary:

This change was reviewed and determined not to constitute an unreviewed safety question. This conclusion is based on the fact that this modification will not adversely affect the plant's operating licenses, Technical Specifications, Emergency Plan, Modified Amended Security Plan, or safety function requirements of the AC Electrical Systems. The GSU is a non-safety related device. The new GSU will continue to perform the same function as the replaced transformer with minimal power limitations to the Unit 1 reactor. The GSU transformer and associated auxiliary equipment (cooling system, heaters, fire detection and protection systems) are not described in the basis for any technical specification.

9.3 MINOR MODIFICATIONS (MMs).

9.3.1 CVCS Hold-up Tank Recirculation Pump Replacement

Description of Change:

12-MM-520 allowed for the replacement of the CVCS hold-up tank recirculation pump (12-pp-28) with a "canned" (sealless) type pump.

Safety Evaluation Summary:

This change was reviewed and determined not to constitute an unreviewed safety question. This conclusion is based on the fact that this modification has no effect on the probability of any accident analyzed in the UFSAR; malfunction of this pump is not considered in the UFSAR and no new accident has been identified as a consequence of this replacement. The new pump has a slightly higher capacity, and thus, it will allow for faster filling of the refueling canal.

9.3.2 Replacement of Emergency Diesel Generator "1CD" Auxiliary Jacket Water Heater Motor Starter.

Description of Change:

01-MM-563 allowed for the replacement of an existing Eaton series A1 motor starter with a series B1 motor starter. The devices are being replaced as necessary due to normal preventative maintenance concerns of contact wear.

Safety Evaluation Summary:

This change was reviewed and determined not to constitute an unreviewed safety question. This conclusion is based on the fact that this replacement is equivalent and will maintain the same electrical and mechanical performance; i.e., the electrical and mechanical performance of the motor starter is unaffected by the model change. Since the model B1 is slightly smaller than the model A1, the installation of an adaptor plate was required. A seismic evaluation was performed because of the change in mass distribution, and the results indicated the consequences to be negligible.

9.3.3 Addition of a Vent Line to the Safety Injection (SI) Pump Suction Header

Description of Change:

12-MM-590 allowed for the installation of a permanent 1-inch vent piping from the common SI pump suction header to a pre-existing drain in both units. The piping is installed off the 8-inch suction header at the 45 degree horizontal run. The vent line contains a 1-inch globe valve (the root valve) and down stream sight glass. The valve is administratively locked closed when not in use.

Safety Evaluation Summary:

This change was reviewed and determined not to constitute an unreviewed safety question. This conclusion is based on the fact that the change is expected to facilitate the effective venting of the gases that may have collected during an outage. The availability of the SI system to perform its safety function is enhanced since the change makes it less likely to have to overcome the effects of non-condensable gasses that accumulate in the system piping at times when SI system operability is required.

9.4 PLANT MODIFICATIONS (PMs).

9.4.1 Increase Speed for the Plant Control Air Compressors.

Description of Change:

12-PM-1356 allowed for a speed increase in the Control Air Compressors from 450 rpm to 498 rpm. This will be achieved by changing the motor sheave of the control air compressors.

Safety Evaluation Summary:

This change was reviewed and determined not to constitute an unreviewed safety question. This conclusion is based on the fact that the increase in capacity will support a more reliable control air system. The 498 rpm will produce in excess of 300 cfm which meets system demands and falls within the horsepower perimeters of the compressor motor. The additional capacity adds reliability to the operation of components, if available, during implementation of the emergency operating procedures. No changes in system function, system configuration, or system interaction result from this modification. There are no technical specifications specific to the control air system; however, this system does supply control air to several containment isolation valves (CIVs) which are covered by T/Ss. This modification does not adversely affect the functionality of the control air system or design basis of the CIVs which actuate to their fail-safe position on loss of control air.

9.4.2 New Acid and Caustic Waste System Installation

Description of Change:

12-PM-818 allowed for the installation of a new system to receive and neutralize the acid and caustic waste from the make-up plant regenerations. Through this system neutralized waste will be discharged to the lake rather than to the turbine room sump and, subsequently, to groundwater via the absorption pond. The system includes a small intermediate sump tank to accept the waste drainage and pump it to a large holding tank where it is neutralized.

Safety Evaluation Summary:

This change was reviewed and determined not to constitute an unreviewed safety question. This conclusion is based on the fact that this modification is not safety related since it does not involve any system equipment, structure or component parts, whose failure might cause or increase the severity of a loss-of-coolant accident (LOCA); whose failure might result in an uncontrolled release of an excessive amount of radioactivity; that are vital to safe shutdown and isolation of the reactor; and/or that are part of the reactor coolant system boundary.

9.4.3 Tie-Ins For The Temporary Essential Service Water/Non-essential Service Water (ESW/NESW) System Chlorination**Description of Change:**

12-PM-1400 ST 44 allowed for a vendor (Betz Industrial) supplied Sodium Hypochlorite Injection System to support zebra mussel control in the service water system. The system includes a tank and three pump skids containing two pumps each and associated valving, and polyethylene tubing to connect the pump skids to the essential service water and non-essential service water systems.

Safety Evaluation Summary:

This change was reviewed and determined not to constitute an unreviewed safety question. This conclusion is based on the fact that, although the implementation of this change eliminates both the need to modify piping each spring to accommodate NaOCl (Sodium Hypochlorite), and the need to restore that piping to the original configuration each fall, the installation of a vendor supplied Sodium Hypochlorite Injection System does not adversely affect the safety function requirements of the Hypochlorite Injection System to support zebra mussel control.

9.5 TEMPORARY MODIFICATIONS (TMs)

9.5.1 Condensate Chemical Feedpump Controller Temporary Modification

Description of Change:

TM-1-95-02 allowed for the installation of one Condensate Chemical Feedpump fitted with a manual micrometer type stroke adjuster. This manual device can be more precisely adjusted and should provide better control than the existing pneumatic controller originally intended for automatic control.

Safety Evaluation Summary:

This change was reviewed and determined not to constitute an unreviewed safety question. This conclusion is based on the fact that the temporary modification does not impact any of the accidents evaluated in the UFSAR and none of the equipment involved is important to safety.

9.5.2 Removal of the Subcooling Margin Remote Meter

Description of Change:

TM-1-95-5 and TM-2-95-6 allowed for the temporary removal of the Subcooling Margin remote meter (TSAT meter), from the BA panel in both the Unit 1 and Unit 2 control rooms. Display of this parameter was still available on the Plant Process Computer control room displays and on the main subcooling monitor unit located behind the front panels in the control room.

Safety Evaluation Summary:

This change was reviewed and determined not to constitute an unreviewed safety question. This conclusion is based on the fact that although the subcooling monitor is covered by Technical Specifications 3/4.3.3.8 (Unit 1) and 3/4.3.3.6 (Unit 2) Post Accident Instrumentation, they indicate that the PPC is an acceptable substitute. In addition, subcooling display is still available on the main Subcooling Monitor. Only the remote indicator is temporarily removed.

9.5.3 East Auxiliary Building Crane Main Hoist Upper Limit Switch

Description of Change:

TM-1-95-17 allowed for the installation of a jumper in the circuitry for the main hoist upper limit switch (33-MHLUS), main hoist equalizer and the main hoist overload relay for the East Auxiliary Building Crane.

Safety Evaluation Summary:

This change was reviewed and determined not to constitute an unreviewed safety question. This conclusion is based on the fact that this TM will not impact the interlocks that prevent crane travel with loads over the spent fuel pool, which are required by the T/Ss. The interlocks that were jumpered by this TM are not required by the T/Ss, nor are they specifically addressed in the UFSAR.

9.5.4 Blockage of Fuel Handling Area Exhaust Charcoal Filter Bypass Circuit

Description of Change:

TM-1-95-21 allowed for the blocking of the bypass circuit off the Fuel Handling Area Exhaust (AFX) Charcoal Filter Unit by installing sheet metal partitions upstream of the bypass dampers. The current bypass dampers have degraded and cannot be repaired. This temporary modification will be closed out with the replacement of these dampers with a new type of damper.

Safety Evaluation Summary:

This change was reviewed and determined not to constitute an unreviewed safety question. This conclusion is based on the fact that the isolation of the bypass circuit is required to ensure sufficient air flow through the charcoal adsorbers to pass required technical specification surveillance criteria (T/S 4.9.12). The sealing off of the bypass circuit ensures that the proper amount of the test gas is passed through the charcoal adsorbers. The temporary sealing off of the bypass circuit places the AFX system in a conservative mode by establishing air flow through the charcoal adsorbers at all times.



9.5.5 Temporary Fuel Assembly Storage Stand in Transfer Canal.

Description of Change:

TM-1-95-22 allowed for the installation of a temporary stand in the transfer canal for the interim storage of a damaged fuel assembly (F/A) and its insert. During the Unit 1 core reload, an unirradiated F/A was damaged beyond the point of being able to place it in the spent fuel storage racks. The insert is a chrome-plated rod cluster control assembly (RCCA) which has received three plant operating cycles of irradiation. The temporary stand was constructed from our existing fuel shpping stand with an additional mounted structure, fabricated by Westinghouse, to suspend the F/A.

Safety Evaluation Summary:

This change was reviewed and determined not to constitute an unreviewed safety question. This conclusion was based on the following facts: 1) the new fuel storage vault criticality analysis bounded fuel criticality concerns; 2) the fuel handling accident bounds are not affected since the damaged fuel assembly is not irradiated; 3) a seismic analysis of the stand concluded that there would be no adverse interaction with the walls and/or liner of the transfer canal; and 4) the seismic analysis concluded that the stand and F/A could not become a missile. In addition, there was no concern of radiation exposure from the irradiated RCCA since it would have adequate shielding from the water in the transfer canal.

9.5.6 Removal of Bolts Connecting Reactor Core Barrel to Former Plate

Description of Change:

TM-1-95-23 allowed for the operation of Unit 1 during cycle 15 (present cycle), with three (3) missing barrel former bolts. Bolts A4, A5, and A6 had been located on the top former plate, near a thermal shield support location. Bolt A5 was found (during the previous outage), on the core plate. Inspections conducted during the Unit 1 1995 refueling outage found the two adjacent (A4 and A6) bolts loose but their locking bars were in place.

Safety Evaluation Summary:

This change was reviewed and determined not to constitute an unreviewed safety question. This conclusion is based on an evaluation prepared by Westinghouse, the original NSSS supplier. The Westinghouse evaluation addressed loose parts, fuel assembly grid crush/core cooling capability during seismic LOCA events, bypass flow increase acceptability, control rod insertion capability, flow induced vibration, effect of the next cycle of operation on the structural integrity of the remaining barrel-former bolts at the "A" former level, and the potential effects on barrel-former bolts on other former levels.

This temporary modification is only acceptable for cycle 15. It must be readdressed for future cycles.

9.5.7 Disconnection of Selected Unit 2 Incore Thermocouples**Description of Change:**

TM-2-95-16 allowed the temporary disconnection of Incore Thermocouples (I/T), TC-3, 18, 24, 27, 30, and 51. These thermocouples were providing incorrect input readings to recorders 2-SG-30 and 2-SG-31, and to the Plant Process Computer.

Safety Evaluation Summary:

This change was reviewed and determined not to constitute an unreviewed safety question. This conclusion is based on the fact that minimum T/S requirements are two (2) I/T per channel per core quadrant. After the implementation of this TM a minimum of five (5) I/T are still available per channel per core quadrant. Therefore, this change does not adversely affect the safety function requirements of the Unit 2 Incore Thermocouple System.

9.5.8 Removal of Main Turbine (Unit 2) Moisture Separator High Level Trip**Description of Change:**

TM-2-95-20 allowed for the disarming of the automatic trip function of the moisture separator high level switches 2-MLS-418 and 2-MLS-420. However, their alarming function are still maintained.

Safety Evaluation Summary:

This change was reviewed and determined not to constitute an unreviewed safety question. This conclusion is based on the fact that the components in this change do not have safety related functions; there are no accident initiators in the UFSAR which assumes a malfunction of the moisture separator drain system; and the moisture separator drain system is not mentioned in the bases of any technical specification.



ATTACHMENT 2 TO AEP:NRG:1147F

DONALD C. COOK NUCLEAR PLANT

1995 ANNUAL OPERATING REPORT

SUPPLEMENTAL STEAM GENERATOR
IN-SERVICE INSPECTION
INFORMATION



ATTACHMENT 2
STEAM GENERATOR ANNUAL OPERATING REPORT

SECTION 1: Unit 1 Inspection Results

- a. SG #11 Imperfections
- b. SG #12 Imperfections
- c. SG #13 Imperfections
- d. SG #14 Imperfections

SECTION 2: Unit 1 Tube Repairs

- a.1 New Plugs Installed in SG #11
- a.2 Tubes Repaired Using F* Reroll Techniques in SG #11
- b.1 New Plugs Installed in SG #12
- b.2 Tubes Repaired Using F* Reroll Techniques in SG #12
- c.1 New Plugs Installed in SG #13
- c.2 Tubes Repaired Using F* Reroll Techniques in SG #13
- d.1 New Plugs Installed in SG #14
- d.2 Tubes Repaired Using F* Reroll Techniques in SG #14

Attachment 2 TO AEP:NRC:1147F

**ATTACHMENT 2
STEAM GENERATOR ANNUAL OPERATING REPORT**

SECTION 1: Unit 1 Inspection Results

a. SG #11 Imperfections



SG - 11 INDICATION DISTRIBUTION

MOST SEVERE INDICATION PER TUBE

D. C. Cook UIR95

AEP-11 SERIES 51

09-22-1995

03:09 HRS.

SUPERTUBIN

X : 2 AXIAL INDICATION

∇ : 4 CECCO DI

/ : 252 CECCO DRI

R : 10 DISTORTED ROLL INDICATION

5 : 3 INDICATION 50 TO 59%

4 : 8 INDICATION 40 TO 49%

3 : 15 INDICATION 30 TO 39%


2 : 21 INDICATION 20 TO 29%

1 : 41 INDICATION 01 TO 19%

P : 173 POSSIBLE INDICATION

N : 4 DI NON-CONFIRMED WITH RPC

□ : 366 PLUGGED TUBE

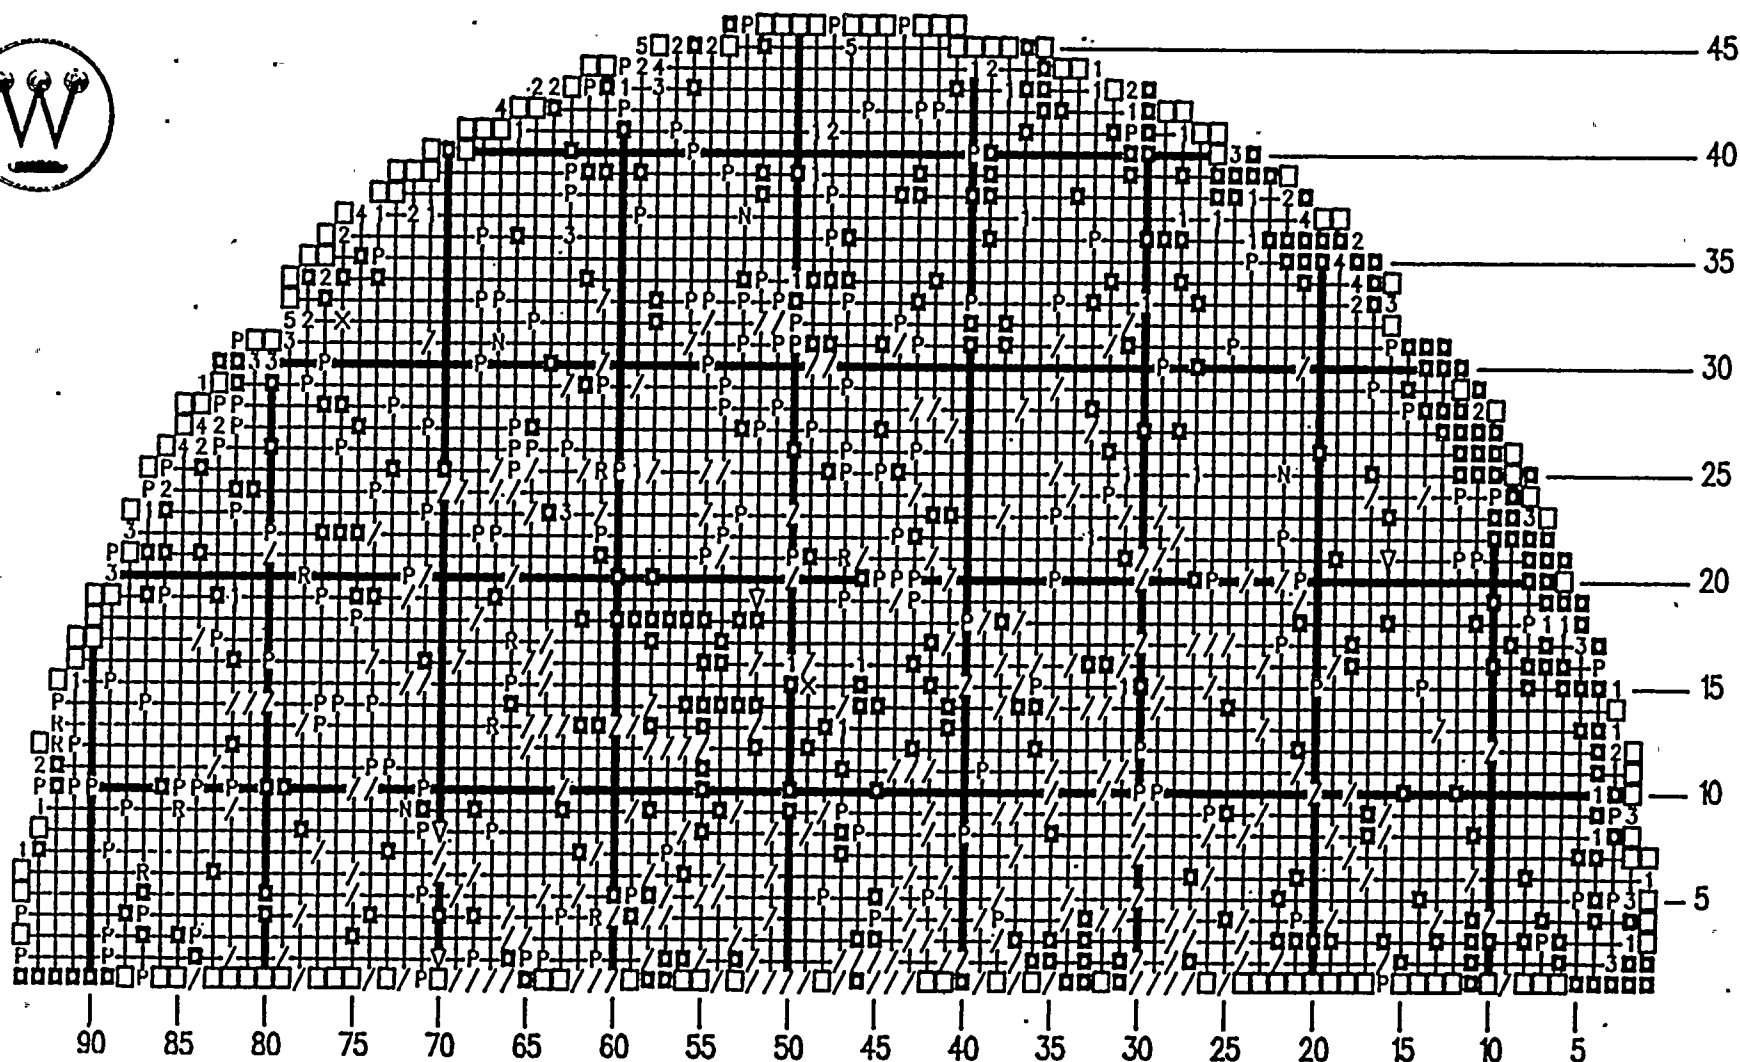



ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
6	1	TEH	TEC	720-EL	12	1C	.10	.00	M1	.97	126	1C	RESULT OF DISCREPANCY RESOLUTION
3	2	7C	TEC	720-EL	1	2C	-.10	.00	M1	1.19	134	1C	RESULT OF DISCREPANCY RESOLUTION
5	2	TEH	TEC	720-EL	36	1C	.07	.00	M1	1.98	107	1C	RESULT OF DISCREPANCY RESOLUTION
9	2	TEH	TEC	720-EL	34	1C	.15	.00	M1	.87	109	1C	RESULT OF DISCREPANCY RESOLUTION
2	3	7C	TEC	720-EL	31	2C	.23	.00	M1	.57	111	1C	RESULT OF DISCREPANCY RESOLUTION
5	3	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.94	57	1C	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
9	3	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.58	88	1C	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
12	3	TEH	TEC	720-EL	29	1C	.05	.00	M1	1.71	117	148	
13	3	TEH	TEC	720-EL	3	2C	-.23	.00	M1	1.46	127	4	
13	3	TEH	TEC	720-EL	5	1C	-.03	.00	M1	1.32	126	4	
15	3	TEH	TEC	720-EL	16	TSC	14.53	.00	1	2.07	148	4	
8	4	TEH	TEC	720-EL	13	1C	.00	.00	M1	.82	125	10	RESULT OF DISCREPANCY RESOLUTION
10	4	TEH	TEC	720-EL	13	5H	-1.53	.00	1	1.55	150	148	
16	4	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.87	56	4	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
5	5	TEH	TEC	720-EL	PI	4H	.00	.00	M1	.37	78	10	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
17	5	TEH	TEC	720-EL	36	2C	-.20	.00	M1	3.05	108	2	
17	5	TEH	TEC	720-EL	31	2C	-.15	.00	M1	2.88	108	4	
18	6	TEH	TEC	720-EL	10	1C	.08	.00	M1	1.08	128	2	
3	7	6H	TEH	720-EL	PI	2H	.00	.00	M1	.42	71	97	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
18	7	TEH	TEC	720-EL	4	1C	.05	.00	M1	.83	132	2	
18	8	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.57	61	4	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
23	8	TEH	TEC	720-EL	31	2C	-.18	.00	M1	2.31	112	20	
23	8	TEH	TEC	720-EL	32	1C	-.12	.00	M1	.35	111	20	
1	9	TRH	TEH	720-RB	SAI	TEH	1.36	.00	1	5.70	5	115	>> POSITIVE ID ESTABLISHED <<
1	9	-----1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST											
4	10	TRH	TEH	720-RB	MAI	TEH	2.37	.00	1	2.69	7	115	RESULT OF DISCREPANCY RESOLUTION
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
4	10												>> POSITIVE ID ESTABLISHED <<
4	10												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	10	TEH	TEC	720-EL	INR	TSH	.84	.00	M1	.20	74	8	RESULT OF DISCREPANCY RESOLUTION
12	10	TRH	TEH	720-RB	SAI	TEH	2.35	.00	1	1.4	19	115	>> POSITIVE ID ESTABLISHED <<
12	10												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	10	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.23	65	20	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
6	11	TEH	TEC	720-EL	INR	TEH	2.60	.00	M1	5.2	171	6	RESULT OF DISCREPANCY RESOLUTION
21	11	STH	TEC	720-EL	PI	1H	.00	.00	M1	.22	36	6	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
28	11	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.5	49	18	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
28	11	TEH	TEC	720-EL	23	1C	.08	.00	M1	1.9	117	18	
21	12	STH	TEC	720-EL	PI	1H	.00	.00	M1	1.16	102	8	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
24	12	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.82	109	20	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
4	13	TRH	TEH	720-RB	SAI	TEH	2.49	.00	1	3.10	12	115	>> POSITIVE ID ESTABLISHED <<
4	13												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	13	TEH	TEC	720-EL	91	TEH	20.17	.00	M1	.80	46	14	RESULT OF DISCREPANCY RESOLUTION
13	13												RETEST - RETEST FOR POSITIVE ID
13	13	TSH	TEH	720-WC	CDI	TSH	.00	.00	C19	2.58	55	27	RESULT OF DISCREPANCY RESOLUTION
13	13												>> POSITIVE ID ESTABLISHED <<
13	13	TRH	TEH	720-RB	MAI	TEH	2.04	.00	1	1.27	22	131	>> POSITIVE ID ESTABLISHED <<
13	13	TSH	TSH	720-RB	SAI	TSH	-1.36	.00	1	1.0	20	131	>> POSITIVE ID ESTABLISHED <<
13	13	TSH	TSH	720-ZC	SAI	TSH	-1.35	.00	4	.54	26	153	RETEST - RETEST FOR POSITIVE ID
15	14	STH	TEC	720-EL	PI	1H	.00	.00	M1	.74	76	22	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
24	14	TRH	TEH	720-RB	MAI	TEH	2.34	.00	1	3.78	8	115	>> POSITIVE ID ESTABLISHED <<
24	14												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	15	STH	TEC	720-EL	PI	2H	.00	.00	M1	.55	28	148	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
1	16	7H	TEH	720-EL	PI	2H	.00	.00	M1	.33	86	91	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
2	16	TRH	TEH	720-RB	SAI	TEH	2.47	.00	1	1.69	14	115	>> POSITIVE ID ESTABLISHED <<
2	16												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	16	TRH	TEH	720-RB	SAI	TEH	2.38	.00	1	6.11	11	115	>> POSITIVE ID ESTABLISHED <<
8	16												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	16	TRH	TEH	720-RB	SAI	TEH	2.37	.00	1	2.03	10	115	>> POSITIVE ID ESTABLISHED <<
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
9	16												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	16	TEH	TEC	720-EL	DIC	TEH	20.55	.00	M1	.52	31	22	RESULT OF DISCREPANCY RESOLUTION
21	16												RETEST - RETEST FOR POSITIVE ID
21	16	TSH	TEH	720-WC	CDI	TSH	-.68	.00	C13	.77	66	29	RESULT OF LA
21	16												RETEST - RETEST FOR POSITIVE ID
21	16	TSH	TSH	720-ZC	SAI	TSH	-.90	.00	4	.28	84	153	>> POSITIVE ID ESTABLISHED <<
31	16	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.41	90	22	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
33	16	TEH	TEC	720-EL	30	2C	-.08	.00	M1	1.84	109	22	
33	16	TEH	TEC	720-EL	13	1C	.08	.00	M1	1.53	121	22	RESULT OF DISCREPANCY RESOLUTION
6	17	TRH	TEH	720-RB	SAI	TEH	2.36	.00	1	4.01	19	115	RESULT OF DISCREPANCY RESOLUTION
6	17												>> POSITIVE ID ESTABLISHED <<
6	17												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	17	TRH	TEH	720-RB	SAI	TEH	2.25	.00	1	1.23	6	115	>> POSITIVE ID ESTABLISHED <<
24	17												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	17	TEH	TEC	720-EL	PI	4H	.00	.00	M1	.19	79	24	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
7	18	TRH	TEH	720-RB	MAI	TEH	2.30	.00	1	3.91	23	115	RESULT OF DISCREPANCY RESOLUTION
7	18												>> POSITIVE ID ESTABLISHED <<
7	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	18	TRH	TEH	720-RB	MAI	TEH	2.42	.00	1	5.20	13	115	>> POSITIVE ID ESTABLISHED <<
10	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	18	TEH	TEC	720-EL	23	2C	-.03	.00	M1	2.01	114	22	
34	18	TEH	TEC	720-EL	45	2C	.05	.00	M1	3.35	97	22	RETEST - RETEST FOR POSITIVE ID
34	18	TEH	TEC	720-EL	6	1C	.00	.00	M1	.82	125	22	
36	18	TEH	TEC	720-EL	21	2C	-.35	.00	M1	2.28	115	22	RESULT OF DISCREPANCY RESOLUTION
36	18	TEH	TEC	720-EL	11	1C	.10	.00	M1	.92	122	22	
4	19	TRH	TEH	720-RB	MAI	TEH	2.44	.00	4	5.40	14	115	>> POSITIVE ID ESTABLISHED <<
4	19												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	19	TRH	TEH	720-RB	MAI	TEH	2.32	.00	4	12.47	15	115	>> POSITIVE ID ESTABLISHED <<
8	19												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	19	TRH	TEH	720-RB	SAI	TEH	2.60	.00	1	2.00	1	115	>> POSITIVE ID ESTABLISHED <<
16	19												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
35	19	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.40	76	24	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
35	19	TEH	TEC	720-EL	47	2C	-.15	.00	M1	2.93	98	24	RESULT OF DISCREPANCY RESOLUTION
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
35	19												RETEST - RETEST FOR POSITIVE ID
10	20	TRH	TEH	720-R5	VAI	TEH	2.44	.00	1	2.12	6	1:5	>> POSITIVE ID ESTABLISHED <<
10	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	20	STH	TEC	720-EL	PI	2H	.00	.00	M1	.41	74	30	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
4	21	STH	TEC	720-EL	PI	1H	.00	.00	M1	.49	92	30	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
11	21	TRH	TEH	720-RB	VAI	TEH	2.48	.00	1	4.38	11	1:5	>> POSITIVE ID ESTABLISHED <<
11	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	21	TRH	TEH	720-RB	SAI	TEH	2.52	.00	1	2.02	25	1:5	>> POSITIVE ID ESTABLISHED <<
19	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	21	STH	TEC	720-EL	PI	2H	.00	.00	M1	.82	73	32	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
30	21	TRH	TEH	720-RB	VAI	TEH	2.45	.00	1	2.02	25	1:5	>> POSITIVE ID ESTABLISHED <<
30	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
37	21	TEH	TEC	720-EL	43	2C	.12	.00	M1	3.47	102	32	RESULT OF DISCREPANCY RESOLUTION
37	21												RETEST - RETEST FOR POSITIVE ID
2	22	TRH	TEH	720-RB	VAI	TEH	2.46	.00	4	6.40	11	125	>> POSITIVE ID ESTABLISHED <<
2	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	22	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.50	71	35	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
20	22	TRH	TEH	720-R5	VAI	TEH	2.70	.00	1	1.15	1:5		>> POSITIVE ID ESTABLISHED <<
20	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	22	STH	TEC	720-EL	PI	2H	.00	.00	M1	.69	74	35	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
25	22	TEH	TEC	720-EL	DIN	TEH	19.75	.00	M1	.33	29	38	RESULT OF DISCREPANCY RESOLUTION
33	22	TEH	TEC	720-EL	INR	TEH	20.50	.00	M1	.17	55	30	RESULT OF DISCREPANCY RESOLUTION
38	22	TEH	TEC	720-EL	24	2C	.03	.00	M1	2.23	113	30	
9	23	TRH	TEH	720-RB	VAI	TEH	2.35	.00	1	2.70	20	1:5	>> POSITIVE ID ESTABLISHED <<
9	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	23	TRH	TEH	720-RB	VAI	TEH	2.42	.00	1	3.90	8	1:5	>> POSITIVE ID ESTABLISHED <<
13	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	23	TRH	TEH	720-RB	SAI	TEH	2.56	.00	1	2.38	12	1:5	>> POSITIVE ID ESTABLISHED <<
16	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
2	24	TRH	TEH	720-RB SAI TEH			2.45	.00	1	4.30	12	**5	>> POSITIVE ID ESTABLISHED <<
2	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	24	TRH	TEH	720-RB MAI TEH			2.30	.00	1	2.52	11	**5	>> POSITIVE ID ESTABLISHED <<
3	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	24	TRH	TEH	720-RB MAI TEH			2.59	.00	1	3.56	16	**5	>> POSITIVE ID ESTABLISHED <<
4	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	24	TRH	TEH	720-RB MAI TEH			2.48	.00	1	3.88	11	**5	>> POSITIVE ID ESTABLISHED <<
8	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	24	TRH	TEH	720-RB MAI TEH			2.48	.00	1	2.73	25	**5	>> POSITIVE ID ESTABLISHED <<
20	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
35	24	STH	TEC	720-EL PI 1H			.00	.00	M1	1.21	53	34	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
36	24	STH	TEC	720-EL 3 2C			.10	.00	M1	.38	134	34	
38	24	TEH	TEC	720-EL 16 3C			.15	.00	M1	1.20	124	34	
38	24	TEH	TEC	720-EL 19 TSC			7.72	.00	1	.46	144	34	
38	24	TEH	TEC	720-EL 5 TSC			9.22	.00	1	.90	157	34	
38	24	TEH	TEC	720-EL 17 TSC			8.16	.00	1	.36	146	34	
17	25	TRH	TEH	720-RB MAI TEH			2.45	.00	1	4.03	17	**5	>> POSITIVE ID ESTABLISHED <<
17	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	25	TEH	TEC	720-EL PI 2H			.00	.00	M1	.64	100	35	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
40	25	TEH	TEC	720-EL 32 2C			.00	.00	M1	4.61	111	35	
6	26	TRH	TEH	720-RB SAI TEH			2.78	.00	1	2.31	16	**5	>> POSITIVE ID ESTABLISHED <<
6	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	26	TRH	TEH	720-RB MAI TEH			2.60	.00	1	4.15	12	**5	>> POSITIVE ID ESTABLISHED <<
8	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	26	TEH	TEC	720-EL PI 2H			.00	.00	M1	.47	50	56	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
15	26	TRH	TEH	720-RB MAI TEH			2.46	.00	1	3.00	15	**5	>> POSITIVE ID ESTABLISHED <<
15	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	26	TRH	TEH	720-RB MAI TEH			2.26	.00	1	8.69	32	**5	>> POSITIVE ID ESTABLISHED <<
17	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	26	STH	TEC	720-EL PI 2H			.00	.00	M1	.48	71	40	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
37	26	TEH	TEC	720-EL 9 4H			4.31	.00	1	.28	153	34	
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
1	27	TRH	TEH	720-RB	SAI	TEH	2.60	.00	1	2.74	15	115	>> POSITIVE ID ESTABLISHED <<
1	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	27	TRH	TEH	720-RB	SAI	TEH	2.58	.00	1	1.15	29	115	>> POSITIVE ID ESTABLISHED <<
3	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	27	TRH	TEH	720-RB	MAI	TEH	2.28	.00	1	3.74	25	115	>> POSITIVE ID ESTABLISHED <<
4	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	27	TRH	TEH	720-RB	MAI	TEH	2.36	.00	1	4.02	15	115	>> POSITIVE ID ESTABLISHED <<
17	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	27	STH	TEC	720-EL	5	5C	33.11	.00	1	.90	158	54	
1	28	TRH	TEH	720-RB	MAI	TEH	2.77	.00	4	2.92	24	125	>> POSITIVE ID ESTABLISHED <<
1	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	28	TRH	TEH	720-RB	SAI	TEH	2.87	.00	4	1.23	196	125	>> POSITIVE ID ESTABLISHED <<
2	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	28	7H	TEH	720-EL	DIN	TEH	20.28	.00	M1	.40	81	111	RESULT OF DISCREPANCY RESOLUTION
3	28	TRH	TEH	720-RB	MAI	TEH	2.56	.00	4	12.84	17	115	RESULT OF LAR
3	28												>> POSITIVE ID ESTABLISHED <<
3	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	28	TRH	TEH	720-RB	MAI	TEH	2.92	.00	1	2.93	28	115	>> POSITIVE ID ESTABLISHED <<
4	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	28	TRH	TEH	720-RB	MAI	TEH	2.60	.00	1	1.06	17	115	>> POSITIVE ID ESTABLISHED <<
22	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	28	TEH	TEC	720-EL	INR	TEH	20.56	.00	M1			38	RESULT OF DISCREPANCY RESOLUTION
37	28	TEH	TEC	720-EL	12	TSC	33.86	.00	1	.47	151	38	
41	28	TEH	TEC	720-EL	19	1C	-.22	.00	M1	.27	120	38	
1	29	TRH	TEH	720-RB	MAI	TEH	2.23	.00	1	5.03	26	115	>> POSITIVE ID ESTABLISHED <<
1	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	29	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.59	102	56	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
14	29	TRH	TEH	720-RB	MAI	TEH	2.62	.00	1	1.65	29	115	>> POSITIVE ID ESTABLISHED <<
14	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	29	TRH	TEH	720-RB	MAI	TEH	2.66	.00	1	2.58	5	115	>> POSITIVE ID ESTABLISHED <<
15	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
21	29	TRH	TEH	720-RB	SAI	TEH	2.57	.00	1	2.68	13	115	>> POSITIVE ID ESTABLISHED <<
21	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	29	TRH	TEH	720-RB	MAI	TEH	2.57	.00	1	4.03	17	115	>> POSITIVE ID ESTABLISHED <<
23	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	29	TSC	TEH	720-EL	PI	1H	.00	.00	M1	1.05	120	89	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
30	29	TSC	TEH	720-EL	PI	2H	.00	.00	M1	.78	83	89	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
1	30	TRH	TEH	720-RB	MAI	TEH	2.45	.00	1	14.60	16	115	>> POSITIVE ID ESTABLISHED <<
1	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	30	TRH	TEH	720-RB	MAI	TEH	2.29	.00	1	2.22	13	115	>> POSITIVE ID ESTABLISHED <<
2	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	30	TRH	TEH	720-RB	MAI	TEH	2.36	.00	1	5.08	22	115	>> POSITIVE ID ESTABLISHED <<
5	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	30	TRH	TEH	720-RB	MAI	TEH	2.83	.00	1	.92	9	115	>> POSITIVE ID ESTABLISHED <<
7	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	30	TRH	TEH	720-RB	MAI	TEH	2.76	.00	1	.51	24	115	>> POSITIVE ID ESTABLISHED <<
8	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	30	TRH	TEH	720-RB	MAI	TEH	2.61	.00	1	2.09	16	115	>> POSITIVE ID ESTABLISHED <<
9	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	30	TSC	TEH	720-EL	PI	1H	.00	.00	M1	1.13	82	89	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
12	30	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.57	55	52	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
17	30	TRH	TEH	720-RB	SAI	TEH	2.60	.00	1	1.36	16	115	>> POSITIVE ID ESTABLISHED <<
17	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	30	TRH	TEH	720-RB	SAI	TEH	2.75	.00	1	1.62	14	115	>> POSITIVE ID ESTABLISHED <<
20	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	30	TRH	TEH	720-RB	SAI	TEH	2.71	.00	1	2.67	7	115	>> POSITIVE ID ESTABLISHED <<
21	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	30	TEC	TEH	720-EL	8	TSH	1.37	.00	1	.26	155	111	
4	31	TRH	TEH	720-RB	MAI	TEH	2.66	.00	1	10.44	16	115	>> POSITIVE ID ESTABLISHED <<
4	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	31	TRH	TEH	720-RB	SAI	TEH	2.64	.00	1	1.18	16	115	>> POSITIVE ID ESTABLISHED <<
11	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
15	31	TEH	TEC	720-EL	3	3H	18.49	.00	1	.58	160	54	
16	31	TRH	TEH	720-RB MAI	TEH		2.63	.00	1	7.86	5	115	>> POSITIVE ID ESTABLISHED <<
16	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	31	TRH	TEH	720-RB SAI	TEH		2.65	.00	1	1.86	13	115	>> POSITIVE ID ESTABLISHED <<
23	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	31	STH	TEC	720-EL	1	TSC	43.37	.00	1	1.18	161	54	
32	31	TEH	TEC	720-EL INR	TEH		20.58	.00	M1	.56	52	50	RESULT OF DISCREPANCY RESOLUTION
32	31	TRH	TEH	720-RB MAI	TEH		2.69	.00	1	4.81	9	115	>> POSITIVE ID ESTABLISHED <<
32	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
41	31	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.61	90	50	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
42	31	TEH	TEC	720-EL	8	2C	.12	.00	M1	.72	130	50	
43	31	TEH	TEC	720-EL	28	1C	.12	.00	M1	.35	114	46	
4	32	TRH	TEH	720-RB SAI	TEH		2.97	.00	1	2.29	20	115	>> POSITIVE ID ESTABLISHED <<
4	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	32	TRH	TEH	720-RB SAI	TEH		2.55	.00	1	.75	28	115	>> POSITIVE ID ESTABLISHED <<
10	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	32	TRH	TEH	720-RB MAI	TEH		2.46	.00	1	.75	28	115	>> POSITIVE ID ESTABLISHED <<
11	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	32	TRH	TEH	720-RB MAI	TEH		2.43	.00	1	1.66	12	115	>> POSITIVE ID ESTABLISHED <<
14	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	32	STH	TEC	720-EL	PI	2H	.00	.00	M1	.77	61	52	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
31	32	TRH	TEH	720-RB MAI	TEH		2.39	.00	1	16.10	7	115	>> POSITIVE ID ESTABLISHED <<
31	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
38	32	TEC	TEH	720-EL INR	1H		.00	.00	M1			97	RESULT OF DISCREPANCY RESOLUTION
14	33	TRH	TEH	720-RB MAI	TEH		2.17	.00	1	5.82	25	115	>> POSITIVE ID ESTABLISHED <<
14	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	33	TEH	TEC	720-EL	16	TEH	20.39	.00	M1	.17	122	54	
27	33	TRH	TEH	720-RB MAI	TEH		2.57	.00	1	3.14	186	115	>> POSITIVE ID ESTABLISHED <<
27	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
36	33	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.37	60	50	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
43	33	TEH	TEC	720-EL	19	2C	-.20	.00	M1	2.46	122	46	
44	33	TEH	TEC	720-EL	16	1C	.12	.00	M1	.71	124	46	RESULT OF DISCREPANCY RESOLUTION
4	34	TRH	TEH	720-RB	MAI	TEH	2.59	.00	1	2.97	8	115	>> POSITIVE ID ESTABLISHED <<
4	34												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	34	TRH	TEH	720-RB	SAI	TEH	2.64	.00	1	2.21	10	115	>> POSITIVE ID ESTABLISHED <<
5	34												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	34	TRH	TEH	720-RB	MAI	TEH	2.26	.00	1	10.19	12	115	>> POSITIVE ID ESTABLISHED <<
16	34												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	34	TRH	TEH	720-RB	MAI	TEH	2.21	.00	1	8.09	16	115	>> POSITIVE ID ESTABLISHED <<
24	34												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	35	TRH	TEH	720-RB	MAI	TEH	2.58	.00	1	1.92	39	117	>> POSITIVE ID ESTABLISHED <<
1	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	35	TRH	TEH	720-RB	MAI	TEH	2.24	.00	1	7.41	15	115	>> POSITIVE ID ESTABLISHED <<
9	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	35	TRH	TEH	720-RB	MAI	TEH	2.52	.00	1	5.43	11	115	>> POSITIVE ID ESTABLISHED <<
10	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	35	TRH	TEH	720-RB	MAI	TEH	2.23	.00	1	10.19	12	115	>> POSITIVE ID ESTABLISHED <<
11	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	35	TSH	TEH	720-WC	CDI	TEH	20.21	.00	C16	1.87	97	39	RESULT OF LAR
14	35												RETEST - RETEST FOR POSITIVE ID
14	35	TEH	TEC	720-EL	DIC	TEH	20.47	.00	M1	1.26	98	68	RESULT OF DISCREPANCY RESOLUTION
14	35												RETEST - RETEST FOR POSITIVE ID
14	35	TRH	TEH	720-RB	MAI	TEH	1.15	.00	1	1.21	25	131	>> POSITIVE ID ESTABLISHED <<
14	35	TSH	TSH	720-RB	MAI	TSH	-.41	.00	1	.39	153	131	>> POSITIVE ID ESTABLISHED <<
14	35	TSH	TSH	720-ZC	MAI	TSH	-.36	.00	4	.30	112	153	>> POSITIVE ID ESTABLISHED <<
20	35	TSC	TEH	720-EL	PI	1H	.00	.00	M1	1.16	69	89	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
23	35	STH	TEC	720-EL	PI	1H	.00	.00	M1	.52	96	54	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
25	35	TRH	TEH	720-RB	SAI	TEH	2.57	.00	1	.91	10	117	>> POSITIVE ID ESTABLISHED <<
25	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	35	TRH	TEH	720-RB	MAI	TEH	2.60	.00	1	.80	17	117	>> POSITIVE ID ESTABLISHED <<
29	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

SG - 11 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -11/51

INSPECTION: August 95

22-Sep-95 2: 7

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
31	35	TRH	TEH	720-RB	MAI	TEH	2.55	.00	1	.55	21	117	>> POSITIVE ID ESTABLISHED <<
31	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	35	STH	TEC	720-EL	PI	1H	.00	.00	M1	.54	46	52	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
44	35	TEH	TEC	720-EL	INR	2H	.10	.00	M1		46		RESULT OF DISCREPANCY RESOLUTION
15	36	STH	TEC	720-EL	PI	1H	.00	.00	M1	.57	52	60	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
16	36	TSH	TEH	720-RB	CDI	TEH	20.57	.00	C12	2.10	67	39	RESULT OF LAR
16	36												RETEST - RETEST FOR POSITIVE ID
16	36	TEH	TEC	720-EL	DIC	TEH	20.52	.00	M1	.28	104	60	RESULT OF LAR
16	36												RETEST - RETEST FOR POSITIVE ID
16	36	TRH	TEH	720-RB	MAI	TEH	1.42	.00	1	2.03	22	13	>> POSITIVE ID ESTABLISHED <<
16	36	TSH	TSH	720-RB	MAI	TSH	-.88	.00	1	.36	112	13	>> POSITIVE ID ESTABLISHED <<
16	36	TSH	TSH	720-RB	MAI	TSH	-.83	.00	1	.66	93	159	>> POSITIVE ID ESTABLISHED <<
1	37	TRH	TEH	720-RB	SAI	TEH	2.68	.00	1	1.10	21	117	>> POSITIVE ID ESTABLISHED <<
1	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	37	TRH	TEH	720-RB	SAI	TEH	2.80	.00	4	1.95	12	125	>> POSITIVE ID ESTABLISHED <<
2	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	37	TRH	TEH	720-RB	MAI	TEH	2.55	.00	1	2.15	16	117	>> POSITIVE ID ESTABLISHED <<
7	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	37	TRH	TEH	720-RB	MAI	TEH	2.67	.00	1	.52	26	117	>> POSITIVE ID ESTABLISHED <<
15	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	37	TRH	TEH	720-RB	MAI	TEH	2.70	.00	1	1.35	37	117	>> POSITIVE ID ESTABLISHED <<
18	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	37	TRH	TEH	720-RB	MAI	TEH	2.59	.00	1	.54	24	117	>> POSITIVE ID ESTABLISHED <<
28	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
37	37	TEH	TEC	720-EL	3	4H	12.44	.00	1	.78	160	54	
3	38	TH	TEH	720-EL	DIN	TEH	19.28	.00	M1	.50	65	111	
3	38	TRH	TEH	720-RB	MAI	TEH	2.66	.00	4	2.03	14	125	>> POSITIVE ID ESTABLISHED <<
3	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	38	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.84	86	70	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
5	38	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.42	75	70	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
5	38	TRH	TEH	720-RB	SAI	TEH	2.62	.00	1	1.52	11	117	>> POSITIVE ID ESTABLISHED <<
5	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	38	TRH	TEH	720-RB	MAI	TEH	2.68	.00	1	.74	21	117	>> POSITIVE ID ESTABLISHED <<
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



D. C. Cook L-225

AEP -11/51

INSPECTION: August 95

22-Sep-95 2: 7

ROW	COL	CEE	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DE3	TAPE	COMMENTS
9	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	38	TEH	720-RB	WAI	TEH		2.52	.00	1	1.77	15	117	>> POSITIVE ID ESTABLISHED <<
14	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	38	TEH	720-RB	SAI	TEH		2.58	.00	1	.52	21	117	>> POSITIVE ID ESTABLISHED <<
23	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
43	38	TEC	720-EL		9	2C	.00	.00	M1	1.66	123	97	
1	39	7-	TEH	720-EL	DIN	TEH	21.09	.00	M1	.71	53	89	RESULT OF DISCREPANCY RESOLUTION
1	39	7-	TEH	720-EL	DIN	TSH	-.36	.00	M1	.70	53	111	RESULT OF DISCREPANCY RESOLUTION
1	39	7-	TEH	720-EL	PI	2H	.00	.00	M1	.82	103	111	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
1	39	TEH	720-RB	WAI	TEH		2.61	.00	1	2.64	21	117	>> POSITIVE ID ESTABLISHED <<
1	39												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	39	TEH	720-RB	SAI	TEH		2.59	.00	1	.93	15	117	>> POSITIVE ID ESTABLISHED <<
4	39												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	39	S-	TEC	720-EL	PI	3H	.00	.00	M1	.38	74	68	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
18	39	TS-	TEH	720-WC	CDI	TSH	-.97	.00	C16	1.33	113	43	RESULT OF DISCREPANCY RESOLUTION
18	39												RETEST - RETEST FOR POSITIVE ID
18	39	TS-	TSH	720-RB	WAI	TSH	-.42	.00	1	.54	15	131	>> POSITIVE ID ESTABLISHED <<
18	39	TS-	TSH	720-ZC	WAI	TSH	-.77	.00	4	.26	5	155	RESULT OF DISCREPANCY RESOLUTION
18	39												>> POSITIVE ID ESTABLISHED <<
44	39	TE-	TEC	720-EL	29	2C	-.05	.00	M1	1.31	114	50	
2	40	7-	TEH	720-EL	DIN	TEH	2.11	.00	M1			107	RESULT OF DISCREPANCY RESOLUTION
8	40	TE-	TEC	720-EL	PI	1H	.00	.00	M1	.48	52	66	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
15	40	TP-	TEH	720-RB	WAI	TEH	2.64	.00	1	.75	17	117	>> POSITIVE ID ESTABLISHED <<
15	40												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	40	S-	TEC	720-EL	PI	1H	.00	.00	M1	.69	52	66	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
33	40	S-	TEC	720-EL	PI	1H	.00	.00	M1	1.03	57	60	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
40	40	TE-	TEC	720-EL	PI	2H	.00	.00	M1	.93	75	60	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
44	40	TEC	720-EL		15	1C	-.20	.00	M1	.81	124	91	
2	41	TS-	TEH	720-WC	CDI	TEH	21.03	.00	C21	.48	53	87	RESULT OF LAR
2	41												RETEST - RETEST FOR POSITIVE ID
2	41	7-	TEH	720-EL	DIC	TEH	21.05	.00	M1	1.28	49	89	RESULT OF DISCREPANCY RESOLUTION
2	41												RETEST - RETEST FOR POSITIVE ID
ROW	COL	CEE	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DE3	TAPE	COMMENTS

D. C. Cook J-955

AEP -11/51

INSPECTION: August 95

22-Sep-95 2: 7

ROW	COL	CE3	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
2	41	74	TEH	720-EL PCN 2H			.00	.00	M1	1.78 112 89			VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
2	41	74	TEH	720-EL PCN 2H			-.19	.00	M1	1.86 112 107			
2	41	70	TEH	720-EL DIC TSH			-.85	.00	M1	.42 80 111			RESULT OF DISCREPANCY RESOLUTION
2	41												RETEST - RETEST FOR POSITIVE ID
2	41	70	TEH	720-EL DIC TSH			-.43	.00	M1	1.01 50 111			RESULT OF DISCREPANCY RESOLUTION
2	41												RETEST - RETEST FOR POSITIVE ID
2	41	70	TEH	720-EL PCN 2H			-.13	.00	M1	1.86 110 111			
2	41	TRH	TEH	720-RB MAI TEH			2.98	.00	1	1.69 15 131			>> POSITIVE ID ESTABLISHED <<
2	41	TSH	TSH	720-RB MAI TSH			-.65	.00	1	.34 22 131			>> POSITIVE ID ESTABLISHED <<
2	41	TSH	TSH	720-ZC MAI TSH			-.51	.00	4	.26 84 155			RESULT OF DISCREPANCY RESOLUTION
2	41												>> POSITIVE ID ESTABLISHED <<
2	41	2H	2H	720-ZC MAI 2H			-.21	.00	4	.45 45 155			RESULT OF DISCREPANCY RESOLUTION
2	41												>> POSITIVE ID ESTABLISHED <<
4	41	TR	TEH	720-RB SAI TEH			2.75	.00	1	.15 10 117			>> POSITIVE ID ESTABLISHED <<
4	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	41	TRH	TEH	720-RB SAI TEH			2.54	.00	1	.57 13 117			>> POSITIVE ID ESTABLISHED <<
6	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	41	TRH	TEH	720-RB MAI TEH			2.70	.00	1	1.86 27 117			>> POSITIVE ID ESTABLISHED <<
17	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	41	TEH	TEC	720-EL PI 1H			.00	.00	M1	.68 96 66			VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
20	41	TRH	TEH	720-RB MAI TEH			2.66	.00	1	1.28 24 117			>> POSITIVE ID ESTABLISHED <<
20	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	41	TRH	TEH	720-RB MAI TEH			2.54	.00	1	.70 23 117			>> POSITIVE ID ESTABLISHED <<
27	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	42	TRH	TEH	720-RB MAI TEH			2.67	.00	1	.98 20 117			>> POSITIVE ID ESTABLISHED <<
3	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	42	STH	TEC	720-EL PI 2H			.00	.00	M1	.82 97 156			VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
8	42	TEC	TEH	720-EL PI 2H			.00	.00	M1	.50 66 99			VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
8	42	TEC	TEH	720-EL PI 2H			.00	.00	M1	.38 92 103			
8	42	TRH	TEH	720-RB SAI TEH			2.58	.00	1	1.00 19 117			>> POSITIVE ID ESTABLISHED <<
8	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	42	TRH	TEH	720-RB MAI TEH			2.67	.00	1	1.69 31 117			>> POSITIVE ID ESTABLISHED <<
9	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	42	TRH	TEH	720-RB MAI TEH			2.61	.00	1	1.84 206 117			>> POSITIVE ID ESTABLISHED <<
11	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	42	TRH	TEH	720-RB SAI TEH			2.67	.00	1	.93 17 117			>> POSITIVE ID ESTABLISHED <<
21	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CE3	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
28	42	TRH	TEH	720-RB	MAI	TEH	2.54	.00	1	4.98	9	117	>> POSITIVE ID ESTABLISHED <<
28	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
42	42	STH	TEC	720-EL	PI	3H	.00	.00	M1	.33	58	64	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
42	42	STH	TEC	720-EL	PI	3H	-.05	.00	M1	.30	67	74	
46	42	TEH	TEC	720-EL	INR	TSH	.71	.00	M1			56	
1	43	TRH	TEH	720-RB	SAI	TEH	2.27	.00	1	.31	5	117	>> POSITIVE ID ESTABLISHED <<
1	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	43	TRH	TEH	720-RB	SAI	TEH	2.73	.00	1	.35	17	117	>> POSITIVE ID ESTABLISHED <<
3	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	43	TRH	TEH	720-RB	MAI	TEH	2.42	.00	1	.90	21	117	>> POSITIVE ID ESTABLISHED <<
4	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	43	TRH	TEH	720-RB	MAI	TEH	2.51	.00	1	.70	16	117	>> POSITIVE ID ESTABLISHED <<
6	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	43	TRH	TEH	720-RB	SAI	TEH	2.60	.00	1	1.24	17	117	>> POSITIVE ID ESTABLISHED <<
11	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	43	STH	TEC	720-EL	PI	1H	.00	.00	M1	1.35	70	72	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
20	43	STH	TEC	720-EL	PI	1H	.00	.00	M1	.65	62	72	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
24	43	TRH	TEH	720-RB	SAI	TEH	2.51	.00	1	3.17	11	117	>> POSITIVE ID ESTABLISHED <<
24	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	43	STH	TEC	720-EL	PI	1H	.00	.00	M1	.46	62	66	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
28	43	TRH	TEH	720-RB	MAI	TEH	2.54	.00	1	.98	15	117	>> POSITIVE ID ESTABLISHED <<
28	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	43	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.53	28	66	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
42	43	STH	TEC	720-EL	PI	3H	.00	.00	M1	.94	67	66	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
1	44	TRH	TEH	720-RB	MAI	TEH	2.38	.00	1	2.64	29	117	>> POSITIVE ID ESTABLISHED <<
1	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	44	TRH	TEH	720-RB	MAI	TEH	2.44	.00	1	1.67	31	117	>> POSITIVE ID ESTABLISHED <<
2	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	44	TRH	TEH	720-RB	MAI	TEH	2.41	.00	1	2.24	27	117	>> POSITIVE ID ESTABLISHED <<
5	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
11	44	TRH	TEH	720-RB	SAI	TEH	2.59	.00	1	4.79	8	117	>> POSITIVE ID ESTABLISHED <<
11	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	44	TRH	TEH	720-RB	MAI	TEH	2.60	.00	1	.13	34	117	>> POSITIVE ID ESTABLISHED <<
19	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	44	STH	TEC	720-EL	PI	1H	.00	.00	M1	.73	53	74	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
22	44	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.49	96	74	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
31	44	TRH	TEH	720-RB	MAI	TEH	2.83	.00	4	1.99	9	125	>> POSITIVE ID ESTABLISHED <<
31	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	44	STH	TEC	720-EL	PI	1H	.00	.00	M1	.75	98	72	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
46	44	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.56	57	56	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
1	45	TRH	TEH	720-RB	SAI	TEH	2.49	.00	1	5.20	11	117	>> POSITIVE ID ESTABLISHED <<
1	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	45	TEC	TEH	720-EL	PI	1H	.00	.00	M1	.63	96	103	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
4	45	TEC	TEH	720-EL	PI	2H	.00	.00	M1	.99	119	103	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
20	45	STH	TEC	720-EL	PI	1H	.00	.00	M1	.68	75	150	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
20	45	STH	TEC	720-EL	INR	2H	.00	.00	M1			150	RESULT OF DISCREPANCY RESOLUTION
25	45	STH	TEC	720-EL	PI	1H	.00	.00	M1	.96	65	74	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
25	45	STH	TEC	720-EL	PI	2H	.00	.00	M1	1.08	79	74	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
2	46	TRH	TEH	720-RB	MAI	TEH	2.57	.00	1	2.36	11	117	>> POSITIVE ID ESTABLISHED <<
2	46												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	46	TEC	TEH	720-EL	PI	1H	.00	.00	M1	.47	39	103	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
16	46	TEH	TEC	720-EL	17	AV4	22.16	.00	3	1.16	102	78	
21	46	TRH	TEH	720-RB	MAI	TEH	2.61	.00	1	.84	5	117	>> POSITIVE ID ESTABLISHED <<
21	46												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
42	46	STH	TEC	720-EL	PI	2H	.00	.00	M1	.46	47	74	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
1	47	TRH	TEH	720-RB	MAI	TEH	2.52	.00	1	2.70	23	117	>> POSITIVE ID ESTABLISHED <<
1	47												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	47	TRH	TEH	720-RB	MAI	TEH	2.63	.00	1	1.26	27	117	>> POSITIVE ID ESTABLISHED <<
2	47												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

D. C. Cook UIR95

AEP -11/51

INSPECTION: August 95

22-Sep-95 2: 7

ROW	COL	CEB	CEE	PROEE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
9	47	TEC	TEH	720-EL	PI	1H	.00	.00	M1	.30	104	103	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
13	47	STH	TEC	720-EL	18	2C	1.75	.00	1	.16	146	146	
14	47	TRH	TEH	720-EB	MAI	TEH	2.70	.00	1	.55	35	117	>> POSITIVE ID ESTABLISHED <<
14	47												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	47	STH	TEC	720-EL	PI	1H	.00	.00	M1	.59	80	76	RESULT OF LAR
19	47	STH	TEC	720-EL	PI	1H	.00	.00	M1	.69	86	146	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
25	47	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.77	102	78	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
25	47	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.73	105	78	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
26	47	STH	TEC	720-EL	PI	1H	.00	.00	M1	1.27	65	78	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
29	47	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.80	32	78	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
33	47	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.49	111	76	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
45	47	TEH	TEC	720-EL	57	1C	-.07	.00	M1	1.04	88	76	RESULT OF DISCREPANCY RESOLUTION
45	47												RETEST - RETEST FOR POSITIVE ID
5	48	TEC	TEH	720-EL	PI	1H	.00	.00	M1	.61	109	103	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
5	48	TEC	TEH	720-EL	PI	2H	.00	.00	M1	.77	62	103	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
9	48	TEC	TEH	720-EL	PI	1H	.00	.00	M1	.57	94	103	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
9	48	TRH	TEH	720-EB	MAI	TEH	2.52	.00	1	1.40	18	117	>> POSITIVE ID ESTABLISHED <<
9	48												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	48	TRH	TEH	720-EB	SAI	TEH	2.44	.00	1	.43	184	117	>> POSITIVE ID ESTABLISHED <<
30	48												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
36	48	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.45	85	128	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
38	48	STH	TEC	720-EL	PI	2H	.00	.00	M1	.78	44	128	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
41	48	STH	TEC	720-EL	21	AV3	.00	.00	M2	.66		128	
41	48	STH	TEC	720-EL	23	AV4	.00	.00	M2	.80		128	
46	48	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.83	71	78	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
1	49	TSH	TEH	720-WC	CDI	TSH	-.08	.00	C1	3.35	111	87	RESULT OF DISCREPANCY RESOLUTION
1	49												RETEST - RETEST FOR POSITIVE ID
1	49	7H	TEH	720-EL	DIC	TSH	-.23	.00	M1	3.31	116	89	RESULT OF DISCREPANCY RESOLUTION
1	49												RETEST - RETEST FOR POSITIVE ID
1	49	7H	TEH	720-EL	DIC	TSH	.00	.00	M1	3.11	116	111	RESULT OF DISCREPANCY RESOLUTION
1	49												RETEST - RETEST FOR POSITIVE ID
1	49	TSH	TSH	720-EB	MAI	TSH	-.29	.00	1	.29	166	131	>> POSITIVE ID ESTABLISHED <<
ROW	COL	CEB	CEE	PROEE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



SG - 11 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -11/51

INSPECTION: August 95

22-Sep-95 2: 7

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
1	49	TSH	TSH	720-ZC	MAI	TSH	.23	.00	4	.24	65	155	RESULT OF DISCREPANCY RESOLUTION
1	49												>> POSITIVE ID ESTABLISHED <<
8	49	TRH	TEH	720-RB	MAI	TEH	2.52	.00	1	1.61	14	117	>> POSITIVE ID ESTABLISHED <<
8	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	49	STH	TEC	720-EL	PCN	1H	.00	.00	M1	1.71	102	146	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
15	49	1H	1H	620-ZC	MAI	1H	.00	.00	4	.21	126	161	RESULT OF DISCREPANCY RESOLUTION
16	49	TRH	TEH	720-RB	MAI	TEH	2.55	.00	1	4.50	11	117	>> POSITIVE ID ESTABLISHED <<
16	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	49	TEC	TEH	720-EL	INR	TEH	21.21	.00	M1			101	RESULT OF DISCREPANCY RESOLUTION
27	49	TEH	TEC	720-EL	INR	TEH	21.04	.00	M1			128	RESULT OF DISCREPANCY RESOLUTION
27	49	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.43	85	128	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
30	49	TRH	TEH	720-RB	MAI	TEH	2.58	.00	1	.66	10	117	>> POSITIVE ID ESTABLISHED <<
30	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
39	49	TSH	TEC	720-EL	18	AV1	.33	.00	M2	.42		130	
39	49	TEH	TEC	720-EL	18	AV1	.00	.00	M2	.48		146	
41	49	TEH	TEC	720-EL	5	3H	46.79	.00	1	.41	157	146	
46	49	TEH	TEC	720-EL	INR	1H	-.04	.00	M1			130	RESULT OF DISCREPANCY RESOLUTION
1	50	TRH	TEH	720-RB	MAI	TEH	2.35	.00	1	1.11	20	117	>> POSITIVE ID ESTABLISHED <<
1	50												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	50	TEC	TEH	720-EL	16	TSH	1.42	.00	M1	.57	124	101	
20	50	TRH	TEH	720-RB	MAI	TEH	2.56	.00	1	1.17	22	117	>> POSITIVE ID ESTABLISHED <<
20	50												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	50	STH	TEC	720-EL	PI	1H	.00	.00	M1	.81	58	144	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
23	50	TRH	TEH	720-RB	SAI	TEH	2.45	.00	1	1.79	17	117	>> POSITIVE ID ESTABLISHED <<
23	50												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	50	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.30	102	78	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
32	50	STH	TEC	720-EL	PI	1H	.00	.00	M1	.49	40	78	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
34	50	STH	TEC	720-EL	16	1H	7.70	.00	1	.32	148	128	
4	51	TRH	TEH	720-RB	SAI	TEH	2.35	.00	1	.39	36	117	>> POSITIVE ID ESTABLISHED <<
4	51												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
6	51	TRH	TEH	720-RB	SAI	TEH	2.45	.00	1	.92	22	117	>> POSITIVE ID ESTABLISHED <<
6	51												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	51	TRH	TEH	720-RB	MAI	TEH	2.59	.00	1	1.21	36	117	>> POSITIVE ID ESTABLISHED <<
8	51												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	51	STH	TEC	720-EL	PI	2H	.00	.00	M1	.71	102	144	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
31	51	TEH	TEC	720-EL	PI	1H	.00	.00	M1	1.06	116	144	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
32	51	TRH	TEH	720-RB	MAI	TEH	2.66	.00	1	.66	13	117	>> POSITIVE ID ESTABLISHED <<
32	51												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	51	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.70	64	144	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
32	51	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.61	34	144	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
33	51	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.80	111	144	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
1	52	TSH	TEH	720-WC	CDI	TEH	20.54	.00	C18	2.16	92	87	RESULT OF LAR
1	52												RETEST - RETEST FOR POSITIVE ID
1	52	7H	TEH	720-EL	DIC	TEH	20.50	.00	M1	.75	80	89	RESULT OF DISCREPANCY RESOLUTION
1	52												RETEST - RETEST FOR POSITIVE ID
1	52	7H	TEH	720-EL	DIC	TEH	20.80	.00	M1	.68	74	105	RESULT OF DISCREPANCY RESOLUTION
1	52												RETEST - RETEST FOR POSITIVE ID
1	52	7H	TEH	720-EL	DIC	TSH	-.62	.00	M1	.67	65	111	RETEST - RETEST FOR POSITIVE ID
1	52	TRH	TEH	720-RB	MAI	TEH	1.66	.00	1	2.43	29	131	>> POSITIVE ID ESTABLISHED <<
1	52	TSH	TSH	720-RB	MAI	TSH	-1.44	.00	1	.52	150	131	>> POSITIVE ID ESTABLISHED <<
1	52	TSH	TSH	720-ZC	MAI	TSH	-.82	.00	4	.62	107	155	RESULT OF DISCREPANCY RESOLUTION
1	52												>> POSITIVE ID ESTABLISHED <<
2	52	TRH	TEH	720-RB	MAI	TEH	2.57	.00	1	1.19	10	117	>> POSITIVE ID ESTABLISHED <<
2	52												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	52	TSH	TEH	720-WC	CDI	TEH	12.09	.00	C17	4.01	66	87	RESULT OF LAR
13	52												RETEST - RETEST FOR POSITIVE ID
13	52	TSC	TEH	720-EL	DIC	TEH	11.91	.00	M1	1.30	76	89	RESULT OF DISCREPANCY RESOLUTION
13	52												RETEST - RETEST FOR POSITIVE ID
13	52	TRH	TEH	720-RB	MAI	TEH	2.07	.00	1	2.11	31	131	>> POSITIVE ID ESTABLISHED <<
13	52	TSH	TEH	720-ZC	MAI	TEH	11.31	.00	4	1.14	111	157	RESULT OF DISCREPANCY RESOLUTION
13	52												>> POSITIVE ID ESTABLISHED <<
13	52	TSH	TEH	720-ZC	MAI	TEH	2.84	.00	4	6.73	28	157	RESULT OF DISCREPANCY RESOLUTION
13	52												RETEST - RETEST FOR POSITIVE ID
16	52	TRH	TEH	720-RB	MAI	TEH	2.55	.00	1	1.12	25	117	>> POSITIVE ID ESTABLISHED <<
16	52												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	52	TSH	TEH	720-WC	CDI	TSH	-1.72	.00	C1	3.37	68	51	RESULT OF DISCREPANCY RESOLUTION
19	52												RETEST - RETEST FOR POSITIVE ID
19	52	TSH	TSH	720-ZC	SAI	TSH	-1.50	.00	4	.49	66	155	RESULT OF DISCREPANCY RESOLUTION
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



SG - 11 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -11/51

INSPECTION: August 95

22-Sep-95 2: 7

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	C-A	VOLTS	DEG	TAPE	COMMENTS
19	52												>> POSITIVE ID ESTABLISHED <<
27	52	STH	TEC	720-EL	PI	1H	.00	.00	M1	.59	98	144	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
32	52	TRH	TEH	720-RB	MAI	TEH	2.60	.00	1	.79	25	117	>> POSITIVE ID ESTABLISHED <<
32	52												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
34	52	STH	TEC	720-EL	PI	1H	.00	.00	M1	1.06	68	140	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
34	52	STH	TEC	720-EL	PI	2H	.00	.00	M1	.42	59	140	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
3	53	TRH	TEH	720-RB	SAI	TEH	2.67	.00	1	.54	26	117	>> POSITIVE ID ESTABLISHED <<
3	53												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	53	TRH	TEH	720-RB	MAI	TEH	2.21	.00	1	.17	52	119	>> POSITIVE ID ESTABLISHED <<
9	53												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	53	TSC	TEH	720-EL	PI	1H	.00	.00	M1	1.44	90	89	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
31	53	STH	TEC	720-EL	PI	1H	.00	.00	M1	.90	109	140	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
33	53	STH	TEC	720-EL	PI	1H	.00	.00	M1	.91	94	140	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
33	53	STH	TEC	720-EL	PI	3H	.00	.00	M1	.45	67	140	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
37	53	TEH	TEC	720-EL	DIN	TEH	11.96	.00	M1	.52	124	140	
46	53	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.38	58	140	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
1	54	TRH	TEH	720-RB	SAI	TEH	2.58	.00	1	3.14	21	117	>> POSITIVE ID ESTABLISHED <<
1	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	54	TRH	TEH	720-RB	SAI	TEH	2.08	.00	1	3.05	17	119	>> POSITIVE ID ESTABLISHED <<
5	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	54	TEC	TEH	720-EL	PI	2H	.00	.00	M1	.73	93	103	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
6	54	TRH	TEH	720-RB	MAI	TEH	1.97	.00	1	1.56	9	119	>> POSITIVE ID ESTABLISHED <<
6	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	54	TRH	TEH	720-RB	SAI	TEH	2.61	.00	1	.72	13	119	>> POSITIVE ID ESTABLISHED <<
21	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	54	STH	TEC	720-EL	PI	1H	.00	.00	M1	.64	28	138	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
25	54	TRH	TEH	720-RB	MAI	TEH	2.74	.00	1	1.32	8	123	>> POSITIVE ID ESTABLISHED <<
25	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	54	TRH	TEH	720-RB	MAI	TEH	2.77	.00	1	1.52	6	125	>> POSITIVE ID ESTABLISHED <<
25	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	54	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.83	102	138	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
25	54	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.46	74	138	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

D. C. Cook U1R95

AEP -11/51

INSPECTION: August 25

22-Sep-95 2: 7

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
28	54	STH	TEC	720-EL	PI	1H	.00	.00	M1	.35	84	142	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
29	54	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.59	59	142	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
39	54	STH	TEC	720-EL	PI	2H	.00	.00	M1	1.02	100	140	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
5	55	TRH	TEH	720-RB	MAI	TEH	2.22	.00	1	.50	16	119	>> POSITIVE ID ESTABLISHED <<
5	55												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	55	TRH	TEH	720-RB	MAI	TEH	2.23	.00	1	1.24	13	119	>> POSITIVE ID ESTABLISHED <<
12	55												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	55	STH	TEC	720-EL	PI	1H	.00	.00	M1	.72	64	132	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
23	55	TRH	TEH	720-RB	MAI	TEH	2.69	.00	1	1.42	17	123	>> POSITIVE ID ESTABLISHED <<
23	55												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	55	TRH	TEH	720-RB	SAI	TEH	2.75	.00	1	1.92	9	125	>> POSITIVE ID ESTABLISHED <<
23	55												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	55	TRH	TEH	720-RB	SAI	TEH	2.74	.00	1	3.36	4	123	>> POSITIVE ID ESTABLISHED <<
25	55												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	55	TRH	TEH	720-RB	SAI	TEH	2.72	.00	4	2.30	18	125	>> POSITIVE ID ESTABLISHED <<
25	55												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	55	STH	TEC	720-EL	PI	1H	.00	.00	M1	1.20	63	132	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
32	55	TRH	TEH	720-RB	MAI	TEH	2.72	.00	1	2.01	20	121	>> POSITIVE ID ESTABLISHED <<
32	55												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	55	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.76	65	122	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
45	55	TEH	TEC	720-EL	25	1C	.20	.00	M1	1.66	117	120	
8	56	TRH	TEH	720-RB	SAI	TEH	1.61	.00	1	2.13	192	119	>> POSITIVE ID ESTABLISHED <<
8	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	56	TRH	TEH	720-RB	SAI	TEH	2.77	.00	1	1.73	23	119	>> POSITIVE ID ESTABLISHED <<
12	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	56	TRH	TEH	720-RB	MAI	TEH	2.63	.00	1	1.03	18	121	>> POSITIVE ID ESTABLISHED <<
31	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	56	STH	TEC	720-EL	PI	1H	.00	.00	M1	.96	84	122	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
40	56	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.26	60	122	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
4	57	TRH	TEH	720-RB	SAI	TEH	2.56	.00	1	1.82	13	119	>> POSITIVE ID ESTABLISHED <<

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

D. C. Cook UIR95

AEP -11/51

INSPECTION: August 95

22-Sep-95 2: 7

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
4	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	57	TEC	TEH	720-EL	DI	SH	.66	.00	M1	.24	13	103	
5	57	TRH	TEH	720-RB	SAI	TEH	2.57	.00	1	.88	11	119	>> POSITIVE ID ESTABLISHED <<
5	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	57	TEC	TEH	720-EL	PI	1H	.00	.00	M1	.72	104	103	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
12	57	TRH	TEH	720-RB	MAI	TEH	2.54	.00	1	.82	5	119	>> POSITIVE ID ESTABLISHED <<
12	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
41	57	TEC	TEH	720-EL	PI	6H	.00	.00	M1	.36	109	105	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
45	57	TEH	TEC	720-EL	24	3C	-.13	.00	M1	2.20	18	120	
2	58	TRH	TEH	720-RB	MAI	TEH	2.09	.00	1	.39	11	119	>> POSITIVE ID ESTABLISHED <<
2	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	58	TRH	TEH	720-RB	MAI	TEH	2.49	.00	1	2.44	18	119	>> POSITIVE ID ESTABLISHED <<
4	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	58	TRH	TEH	720-RB	MAI	TEH	2.56	.00	1	.65	12	119	>> POSITIVE ID ESTABLISHED <<
6	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	58	TRH	TEH	720-RB	MAI	TEH	1.78	.00	1	3.51	4	119	>> POSITIVE ID ESTABLISHED <<
12	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	58	TRH	TEH	720-RB	MAI	TEH	2.66	.00	1	1.69	14	119	>> POSITIVE ID ESTABLISHED <<
14	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	58	TRH	TEH	720-RB	MAI	TEH	2.73	.00	1	.62	20	123	>> POSITIVE ID ESTABLISHED <<
25	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	58	TRH	TEH	720-RB	SAI	TEH	2.66	.00	1	.92	186	125	>> POSITIVE ID ESTABLISHED <<
25	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
43	58	TEH	TEC	720-EL	39	2C	-.07	.00	M1	1.97	106	118	
43	58	TEH	TEC	720-EL	3	1C	-.10	.00	M1	.55	135	118	
44	58	TEH	TEC	720-EL	49	1C	-.10	.00	M1	6.73	96	118	RESULT OF DISCREPANCY RESOLUTION
44	58												RETEST - RETEST FOR POSITIVE ID
45	58	TEH	TEC	720-EL	INR	1H	.10	.00	M1			118	RESULT OF DISCREPANCY RESOLUTION
5	59	TEC	TEH	720-EL	PI	1H	.00	.00	M1	.69	67	103	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
9	59	TRH	TEH	720-RB	MAI	TEH	2.65	.00	1	1.88	12	119	>> POSITIVE ID ESTABLISHED <<
9	59												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

SG - 11 LISTING OF ALL INDICATIONS

D. C. Cook UIR95

AEP -11/51

INSPECTION: August 95

22-Sep-95 2: 7

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DES	TAPE	COMMENTS
13	59	TRH	TEH	720-RB	MAI	TEH	2.58	.00	1	1.03	5	19	>> POSITIVE ID ESTABLISHED <<
13	59												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	59	TEH	TEC	720-EL	4	4C	31.32	.00	1	.44	15	32	
29	59	TRH	TEH	720-RB	MAI	TEH	2.58	.00	1	4.94	11	21	>> POSITIVE ID ESTABLISHED <<
29	59												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
37	59	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.47	5	16	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
44	59	TEH	TEC	720-EL	24	2C	-.10	.00	M1	2.17	12	14	
45	59	TEH	TEC	720-EL	50	2C	-.15	.00	M1	5.30	57	14	RESULT OF DISCREPANCY RESOLUTION
45	59												RETEST - RETEST FOR POSITIVE ID
1	60	TRH	TEH	720-RB	MAI	TEH	2.64	.00	1	.66	15	19	>> POSITIVE ID ESTABLISHED <<
1	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	60	TRH	TEH	720-RB	SAI	TEH	2.58	.00	1	1.48	13	19	>> POSITIVE ID ESTABLISHED <<
4	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	60	TRH	TEH	720-RB	MAI	TEH	2.77	.00	1	.59	11	19	>> POSITIVE ID ESTABLISHED <<
13	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	60	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.68	53	34	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
31	60	TEH	TEC	720-EL	INH	1H	.00	.00	M1			118	RESULT OF DISCREPANCY RESOLUTION
42	60	TEH	TEC	720-EL	PI	1H	.00	.00	M1	1.05	74	14	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
43	60	TEH	TEC	720-EL	18	1C	-.02	.00	M1	1.06	125	114	
44	60	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.49	5	114	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
1	61	TSH	TEH	720-WC	CDI	TEH	20.47	.00	C11	1.63	85	87	RESULT OF LAR
1	61												RETEST - RETEST FOR POSITIVE ID
1	61	7H	TEH	720-EL	DIC	TEH	20.11	.00	M1	.38	52	91	RESULT OF DISCREPANCY RESOLUTION
1	61												RETEST - RETEST FOR POSITIVE ID
1	61	TRH	TEH	720-RB	MAI	TEH	1.11	.00	1	1.91	15	31	>> POSITIVE ID ESTABLISHED <<
1	61	TSH	TSH	720-R9	MAI	TSH	-.87	.00	1	.27	145	31	>> POSITIVE ID ESTABLISHED <<
1	61	TSH	TSH	720-ZC	MAI	TSH	-.88	.00	4	.46	95	55	RESULT OF DISCREPANCY RESOLUTION
1	61												>> POSITIVE ID ESTABLISHED <<
2	61	STH	TEC	720-EL	PI	1H	.00	.00	M1	.56	42	58	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
7	61	TRH	TEH	720-RB	MAI	TEH	2.47	.00	1	4.07	17	121	>> POSITIVE ID ESTABLISHED <<
7	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DES	TAPE	COMMENTS

SG - 11 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP 000/51

INSPECTION: August 95

22-Sep-95 2: 7

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
22	61	STH	TEC	720-EL	PI	1H	.00	.00	M1	.71	40	126	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
23	61	TRH	TEH	720-RB	SAI	TEH	2.30	.00	1	1.47	12	121	>> POSITIVE ID ESTABLISHED <<
23	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	61	STH	TEC	720-EL	PI	1H	.00	.00	M1	.83	76	150	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
30	61	TRH	TEH	720-RB	MAI	TEH	2.66	.00	1	2.27	17	121	>> POSITIVE ID ESTABLISHED <<
30	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	61	TRH	TEH	720-RB	MAI	TEH	2.52	.00	1	2.49	17	121	>> POSITIVE ID ESTABLISHED <<
33	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	62	TRH	TEH	720-RB	MAI	TEH	2.42	.00	1	4.02	28	121	>> POSITIVE ID ESTABLISHED <<
1	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	62	TRH	TEH	720-RB	MAI	TEH	2.44	.00	1	3.98	11	121	>> POSITIVE ID ESTABLISHED <<
5	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	62	TRH	TEH	720-RB	MAI	TEH	2.45	.00	1	1.19	17	121	>> POSITIVE ID ESTABLISHED <<
25	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
43	62	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.66	114	114	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
4	63	TEH	TEC	720-EL	PI	1H	.00	.00	M1	1.47	54	126	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
4	63	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.77	79	126	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
10	63	TRH	TEH	720-RB	SAI	TEH	2.51	.00	1	2.08	15	121	>> POSITIVE ID ESTABLISHED <<
10	63												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	63	TRH	TEH	720-RB	SAI	TEH	2.45	.00	1	2.14	14	121	>> POSITIVE ID ESTABLISHED <<
13	63												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	63	STH	TEC	720-EL	30	AV2	.00	.00	M2	1.12		108	RESULT OF DISCREPANCY RESOLUTION
23	63	STH	TEC	720-EL	27	AV3	.00	.00	M2	.95		108	RESULT OF DISCREPANCY RESOLUTION
26	63	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.55	89	114	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
29	63	TRH	TEH	720-RB	MAI	TEH	2.42	.00	1	1.24	16	121	>> POSITIVE ID ESTABLISHED <<
29	63												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
36	63	TEH	TEC	720-EL	30	AV3	.00	.00	M2	1.13		116	
36	63	TEH	TEC	720-EL	25	AV4	.00	.00	M2	.79		116	
38	63	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.71	98	116	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
39	63	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.54	66	116	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

SG - 1 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP ... 5

INSPECTION: August 95

22-Sep-95 2: 7

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
2	64	7H	TEH	720-EL	PI	1H	.00	.00	M1	.57	23	91	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
5	64	TRH	TEH	720-RB	SAI	TEH	2.47	.00	1	3.99	11	121	>> POSITIVE ID ESTABLISHED <<
5	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	64	TRH	TEH	720-RB	MAI	TEH	2.43	.00	1	.82	12	121	>> POSITIVE ID ESTABLISHED <<
13	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	64	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.94	77	114	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
15	64	TRH	TEH	720-RB	MAI	TEH	2.51	.00	1	1.29	15	121	>> POSITIVE ID ESTABLISHED <<
15	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	64	TRH	TEH	720-RB	MAI	TEH	2.57	.00	1	2.73	19	121	>> POSITIVE ID ESTABLISHED <<
16	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	64	TRH	TEH	720-RB	MAI	TEH	2.40	.00	1	1.92	14	121	>> POSITIVE ID ESTABLISHED <<
17	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
43	64	TEH	TEC	720-EL	29	1C	.00	.00	M1	.78	114	80	RESULT OF DISCREPANCY RESOLUTION
2	65	7H	TEH	720-EL	PI	1H	.00	.00	M1	.97	107	89	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
3	65	TRH	TEH	720-RB	SAI	TEH	2.63	.00	1	2.30	14	121	>> POSITIVE ID ESTABLISHED <<
3	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	65	TRH	TEH	720-RB	MAI	TEH	2.76	.00	1	3.31	19	121	>> POSITIVE ID ESTABLISHED <<
13	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	65	TRH	TEH	720-RB	MAI	TEH	2.58	.00	1	1.09	13	121	>> POSITIVE ID ESTABLISHED <<
16	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	65	TRH	TEH	720-RB	MAI	TEH	2.24	.00	1	2.07	9	121	>> POSITIVE ID ESTABLISHED <<
23	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	65	TRH	TEH	720-RB	MAI	TEH	2.42	.00	1	2.63	11	121	>> POSITIVE ID ESTABLISHED <<
25	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	65	TSC	TEH	720-EL	PI	1H	.00	.00	M1	1.00	76	89	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
32	65	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.64	54	112	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
43	65	TEH	TEC	720-EL	24	1C	.00	.00	M1	1.31	117	82	RESULT OF DISCREPANCY RESOLUTION
1	66	7H	TEH	720-EL	PI	3H	.00	.00	M1	.71	131	89	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
1	66	7H	TEH	720-EL	DIN	TSH	-.63	.00	M1	.64	50	111	
1	66	7H	TEH	720-EL	PI	3H	-.24	.00	M1	.65	131	111	RESULT OF DISCREPANCY RESOLUTION
1	66	TRH	TEH	720-RB	SAI	TEH	2.30	.00	1	4.46	13	121	>> POSITIVE ID ESTABLISHED <<
1	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

53 - 11 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -11/51

INSPECTION: August 95

22-Sep-95 2: 7

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
3	66	TRH	TEH	720-RB MAI	TEH		2.54	.00	1	1.37	27	121	>> POSITIVE ID ESTABLISHED <<
3	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	66	TRH	TEH	720-RB MAI	TEH		2.38	.00	1	1.84	26	121	>> POSITIVE ID ESTABLISHED <<
4	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	66	STH	TEC	720-EL	PI	2H	.00	.00	M1	.42	34	108	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
20	66	TRH	TEH	720-RB SAI	TEH		2.55	.00	1	2.91	9	121	>> POSITIVE ID ESTABLISHED <<
20	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	66	TRH	TEH	720-RB SAI	TEH		2.55	.00	1	1.45	17	121	>> POSITIVE ID ESTABLISHED <<
24	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	66	TEH	TEC	720-EL	PI	1H	.00	.00	M1	1.15	52	110	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
26	66	STH	TEC	720-EL	PI	1H	.00	.00	M1	1.16	95	108	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
27	66	STH	TEC	720-EL	PI	1H	.00	.00	M1	.99	60	108	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
41	66	TEH	TEC	720-EL	9	2C	-.05	.00	M1	1.15	129	80	
41	66	TEH	TEC	720-EL	9	1C	.00	.00	M1	.75	129	80	
1	67	TRH	TEH	720-RB SAI	TEH		2.50	.00	1	1.56	16	121	>> POSITIVE ID ESTABLISHED <<
1	67												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	67	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.51	117	112	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
13	67	TEH	TEC	720-EL	INR	TSH	.35	.00	M1			110	RESULT OF DISCREPANCY RESOLUTION
22	67	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.49	108	108	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
24	67	TRH	TEH	720-RB MAI	TEH		2.52	.00	1	2.38	12	121	>> POSITIVE ID ESTABLISHED <<
24	67												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	67	TRH	TEH	720-RB MAI	TEH		2.49	.00	1	2.36	11	121	>> POSITIVE ID ESTABLISHED <<
24	67												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	67	TRH	TEH	720-RB SAI	TEH		2.44	.00	1	.95	18	121	>> POSITIVE ID ESTABLISHED <<
25	67												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	67	TEH	TEC	720-EL	DIN	TEH	21.02	.00	M1	.55	121	108	RESULT OF DISCREPANCY RESOLUTION
33	67	TEC	TEH	720-EL	PI	1H	.00	.00	M1	.40	90	111	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
33	67	TEC	TEH	720-EL	PI	3H	.00	.00	M1	.60	87	111	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
42	67	TEH	TEC	720-EL	41	1C	.00	.00	M1	1.90	103	82	RESULT OF DISCREPANCY RESOLUTION
42	67												RETEST - RETEST FOR POSITIVE ID
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



D. C. Cook UIR95

AEP -11/51

INSPECTION: August 95

22-Sep-95 2: 7

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
1	68	7H	TEH	720-EL	PI	1-	.00	.00	M1	.47	110	111	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
1	68	TRH	TEH	720-RB	SAI	TE-	2.30	.00	1	1.47	20	121	>> POSITIVE ID ESTABLISHED <<
1	68												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	68	1H	TEC	720-EL	PI	1-	.00	.00	M1	.44	42	158	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
6	68	TEC	TEH	720-EL	INR	TE-	2.33	.00	5			105	RESULT OF DISCREPANCY RESOLUTION
18	68	TRH	TEH	720-RB	SAI	TE-	2.39	.00	1	3.85	13	121	>> POSITIVE ID ESTABLISHED <<
18	68												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	68	TEH	TEC	720-EL	PI	1-	.00	.00	M1	1.02	89	100	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
30	68	TEH	TEC	720-EL	PI	1-	.00	.00	M1	.44	57	106	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
33	68	STH	TEC	720-EL	PI	1-	.00	.00	M1	.59	68	106	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
36	68	TEH	TEC	720-EL	PI	2-	.00	.00	M1	1.01	90	80	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
1	69	TRH	TEH	720-RB	MAI	TEH	2.32	.00	1	3.49	17	121	>> POSITIVE ID ESTABLISHED <<
1	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	69	TRH	TEH	720-RB	MAI	TEH	2.49	.00	1	.80	28	121	>> POSITIVE ID ESTABLISHED <<
5	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	69	TRH	TEH	720-RB	MAI	TEH	2.46	.00	1	3.90	9	121	>> POSITIVE ID ESTABLISHED <<
16	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	69	TRH	TEH	720-RB	MAI	TEH	2.51	.00	1	3.06	11	121	>> POSITIVE ID ESTABLISHED <<
24	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	70	TSH	TEH	720-WC	CDI	TEH	20.58	.00	C19	1.01	86	61	RESULT OF DISCREPANCY RESOLUTION
2	70												RETEST - RETEST FOR POSITIVE ID
2	70	TSH	TSH	720-ZC	SAI	TSH	-1.04	.00	4	.15	68	155	RESULT OF DISCREPANCY RESOLUTION
2	70												>> POSITIVE ID ESTABLISHED <<
6	70	TRH	TEH	720-RB	MAI	TEH	2.38	.00	1	1.78	13	121	>> POSITIVE ID ESTABLISHED <<
6	70												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	70	TRH	TEH	720-RB	MAI	TEH	2.47	.00	1	2.39	17	121	>> POSITIVE ID ESTABLISHED <<
7	70												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	70	TSH	TEH	720-WC	CDI	TEH	20.74	.00	C4	.71	78	61	RESULT OF DISCREPANCY RESOLUTION
8	70												RETEST - RETEST FOR POSITIVE ID
8	70	TSH	TSH	720-ZC	SAI	TSH	-.99	.00	4	.12	38	155	RESULT OF DISCREPANCY RESOLUTION
8	70												>> POSITIVE ID ESTABLISHED <<
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
24	70	TRH	TEH	720-RB	MAI	TEH	2.60	.00	1	1.47	27	121	>> POSITIVE ID ESTABLISHED <<
24	70												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	71	7H	TEH	720-EL	PI	1H	.00	.00	M1	.43	04	89	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
5	71	STH	TEC	720-EL	PI	1H	.00	.00	M1	.58	55	102	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
8	71	STH	TEC	720-EL	PI	1H	.00	.00	M1	.44	39	102	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
10	71	STH	TEC	720-EL	PI	1H	.00	.00	M1	.48	55	100	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
15	71	TRH	TEH	720-RB	MAI	TEH	2.55	.00	1	1.53	19	121	>> POSITIVE ID ESTABLISHED <<
15	71												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	71	TRH	TEH	720-RB	MAI	TEH	2.43	.00	1	7.48	16	121	>> POSITIVE ID ESTABLISHED <<
20	71												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	71	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.39	71	100	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
27	71	STH	TEC	720-EL	PI	1H	.00	.00	M1	.54	94	100	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
31	71	TRH	TEH	720-RB	SAI	TEH	2.37	.00	1	4.77	13	121	>> POSITIVE ID ESTABLISHED <<
31	71												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
37	71	TEH	TEC	720-EL	8	6H	40.19	.00	1	.59	155	82	
1	72	7H	TEH	720-EL	DIN	TEH	20.50	.00	M1	1.45	48	89	RESULT OF DISCREPANCY RESOLUTION
1	72	7H	TEH	720-EL	PI	1H	.00	.00	M1	.86	107	89	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
1	72	7H	TEH	720-EL	PI	2H	.00	.00	M1	1.14	06	89	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
1	72	7H	TEH	720-EL	PI	3H	.00	.00	M1	.39	66	89	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
1	72	7H	TEH	720-EL	DIN	TSH	-.76	.00	M1	1.26	38	111	RESULT OF DISCREPANCY RESOLUTION
1	72	7H	TEH	720-EL	PI	1H	-.05	.00	M1	.81	108	111	
1	72	7H	TEH	720-EL	PI	2H	.00	.00	M1	1.23	111	111	RESULT OF LAR
1	72	7H	TEH	720-EL	PI	3H	.05	.00	M1	.48	73	111	
1	72	TRH	TEH	720-RB	MAI	TEH	2.55	.00	1	2.09	21	121	>> POSITIVE ID ESTABLISHED <<
1	72												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	72	TEH	TEC	720-EL	DIN	TEH	21.15	.00	M1	1.31	64	86	RESULT OF DISCREPANCY RESOLUTION
15	72	TRH	TEH	720-RB	SAI	TEH	2.45	.00	1	3.67	9	121	>> POSITIVE ID ESTABLISHED <<
15	72												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	72	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.61	67	86	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
19	72	TRH	TEH	720-RB	MAI	TEH	2.50	.00	1	5.20	20	121	>> POSITIVE ID ESTABLISHED <<
19	72												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	72	STH	TEC	720-EL	PI	1H	.00	.00	M1	.20	72	86	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

SG - 11 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -11/51

INSPECTION: August 95

22-Sep-95 2: 7

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
37	72	TEH	TEC	720-EL	26	1C	.00	.00	M1	.80	115	76	RESULT OF DISCREPANCY RESOLUTION
11	73	STH	TEC	720-EL	PI	1H	.00	.00	M1	.57	44	84	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
28	73	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.50	64	84	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
1	74	7H	TEH	720-EL	PI	1H	.00	.00	M1	.96	115	89	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
1	74	7H	TEH	720-EL	PI	1H	.02	.00	M1	.78	11	111	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
1	74	TRH	TEH	720-RB	MAI	TEH	2.32	.00	1	3.08	2	121	>> POSITIVE ID ESTABLISHED <<
1	74												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	74	TEH	TEC	720-EL	INR	TEH	2.60	.00	M1	8.57	22	86	RESULT OF DISCREPANCY RESOLUTION
9	74	TEH	TEC	720-EL	INR	TEH	2.63	.00	M1	10.19	165	86	RESULT OF DISCREPANCY RESOLUTION
10	74	TRH	TEH	720-RB	MAI	TEH	2.51	.00	1	1.72	2	121	>> POSITIVE ID ESTABLISHED <<
10	74												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	74	STH	TEC	720-EL	PI	1H	.00	.00	M1	.64	65	80	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
14	74	STH	TEC	720-EL	PI	1H	.00	.00	M1	1.00	54	80	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
16	74	TRH	TEH	720-RB	MAI	TEH	2.31	.00	1	2.05	25	121	>> POSITIVE ID ESTABLISHED <<
16	74												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	74	TEH	TEC	720-EL	INR	TEH	2.34	.00	M1	2.90	115	80	RESULT OF DISCREPANCY RESOLUTION
24	74	STH	TEC	720-EL	PI	1H	.00	.00	M1	1.39	51	80	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
35	74	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.85	5	76	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
37	74	TEH	TEC	720-EL	8	1C	.01	.00	M1	.82	130	76	
5	75	TRH	TEH	720-RB	MAI	TEH	2.34	.00	1	1.23	21	121	>> POSITIVE ID ESTABLISHED <<
5	75												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	75	TRH	TEH	720-RB	MAI	TEH	1.23	.00	1	1.20	16	131	>> POSITIVE ID ESTABLISHED <<
6	75												-DO NOT REPAIR - 1.31" F* DISTANCE ACHIEVED
6	75												1994 REROLL SUCCESSFUL
10	75	TRH	TEH	720-RB	SAI	TEH	2.37	.00	1	.58	13	121	>> POSITIVE ID ESTABLISHED <<
10	75												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	75	STH	TEC	720-EL	PI	1H	.00	.00	M1	.49	67	82	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
37	75	TEH	TEC	720-EL	43	2C	.00	.00	M1	3.04	101	78	RESULT OF DISCREPANCY RESOLUTION
37	75												RETEST - RETEST FOR POSITIVE ID
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



D. C. Cook UIR95

AEP -11/5*

INSPECTION: August 95

22-Sep-95 2: 7

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
14	76	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.62	112	84	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
26	76	STH	TEC	720-EL	PI	1H	.00	.00	M1	.38	52	84	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
32	76	TSC	TEH	720-EL	PCN	1H	.00	.00	M1	1.62	71	89	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
32	76	1H	1H	720-ZC	SAI	1H	.00	.00	4	.67	88	155	RESULT OF DISCREPANCY RESOLUTION
36	76	TEH	TEC	720-EL	29	1C	.25	.00	M1	1.65	114	84	
7	77	TRH	TEH	720-RB	MAI	TEH	2.37	.00	1	2.54	23	121	>> POSITIVE ID ESTABLISHED <<
7	77												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	77	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.61	75	86	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
14	77	STH	TEC	720-EL	PI	2H	.00	.00	M1	.60	63	86	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
19	77	STH	TEC	720-EL	PI	1H	.00	.00	M1	.61	77	86	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
30	77	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.68	97	86	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
34	77	TEH	TEC	720-EL	25	1C	.00	.00	M1	.80	117	86	
1	78	TRH	TEH	720-RB	MAI	TEH	2.46	.00	1	1.62	16	121	>> POSITIVE ID ESTABLISHED <<
1	78												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	78	TRH	TEH	720-RB	SAI	TEH	2.37	.00	1	2.08	15	121	>> POSITIVE ID ESTABLISHED <<
4	78												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	78	TRH	TEH	720-RB	MAI	TEH	2.52	.00	1	3.82	18	121	>> POSITIVE ID ESTABLISHED <<
13	78												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	78	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.44	46	88	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
32	78	TEH	TEC	720-EL	16	2C	-.08	.00	M1	1.47	124	88	
32	78	TEH	TEC	720-EL	28	1C	.08	.00	M1	1.50	115	88	
2	79	TRH	TEH	720-RB	MAI	TEH	2.07	.00	1	1.60	19	121	>> POSITIVE ID ESTABLISHED <<
2	79												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	79	TEH	TEC	720-EL	37	2C	-.22	.00	M1	2.55	109	90	
31	79	TEH	TEC	720-EL	3	1C	-.10	.00	M1	1.05	135	90	
32	79	TEH	TEC	720-EL	PI	4H	.00	.00	M1	.65	58	90	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
32	79	TEH	TEC	720-EL	55	1C	.00	.00	M1	2.21	92	90	RESULT OF DISCREPANCY RESOLUTION
32	79												RETEST - RETEST FOR POSITIVE ID
14	80	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.34	54	88	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
14	80	TRH	TEH	720-RB	MAI	TEH	2.45	.00	1	2.83	21	121	>> POSITIVE ID ESTABLISHED <<
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



SG - 11 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP 11/51

INSPECTION: August 95

22-Sep-95 2: 7

ROW	COL	CEB	CEE	PROBE	IND	LCC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
14	80												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	80	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.46	81	88	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
21	80	TRH	TEH	720-RB	MAI	TEH	2.35	.00	1	2.29	11	121	>> POSITIVE ID ESTABLISHED <<
21	80												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	80	STH	TEC	720-EL	PI	1H	.00	.00	M1	.79	44	88	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
30	80	TEH	TEC	720-EL	37	2C	.10	.00	M1	2.06	107	88	
14	81	TRH	TEH	720-RB	SAI	TEH	2.44	.00	1	.74	29	131	>> POSITIVE ID ESTABLISHED <<
14	81												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	81	TEH	TEC	720-EL	35	1C	.23	.00	M1	3.20	111	90	
2	82	TRH	TEH	720-RB	MAI	TEH	2.29	.00	1	1.02	26	121	>> POSITIVE ID ESTABLISHED <<
2	82												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	82	TRH	TEH	720-RB	MAI	TEH	2.56	.00	1	1.92	13	121	>> POSITIVE ID ESTABLISHED <<
9	82												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	82	STH	TEC	720-EL	PI	1H	.00	.00	M1	.65	74	94	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
14	82	TRH	TEH	720-RB	SAI	TEH	2.55	.00	1	3.62	14	121	>> POSITIVE ID ESTABLISHED <<
14	82												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	82	STH	TEC	720-EL	12	4C	26.20	.00	3	.92	105	94	
23	82	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.84	87	94	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
27	82	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.48	66	88	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
28	82	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.48	83	88	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
31	82	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.82	26	90	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
11	83	TRH	TEH	720-RB	MAI	TEH	2.03	.00	1	1.60	10	121	>> POSITIVE ID ESTABLISHED <<
11	83												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	83	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.69	140	92	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
26	83	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.29	54	90	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
27	83	TEH	TEC	720-EL	25	2C	.00	.00	M1	.66	119	90	
28	83	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.93	86	90	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
ROW	COL	CEB	CEE	PROBE	IND	LCC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

SG - 11 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -11/51

INSPECTION: August 95

22-Sep-95 2: 7

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
1	84	TRH	TEH	720-RB	MAI	TEH	2.55	.00	4	1.68	6	125	>> POSITIVE ID ESTABLISHED <<
1	84												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	84	7H	TEH	720-EL	PI	1H	.00	.00	M1	.39	37	95	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
3	84	7H	TEH	720-EL	PI	1H	.00	.00	M1	.44	38	113	
10	84	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.39	63	98	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
17	84	TRH	TEH	720-RB	MAI	TEH	1.47	.00	1	3.96	18	121	>> POSITIVE ID ESTABLISHED <<
17	84												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	84	TEH	TEC	720-EL	25	1C	.00	.00	M1	1.67	117	88	
27	84	TEH	TEC	720-EL	45	2C	.00	.00	M1	3.85	100	88	RESULT OF DISCREPANCY RESOLUTION
27	84												RETEST - RETEST FOR POSITIVE ID
29	84	TEH	TEC	720-EL	2	2C	.08	.00	M1	.80	134	88	RESULT OF DISCREPANCY RESOLUTION
10	85	STH	TEC	720-EL	PI	2H	.00	.00	M1	.56	38	94	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
26	85	TEH	TEC	720-EL	23	2C	.00	.00	M1	2.20	121	90	
26	85	TEH	TEC	720-EL	41	1C	.03	.00	M1	4.52	106	90	RESULT OF DISCREPANCY RESOLUTION
26	85												RETEST - RETEST FOR POSITIVE ID
3	86	7H	TEH	720-EL	INR	1H	.00	.00	M1			95	RESULT OF LAR
3	86	7H	TEH	720-EL	INR	1H	-.05	.00	M1			113	RESULT OF DISCREPANCY RESOLUTION
19	86	STH	TEC	720-EL	PI	1H	.00	.00	M1	.40	122	92	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
24	86	TEH	TEC	720-EL	28	1C	.10	.00	M1	2.91	115	92	
25	86	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.72	58	90	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
1	87	7H	TEH	720-EL	PI	1H	.00	.00	M1	.74	105	91	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
4	87	STH	TEC	720-EL	PI	1H	.00	.00	M1	.92	68	96	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
14	87	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.54	71	94	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
23	87	TEH	TEC	720-EL	16	1C	.05	.00	M1	1.20	126	94	
24	87	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.40	54	94	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
9	88	STH	TEC	720-EL	PI	1H	.00	.00	M1	.87	80	98	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
22	88	TEH	TEC	720-EL	30	1C	.15	.00	M1	.97	113	92	
2	89	7C	TEH	720-EL	PI	1H	.00	.00	M1	.70	82	89	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

D. C. Cook U1R95

AEP -11/51

INSPECTION: August 95

22-Sep-95 2: 7

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
2	89	7C	TEH	720-EL	PI	2H	.00	.00	M1	.77	93	89	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
2	89	7H	TEH	720-EL	PI	1H	.00	.00	M1	.70	91	91	
2	89	7H	TEH	720-EL	PI	2H	-.20	.00	M1	.81	95	91	
3	89	7H	TEH	720-EL	PI	3H	.00	.00	M1	.47	31	95	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
3	89	7H	TEH	720-EL	PI	3H	.05	.00	M1	.41	23	113	
7	89	STH	TEC	720-EL	PI	1H	.00	.00	M1	.84	83	96	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
15	89	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.38	68	94	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
20	89	TEH	TEC	720-EL	2	TSH	.77	.00	M1	1.42	136	94	RESULT OF DISCREPANCY RESOLUTION
20	89	TEH	TEC	720-EL	30	1C	.15	.00	M1	4.33	115	94	
21	89	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.63	45	94	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
10	90	STH	TEC	720-EL	PI	1H	.00	.00	M1	.71	78	98	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
10	91	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.39	129	94	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
10	91	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.49	70	94	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
12	91	TEH	TEC	720-EL	PI	1H	.00	.00	M1	1.02	110	98	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
12	91	TEH	TEC	720-EL	PI	3H	.00	.00	M1	1.00	114	98	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
12	91	TEH	TEC	720-EL	PI	4H	.00	.00	M1	.43	115	98	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
15	91	TEH	TEC	720-EL	16	1C	-.02	.00	M1	1.17	125	98	RESULT OF DISCREPANCY RESOLUTION
14	92	1C	TEH	720-EL	PI	2H	.00	.00	M1	.47	54	95	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
9	93	TEH	TEC	720-EL	17	1C	.05	.00	M1	.71	125	98	RESULT OF DISCREPANCY RESOLUTION
10	93	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.56	102	98	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
11	93	TEC	TEH	720-EL	25	1C	.21	.00	M1	2.18	117	93	
2	94	7H	TEH	720-EL	PI	2H	.00	.00	M1	.36	111	89	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
4	94	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.38	80	98	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
4	94	TEH	TEC	720-EL	INR	5H	.00	.00	M1			98	RESULT OF DISCREPANCY RESOLUTION
7	94	TEH	TEC	720-EL	19	1C	-.05	.00	M1	.45	124	98	
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS







Attachment 2 TO AEP:NRC:1147F

ATTACHMENT 2
STEAM GENERATOR ANNUAL OPERATING REPORT

SECTION 1: Unit 1 Inspection Results

b. SG #12 Imperfections



SG - 12 INDICATION DISTRIBUTION

MOST SEVERE INDICATION PER TUBE

D. C. Cook U1R95

AEP-12 SERIES 51

09-22-1995

03:24 HRS.

SUPERTUBIN

X : 1 AXIAL INDICATION
 ∇ : 11 CECCO DI
 / : 119 CECCO DRI
 P : 1 PI CONFIRMED WITH RPC
 R : 13 DISTORTED ROLL INDICATION


3 : 18 INDICATION 30 TO 39%
 2 : 11 INDICATION 20 TO 29%
 1 : 45 INDICATION 01 TO 39%

D : 2 DISTORTED INDICATION
 P : 101 POSSIBLE INDICATION

6 : 1 INDICATION 60 TO 69%
 5 : 2 INDICATION 50 TO 59%
 4 : 9 INDICATION 40 TO 49%

N : 5 PI/DI NON-CONFIRMED WITH RPC

□ : 280 PLUGGED TUBE

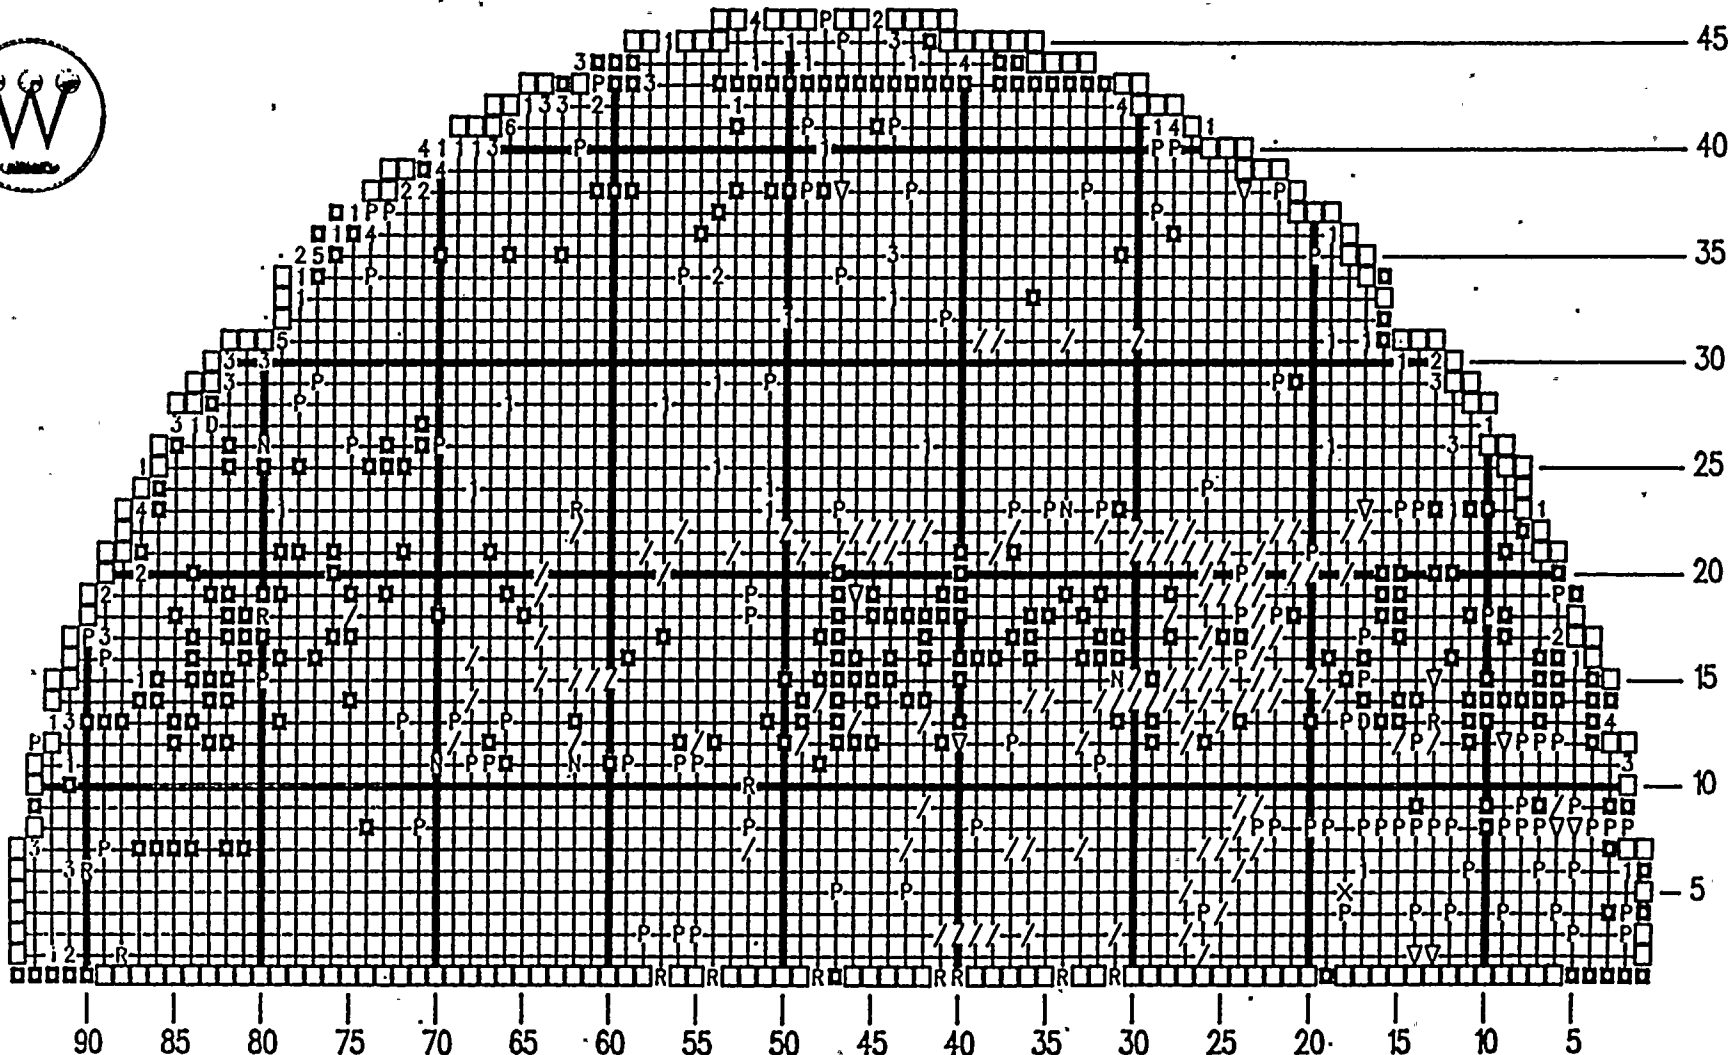

SG - 12 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -12/51

INSPECTION: August 95

22-Sep-95 2:12

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
3	2	7H	TEH	720-EL	PI	1H	.00	.00	M1	.63	87	89	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
4	2	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.65	149	62	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
6	2	TEH	TEC	720-EL	15	1C	.05	.00	M1	.58	123	62	
8	2	TSC	TEH	720-EL	DIH	TEH	20.95	.00	M1	.88	108	83	RESULT OF DISCREPANCY RESOLUTION
8	2	TSC	TEH	720-EL	PI	3H	.00	.00	M1	.98	71	83	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
8	2	TSC	TEH	720-EL	PI	4H	.00	.00	M1	1.18	103	83	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
11	2	TEH	TEC	720-EL	31	1C	.00	.00	M1	1.47	111	46	
8	3	TEH	TEC	720-EL	PI	2H	.00	.00	M1	1.35	79	62	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
13	3	TEH	TEC	720-EL	45	1C	.00	.00	M1	3.18	101	48	RESULT OF DISCREPANCY RESOLUTION
13	3	RETEST - RETEST FOR POSITIVE ID											
8	4	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.97	74	64	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
3	5	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.70	64	62	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
3	5	TEH	TEC	720-EL	PI	4H	.00	.00	M1	.59	102	62	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
6	5	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.64	54	62	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
8	5	TSC	TEH	720-EL	DI	TSH	-.45	.00	M1	2.36	98	83	
8	5	TSC	TEH	720-EL	PCN	1H	.00	.00	M1	1.77	100	83	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
8	5	TSH	TEH	720-WC	CDI	TSH	-.37	.00	C11	2.27	104	93	RESULT OF DISCREPANCY RESOLUTION
8	5	RETEST - RETEST FOR POSITIVE ID											
8	5	TSH	TSH	720-ZC	MAI	TSH	-.40	.00	4	.58	51	125	RESULT OF DISCREPANCY RESOLUTION
8	5	<< POSITIVE ID ESTABLISHED >>											
8	5	1H	1H	720-ZC	MAI	1H	.00	.00	4	1.00	56	125	
9	5	TEH	TEC	720-EL	PI	2H	.00	.00	M1	1.06	137	62	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
16	5	TEH	TEC	720-EL	17	2C	.02	.00	M1	.83	121	46	RESULT OF DISCREPANCY RESOLUTION
4	6	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.73	81	64	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
4	6	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.43	41	64	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
8	6	TSC	TEH	720-EL	DI	TEH	20.89	.00	M1	.83	100	83	RESULT OF DISCREPANCY RESOLUTION
8	6	TSC	TEH	720-EL	PI	1H	.00	.00	M1	1.42	91	83	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
8	6	TSC	TEH	720-EL	PI	3H	.00	.00	M1	1.22	87	83	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
8	6	TSH	TEH	720-WC	CDI	TSH	-.04	.00	C2	1.74	100	93	RESULT OF DISCREPANCY RESOLUTION
8	6	RETEST - RETEST FOR POSITIVE ID											
8	6	TSH	TSH	720-ZC	SAI	TSH	-.56	.00	1	.56	46	125	RESULT OF DISCREPANCY RESOLUTION
8	6	<< POSITIVE ID ESTABLISHED >>											
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
9	6	TSC	TEH	720-EL	PI	1H	.00	.00	M1	1.02	116	83	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
9	6	TAH	TEH	720-RB	COI	TEH	2.47	.00	1	3.74	10	103	<< POSITIVE ID ESTABLISHED >>
9	6												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	6	TSC	TEH	720-EL	PI	1H	.00	.00	M1	1.37	71	83	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
17	6	TEH	TEC	720-EL	21	1C	.00	.00	M1	1.71	119	48	
19	6	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.56	84	48	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
6	7	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.40	116	62	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
8	7	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.63	99	62	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
12	7	TEH	TEC	720-EL	PI	1H	.00	.00	M1	1.21	109	46	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
12	7	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.80	116	46	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
23	7	TEH	TEC	720-EL	19	1C	.00	.00	M1	.97	120	46	RESULT OF DISCREPANCY RESOLUTION
8	8	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.52	93	64	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
9	8	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.22	112	64	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
9	8	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.37	90	64	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
9	8	TEH	TEC	720-EL	PI	4H	.00	.00	M1	.38	61	64	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
12	8	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.65	59	48	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
4	9	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.81	67	62	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
8	9	TSC	TEH	720-EL	DIN	TSH	-.56	.00	M1	.51	108	83	
8	9	TSC	TEH	720-EL	PI	1H	.00	.00	M1	1.49	94	83	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
8	9	TSC	TEH	720-EL	PI	3H	.00	.00	M1	1.00	96	83	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
12	9	TSH	TEH	720-WC	COI	TSH	-.72	.00	C21	2.66	46	11	RESULT OF DISCREPANCY RESOLUTION
12	9												RETEST - RETEST FOR POSITIVE ID
12	9	TEH	TEC	720-EL	DI	TEH	20.44	.00	M1	1.23	40	46	RESULT OF DISCREPANCY RESOLUTION
12	9	TEH	TEC	720-EL	PI	1H	.00	.00	M1	1.33	76	46	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
12	9	TEH	TEC	720-EL	PI	4H	.00	.00	M1	.58	67	46	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
12	9	TSH	TSH	720-ZC	SAI	TSH	-.85	.00	4	1.22	21	125	<< POSITIVE ID ESTABLISHED >>
18	10	TSC	TEH	720-EL	DIN	TEH	20.36	.00	M1	3.82	99	83	RESULT OF DISCREPANCY RESOLUTION
18	10	TSC	TEH	720-EL	PI	1H	.00	.00	M1	.95	107	83	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
18	10	TSC	TEH	720-EL	PI	2H	.00	.00	M1	1.11	116	83	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
27	10	TEH	TEC	720-EL	11	1C	.00	.00	M1	.87	126	48	
6	11	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.69	49	62	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



SG - 12 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -12/51

INSPECTION: August 95

22-Sep-95 2:12

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
4	12	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.77	97	64	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
8	12	STH	TEC	720-EL	PI	1H	.00	.00	M1	1.03	95	64	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
8	12	STH	TEC	720-EL	PI	2H	.00	.00	M1	.52	69	64	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
22	12	TEH	TEC	720-EL	INR	TEH	20.99	.00	M1			48	RESULT OF DISCREPANCY RESOLUTION
23	12	TEH	TEC	720-EL	10	AV3	.00	.00	M2	.23		48	RESULT OF DISCREPANCY RESOLUTION
26	12	TEH	TEC	720-EL	35	1C	.00	.00	M1	2.07	109	48	
2	13	TSH	TEH	720-WC	CDI	TSH	-.95	.00	C2	1.12	77	13	RESULT OF DISCREPANCY RESOLUTION
2	13												RETEST - RETEST FOR POSITIVE ID
2	13	7H	TEH	720-EL	DI	TEH	20.80	.00	M1	.46	64	83	RESULT OF DISCREPANCY RESOLUTION
2	13	TSH	TSH	720-ZC	MAI	TSH	-.85	.00	4	.29	52	125	RESULT OF DISCREPANCY RESOLUTION
2	13												<< POSITIVE ID ESTABLISHED >>
8	13	TEH	TEC	720-EL	PI	1H	.00	.00	M1	1.04	101	64	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
12	13	TRH	TEH	720-RB	SAI	TEH	2.53	.00	1	2.87	11	103	<< POSITIVE ID ESTABLISHED >>
12	13												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	13	TSH	TEH	720-WC	CDI	TSH	-.50	.00	C23	2.67	54	13	RESULT OF DISCREPANCY RESOLUTION
15	13												RETEST - RETEST FOR POSITIVE ID
15	13	TEH	TEC	720-EL	DI	TEH	20.71	.00	M1	1.83	43	46	RESULT OF DISCREPANCY RESOLUTION
15	13	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.79	99	46	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
15	13	TSH	TSH	720-ZC	SAI	TSH	-.65	.00	4	.65	33	125	RESULT OF DISCREPANCY RESOLUTION
15	13												<< POSITIVE ID ESTABLISHED >>
29	13	TEH	TEC	720-EL	35	1C	.00	.00	M1	2.23	108	42	
30	13	TEH	TEC	720-EL	21	2C	.10	.00	M1	.45	118	42	RESULT OF DISCREPANCY RESOLUTION
2	14	7H	TEH	720-EL	DI	TEH	21.10	.00	M1	1.99	110	83	RESULT OF DISCREPANCY RESOLUTION
2	14	7H	TEH	720-EL	DI	TEH	20.82	.00	M1	1.22	86	83	RESULT OF DISCREPANCY RESOLUTION
2	14	7H	TEH	720-EL	PCN	1H	.00	.00	M1	1.81	102	83	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
2	14	TSH	TEH	720-WC	CDI	TSH	-.34	.00	C11	3.48	83	93	RESULT OF DISCREPANCY RESOLUTION
2	14												RETEST - RETEST FOR POSITIVE ID
2	14	TSH	TSH	720-ZC	MAI	TSH	-.50	.00	1	.52	113	125	RESULT OF DISCREPANCY RESOLUTION
2	14												<< POSITIVE ID ESTABLISHED >>
2	14	1H	1H	720-ZC	SAI	1H	.00	.00	4	.97	43	125	RESULT OF DISCREPANCY RESOLUTION
4	14	STH	TEC	720-EL	PI	2H	.00	.00	M1	.83	110	62	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
8	14	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.38	103	62	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
12	14	TSC	TEH	720-EL	DIN	TEH	21.21	.00	M1	1.57	57	83	RESULT OF DISCREPANCY RESOLUTION
12	14	TSC	TEH	720-EL	PI	1H	.00	.00	M1	1.49	73	83	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

SG - 12 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -12/51

INSPECTION: August 95

22-Sep-95 2:12

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
23	14	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.82	103	44	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
8	15	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.99	89	12	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
12	15	TRH	TEH	720-RB	MAI	TEH	1.36	.00	1	5.34	20	103	<< POSITIVE ID ESTABLISHED >>
12	15	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST											
23	15	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.95	132	12	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
30	15	TEH	TEC	720-EL	13	2C	.00	.00	M1	.88	124	42	
30	15	TEH	TEC	720-EL	7	1C	.05	.00	M1	.45	128	42	
8	16	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.46	109	10	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
6	17	TEH	TEC	720-EL	19	TSC	.60	.00	M1	.16	124	12	
8	17	TEH	TSC	720-EL	PI	1H	.00	.00	M1	.71	45	8	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
8	17	TEH	TSC	720-EL	PI	2H	.00	.00	M1	.88	101	8	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
13	17	TEH	TEC	720-EL	DI	TEH	3.08	.00	M1	.49	112	4	
15	17	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.68	106	4	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
17	17	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.66	90	4	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
22	17	TRH	TEH	720-RB	MAI	TEH	2.72	.00	1	2.50	18	103	<< POSITIVE ID ESTABLISHED >>
22	17	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST											
23	17	TSC	TEH	720-EL	DI	TEH	20.00	.00	M1	1.46	102	83	RESULT OF DISCREPANCY RESOLUTION
23	17	TSC	TEH	720-EL	PI	1H	.00	.00	M1	1.18	88	83	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
23	17	TSH	TEH	720-WC	CDI	TSH	-.69	.00	C15	2.77	95	93	RESULT OF DISCREPANCY RESOLUTION
23	17	RETEST - RETEST FOR POSITIVE ID											
23	17	TSH	TSH	720-ZC	SAI	TSH	-.79	.00	4	1.14	112	123	RESULT OF DISCREPANCY RESOLUTION
23	17	<< POSITIVE ID ESTABLISHED >>											
31	17	TEH	TEC	720-EL	1	1C	-.10	.00	M1	1.19	132	44	
4	18	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.92	93	6	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
4	18	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.71	48	6	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
4	18	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.93	90	10	
4	18	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.65	51	10	
5	18	TEH	TEC	720-EL	PCN	1H	.00	.00	M1	.15	152	10	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
5	18	1H	1H	720-ZC	SAI	1H	.00	.00	4	.18	79	125	
13	18	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.77	115	2	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



SG - 12 LISTING OF ALL INDICATIONS

D. C. Cook UIR95

AEP -12/51

INSPECTION: August 95

22-Sep-95 2:12

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
20	18	TRH	TEH	720-RB	SAI	TEH	2.44	.00	1	1.05	27	103	<< POSITIVE ID ESTABLISHED >>
20	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	18	TRH	TEH	720-RB	MAI	TEH	2.32	.00	4	2.87	10	103	RESULT OF DISCREPANCY RESOLUTION
22	18												<< POSITIVE ID ESTABLISHED >>
22	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	19	TEH	TEC	720-EL	PI	1H	.00	.00	M1	1.21	108	16	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
8	19	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.81	104	16	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
14	19	TRH	TEH	720-RB	MAI	TEH	2.42	.00	1	.97	13	103	<< POSITIVE ID ESTABLISHED >>
14	19												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	19	TEH	TEC	720-EL	12	AV2	.00	.00	M2	.28		16	
31	19	TEH	TEC	720-EL	11	AV2	.00	.00	M2	.24		44	
36	19	TEH	TEC	720-EL	19	1C	-.37	.00	M1	.94	121	44	RESULT OF DISCREPANCY RESOLUTION
8	20	TEH	TEC	720-EL	PI	2H	.00	.00	M1	1.00	92	14	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
15	20	TRH	TEH	720-RB	SAI	TEH	2.35	.00	1	2.08	18	103	<< POSITIVE ID ESTABLISHED >>
15	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	20	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.59	88	14	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
20	20	TRH	TEH	720-RB	COI	TEH	2.55	.00	1	1.33	10	103	<< POSITIVE ID ESTABLISHED >>
20	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	20	TSC	TEH	720-EL	DIN	TEH	20.69	.00	M1	1.80	56	83	RESULT OF DISCREPANCY RESOLUTION
21	20	TSC	TEH	720-EL	PI	1H	.00	.00	M1	1.45	109	83	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
35	20	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.20	102	42	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
20	21	TRH	TEH	720-RB	MAI	TEH	2.30	.00	1	.96	14	103	<< POSITIVE ID ESTABLISHED >>
20	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	21	TRH	TEH	720-RB	MAI	TEH	2.30	.00	1	1.35	10	103	<< POSITIVE ID ESTABLISHED >>
22	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	22	TEH	TEC	720-EL	PCN	1H	.00	.00	M1	1.59	119	18	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
8	22	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.45	89	18	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
8	22	1H	1H	720-ZC	SAI	1H	.00	.00	4	.73	143	125	RESULT OF DISCREPANCY RESOLUTION
14	22	TRH	TEH	720-RB	COI	TEH	2.38	.00	1	1.96	13	103	<< POSITIVE ID ESTABLISHED >>
14	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	22	TRH	TEH	720-RB	SAI	TEH	2.47	.00	1	5.63	12	103	<< POSITIVE ID ESTABLISHED >>
15	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

SG - 12 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -12/51

INSPECTION: August 95

22-Sep-95 2:12

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
17	22	TRH	TEH	720-RB MAI	TEH		2.19	.00	1	.67	121	103	<< POSITIVE ID ESTABLISHED >>
17	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	22	STH	TEC	720-EL	PI	1H	.00	.00	M1	.86	88	18	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
22	22	TRH	TEH	720-RB MAI	TEH		2.27	.00	1	2.41	15	103	<< POSITIVE ID ESTABLISHED >>
22	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	22	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.25	56	18	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
38	22	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.56	72	42	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
7	23	TRH	TEH	720-RB SAI	TEH		2.50	.00	1	1.86	18	103	<< POSITIVE ID ESTABLISHED >>
7	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	23	TSC	TEH	720-EL	PI	1H	.00	.00	M1	1.43	94	83	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
9	23	TRH	TEH	720-RB SAI	TEH		2.48	.00	1	1.31	26	103	<< POSITIVE ID ESTABLISHED >>
9	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	23	TRH	TEH	720-RB MAI	TEH		2.51	.00	1	2.21	19	103	<< POSITIVE ID ESTABLISHED >>
14	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	23	TRH	TEH	720-RB MAI	TEH		2.37	.00	4	3.52	16	103	RESULT OF DISCREPANCY RESOLUTION
15	23												<< POSITIVE ID ESTABLISHED >>
15	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	23	TRH	TEH	720-RB MAI	TEH		2.26	.00	1	3.13	14	103	<< POSITIVE ID ESTABLISHED >>
16	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	23	TRH	TEH	720-RB MAI	TEH		2.37	.00	1	1.22	24	103	<< POSITIVE ID ESTABLISHED >>
17	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	23	TRH	TEH	720-RB COI	TEH		2.22	.00	1	1.98	15	103	<< POSITIVE ID ESTABLISHED >>
18	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	23	TRH	TEH	720-RB MAI	TEH		2.38	.00	1	4.05	20	103	<< POSITIVE ID ESTABLISHED >>
19	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	23	TRH	TEH	720-RB COI	TEH		2.22	.00	1	.86	20	103	<< POSITIVE ID ESTABLISHED >>
20	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	23	TRH	TEH	720-RB COI	TEH		2.35	.00	1	1.41	14	103	<< POSITIVE ID ESTABLISHED >>
21	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	24	TRH	TEH	720-RB SAI	TEH		2.50	.00	1	1.53	19	103	<< POSITIVE ID ESTABLISHED >>
6	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



SG - 12 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -12/51

INSPECTION: August 95

22-Sep-95 2:12

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
8	24	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.60	76	22	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
8	24	TEH	TEC	720-EL	PI	2H	.00	.00	M1	1.39	86	22	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
8	24	TRH	TEH	720-RB	MAI	TEH	2.44	.00	1	1.27	15	103	<< POSITIVE ID ESTABLISHED >>
8	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	24	TRH	TEH	720-RB	COI	TEH	2.53	.00	1	9.33	5	103	<< POSITIVE ID ESTABLISHED >>
9	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	24	TRH	TEH	720-RB	MAI	TEH	2.33	.00	1	1.56	20	103	<< POSITIVE ID ESTABLISHED >>
14	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	24	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.93	87	22	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
18	24	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.66	63	22	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
19	24	TRH	TEH	720-RB	COI	TEH	2.31	.00	1	3.23	9	103	RESULT OF DISCREPANCY RESOLUTION
19	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	24	STH	TEC	720-EL	PI	1H	.00	.00	M1	.69	88	22	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
38	24	TSH	TEH	720-WC	CDI	TSH	.54	.00	C22	.74	80	21	RESULT OF LAR
38	24												<< POSITIVE ID ESTABLISHED >>
38	24	TEH	TEC	720-EL	DIC	TEH	20.75	.00	M1	.79	38	42	RESULT OF DISCREPANCY RESOLUTION
38	24												RETEST - RETEST FOR POSITIVE ID
38	24	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.56	76	42	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
38	24	TEH	TEC	720-EL	33	1C	.00	.00	M1	2.02	109	42	
38	24	TSH	TSH	720-ZC	SAI	TSH	.86	.00	4	.47	22	123	<< POSITIVE ID ESTABLISHED >>
4	25	TRH	TEH	720-RB	SAI	TEH	2.38	.00	4	3.52	30	103	RESULT OF DISCREPANCY RESOLUTION
4	25												<< POSITIVE ID ESTABLISHED >>
4	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	25	TRH	TEH	720-RB	MAI	TEH	2.47	.00	4	3.41	21	103	RESULT OF DISCREPANCY RESOLUTION
7	25												<< POSITIVE ID ESTABLISHED >>
7	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	25	TRH	TEH	720-RB	MAI	TEH	2.34	.00	1	1.35	20	103	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	25	TRH	TEH	720-RB	SAI	TEH	2.45	.00	1	3.13	13	103	<< POSITIVE ID ESTABLISHED >>
15	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	25	TRH	TEH	720-RB	MAI	TEH	2.25	.00	1	1.32	18	103	<< POSITIVE ID ESTABLISHED >>
19	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	25	TRH	TEH	720-RB	SAI	TEH	2.24	.00	1	3.62	19	103	<< POSITIVE ID ESTABLISHED >>
21	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
2	26	TRH	TEH	720-RB	MAI	TEH	2.48	.00	1	.85	31	103	<< POSITIVE ID ESTABLISHED >>
2	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	26	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.36	122	22	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
7	26	TRH	TEH	720-RB	SAI	TEH	2.50	.00	1	2.49	19	103	<< POSITIVE ID ESTABLISHED >>
7	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	26	TRH	TEH	720-RB	MAI	TEH	2.47	.00	1	2.97	18	103	<< POSITIVE ID ESTABLISHED >>
14	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	26	TRH	TEH	720-RB	MAI	TEH	2.31	.00	1	3.23	14	103	<< POSITIVE ID ESTABLISHED >>
15	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	26	TRH	TEH	720-RB	MAI	TEH	2.43	.00	1	2.49	18	103	<< POSITIVE ID ESTABLISHED >>
16	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	26	TRH	TEH	720-RB	SAI	TEH	2.30	.00	1	2.26	11	103	<< POSITIVE ID ESTABLISHED >>
17	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	26	TRH	TEH	720-RB	SAI	TEH	2.25	.00	1	2.97	17	103	<< POSITIVE ID ESTABLISHED >>
19	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	26	TRH	TEH	720-RB	MAI	TEH	2.33	.00	1	1.79	26	103	<< POSITIVE ID ESTABLISHED >>
20	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	26	TRH	TEH	720-RB	COI	TEH	2.39	.00	1	1.64	18	103	<< POSITIVE ID ESTABLISHED >>
21	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	26	TEH	TEC	720-EL	PI	4H	.05	.00	M1	.33	45	22	RESULT OF DISCREPANCY RESOLUTION
24	26	TEH	TEC	720-EL	PI	4H	.00	.00	M1	.30	42	22	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
28	26	TEH	TEC	720-EL	INR	AV1	.00	.00	M2			26	RESULT OF DISCREPANCY RESOLUTION
28	26	TEH	TEC	720-EL	INR	AV2	.10	.00	M2			26	RESULT OF DISCREPANCY RESOLUTION
41	26	TEH	TEC	720-EL	17	3C	.88	.00	M1	.47	122	44	RESULT OF DISCREPANCY RESOLUTION
3	27	TRH	TEH	720-RB	MAI	TEH	2.52	.00	4	5.04	12	103	RESULT OF DISCREPANCY RESOLUTION
3	27												<< POSITIVE ID ESTABLISHED >>
3	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	27	TRH	TEH	720-RB	MAI	TEH	2.55	.00	1	2.36	16	103	<< POSITIVE ID ESTABLISHED >>
5	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	27	TRH	TEH	720-RB	MAI	TEH	2.25	.00	1	3.77	16	103	<< POSITIVE ID ESTABLISHED >>
12	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	27	TRH	TEH	720-RB	SAI	TEH	2.31	.00	1	2.21	18	103	<< POSITIVE ID ESTABLISHED >>

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

SG - 12 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -12/51

INSPECTION: August 95

22-Sep-95 2:12

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
13	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	27	TRH	TEH	720-RB	MAI	TEH	2.11	.00	1	3.43	15	103	<< POSITIVE ID ESTABLISHED >>
15	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	27	TRH	TEH	720-RB	MAI	TEH	2.23	.00	1	1.89	18	103	<< POSITIVE ID ESTABLISHED >>
21	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	27	TRH	TEH	720-RB	MAI	TEH	2.25	.00	4	4.57	18	103	RESULT OF DISCREPANCY RESOLUTION
22	27												<< POSITIVE ID ESTABLISHED >>
22	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	27	TEH	TEC	720-EL	INR	TEH	21.29	.00	M1		28		RESULT OF DISCREPANCY RESOLUTION
14	28	TRH	TEH	720-RB	SAI	TEH	2.23	.00	1	2.23	196	103	<< POSITIVE ID ESTABLISHED >>
14	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	28	TRH	TEH	720-RB	MAI	TEH	2.18	.00	1	2.80	15	103	<< POSITIVE ID ESTABLISHED >>
15	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	28	TRH	TEH	720-RB	MAI	TEH	2.25	.00	1	2.09	21	103	<< POSITIVE ID ESTABLISHED >>
18	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	28	TRH	TEH	720-RB	SAI	TEH	2.23	.00	1	5.19	19	103	<< POSITIVE ID ESTABLISHED >>
21	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	28	TRH	TEH	720-RB	MAI	TEH	2.24	.00	1	2.05	25	103	<< POSITIVE ID ESTABLISHED >>
22	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	28	TEH	TEC	720-EL	INR	TEH	21.12	.00	M1	1.25	28	26	RESULT OF DISCREPANCY RESOLUTION
40	28	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.47	70	42	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
41	28	TEH	TEC	720-EL	48	1C	.00	.00	M1	4.20	97	42	RESULT OF DISCREPANCY RESOLUTION
41	28												RETEST - RETEST FOR POSITIVE ID
10	29	TEH	TEC	720-EL	INR	4H	.00	.00	M1		28		RESULT OF DISCREPANCY RESOLUTION
14	29	TRH	TEH	720-RB	SAI	TEH	2.70	.00	1	1.29	21	109	RESULT OF DISCREPANCY RESOLUTION
14	29												<< POSITIVE ID ESTABLISHED >>
14	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	29	TRH	TEH	720-RB	MAI	TEH	2.15	.00	4	7.63	15	103	RESULT OF DISCREPANCY RESOLUTION
21	29												<< POSITIVE ID ESTABLISHED >>
21	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
37	29	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.35	44	44	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
40	29	TEH	TEC	720-EL	PI	5H	.05	.00	M1	.28	53	44	
40	29	TEH	TEC	720-EL	PI	5H	.00	.00	M1	.37	62	44	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
41	29	TEH	TEC	720-EL	14	1C	.10	.00	M1	.96	124	44	RESULT OF DISCREPANCY RESOLUTION
14	30	TSC	TEH	720-EL	DI	TSH	1.24	.00	M1	.41	98	83	RESULT OF DISCREPANCY RESOLUTION
14	30	TSH	TEH	720-WC	COI	TSH	.92	.00	C13	5.03	85	93	RESULT OF DISCREPANCY RESOLUTION
14	30												RETEST - RETEST FOR POSITIVE ID
14	30	TRH	TEH	720-RB	MAI	TEH	2.61	.00	1	1.19	14	109	RESULT OF LAR
14	30												<< POSITIVE ID ESTABLISHED >>
14	30	TSH	TSH	720-RB	SAI	TSH	.21	.00	1	.63	86	109	RESULT OF LAR
14	30												<< POSITIVE ID ESTABLISHED >>
14	30	TSH	TSH	720-ZC	SAI	TSH	-.10	.00	4	.89	61	125	RESULT OF DISCREPANCY RESOLUTION
14	30												<< POSITIVE ID ESTABLISHED >>
15	30	TRH	TEH	720-RB	SAI	TEH	2.26	.00	1	1.70	20	103	<< POSITIVE ID ESTABLISHED >>
15	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	30	TRH	TEH	720-RB	MAI	TEH	2.10	.00	1	3.50	13	103	<< POSITIVE ID ESTABLISHED >>
21	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	30	TRH	TEH	720-RB	COI	TEH	2.17	.00	1	2.08	16	103	<< POSITIVE ID ESTABLISHED >>
22	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	30	TRH	TEH	720-RB	MAI	TEH	2.25	.00	1	5.66	18	103	<< POSITIVE ID ESTABLISHED >>
31	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	31	TRH	TEH	720-RB	SAI	TEH	2.19	.00	1	1.03	21	103	<< POSITIVE ID ESTABLISHED >>
3	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	31	TRH	TEH	720-RB	SAI	TEH	2.46	.00	1	3.36	24	103	<< POSITIVE ID ESTABLISHED >>
14	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	31	TEH	TEC	720-EL	DIN	TSH	.86	.00	M1	1.18	41	32	
42	31	TEH	TEC	720-EL	43	1C	.02	.00	M1	2.46	103	44	RESULT OF DISCREPANCY RESOLUTION
42	31												RETEST - RETEST FOR POSITIVE ID
11	32	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.73	100	30	
11	32	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.73	100	30	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
14	32	TRH	TEH	720-RB	MAI	TEH	2.33	.00	1	3.77	12	103	<< POSITIVE ID ESTABLISHED >>
14	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	32	TRH	TEH	720-RB	MAI	TEH	2.60	.00	4	1.55	24	109	RESULT OF DISCREPANCY RESOLUTION
14	32												<< POSITIVE ID ESTABLISHED >>
14	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	32	TRH	TEH	720-RB	MAI	TEH	2.54	.00	1	1.81	18	119	<< POSITIVE ID ESTABLISHED >>
14	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------



SG - 12 LISTING OF ALL INDICATIONS

D. C. Cook UIR95

AEP -12/51

INSPECTION: August 95

22-Sep-95 2:12

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
22	32	TRH	TEH	720-RB	MAI	TEH	2.42	.00	1	3.95	25	103	<< POSITIVE ID ESTABLISHED >>
22	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	32	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.94	99	30	
23	32	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.98	101	30	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
38	32	TEH	TEC	720-EL	INR	TEH	20.82	.00	M1	1.05	31	38	RESULT OF DISCREPANCY RESOLUTION
7	33	TRH	TEH	720-RB	MAI	TEH	2.41	.00	1	2.78	13	103	<< POSITIVE ID ESTABLISHED >>
7	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	33	TRH	TEH	720-RB	MAI	TEH	2.27	.00	1	2.20	17	103	<< POSITIVE ID ESTABLISHED >>
12	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
38	33	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.73	115	40	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
23	34	TEH	TEC	720-EL	DIN	TEH	21.18	.00	M1	2.03	26	34	RESULT OF DISCREPANCY RESOLUTION
31	34	TRH	TEH	720-RB	SAI	TEH	2.36	.00	1	2.57	14	103	<< POSITIVE ID ESTABLISHED >>
31	34												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	35	TRH	TEH	720-RB	MAI	TEH	2.34	.00	1	2.05	19	103	<< POSITIVE ID ESTABLISHED >>
14	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	35	STH	TEC	720-EL	PI	2H	.00	.00	M1	.52	56	52	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
3	36	TRH	TEH	720-RB	MAI	TEH	2.30	.00	1	1.95	31	103	<< POSITIVE ID ESTABLISHED >>
3	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	36	TRH	TEH	720-RB	MAI	TEH	2.18	.00	4	3.55	4	103	RESULT OF LAR
7	36												<< POSITIVE ID ESTABLISHED >>
7	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	36	TRH	TEH	720-RB	MAI	TEH	2.14	.00	1	3.55	11	103	<< POSITIVE ID ESTABLISHED >>
14	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	36	TEH	TEC	720-EL	INR	TEH	21.24	.00	M1			50	RESULT OF LAR
7	37	TRH	TEH	720-RB	SAI	TEH	2.32	.00	1	1.67	22	103	<< POSITIVE ID ESTABLISHED >>
7	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	37	STH	TEC	720-EL	PI	2H	.00	.00	M1	1.06	87	52	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
22	37	TRH	TEH	720-RB	MAI	TEH	2.19	.00	1	2.45	15	103	<< POSITIVE ID ESTABLISHED >>
22	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	37	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.29	99	56	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

SG - 12 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -12/51

INSPECTION: August 95

22-Sep-95 2:13

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
3	38	TRH	TEH	720-RB	MAI	TEH	2.15	.00	1	1.84	13	103	<< POSITIVE ID ESTABLISHED >>
3	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	38	TRH	TEH	720-RB	MAI	TEH	2.01	.00	1	2.36	15	103	<< POSITIVE ID ESTABLISHED >>
21	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	38	TEH	TEC	720-EL	INR	TEH	21.23	.00	M1	1.41	36	54	RESULT OF DISCREPANCY RESOLUTION
31	38	TRH	TEH	720-RB	SAI	TEH	2.04	.00	1	1.98	27	103	<< POSITIVE ID ESTABLISHED >>
31	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	39	TRH	TEH	720-RB	MAI	TEH	1.99	.00	1	2.15	12	103	<< POSITIVE ID ESTABLISHED >>
3	39												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	39	TEH	TEC	720-EL	PI	1H	.00	.00	M1	1.14	104	58	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
31	39	TRH	TEH	720-RB	SAI	TEH	2.12	.00	1	.51	18	103	<< POSITIVE ID ESTABLISHED >>
31	39												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	40	TRH	TEH	720-RB	SAI	TEH	2.12	.00	1	1.75	20	103	<< POSITIVE ID ESTABLISHED >>
3	40												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	40	TSH	TEH	720-WC	CDI	TSH	.00	.00	41	3.51	92	37	RESULT OF LAR
12	40												RETEST - RETEST FOR POSITIVE ID
12	40	TEH	TEC	720-EL	INR	TSH	.81	.00	M1	1.63	63	54	RESULT OF DISCREPANCY RESOLUTION
12	40	TSH	TSH	720-ZC	SAI	TSH	.55	.00	4	.83	71	125	RESULT OF DISCREPANCY RESOLUTION
12	40												<< POSITIVE ID ESTABLISHED >>
44	40	TEH	TEC	720-EL	44	2C	.00	.00	M1	2.66	102	66	RESULT OF DISCREPANCY RESOLUTION
44	40												RETEST - RETEST FOR POSITIVE ID
3	41	TRH	TEH	720-RB	SAI	TEH	2.27	.00	1	1.40	23	105	<< POSITIVE ID ESTABLISHED >>
3	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	41	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.32	79	56	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
9	42	TRH	TEH	720-RB	MAI	TEH	2.11	.00	1	1.77	20	103	<< POSITIVE ID ESTABLISHED >>
9	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	42	TRH	TEH	720-RB	SAI	TEH	2.52	.00	1	1.74	14	103	<< POSITIVE ID ESTABLISHED >>
13	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	42	TRH	TEH	720-RB	MAI	TEH	2.25	.00	1	3.20	16	103	<< POSITIVE ID ESTABLISHED >>
22	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	42	TEH	TEC	720-EL	6	TSC	8.39	.00	1	.84	161	54	
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
5	43	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.95	93	126	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
7	43	TRH	TEH	720-RB	SAI	TEH	2.38	.00	1	1.21	16	103	<< POSITIVE ID ESTABLISHED >>
7	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	43	TRH	TEH	720-RB	MAI	TEH	2.40	.00	1	1.57	12	101	<< POSITIVE ID ESTABLISHED >>
22	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	43	TRH	TEH	720-RB	MAI	TEH	2.05	.00	1	1.57	13	103	<< POSITIVE ID ESTABLISHED >>
22	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
38	43	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.74	58	68	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
44	43	TEH	TEC	720-EL	10	AV1	.00	.00	M2	.23		68	
19	44	TEH	TEC	720-EL	INR	TSH	.23	.00	M1			58	RESULT OF DISCREPANCY RESOLUTION
21	44	TRH	TEH	720-RB	MAI	TEH	2.36	.00	1	1.73	22	101	<< POSITIVE ID ESTABLISHED >>
21	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	44	TRH	TEH	720-RB	SAI	TEH	2.49	.00	1	.76	148	101	<< POSITIVE ID ESTABLISHED >>
22	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	44	TEH	TEC	720-EL	13	AV2	.00	.00	M2	.31		58	
35	44	TEH	TEC	720-EL	32	AV1	.00	.00	M2	1.93		66	
35	44	TEH	TEC	720-EL	21	AV2	.17	.00	M2	.76		66	
35	44	TEH	TEC	720-EL	14	AV2	.42	.00	M2	.36		66	
41	44	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.23	76	66	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
45	44	TEH	TEC	720-EL	35	2C	.00	.00	M1	2.27	109	70	
45	44	TEH	TEC	720-EL	10	1C	.00	.00	M1	1.39	127	70	
21	45	TRH	TEH	720-RB	MAI	TEH	2.54	.00	1	1.31	29	101	<< POSITIVE ID ESTABLISHED >>
21	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	45	TRH	TEH	720-RB	MAI	TEH	1.99	.00	1	.92	24	105	<< POSITIVE ID ESTABLISHED >>
22	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
46	45	TEH	TEC	720-EL	21	2C	.10	.00	M1	.93	119	70	RESULT OF DISCREPANCY RESOLUTION
13	46	TSC	TEH	720-EL	DI	TSH	.49	.00	M1	1.09	112	83	RESULT OF DISCREPANCY RESOLUTION
13	46	TSH	TEH	720-WC	COI	TSH	.33	.00	C6	3.51	78	93	RESULT OF DISCREPANCY RESOLUTION
13	46												RETEST - RETEST FOR POSITIVE ID
13	46	TRH	TEH	720-RB	MAI	TEH	2.45	.00	1	.77	13	111	RESULT OF DISCREPANCY RESOLUTION
13	46												<< POSITIVE ID ESTABLISHED >>
13	46	TSH	TSH	720-RB	SAI	TSH	.48	.00	1	.67	83	111	RESULT OF DISCREPANCY RESOLUTION
13	46												<< POSITIVE ID ESTABLISHED >>
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
13	46	TSH	TSH	720-ZC SAI	TSH		.50	.00	4	.89	65	123	RESULT OF DISCREPANCY RESOLUTION
13	46												<< POSITIVE ID ESTABLISHED >>
13	46	TSH	TSH	720-ZC MAI	TSH		.11	.00	4	.57	114	123	RESULT OF DISCREPANCY RESOLUTION
13	46												<< POSITIVE ID ESTABLISHED >>
19	46	TSH	TEH	720-WC CDI	TSH		.61	.00	C23	4.45	80	41	RESULT OF DISCREPANCY RESOLUTION
19	46												RETEST - RETEST FOR POSITIVE ID
19	46	TEH	TEC	720-EL DI	TSH		.57	.00	M1	.59	124	58	RESULT OF DISCREPANCY RESOLUTION
19	46	TSH	TSH	720-ZC MAI	TSH		.25	.00	4	.44	51	123	RESULT OF DISCREPANCY RESOLUTION
19	46												<< POSITIVE ID ESTABLISHED >>
22	46	TRH	TEH	720-RB MAI	TEH		2.33	.00	1	2.08	17	101	<< POSITIVE ID ESTABLISHED >>
22	46												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	47	TEH	TEC	720-EL PI	1H		.00	.00	M1	.49	98	126	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
21	47	TRH	TEH	720-RB SAI	TEH		2.24	.00	1	.95	36	101	<< POSITIVE ID ESTABLISHED >>
21	47												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	47	TEH	TEC	720-EL PI	1H		.00	.00	M1	.74	17	100	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
34	47	TEH	TEC	720-EL PI	1H		.00	.00	M1	.40	77	72	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
38	47	TSH	TEH	720-WC CDI	TSH		.08	.00	C21	2.60	90	95	RESULT OF LAR
38	47												RETEST - RETEST FOR POSITIVE ID
38	47	TSH	TSH	720-ZC MAI	TSH		.66	.00	5	.80	105	123	<< POSITIVE ID ESTABLISHED >>
38	47	TEH	TEC	720-EL DI	TEH		20.92	.00	M1	1.13	99	154	RESULT OF DISCREPANCY RESOLUTION
38	47	TEH	TEC	720-EL PI	2H		.00	.00	M1	1.17	85	154	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
45	47	TEH	TEC	720-EL PI	3H		.00	.00	M1	.39	144	72	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
14	48	TSC	TEH	720-EL DIN	TSH		.76	.00	M1	7.28	36	83	RESULT OF DISCREPANCY RESOLUTION
14	48	TRH	TEH	720-RB MAI	TEH		2.16	.00	1	1.81	14	101	<< POSITIVE ID ESTABLISHED >>
14	48												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	48	TRH	TEH	720-RB MAI	TEH		2.46	.00	1	1.15	14	111	RESULT OF DISCREPANCY RESOLUTION
14	48												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
40	48	TEH	TEC	720-EL	15 AV1		.00	.00	M2	.41		70	
45	48	TEH	TEC	720-EL INR	TSH		.82	.00	M1			98	RESULT OF DISCREPANCY RESOLUTION
46	48	TEH	TEC	720-EL PI	2H		.00	.00	M1	.42	54	98	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
12	49	TRH	TEH	720-RB MAI	TEH		2.53	.00	1	2.53	22	101	<< POSITIVE ID ESTABLISHED >>
12	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	49	TRH	TEH	720-RB MAI	TEH		2.39	.00	1	.78	205	101	<< POSITIVE ID ESTABLISHED >>
21	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

SG - 12 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -12/51

INSPECTION: August 95

22-Sep-95 2:13

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
38	49	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.38	52	72	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
41	49	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.29	61	72	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
44	49	TEH	TEC	720-EL	19	1C	.12	.00	M1	1.25	123	100	RESULT OF DISCREPANCY RESOLUTION
22	50	TRH	TEH	720-RB	MAI	TEH	2.06	.00	1	3.50	211	101	<< POSITIVE ID ESTABLISHED >>
22	50												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	50	TEH	TEC	720-EL	11	TSC	1.83	.00	M1	.42	126	70	
45	50	TEH	TEC	720-EL	17	1C	.10	.00	M1	.94	122	98	RESULT OF DISCREPANCY RESOLUTION
23	51	TEH	TEC	720-EL	12	AV2	.00	.00	M2	.30		96	
24	51	TEH	TEC	720-EL	17	TSC	4.86	.00	1	.53	153	96	RESULT OF DISCREPANCY RESOLUTION
29	51	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.49	53	72	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
7	52	TRH	TEH	720-RB	SAI	TEH	2.44	.00	1	1.96	8	101	<< POSITIVE ID ESTABLISHED >>
7	52												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	52	TSH	TEC	720-EL	PI	2H	.00	.00	M1	.58	80	124	RESULT OF DISCREPANCY RESOLUTION
8	52	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.58	131	132	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
18	52	TEH	TEC	720-EL	PI	1H	.00	.00	M1	1.03	48	94	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
19	52	STH	TEC	720-EL	PI	1H	.00	.00	M1	.78	83	94	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
44	52	TEH	TEC	720-EL	11	AV2	.00	.00	M2	.25		72	
46	52	TEH	TEC	720-EL	43	1C	.19	.00	M1	1.93	103	98	RESULT OF DISCREPANCY RESOLUTION
46	52												RETEST - RETEST FOR POSITIVE ID
21	53	TRH	TEH	720-RB	MAI	TEH	2.18	.00	1	1.81	12	101	<< POSITIVE ID ESTABLISHED >>
21	53												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
42	53	TEH	TEC	720-EL	13	AV1	.00	.00	M2	.35		70	
25	54	TEH	TEC	720-EL	3	TSC	2.02	.00	M1	.33	131	94	
29	54	TEH	TEC	720-EL	4	TSC	1.01	.00	M1	.53	130	94	
34	54	TEH	TEC	720-EL	12	AV3	.00	.00	M2	.29		72	
34	54	TEH	TEC	720-EL	21	AV4	.00	.00	M2	.77		72	RESULT OF DISCREPANCY RESOLUTION
3	55	TSC	TEH	720-EL	DIN	TEH	20.60	.00	M1	.41	101	85	RESULT OF DISCREPANCY RESOLUTION
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



SG - 12 LISTING OF ALL INDICATIONS

D. C. Cook UIR95

AEP -12/51

INSPECTION: August 95

22-Sep-95 2:13

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
3	55	TSC	TEH	720-EL	DIN	TEH	19.33	.00	M1	.28	116	85	RESULT OF DISCREPANCY RESOLUTION
3	55	TSC	TEH	720-EL	PIC	1H	.00	.00	M1	2.45	102	85	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
3	55												RETEST - RETEST FOR POSITIVE ID
3	55	1H	1H	720-ZC	MAI	1H	.00	.00	4	.93	104	123	<< POSITIVE ID ESTABLISHED >>
11	55	TEH	TEC	720-EL	PI	2H	.00	.00	M1	1.44	100	96	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
12	55	TRH	TEH	720-RB	MAI	TEH	2.19	.00	1	2.04	9	101	<< POSITIVE ID ESTABLISHED >>
12	55												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	56	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.65	114	102	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
11	56	TEH	TEC	720-EL	PI	2H	.00	.00	M1	1.40	115	94	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
22	56	TRH	TEH	720-RB	MAI	TEH	2.36	.00	1	1.73	22	101	<< POSITIVE ID ESTABLISHED >>
22	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
34	56	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.74	24	72	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
20	57	TRH	TEH	720-RB	MAI	TEH	2.54	.00	1	.63	14	99	<< POSITIVE ID ESTABLISHED >>
20	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	57	TEH	TEC	720-EL	8	TSC	2.35	.00	1	.62	160	92	
45	57	TEH	TEC	720-EL	16	1C	-.02	.00	M1	.45	123	70	
3	58	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.53	38	102	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
21	58	TRH	TEH	720-RB	MAI	TEH	2.26	.00	1	.78	14	99	<< POSITIVE ID ESTABLISHED >>
21	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
43	58	TEH	TEC	720-EL	30	1C	-.12	.00	M1	2.42	114	72	
11	59	TEH	TEC	720-EL	PI	1H	.00	.00	M1	1.04	88	92	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
15	60	TRH	TEH	720-RB	MAI	TEH	2.39	.00	1	.87	11	99	<< POSITIVE ID ESTABLISHED >>
15	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	61	TEH	TEC	720-EL	INR	TEH	21.24	.00	M1	1.65	30	92	RESULT OF DISCREPANCY RESOLUTION
15	61	TRH	TEH	720-RB	MAI	TEH	2.46	.00	1	.80	15	99	<< POSITIVE ID ESTABLISHED >>
15	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
42	61	TEH	TEC	720-EL	23	2C	-.05	.00	M1	1.28	118	74	RESULT OF DISCREPANCY RESOLUTION
43	61	TEH	TEC	720-EL	PI	2H	.00	.00	M1	1.00	81	74	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
43	61	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.70	107	74	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
11	62	TEH	TEC	720-EL	DIN	TSH	-.39	.00	M1	1.71	37	90	RESULT OF DISCREPANCY RESOLUTION
12	62	TRH	TEH	720-RB	MAI	TEH	2.24	.00	1	3.57	22	99	<< POSITIVE ID ESTABLISHED >>
12	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	62	TRH	TEH	720-RB	MAI	TEH	2.41	.00	4	3.15	27	99	RESULT OF LAR
15	62												<< POSITIVE ID ESTABLISHED >>
15	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	62	TRH	TEH	720-RB	SAI	TEH	2.46	.00	1	1.58	14	99	<< POSITIVE ID ESTABLISHED >>
22	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
40	62	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.46	70	76	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
44	62	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.21	34	74	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
44	62	TEH	TEC	720-EL	33	2C	.10	.00	M1	2.40	110	74	
42	63	TEH	TEC	720-EL	25	AV3	.00	.00	M2	1.06		74	
42	63	TEH	TEC	720-EL	33	AV4	.00	.00	M2	2.09		74	
11	64	TEH	TEC	720-EL	INR	TEH	21.09	.00	M1	1.96	29	88	RESULT OF DISCREPANCY RESOLUTION
15	64	TRH	TEH	720-RB	MAI	TEH	2.49	.00	1	1.89	24	99	<< POSITIVE ID ESTABLISHED >>
15	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	64	TRH	TEH	720-RB	MAI	TEH	2.42	.00	1	1.18	13	99	<< POSITIVE ID ESTABLISHED >>
17	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	64	TRH	TEH	720-RB	SAI	TEH	2.37	.00	1	1.84	17	99	RESULT OF DISCREPANCY RESOLUTION
19	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	64	TRH	TEH	720-RB	SAI	TEH	2.35	.00	1	.65	20	99	<< POSITIVE ID ESTABLISHED >>
20	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
42	64	TEH	TEC	720-EL	34	1C	.02	.00	M1	2.30	111	76	
8	65	TEH	TEC	720-EL	INR	2H	.00	.00	M1			104	RESULT OF DISCREPANCY RESOLUTION
42	65	TEH	TEC	720-EL	16	AV1	.00	.00	M2	.47		74	
42	65	TEH	TEC	720-EL	17	1C	.10	.00	M1	.94	122	74	
13	66	STH	TEC	720-EL	PI	2H	.00	.00	M1	.76	51	88	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
28	66	TEH	TEC	720-EL	7	TSC	13.85	.00	1	.64	161	76	RESULT OF DISCREPANCY RESOLUTION
41	66	TEH	TEC	720-EL	34	2C	.07	.00	M1	1.99	111	76	
41	66	TEH	TEC	720-EL	60	1C	-.05	.00	M1	2.00	86	76	RESULT OF DISCREPANCY RESOLUTION
41	66												RETEST - RETEST FOR POSITIVE ID
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

SG - 12 LISTING OF ALL INDICATIONS

D.. C. Cook U1R95

AEP -12/51

INSPECTION: August 95

22-Sep-95 2:13

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
11	67	TEH	TEC	720-EL	INR	TEH	21.05	.00	M1			86	RESULT OF DISCREPANCY RESOLUTION
11	67	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.98	124	86	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
40	67	TEH	TEC	720-EL	3	2C	-.02	.00	M1	.68	134	78	
40	67	TEH	TEC	720-EL	38	1C	.15	.00	M1	.70	107	78	RESULT OF DISCREPANCY RESOLUTION
11	68	TEH	TEC	720-EL	INR	TEH	21.03	.00	M1	1.32	33	88	RESULT OF DISCREPANCY RESOLUTION
11	68	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.95	90	88	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
14	68	TRH	TEH	720-RB	MAI	TEH	2.31	.00	1	.83	14	99	<< POSITIVE ID ESTABLISHED >>
14	68												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	68	TRH	TEH	720-RB	SAI	TEH	2.49	.00	1	.67	9	99	<< POSITIVE ID ESTABLISHED >>
16	68												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	68	TEH	TEC	720-EL	13	AV4	.00	.00	M2	.33		76	
40	68	TEH	TEC	720-EL	14	2C	-.20	.00	M1	1.19	126	80	
11	69	TEH	TEC	720-EL	INR	TEH	21.27	.00	M1	1.02	52	78	RESULT OF DISCREPANCY RESOLUTION
12	69	TRH	TEH	720-RB	SAI	TEH	1.99	.00	1	.39	33	99	<< POSITIVE ID ESTABLISHED >>
12	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	69	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.45	52	78	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
40	69	TEH	TEC	720-EL	19	1C	.02	.00	M1	.91	121	78	RESULT OF DISCREPANCY RESOLUTION
11	70	TEH	TEC	720-EL	PIH	2H	.00	.00	M1	1.69	69	80	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
26	70	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.18	59	80	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
39	70	TEH	TEC	720-EL	43	2C	-.05	.00	M1	1.65	104	80	RESULT OF DISCREPANCY RESOLUTION
39	70												RETEST - RETEST FOR POSITIVE ID
40	70	TEH	TEC	720-EL	8	1C	-.07	.00	M1	.55	130	80	
8	71	TEH	TEC	720-EL	INR	TEH	21.35	.00	M1			108	RESULT OF DISCREPANCY RESOLUTION
8	71	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.48	109	108	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
8	71	TEH	TEC	720-EL	PI	4H	.00	.00	M1	.55	25	108	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
38	71	TEH	TEC	720-EL	20	1C	-.10	.00	M1	1.28	121	82	
40	71	TEH	TEC	720-EL	41	1C	.07	.00	M1	2.21	104	82	RESULT OF DISCREPANCY RESOLUTION
40	71												RETEST - RETEST FOR POSITIVE ID
2	72	7H	TEH	720-EL	INR	1H	.08	.00	M1			85	RESULT OF LAR
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
13	72	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.69	117	80	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
38	72	TEH	TEC	720-EL	19	AV3	.00	.00	M2	.62		84	RESULT OF DISCREPANCY RESOLUTION
38	72	TEH	TEC	720-EL	24	AV4	.00	.00	M2	1.01		84	
37	73	TEH	TEC	720-EL	PI	4H	.00	.00	M1	.30	59	82	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
28	74	TEH	TEC	720-EL	INR	1H	.15	.00	M1			120	RESULT OF DISCREPANCY RESOLUTION
34	74	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.87	23	84	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
34	74	TEH	TEC	720-EL	INR	2H	.00	.00	M1	.71	166	84	RESULT OF DISCREPANCY RESOLUTION
36	74	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.52	74	84	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
36	74	TEH	TEC	720-EL	49	2C	.00	.00	M1	2.88	97	84	RESULT OF DISCREPANCY RESOLUTION
36	74												RETEST - RETEST FOR POSITIVE ID
36	74	TEH	TEC	720-EL	19	1C	.00	.00	M1	.25	121	84	
37	74	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.44	64	84	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
37	74	TEH	TEC	720-EL	PI	4H	.00	.00	M1	.34	96	84	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
18	75	TRH	TEH	720-RB	COI	TEH	2.14	.00	1	14.40	4	99	<< POSITIVE ID ESTABLISHED >>
18	75												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	75	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.42	33	82	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
34	75	TEH	TEC	720-EL	INR	5H	.00	.00	M1	.19	43	82	RESULT OF DISCREPANCY RESOLUTION
37	75	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.60	70	82	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
37	75	TEH	TEC	720-EL	PI	4H	.00	.00	M1	.34	110	82	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
37	75	TEH	TEC	720-EL	PI	5H	.00	.00	M1	.54	44	82	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
37	75	TEH	TEC	720-EL	7	2C	.12	.00	M1	.89	130	82	
36	76	TEH	TEC	720-EL	10	1C	.00	.00	M1	.76	127	84	
29	77	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.40	84	82	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
35	77	TEH	TEC	720-EL	9	2C	.10	.00	M1	.58	129	82	
35	77	TEH	TEC	720-EL	53	1C	.07	.00	M1	4.67	93	82	RESULT OF DISCREPANCY RESOLUTION
35	77												RETEST - RETEST FOR POSITIVE ID
28	78	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.56	70	84	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
33	78	TEH	TEC	720-EL	16	1C	.00	.00	M1	.97	123	84	RESULT OF DISCREPANCY RESOLUTION
34	78	TEH	TEC	720-EL	3	1C	.00	.00	M1	.94	131	84	
35	78	TEH	TEC	720-EL	28	2C	.00	.00	M1	2.39	114	84	RESULT OF DISCREPANCY RESOLUTION
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

SG - 12 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -12/51

INSPECTION: August 95

22-Sep-95 2:13

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
35	78	TEH	TEC	720-EL	10	1C	.00	.00	M1	1.38	127	84	RESULT OF DISCREPANCY RESOLUTION
23	79	TEH	TEC	720-EL	10	AV2	.00	.00	M2	.23		82	
31	79	TEH	TEC	720-EL	57	2C	.00	.00	M1	5.39	89	82	RESULT OF DISCREPANCY RESOLUTION
31	79												RETEST - RETEST FOR POSITIVE ID
31	79	TEH	TEC	720-EL	19	1C	.12	.00	M1	1.48	122	82	
15	80	STH	TEC	720-EL	PI	2H	.00	.00	M1	.77	50	84	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
26	80	TEH	TEC	720-EL	DIN	TEH	20.96	.00	M1	.39	52	84	RESULT OF DISCREPANCY RESOLUTION
30	80	TEH	TEC	720-EL	31	1C	.00	.00	M1	1.39	112	84	
29	82	TEH	TEC	720-EL	37	2C	.00	.00	M1	1.75	109	88	
30	82	TEH	TEC	720-EL	36	2C	.00	.00	M1	3.14	110	88	
30	82	TEH	TEC	720-EL	INR	1C	.00	.00	M1	1.07	135	88	RESULT OF DISCREPANCY RESOLUTION
27	83	TEH	TEC	720-EL	DI	1C	.05	.00	M1	.69	99	86	RESULT OF DISCREPANCY RESOLUTION
2	84	7H	TEH	720-EL	INR	1H	.00	.00	M1			85	RESULT OF LAR
27	84	TEH	TEC	720-EL	16	1C	.00	.00	M1	1.06	125	88	
27	85	TEH	TEC	720-EL	38	1C	-.15	.00	M1	1.16	107	86	
15	87	TEH	TEC	720-EL	3	2C	-.05	.00	M1	1.06	131	86	
20	87	TEH	TEC	720-EL	29	2C	.00	.00	M1	1.45	114	86	
23	87	TEH	TEC	720-EL	49	1C	.00	.00	M1	2.95	98	86	RESULT OF DISCREPANCY RESOLUTION
23	87												RETEST - RETEST FOR POSITIVE ID
25	87	TEH	TEC	720-EL	11	1C	.00	.00	M1	.87	126	86	RESULT OF DISCREPANCY RESOLUTION
7	89	TSC	TEH	720-EL	PI	2H	.00	.00	M1	1.46	104	87	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
16	89	TSC	TEH	720-EL	PI	2H	.00	.00	M1	1.45	94	87	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
17	89	TEH	TEC	720-EL	8	2C	.00	.00	M1	1.65	129	86	
17	89	TEH	TEC	720-EL	38	1C	.00	.00	M1	3.79	107	86	
19	89	TEH	TEC	720-EL	23	1C	.00	.00	M1	1.47	118	86	
17	90	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.76	89	88	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
2	91	7C	TEC	720-EL	26	1C	.00	.00	M1	1.37	117	114	
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

SG - 12 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -12/51

INSPECTION: August 95

22-Sep-95 2:13

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
6	91	TEH	TEC	720-EL	17	2C	-.19	.00	M1	1.09 124	110		RESULT OF DISCREPANCY RESOLUTION
6	91	TEH	TEC	720-EL	34	1C	.00	.00	M1	2.15 111	110		
11	91	TEH	TEC	720-EL	19	1C	-.05	.00	M1	1.37 121	86		
13	91	TEH	TEC	720-EL	30	1C	.02	.00	M1	1.40 113	86		RESULT OF DISCREPANCY RESOLUTION
17	91	TEH	TEC	720-EL	INR	2C	-.17	.00	M1		86		RESULT OF DISCREPANCY RESOLUTION
2	92	7C	TEC	720-EL	4	1C	-.32	.00	M1	1.41 131	114		RESULT OF DISCREPANCY RESOLUTION
13	92	TEH	TEC	720-EL	14	2C	.00	.00	M1	.91 126	88		
7	93	TEH	TEC	720-EL	30	1C	.00	.00	M1	1.15 115	112		
12	93	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.70 107	88		VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

PAGE 21

TOTAL TUBES 345

Attachment 2 TO AEP:NRC:1147F

ATTACHMENT 2
STEAM GENERATOR ANNUAL OPERATING REPORT

SECTION 1: Unit 1 Inspection Results

c. SG #13 Imperfections



SG - 13

INDICATION DISTRIBUTION

MOST SEVERE INDICATION PER TUBE

D. C. Cook U1R95

AEP-13 SERIES 51

09-22-1995

04:52 HRS.

SUPERTUBIN

▽ : 4 CECCO DI
/ : 481 CECCO DRI

R : 24 DISTORTED ROLL INDICATION


6 : 1 INDICATION 60 TO 69%
5 : 5 INDICATION 50 TO 59%
4 : 14 INDICATION 40 TO 49%

3 : 17 INDICATION 30 TO 39%
2 : 33 INDICATION 20 TO 29%
1 : 25 INDICATION 01 TO 19%

D : 2 DISTORTED INDICATION
P : 71 POSSIBLE INDICATION

N : 8 DI NON-CONFIRMED WITH RPC

□ : 165 PLUGGED TUBE

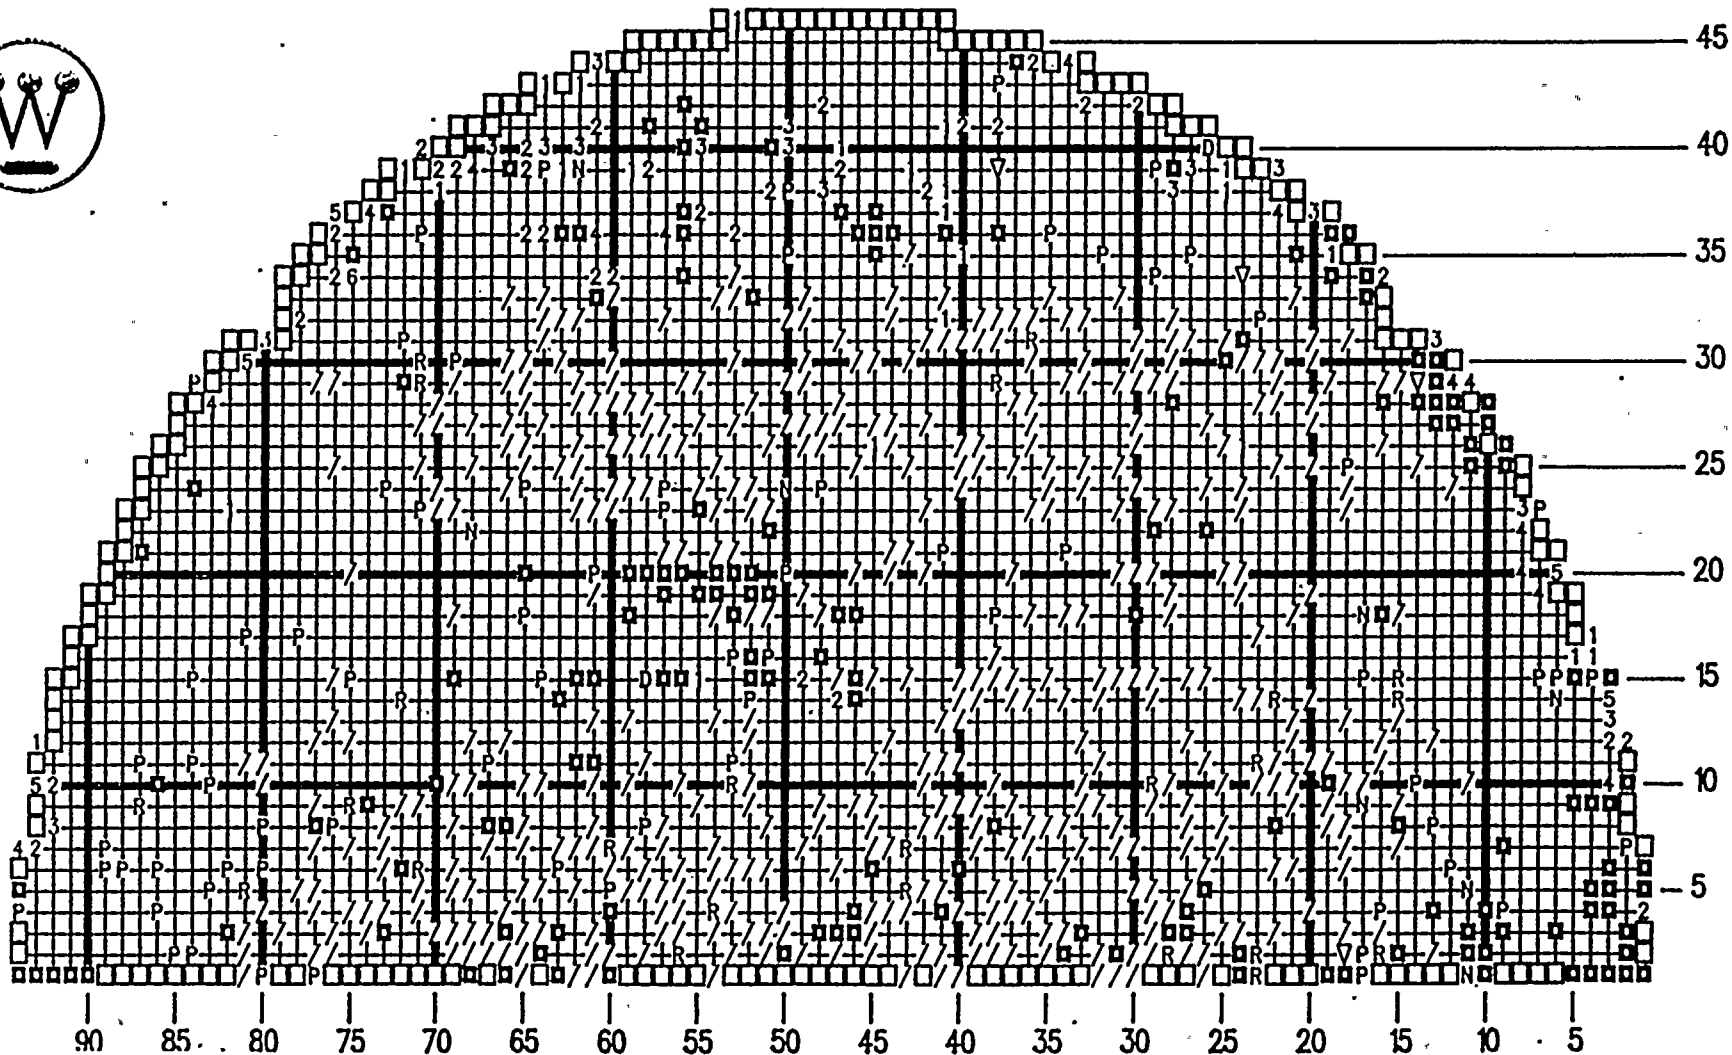

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
4	1	TEH	TEC	720-EL	23	1C	-.15	.00	M1	3.14	115	108	
7	2	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.54	64	106	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
12	2	TEH	TEC	720-EL	27	2C	-.12	.00	M1	.91	113	14	
10	3	TEH	TEC	720-EL	46	2C	.00	.00	M1	4.14	100	24	RETEST - RETEST FOR POSITIVE ID
10	3	TEH	TEC	720-EL	49	1C	-.17	.00	M1	3.58	97	24	RETEST - RETEST FOR POSITIVE ID
12	3	TEH	TEC	720-EL	24	2C	.00	.00	M1	1.08	119	120	
13	3	TEH	TEC	720-EL	38	2C	.00	.00	M1	2.82	105	14	
14	3	TEH	TEC	720-EL	50	2C	.00	.00	M1	3.12	95	14	RESULT OF DISCREPANCY RESOLUTION
14	3	TEH	TEC	720-EL	17	1C	.00	.00	M1	1.18	120	14	RETEST - RETEST FOR POSITIVE ID
14	3	TEH	TEC	720-EL	17	1C	.00	.00	M1	1.18	120	14	
15	4	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.47	124	24	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
16	4	TEH	TEC	720-EL	12	2C	-.02	.00	M1	.75	127	24	RESULT OF DISCREPANCY RESOLUTION
17	4	TEH	TEC	720-EL	12	AV1	.00	.00	M2	.21		24	RESULT OF DISCREPANCY RESOLUTION
4	5	STH	TEC	720-EL	INR	3H	.00	.00	M1			108	RESULT OF DISCREPANCY RESOLUTION
16	5	TEH	TEC	720-EL	11	2C	.17	.00	M1	.90	124	14	
16	5	TEH	TEC	720-EL	19	1C	-.22	.00	M1	.92	119	14	RESULT OF LAR
19	5	TEH	TEC	720-EL	INR	5H	.00	.00	M1			24	RESULT OF DISCREPANCY RESOLUTION
14	6	TEH	TEC	720-EL	DIN	TEH	20.84	.00	M1	.44	64	24	RESULT OF DISCREPANCY RESOLUTION
15	6	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.61	57	24	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
20	6	TEH	TEC	720-EL	54	2C	-.20	.00	M1	5.02	91	14	RESULT OF DISCREPANCY RESOLUTION
20	6	TEH	TEC	720-EL	3	1C	.05	.00	M1	1.07	129	14	RETEST - RETEST FOR POSITIVE ID
20	6	TEH	TEC	720-EL	3	1C	.05	.00	M1	1.07	129	14	
15	7	STH	TEC	720-EL	PI	2H	.00	.00	M1	.51	25	14	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
15	7	STH	TEC	720-EL	PI	3H	.00	.00	M1	.68	49	14	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
19	7	TEH	TEC	720-EL	44	1C	.00	.00	M1	3.60	100	14	RESULT OF DISCREPANCY RESOLUTION
19	7	TEH	TEC	720-EL	44	1C	.00	.00	M1	3.60	100	14	RETEST - RETEST FOR POSITIVE ID
23	7	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.51	57	10	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
5	8	TEH	TEC	720-EL	INR	TEH	20.07	.00	M1			24	RESULT OF DISCREPANCY RESOLUTION
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

D. C. Cook UIR95

AEP -13/51

INSPECTION: August 95

22-Sep-95 2:11

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
20	8	TEH	TEC	720-EL	42	1C	.12	.00	M1	3.31	101	14	RESULT OF DISCREPANCY RESOLUTION
20	8												RETEST - RETEST FOR POSITIVE ID
22	8	TEH	TEC	720-EL	47	2C	.00	.00	M1	3.33	97	10	RESULT OF DISCREPANCY RESOLUTION
22	8												RETEST - RETEST FOR POSITIVE ID
22	8	TEH	TEC	720-EL	47	1C	.00	.00	M1	2.92	97	10	RESULT OF DISCREPANCY RESOLUTION
22	8												RETEST - RETEST FOR POSITIVE ID
23	8	TEH	TEC	720-EL	38	2C	.00	.00	M1	2.65	105	10	
23	8	TEH	TEC	720-EL	33	1C	-.17	.00	M1	2.17	109	10	
4	9	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.85	78	56	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
15	9	TEH	TEC	720-EL	INR	TEH	21.03	.00	M1	.32	92	14	RESULT OF DISCREPANCY RESOLUTION
1	11	7H	TEH	720-EL	DIN	TEH	20.74	.00	M1	.64	64	87	RESULT OF DISCREPANCY RESOLUTION
5	11	TEH	TEC	720-EL	DIN	TEH	20.55	.00	M1	.17	103	56	RESULT OF DISCREPANCY RESOLUTION
10	11	TSH	TEH	720-WC	CRI	TRH	.00	.00	C7	4.58	39	3	RESULT OF DISCREPANCY RESOLUTION
10	11												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	11	TRH	TEH	720-RB	MAI	TEH	2.86	.00	1	1.70	21	99	>> POSITIVE ID ESTABLISHED <<
10	11												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	11	TEH	TEC	720-EL	45	2C	.00	.00	M1	5.00	99	10	RESULT OF DISCREPANCY RESOLUTION
29	11												RETEST - RETEST FOR POSITIVE ID
6	12	STH	TEC	720-EL	PI	1H	.00	.00	M1	.93	41	28	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
24	12	TSH	TEH	720-WC	CRI	TRH	.00	.00	C21	1.87	34	3	RESULT OF DISCREPANCY RESOLUTION
24	12												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	12	TRH	TEH	720-RB	COI	TEH	2.83	.00	1	1.10	14	99	>> POSITIVE ID ESTABLISHED <<
24	12												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	12	TEH	TEC	720-EL	14	AV1	.40	.00	M2	.31		10	
29	12	TEH	TEC	720-EL	16	AV2	.00	.00	M2	.36		10	
29	12	TEH	TEC	720-EL	47	2C	.00	.00	M1	2.49	97	10	RESULT OF DISCREPANCY RESOLUTION
29	12												RETEST - RETEST FOR POSITIVE ID
2	13	TSH	TEH	720-WC	CRI	TRH	.00	.00	C7	2.65	34	3	RESULT OF DISCREPANCY RESOLUTION
2	13												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	13	7H	TEH	720-EL	DRI	TEH	2.24	.00	M1	35.80	359	87	
2	13	TRH	TEH	720-RB	SAI	TEH	2.83	.00	1	.90	27	99	>> POSITIVE ID ESTABLISHED <<
2	13												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	13	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.57	50	46	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
12	13	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	2.36	38	5	RESULT OF DISCREPANCY RESOLUTION
12	13												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	13	TRH	TEH	720-RB	COI	TEH	2.94	.00	1	.25	35	99	>> POSITIVE ID ESTABLISHED <<
12	13												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	13	TEH	TEC	720-EL	34	1C	.00	.00	M1	.63	108	10	
10	14	STH	TEC	720-EL	PI	1H	.00	.00	M1	.42	81	12	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
10	14	STH	TEC	720-EL	PI	1H	.00	.00	M1	.42	74	56	RESULT OF DISCREPANCY RESOLUTION
25	14	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	1.49	60	5	RESULT OF DISCREPANCY RESOLUTION
25	14												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	14	TRH	TEH	720-RB	COI	TEH	2.80	.00	1	.74	14	99	>> POSITIVE ID ESTABLISHED <<
25	14												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	14	TSH	TEH	720-WC	COI	TEH	20.76	.00	C13	1.50	67	5	RESULT OF LAR
29	14												RETEST - RETEST FOR POSITIVE ID
29	14	TEH	TEC	720-EL	DI	TEH	20.84	.00	M1	.80	53	12	
29	14	TSH	TSH	720-ZC	MAI	TSH	.81	.00	4	.63	162	119	RESULT OF DISCREPANCY RESOLUTION
29	14												>> POSITIVE ID ESTABLISHED <<
7	15	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	3.91	29	5	RESULT OF DISCREPANCY RESOLUTION
7	15												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	15	TRH	TEH	720-RB	COI	TEH	2.40	.00	1	1.02	10	99	>> POSITIVE ID ESTABLISHED <<
7	15												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	15	TSH	TEH	720-WC	CRI	TRH	.00	.00	C10	1.82	81	5	RESULT OF DISCREPANCY RESOLUTION
9	15												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	15	TRH	TEH	720-RB	SAI	TEH	2.37	.00	1	.59	22	99	>> POSITIVE ID ESTABLISHED <<
9	15												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	15	TEH	TEC	720-EL	DRI	TRH	.00	.00	M1	53.89	182	2	RESULT OF DISCREPANCY RESOLUTION
13	15	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	1.79	125	5	RESULT OF DISCREPANCY RESOLUTION
13	15												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	15	TRH	TEH	720-RB	MAI	TEH	2.45	.00	1	1.05	22	99	>> POSITIVE ID ESTABLISHED <<
13	15												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	15	TEH	TEC	720-EL	DRI	TEH	1.93	.00	M1	57.54	1	2	RESULT OF DISCREPANCY RESOLUTION
15	15	TEH	TEC	720-EL	DRI	TEH	2.53	.00	M1	57.54	1	2	RESULT OF DISCREPANCY RESOLUTION
18	15	TEH	TEC	720-EL	DRI	TRH	.00	.00	M1	57.54	1	2	RESULT OF DISCREPANCY RESOLUTION
18	15	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	2.44	31	5	RESULT OF LAR
18	15												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	15	TRH	TEH	720-RB	MAI	TEH	2.67	.00	1	.40	35	117	>> POSITIVE ID ESTABLISHED <<
18	15												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	15	TEH	TEC	720-EL	DRI	TRH	.00	.00	M1	57.72	182	2	RESULT OF DISCREPANCY RESOLUTION

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

SG - 13 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

22-Sep-95 2:11

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
29	15	TSH	TEH	720-WC	CRI	TRH	.00	.00	C16	3.49	34	5	RESULT OF DISCREPANCY RESOLUTION
29	15												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	15	TRH	TEH	720-RB	MAI	TEH	3.04	.00	1	1.03	17	117	>> POSITIVE ID ESTABLISHED <<
29	15												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	16	7H	TEH	720-EL	DRI	TEH	2.38	.00	M1	35.19	186	87	
3	16	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	1.62	57	7	RESULT OF DISCREPANCY RESOLUTION
3	16												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	16	TRH	TEH	720-RB	COI	TEH	2.33	.00	1	.76	8	99	>> POSITIVE ID ESTABLISHED <<
3	16												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	16	STH	TEC	720-EL	PI	2H	.00	.00	M1	1.24	94	56	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
11	16	TSH	TEH	720-WC	CRI	TRH	.00	.00	C23	6.19	31	7	RESULT OF DISCREPANCY RESOLUTION
11	16												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	16	TRH	TEH	720-RB	MAI	TEH	2.43	.00	1	1.52	17	99	>> POSITIVE ID ESTABLISHED <<
11	16												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	16	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	2.38	38	7	RESULT OF DISCREPANCY RESOLUTION
12	16												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	16	TRH	TEH	720-RB	COI	TEH	2.45	.00	1	.60	27	99	>> POSITIVE ID ESTABLISHED <<
12	16												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	16	TSH	TEH	720-WC	CRI	TRH	.00	.00	C20	3.03	28	7	RESULT OF DISCREPANCY RESOLUTION
26	16												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	16	TRH	TEH	720-RB	COI	TEH	2.44	.00	1	.76	22	99	>> POSITIVE ID ESTABLISHED <<
26	16												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	16	TSH	TEH	720-WC	CRI	TRH	.00	.00	C15	1.79	42	7	RESULT OF DISCREPANCY RESOLUTION
29	16												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	16	TRH	TEH	720-RB	COI	TEH	2.24	.00	1	.56	18	99	>> POSITIVE ID ESTABLISHED <<
29	16												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
34	16	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.79	61	12	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
34	16	TEH	TEC	720-EL	21	2C	-.10	.00	M1	.80	120	12	RESULT OF DISCREPANCY RESOLUTION
1	17	7H	TEH	720-EL	PI	2H	.00	.00	M1	.56	63	87	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
2	17	7H	TEH	720-EL	PI	2H	.00	.00	M1	.76	91	87	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
9	17	TEH	TEC	720-EL	DIN	TEH	20.26	.00	M1	.39	43	46	RESULT OF DISCREPANCY RESOLUTION
10	17	TSH	TEH	720-WC	CRI	TRH	.00	.00	C22	11.85	19	7	RESULT OF DISCREPANCY RESOLUTION
10	17												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	17	TRH	TEH	720-RB	MAI	TEH	2.28	.00	1	1.24	16	99	>> POSITIVE ID ESTABLISHED <<
10	17												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
15	17	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.59	26	2	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
18	17	TEH	TSC	720-EL	DIN	TEH	20.77	.00	M1	.36	114	2	
2	18	TSH	TEH	720-WC	COI	TEH	21.03	.00	C11	1.39	76	7	RESULT OF LAR
2	18												RETEST - RETEST FOR POSITIVE ID
2	18	7H	TEH	720-EL	DI	TEH	20.45	.00	M1	.60	64	87	RESULT OF DISCREPANCY RESOLUTION
2	18	7H	TEH	720-EL	INR	TEH	2.77	.00	M1	8.41	13	87	RESULT OF DISCREPANCY RESOLUTION
2	18	TSH	TSH	720-RB	SAI	TSH	-.72	.00	1	.41	98	117	>> POSITIVE ID ESTABLISHED <<
2	18	TSH	TSH	720-ZC	SAI	TSH	-.55	.00	4	.54	69	119	>> POSITIVE ID ESTABLISHED <<
3	18	TSH	TEH	720-WC	CRI	TRH	.00	.00	C8	2.11	73	7	RESULT OF DISCREPANCY RESOLUTION
3	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	18	TRH	TEH	720-RB	SAI	TEH	2.39	.00	1	.31	160	99	>> POSITIVE ID ESTABLISHED <<
3	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	18	TSH	TEH	720-WC	CRI	TRH	.00	.00	C7	1.79	31	7	RESULT OF DISCREPANCY RESOLUTION
6	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	18	TRH	TEH	720-RB	SAI	TEH	2.44	.00	1	.42	19	99	>> POSITIVE ID ESTABLISHED <<
6	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	18	TSH	TEH	720-WC	CRI	TRH	.00	.00	C7	4.26	25	7	RESULT OF DISCREPANCY RESOLUTION
7	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	18	TRH	TEH	720-RB	MAI	TEH	2.48	.00	1	.62	12	99	>> POSITIVE ID ESTABLISHED <<
7	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	18	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	1.52	45	7	RESULT OF DISCREPANCY RESOLUTION
8	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	18	TRH	TEH	720-RB	SAI	TEH	2.43	.00	1	.46	24	99	>> POSITIVE ID ESTABLISHED <<
8	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	18	TSH	TEH	720-WC	CRI	TRH	.00	.00	C10	1.43	64	7	RESULT OF DISCREPANCY RESOLUTION
10	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	18	TRH	TEH	720-RB	MAI	TEH	2.33	.00	1	1.16	17	99	>> POSITIVE ID ESTABLISHED <<
10	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	18	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	1.91	44	7	RESULT OF DISCREPANCY RESOLUTION
13	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	18	TRH	TEH	720-RB	COI	TEH	2.43	.00	1	.64	13	99	>> POSITIVE ID ESTABLISHED <<
13	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	18	TSH	TEH	720-WC	CRI	TRH	.00	.00	C24	4.33	25	7	RESULT OF DISCREPANCY RESOLUTION
23	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	18	TRH	TEH	720-RB	SAI	TEH	2.37	.00	1	2.01	12	99	>> POSITIVE ID ESTABLISHED <<
23	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	18	TSH	TEH	720-WC	CRI	TRH	.00	.00	C12	4.78	26	7	RESULT OF DISCREPANCY RESOLUTION
24	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
24	18	TRH	TEH	720-RB SAI	TEH		2.43	.00	1	1.28	19	99	>> POSITIVE ID ESTABLISHED <<
24	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	18	STH	TEC	720-EL	PI	2H	.00	.00	M1	.33	55	12	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
31	18	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	4.89	34	7	RESULT OF DISCREPANCY RESOLUTION
31	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	18	TRH	TEH	720-RB	MAI	TEH	2.59	.00	1	1.45	11	117	>> POSITIVE ID ESTABLISHED <<
31	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	19	TSH	TEH	720-WC	CRI	TRH	.00	.00	C23	2.48	35	9	RESULT OF DISCREPANCY RESOLUTION
8	19												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	19	TRH	TEH	720-RB	SAI	TEH	2.15	.00	1	.55	17	99	>> POSITIVE ID ESTABLISHED <<
8	19												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	19	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	4.90	47	9	RESULT OF DISCREPANCY RESOLUTION
9	19												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	19	TRH	TEH	720-RB	MAI	TEH	2.54	.00	1	1.51	19	99	>> POSITIVE ID ESTABLISHED <<
9	19												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	19	TSH	TEH	720-WC	CRI	TRH	.00	.00	C24	8.63	17	9	RESULT OF DISCREPANCY RESOLUTION
11	19												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	19	TRH	TEH	720-RB	SAI	TEH	2.93	.00	1	.97	12	117	>> POSITIVE ID ESTABLISHED <<
11	19												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	19	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	2.70	48	9	RESULT OF DISCREPANCY RESOLUTION
29	19												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	19	TRH	TEH	720-RB	MAI	TEH	2.37	.00	1	.73	17	99	>> POSITIVE ID ESTABLISHED <<
29	19												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
35	19	TEH	TEC	720-EL	7	1C	.10	.00	M1	.97	129	2	
4	20	TSH	TEH	720-WC	CRI	TRH	.00	.00	C10	1.51	53	9	RESULT OF DISCREPANCY RESOLUTION
4	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	20	TRH	TEH	720-RB	SAI	TEH	2.48	.00	1	.57	17	99	>> POSITIVE ID ESTABLISHED <<
4	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	20	TSH	TEH	720-WC	CRI	TRH	.00	.00	C12	4.39	25	9	RESULT OF DISCREPANCY RESOLUTION
11	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	20	TRH	TEH	720-RB	MAI	TEH	2.60	.00	1	1.34	14	101	>> POSITIVE ID ESTABLISHED <<
11	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	20	TSH	TEH	720-WC	CRI	TRH	.00	.00	C12	5.36	25	9	RESULT OF DISCREPANCY RESOLUTION
14	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	20	TRH	TEH	720-RB	COI	TEH	2.53	.00	1	.74	28	99	>> POSITIVE ID ESTABLISHED <<
14	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	20	TSH	TEH	720-WC	CRI	TRH	.00	.00	C21	5.63	22	9	RESULT OF DISCREPANCY RESOLUTION

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
19	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	20	TRH	TEH	720-RB	COI	TEH	2.41	.00	1	.83	23	99	>> POSITIVE ID ESTABLISHED <<
19	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	20	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	4.89	23	9	RESULT OF DISCREPANCY RESOLUTION
25	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	20	TRH	TEH	720-RB	MAI	TEH	2.30	.00	1	1.31	16	99	>> POSITIVE ID ESTABLISHED <<
25	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	20	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	4.86	31	9	RESULT OF DISCREPANCY RESOLUTION
27	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	20	TRH	TEH	720-RB	SAI	TEH	2.30	.00	1	.64	40	99	>> POSITIVE ID ESTABLISHED <<
27	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	20	TSH	TEH	720-WC	CRI	TRH	.00	.00	C20	4.53	30	9	RESULT OF DISCREPANCY RESOLUTION
28	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	20	TRH	TEH	720-RB	MAI	TEH	2.36	.00	1	1.36	28	99	>> POSITIVE ID ESTABLISHED <<
28	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	20	TSH	TEH	720-WC	CRI	TRH	.00	.00	C10	3.91	56	9	RESULT OF DISCREPANCY RESOLUTION
30	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	20	TRH	TEH	720-RB	SAI	TEH	2.41	.00	1	1.67	19	99	>> POSITIVE ID ESTABLISHED <<
30	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	20	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	6.02	37	9	RESULT OF DISCREPANCY RESOLUTION
31	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	20	TRH	TEH	720-RB	MAI	TEH	2.26	.00	1	1.10	25	99	>> POSITIVE ID ESTABLISHED <<
31	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
37	20	TEH	TEC	720-EL	30	2C	.10	.00	M1	1.45	103	6	
37	20	TEH	TEC	720-EL	27	2C	.17	.00	M1	1.41	116	16	
6	21	TSH	TEH	720-WC	CRI	TRH	.00	.00	C10	2.79	26	9	RESULT OF DISCREPANCY RESOLUTION
6	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	21	TRH	TEH	720-RB	MAI	TEH	2.47	.00	1	.69	17	101	RESULT OF DISCREPANCY RESOLUTION
6	21												>> POSITIVE ID ESTABLISHED <<
6	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	21	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	2.77	43	9	RESULT OF DISCREPANCY RESOLUTION
9	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	21	TRH	TEH	720-RB	MAI	TEH	2.34	.00	1	.45	46	101	>> POSITIVE ID ESTABLISHED <<
9	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	21	TSH	TEH	720-WC	CRI	TRH	.00	.00	C12	2.45	25	9	RESULT OF DISCREPANCY RESOLUTION
10	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	21	TRH	TEH	720-RB	MAI	TEH	2.48	.00	1	.37	33	101	>> POSITIVE ID ESTABLISHED <<
10	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
12	21	TSH	TEH	720-WC	CRI	TRH	.00	.00	C2	3.18	32	9	RESULT OF DISCREPANCY RESOLUTION
12	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	21	TRH	TEH	720-RB	SAI	TEH	2.23	.00	1	.34	11	101	>> POSITIVE ID ESTABLISHED <<
12	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	21	TSH	TEH	720-WC	CRI	TRH	.00	.00	C24	5.41	22	9	RESULT OF DISCREPANCY RESOLUTION
13	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	21	TRH	TEH	720-RB	MAI	TEH	2.59	.00	1	.47	27	101	>> POSITIVE ID ESTABLISHED <<
13	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	21	TSH	TEH	720-WC	CRI	TRH	.00	.00	C2	5.05	33	9	RESULT OF DISCREPANCY RESOLUTION
18	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	21	TRH	TEH	720-RB	MAI	TEH	2.53	.00	1	.83	20	99	>> POSITIVE ID ESTABLISHED <<
18	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	21	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	3.14	31	9	RESULT OF DISCREPANCY RESOLUTION
33	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	21	TRH	TEH	720-RB	COI	TEH	2.08	.00	1	1.27	12	99	>> POSITIVE ID ESTABLISHED <<
33	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	22	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	3.47	51	11	RESULT OF DISCREPANCY RESOLUTION
3	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	22	7H	TEH	720-EL	DI	TEH	19.57	.00	M1	.29	107	91	
3	22	TRH	TEH	720-RB	SAI	TEH	2.38	.00	1	2.61	16	99	>> POSITIVE ID ESTABLISHED <<
3	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	22	TSH	TEH	720-WC	CRI	TRH	.00	.00	C10	2.75	142	11	RESULT OF DISCREPANCY RESOLUTION
6	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	22	TRH	TEH	720-RB	MAI	TEH	2.64	.00	4	2.24	6	101	RESULT OF LAR
6	22												>> POSITIVE ID ESTABLISHED <<
6	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	22	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	3.02	24	11	RESULT OF DISCREPANCY RESOLUTION
10	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	22	TRH	TEH	720-RB	MAI	TEH	2.59	.00	1	1.35	16	101	>> POSITIVE ID ESTABLISHED <<
10	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	22	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	1.77	40	11	RESULT OF DISCREPANCY RESOLUTION
11	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	22	TRH	TEH	720-RB	MAI	TEH	2.72	.00	1	.48	195	101	>> POSITIVE ID ESTABLISHED <<
11	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	22	TEH	TEC	720-EL	ORI	TEH	5.00	.00	5	12.48	17	20	RESULT OF DISCREPANCY RESOLUTION
25	22	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	3.80	31	11	RESULT OF DISCREPANCY RESOLUTION
25	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	22	TRH	TEH	720-RB	MAI	TEH	2.43	.00	1	1.14	13	101	>> POSITIVE ID ESTABLISHED <<
25	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
28	22	TSH	TEH	720-WC	CRI	TRH	.00	.00	C12	7.34	34	11	RESULT OF DISCREPANCY RESOLUTION
28	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	22	TRH	TEH	720-RB	MAI	TEH	2.36	.00	1	.62	33	101	>> POSITIVE ID ESTABLISHED <<
28	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	22	TSH	TEH	720-WC	CRI	TRH	.00	.00	C4	4.62	31	11	RESULT OF DISCREPANCY RESOLUTION
29	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	22	TRH	TEH	720-RB	MAI	TEH	2.43	.00	1	.26	57	101	>> POSITIVE ID ESTABLISHED <<
29	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	22	TSH	TEH	720-WC	CRI	TRH	.00	.00	C8	4.02	34	11	RESULT OF DISCREPANCY RESOLUTION
30	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	22	TRH	TEH	720-RB	MAI	TEH	2.32	.00	4	1.62	27	101	RESULT OF LAR
30	22												>> POSITIVE ID ESTABLISHED <<
30	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
37	22	TEH	TEC	720-EL	44	2C	.00	.00	M1	3.62	100	6	RETEST - RETEST FOR POSITIVE ID
37	22	TEH	TEC	720-EL	44	2C	.00	.00	M1	3.38	102	16	RETEST - RETEST FOR POSITIVE ID
39	22	TEH	TEC	720-EL	INR	TEH	20.90	.00	M1			6	RESULT OF DISCREPANCY RESOLUTION
39	22	TEH	TEC	720-EL	33	1C	.07	.00	M1	1.17	109	6	RESULT OF DISCREPANCY RESOLUTION
1	23	7H	TEH	720-EL	DRI	TEH	2.25	.00	M1	34.91	184	87	
2	23	7H	TEH	720-EL	DRI	TEH	2.46	.00	M1	42.95	185	87	RESULT OF DISCREPANCY RESOLUTION
10	23	TSH	TEH	720-WC	CRI	TRH	.00	.00	C24	10.45	21	11	RESULT OF DISCREPANCY RESOLUTION
10	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	23	TRH	TEH	720-RB	MAI	TEH	2.42	.00	1	.37	33	101	>> POSITIVE ID ESTABLISHED <<
10	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	23	TEH	TEC	720-EL	DRI	TEH	2.75	.00	5	14.48	5	10	RESULT OF DISCREPANCY RESOLUTION
14	23	TSH	TEH	720-WC	CRI	TRH	.00	.00	C2	3.47	44	11	RESULT OF DISCREPANCY RESOLUTION
14	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	23	TRH	TEH	720-RB	MAI	TEH	2.45	.00	1	.83	31	101	>> POSITIVE ID ESTABLISHED <<
14	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	23	TSH	TEH	720-WC	CRI	TRH	.00	.00	C21	4.85	28	11	RESULT OF DISCREPANCY RESOLUTION
17	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	23	TRH	TEH	720-RB	MAI	TEH	2.50	.00	1	2.06	9	101	>> POSITIVE ID ESTABLISHED <<
17	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	23	TSH	TEH	720-WC	CRI	TRH	.00	.00	C14	3.58	29	11	RESULT OF DISCREPANCY RESOLUTION
28	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	23	TRH	TEH	720-RB	MAI	TEH	2.58	.00	1	1.45	14	117	>> POSITIVE ID ESTABLISHED <<
28	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

SG - 13 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

22-Sep-95 2:11

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
30	23	TSH	TEH	720-WC	CRI	TRH	.00	.00	C14	4.14	32	11	RESULT OF DISCREPANCY RESOLUTION
30	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	23	TRH	TEH	720-RB	MAI	TEH	2.57	.00	1	.63	31	101	>> POSITIVE ID ESTABLISHED <<
30	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	23	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.39	37	10	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
39	23	TEH	TEC	720-EL	INR	2H	.02	.00	M1			6	RESULT OF DISCREPANCY RESOLUTION
39	23	TEH	TEC	720-EL	INR	2H	.00	.00	M1			28	RESULT OF DISCREPANCY RESOLUTION
3	24	TSH	TEH	720-WC	CRI	TRH	.00	.00	C6	6.34	28	13	RESULT OF DISCREPANCY RESOLUTION
3	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	24	7H	TEH	720-EL	DRI	TEH	2.45	.00	M1	56.12	189	91	RESULT OF DISCREPANCY RESOLUTION
3	24	TRH	TEH	720-RB	MAI	TEH	2.48	.00	1	1.51	29	99	>> POSITIVE ID ESTABLISHED <<
3	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	24	TSH	TEH	720-WC	CRI	TRH	.00	.00	C21	.08	145	13	RESULT OF DISCREPANCY RESOLUTION
14	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	24	TRH	TEH	720-RB	MAI	TEH	2.51	.00	1	.54	16	101	>> POSITIVE ID ESTABLISHED <<
14	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	24	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	1.89	55	11	RESULT OF DISCREPANCY RESOLUTION
19	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	24	TRH	TEH	720-RB	MAI	TEH	2.49	.00	1	.33	33	101	>> POSITIVE ID ESTABLISHED <<
19	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	24	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	2.66	32	11	RESULT OF DISCREPANCY RESOLUTION
20	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	24	TRH	TEH	720-RB	MAI	TEH	2.54	.00	1	.24	48	101	>> POSITIVE ID ESTABLISHED <<
20	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	24	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	2.72	46	11	RESULT OF DISCREPANCY RESOLUTION
23	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	24	TRH	TEH	720-RB	MAI	TEH	2.61	.00	1	.88	18	101	>> POSITIVE ID ESTABLISHED <<
23	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	24	TSH	TEH	720-WC	CRI	TRH	.00	.00	C2	12.87	35	11	RESULT OF DISCREPANCY RESOLUTION
24	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	24	TRH	TEH	720-RB	MAI	TEH	2.79	.00	1	1.98	22	101	>> POSITIVE ID ESTABLISHED <<
24	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	24	STH	TEC	720-EL	17	AV3	.00	.00	M2	.41		18	
30	24	TSH	TEH	720-WC	CRI	TRH	.00	.00	C10	2.00	75	11	RESULT OF DISCREPANCY RESOLUTION
30	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	24	TRH	TEH	720-RB	MAI	TEH	2.53	.00	1	1.25	10	101	RESULT OF DISCREPANCY RESOLUTION
30	24												>> POSITIVE ID ESTABLISHED <<
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

22-Sep-95 2:11

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
30	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
34	24	TSH	TEH	720-WC	CDI	TSH	-.75	.00	C9	7.54	48	11	RESULT OF DISCREPANCY RESOLUTION
34	24												>> POSITIVE ID ESTABLISHED <<
34	24	TEH	TEC	720-EL	95	TEH	20.57	.00	M1	3.73	39	28	RESULT OF DISCREPANCY RESOLUTION
34	24												RETEST - RETEST FOR POSITIVE ID
34	24	TSH	TSH	720-ZC	SAI	TSH	-.80	.00	4	2.58	43	119	>> POSITIVE ID ESTABLISHED <<
3	25	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	2.40	54	13	RESULT OF DISCREPANCY RESOLUTION
3	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	25	7H	TEH	720-EL	DIN	TEH	20.14	.00	M1	.37	77	91	RESULT OF DISCREPANCY RESOLUTION
3	25	7H	TEH	720-EL	DRI	TEH	2.47	.00	M1	42.77	187	91	RESULT OF DISCREPANCY RESOLUTION
3	25	TRH	TEH	720-RB	COI	TEH	2.32	.00	1	1.28	16	99	>> POSITIVE ID ESTABLISHED <<
3	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	25	TSH	TEH	720-WC	CRI	TRH	.00	.00	C24	9.24	23	13	RESULT OF DISCREPANCY RESOLUTION
7	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	25	TRH	TEH	720-RB	MAI	TEH	2.54	.00	1	2.90	20	101	>> POSITIVE ID ESTABLISHED <<
7	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	25	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	4.85	36	13	RESULT OF DISCREPANCY RESOLUTION
8	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	25	TRH	TEH	720-RB	MAI	TEH	2.49	.00	1	.75	24	101	>> POSITIVE ID ESTABLISHED <<
8	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	25	TSH	TEH	720-WC	CRI	TRH	.00	.00	C2	3.71	40	13	RESULT OF DISCREPANCY RESOLUTION
10	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	25	TRH	TEH	720-RB	MAI	TEH	2.38	.00	1	.37	33	101	>> POSITIVE ID ESTABLISHED <<
10	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	25	TSH	TEH	720-WC	CRI	TRH	.00	.00	C2	3.07	41	13	RESULT OF DISCREPANCY RESOLUTION
20	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	25	TRH	TEH	720-RB	MAI	TEH	2.57	.00	1	1.20	22	101	>> POSITIVE ID ESTABLISHED <<
20	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	25	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	2.68	38	13	RESULT OF DISCREPANCY RESOLUTION
26	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	25	TRH	TEH	720-RB	MAI	TEH	2.47	.00	1	.54	27	101	>> POSITIVE ID ESTABLISHED <<
26	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	25	TSH	TEH	720-WC	CRI	TRH	.00	.00	C20	3.81	28	13	RESULT OF DISCREPANCY RESOLUTION
31	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	25	TRH	TEH	720-RB	MAI	TEH	2.57	.00	1	1.54	15	101	>> POSITIVE ID ESTABLISHED <<
31	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
38	25	TEH	TEC	720-EL	9	1C	-.02	.00	M1	.76	125	18	RESULT OF DISCREPANCY RESOLUTION
39	25	TEH	TEC	720-EL	14	1C	-.02	.00	M1	.42	122	18	RESULT OF DISCREPANCY RESOLUTION
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

SG - 13 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

22-Sep-95 2:11

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
1	26	TSH	TEH	720-WC	CRI	TRH	.00	.00	C22	5.94	24	13	RESULT OF DISCREPANCY RESOLUTION
1	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	26	7H	TEH	720-EL	DRI	TEH	2.06	.00	M1	30.68	183	87	RESULT OF DISCREPANCY RESOLUTION
1	26	TRH	TEH	720-RB	MAI	TEH	2.28	.00	1	.90	16	99	>> POSITIVE ID ESTABLISHED <<
1	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	26	TSH	TEH	720-WC	CRI	TRH	.00	.00	C1	6.65	34	13	RESULT OF DISCREPANCY RESOLUTION
2	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	26	7H	TEH	720-EL	DRI	TEH	2.07	.00	M1	49.70	187	87	RESULT OF DISCREPANCY RESOLUTION
2	26	TRH	TEH	720-RB	MAI	TEH	2.38	.00	1	2.85	15	99	>> POSITIVE ID ESTABLISHED <<
2	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	26	TSH	TEH	720-WC	CRI	TRH	.00	.00	C18	3.33	23	13	RESULT OF DISCREPANCY RESOLUTION
6	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	26	TRH	TEH	720-RB	SAI	TEH	2.58	.00	1	2.86	187	101	>> POSITIVE ID ESTABLISHED <<
6	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	26	TSH	TEH	720-WC	CRI	TRH	.00	.00	C10	2.00	32	13	RESULT OF DISCREPANCY RESOLUTION
11	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	26	TRH	TEH	720-RB	MAI	TEH	2.48	.00	1	1.11	12	101	>> POSITIVE ID ESTABLISHED <<
11	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	26	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	2.64	39	13	RESULT OF DISCREPANCY RESOLUTION
15	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	26	TRH	TEH	720-RB	MAI	TEH	2.55	.00	1	.42	13	101	>> POSITIVE ID ESTABLISHED <<
15	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	26	TSH	TEH	720-WC	CRI	TRH	.00	.00	C14	5.11	28	13	RESULT OF DISCREPANCY RESOLUTION
24	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	26	TRH	TEH	720-RB	MAI	TEH	2.50	.00	1	.66	23	101	>> POSITIVE ID ESTABLISHED <<
24	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	26	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	3.43	25	13	RESULT OF DISCREPANCY RESOLUTION
27	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	26	TRH	TEH	720-RB	MAI	TEH	2.48	.00	1	.52	22	101	>> POSITIVE ID ESTABLISHED <<
27	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
40	26	TEH	TEC	720-EL	DI	1C	.00	.00	M1	.49	103	28	RESULT OF DISCREPANCY RESOLUTION
2	27	TSH	TEH	720-WC	CRI	TRH	.00	.00	C6	6.37	72	13	RESULT OF DISCREPANCY RESOLUTION
2	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	27	7H	TEH	720-EL	DRI	TEH	2.19	.00	M1	43.52	186	87	RESULT OF DISCREPANCY RESOLUTION
2	27	TRH	TEH	720-RB	MAI	TEH	2.47	.00	1	2.02	25	99	>> POSITIVE ID ESTABLISHED <<
2	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	27	TSH	TEH	720-WC	CRI	TRH	.00	.00	C4	4.97	25	13	RESULT OF DISCREPANCY RESOLUTION
5	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

SG - 13 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

22-Sep-95 2:11

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
5	27	TRH	TEH	720-RB	COI	TEH	2.30	.00	1	.33	35	101	>> POSITIVE ID ESTABLISHED <<
5	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	27	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	2.95	47	13	RESULT OF DISCREPANCY RESOLUTION
7	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	27	TRH	TEH	720-RB	COI	TEH	2.50	.00	1	.37	33	101	>> POSITIVE ID ESTABLISHED <<
7	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	27	TSH	TEH	720-WC	CRI	TRH	.00	.00	C15	3.03	33	13	RESULT OF DISCREPANCY RESOLUTION
8	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	27	TRH	TEH	720-RB	MAI	TEH	2.55	.00	1	2.05	7	101	>> POSITIVE ID ESTABLISHED <<
8	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	27	TSH	TEH	720-WC	CRI	TRH	.00	.00	C2	2.37	59	13	RESULT OF DISCREPANCY RESOLUTION
9	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	27	TRH	TEH	720-RB	MAI	TEH	2.45	.00	1	.37	33	101	>> POSITIVE ID ESTABLISHED <<
9	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	27	TSH	TEH	720-WC	CRI	TRH	.00	.00	C10	3.80	50	13	RESULT OF DISCREPANCY RESOLUTION
12	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	27	TRH	TEH	720-RB	MAI	TEH	2.58	.00	1	.73	33	101	>> POSITIVE ID ESTABLISHED <<
12	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	27	TSH	TEH	720-WC	CRI	TRH	.00	.00	C23	7.27	31	13	RESULT OF DISCREPANCY RESOLUTION
15	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	27	TRH	TEH	720-RB	MAI	TEH	2.44	.00	1	1.14	23	101	>> POSITIVE ID ESTABLISHED <<
15	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	27	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	2.20	42	13	RESULT OF DISCREPANCY RESOLUTION
31	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	27	TEH	TEC	720-EL	INR	TEH	20.49	.00	M1			22	RESULT OF DISCREPANCY RESOLUTION
31	27	TRH	TEH	720-RB	MAI	TEH	2.48	.00	1	.83	12	101	>> POSITIVE ID ESTABLISHED <<
31	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
35	27	TSH	TEC	720-EL	PI	2H	.00	.00	M1	.76	60	18	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
35	27	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.50	74	118	
39	27	TEH	TEC	720-EL	30	1C	-.05	.00	M1	.52	111	18	RESULT OF DISCREPANCY RESOLUTION
2	28	7H	TEH	720-EL	DRI	TEH	2.19	.00	M1	48.15	188	87	
4	28	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	7.95	36	15	RESULT OF DISCREPANCY RESOLUTION
4	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	28	TEH	TEC	720-EL	DIM	TSH	-.35	.00	M1	1.01	27	58	
4	28	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.95	89	58	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
4	28	TRH	TEH	720-RB	MAI	TEH	2.30	.00	1	.82	54	101	>> POSITIVE ID ESTABLISHED <<
4	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

SG - 13 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

22-Sep-95 2:11

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
10	28	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	2.40	44	15	RESULT OF DISCREPANCY RESOLUTION
10	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	28	TRH	TEH	720-RB	SAI	TEH	2.59	.00	1	.37	33	101	>> POSITIVE ID ESTABLISHED <<
10	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	28	TEH	TEC	720-EL	INR	TSH	.73	.00	M1			22	RESULT OF DISCREPANCY RESOLUTION
18	28	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	.69	63	15	RESULT OF DISCREPANCY RESOLUTION
18	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	28	TRH	TEH	720-RB	MAI	TEH	2.59	.00	1	.51	29	101	>> POSITIVE ID ESTABLISHED <<
18	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	28	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	1.81	55	15	RESULT OF DISCREPANCY RESOLUTION
19	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	28	TRH	TEH	720-RB	MAI	TEH	2.65	.00	1	.46	42	101	>> POSITIVE ID ESTABLISHED <<
19	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	28	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	4.59	41	15	RESULT OF DISCREPANCY RESOLUTION
23	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	28	TRH	TEH	720-RB	MAI	TEH	2.69	.00	1	1.18	18	101	>> POSITIVE ID ESTABLISHED <<
23	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	28	TSH	TEH	720-WC	CRI	TRH	.00	.00	C20	2.43	24	15	RESULT OF DISCREPANCY RESOLUTION
29	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	28	TRH	TEH	720-RB	MAI	TEH	2.53	.00	1	.97	16	101	>> POSITIVE ID ESTABLISHED <<
29	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	28	TSH	TEH	720-WC	CRI	TRH	.00	.00	C19	2.85	22	15	RESULT OF DISCREPANCY RESOLUTION
30	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	28	TRH	TEH	720-RB	MAI	TEH	2.59	.00	1	.89	10	101	>> POSITIVE ID ESTABLISHED <<
30	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	28	TSH	TEH	720-WC	CRI	TRH	.00	.00	C24	5.06	26	15	RESULT OF DISCREPANCY RESOLUTION
31	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	28	TRH	TEH	720-RB	MAI	TEH	2.57	.00	1	1.66	15	101	>> POSITIVE ID ESTABLISHED <<
31	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	28	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	.53	88	15	RESULT OF DISCREPANCY RESOLUTION
32	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	28	TRH	TEH	720-RB	MAI	TEH	2.50	.00	1	.39	19	101	>> POSITIVE ID ESTABLISHED <<
32	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
38	28	TEH	TEC	720-EL	PI	5H	.00	.00	M1	.21	133	22	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
38	28	TEH	TEC	720-EL	29	AV2	.00	.00	M2	1.20		22	RESULT OF DISCREPANCY RESOLUTION
38	28	TEH	TEC	720-EL	30	AV3	.00	.00	M2	1.34		22	RESULT OF DISCREPANCY RESOLUTION
38	28	TEH	TEC	720-EL	26	AV4	.00	.00	M2	1.00		22	RESULT OF DISCREPANCY RESOLUTION
2	29	TSH	TEH	720-WC	CRI	TRH	.00	.00	C19	7.31	30	15	RESULT OF DISCREPANCY RESOLUTION

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

D. C. Cook UIR95

AEP -13/51

INSPECTION: August 95

22-Sep-95 12:11

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
2	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	29	7H	TEH	720-EL	DRI	TEH	2.04	.00	M1	49.35	187	87	
2	29	TRH	TEH	720-RB	MAI	TEH	2.49	.00	1	1.20	24	99	>> POSITIVE ID ESTABLISHED <<
2	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	29	TSH	TEH	720-WC	CRI	TRH	.00	.00	C6	6.20	38	15	RESULT OF DISCREPANCY RESOLUTION
3	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	29	7H	TEH	720-EL	DRI	TEH	2.56	.00	M1	50.15	189	91	
3	29	TRH	TEH	720-RB	COI	TEH	2.61	.00	1	1.10	25	99	>> POSITIVE ID ESTABLISHED <<
3	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	29	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	13.86	42	15	RESULT OF DISCREPANCY RESOLUTION
4	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	29	TRH	TEH	720-RB	MAI	TEH	2.38	.00	1	2.39	18	99	>> POSITIVE ID ESTABLISHED <<
4	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	29	TSH	TEH	720-WC	CRI	TRH	.00	.00	C21	.93	94	15	RESULT OF DISCREPANCY RESOLUTION
5	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	29	TRH	TEH	720-RB	SAI	TEH	2.37	.00	1	1.13	17	99	>> POSITIVE ID ESTABLISHED <<
5	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	29	TEH	TEC	720-EL	DRI	TRH	.00	.00	5	11.24	15	8	RESULT OF DISCREPANCY RESOLUTION
9	29	TSH	TEH	720-WC	CRI	TRH	.00	.00	C21	4.89	28	15	RESULT OF DISCREPANCY RESOLUTION
9	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	29	TRH	TEH	720-RB	MAI	TEH	2.51	.00	1	1.95	9	101	>> POSITIVE ID ESTABLISHED <<
9	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	29	TEH	TEC	720-EL	DRI	TRH	.00	.00	5	17.02	6	8	RESULT OF DISCREPANCY RESOLUTION
14	29	TEH	TEC	720-EL	DRI	TRH	.00	.00	5	17.85	9	8	RESULT OF DISCREPANCY RESOLUTION
14	29	TSH	TEH	720-WC	CRI	TRH	.00	.00	C15	5.10	28	15	RESULT OF DISCREPANCY RESOLUTION
14	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	29	TRH	TEH	720-RB	MAI	TEH	2.61	.00	1	1.27	16	101	>> POSITIVE ID ESTABLISHED <<
14	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	29	TEH	TEC	720-EL	DRI	TRH	.00	.00	5	15.21	14	8	RESULT OF DISCREPANCY RESOLUTION
15	29	TSH	TEH	720-WC	CRI	TRH	.00	.00	C4	5.52	25	15	RESULT OF DISCREPANCY RESOLUTION
15	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	29	TRH	TEH	720-RB	MAI	TEH	2.59	.00	1	1.13	15	101	>> POSITIVE ID ESTABLISHED <<
15	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	29	TSH	TEH	720-WC	CRI	TRH	.00	.00	C23	5.01	23	15	RESULT OF DISCREPANCY RESOLUTION
20	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	29	TRH	TEH	720-RB	MAI	TEH	2.65	.00	1	.78	30	101	>> POSITIVE ID ESTABLISHED <<
20	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	29	TSH	TEH	720-WC	CRI	TRH	.00	.00	C10	2.72	57	15	RESULT OF DISCREPANCY RESOLUTION
23	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

SG - 13 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

22-Sep-95 2:11

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
23	29	TRH	TEH	720-RB MAI	TEH		2.69	.00	1	1.15	20	101	>> POSITIVE ID ESTABLISHED <<
23	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	29	TEH	TEC	720-EL DRI	TRH		.00	.00	5	13.95	14	4	RESULT OF DISCREPANCY RESOLUTION
29	29	TSH	TEH	720-WC CRI	TRH		.00	.00	C22	3.39	26	15	RESULT OF DISCREPANCY RESOLUTION
29	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	29	TRH	TEH	720-RB MAI	TEH		2.49	.00	1	1.02	19	101	>> POSITIVE ID ESTABLISHED <<
29	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
34	29	TEH	TEC	720-EL DIN	TEH		20.81	.00	M1	.49	85	4	RESULT OF DISCREPANCY RESOLUTION
34	29	TEH	TEC	720-EL PI	1H		.00	.00	M1	.98	55	4	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
39	29	TEH	TEC	720-EL INR	TEH		20.62	.00	M1	.23	93	4	RESULT OF DISCREPANCY RESOLUTION
39	29	TEH	TEC	720-EL PI	1H		.00	.00	M1	.36	75	4	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
1	30	TSH	TEH	720-WC CRI	TRH		.00	.00	C10	1.51	76	17	RESULT OF DISCREPANCY RESOLUTION
1	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	30	7H	TEH	720-EL DRI	TEH		2.26	.00	M1	32.47	183	87	
1	30	TRH	TEH	720-RB MAI	TEH		2.43	.00	1	1.10	31	99	>> POSITIVE ID ESTABLISHED <<
1	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	30	TSH	TEH	720-WC CRI	TRH		.00	.00	C10	2.23	121	17	RESULT OF DISCREPANCY RESOLUTION
2	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	30	7H	TEH	720-EL DRI	TEH		2.34	.00	M1	36.70	187	87	RESULT OF DISCREPANCY RESOLUTION
2	30	TRH	TEH	720-RB SAI	TEH		2.42	.00	1	1.02	16	99	>> POSITIVE ID ESTABLISHED <<
2	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	30	TSH	TEH	720-WC CRI	TRH		.00	.00	C15	2.79	31	17	RESULT OF DISCREPANCY RESOLUTION
5	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	30	TRH	TEH	720-RB SAI	TEH		2.37	.00	1	2.02	7	99	>> POSITIVE ID ESTABLISHED <<
5	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	30	TSH	TEH	720-WC CRI	TRH		.00	.00	C22	7.88	14	17	RESULT OF DISCREPANCY RESOLUTION
7	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	30	TRH	TEH	720-RB MAI	TEH		2.61	.00	1	1.01	20	101	>> POSITIVE ID ESTABLISHED <<
7	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	30	TSH	TEH	720-WC CRI	TRH		.00	.00	C21	5.22	23	17	RESULT OF DISCREPANCY RESOLUTION
15	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	30	TRH	TEH	720-RB MAI	TEH		2.70	.00	1	.51	22	101	>> POSITIVE ID ESTABLISHED <<
15	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	30	TSH	TEH	720-WC CRI	TRH		.00	.00	C13	2.06	51	17	RESULT OF DISCREPANCY RESOLUTION
20	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	30	TRH	TEH	720-RB MAI	TEH		2.67	.00	1	.39	38	101	>> POSITIVE ID ESTABLISHED <<
20	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	30	TSH	TEH	720-WC CRI	TRH		.00	.00	C2	1.02	76	17	RESULT OF DISCREPANCY RESOLUTION

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------



ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
24	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	30	TRH	TEH	720-RB	MAI	TEH	2.69	.00	1	.40	23	101	>> POSITIVE ID ESTABLISHED <<
24	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	30	TSH	TEH	720-WC	CRI	TRH	.00	.00	C20	5.58	29	17	RESULT OF DISCREPANCY RESOLUTION
26	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	30	TRH	TEH	720-RB	MAI	TEH	2.67	.00	1	.30	56	101	>> POSITIVE ID ESTABLISHED <<
26	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	30	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	2.20	45	17	RESULT OF DISCREPANCY RESOLUTION
27	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	30	TRH	TEH	720-RB	MAI	TEH	2.62	.00	1	1.03	16	101	>> POSITIVE ID ESTABLISHED <<
27	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	30	TSH	TEH	720-WC	CRI	TRH	.00	.00	C23	3.15	30	17	RESULT OF DISCREPANCY RESOLUTION
29	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	30	TRH	TEH	720-RB	MAI	TEH	2.74	.00	1	.69	9	101	>> POSITIVE ID ESTABLISHED <<
29	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	30	TSH	TEH	720-WC	CRI	TRH	.00	.00	C2	13.51	43	17	RESULT OF DISCREPANCY RESOLUTION
30	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	30	TRH	TEH	720-RB	MAI	TEH	2.77	.00	1	.46	26	101	>> POSITIVE ID ESTABLISHED <<
30	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	30	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	3.93	52	17	RESULT OF DISCREPANCY RESOLUTION
31	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	30	TRH	TEH	720-RB	MAI	TEH	2.61	.00	1	.88	17	117	>> POSITIVE ID ESTABLISHED <<
31	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
36	30	TEH	TEC	720-EL	INR	TEH	20.54	.00	M1			32	RESULT OF DISCREPANCY RESOLUTION
42	30	TEH	TEC	720-EL	23	1C	-.10	.00	M1	1.09	118	32	RESULT OF DISCREPANCY RESOLUTION
1	31	TSH	TEH	720-WC	CRI	TRH	.00	.00	C12	1.64	50	17	RESULT OF DISCREPANCY RESOLUTION
1	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	31	TH	TEH	720-EL	DRI	TEH	2.06	.00	M1	31.96	182	87	
1	31	TRH	TEH	720-RB	MAI	TEH	2.55	.00	1	1.89	17	105	>> POSITIVE ID ESTABLISHED <<
1	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	31	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	15.26	45	17	RESULT OF DISCREPANCY RESOLUTION
7	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	31	TRH	TEH	720-RB	MAI	TEH	3.08	.00	1	2.89	22	117	>> POSITIVE ID ESTABLISHED <<
7	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	31	TSH	TEH	720-WC	CRI	TRH	.00	.00	C22	7.52	27	17	RESULT OF DISCREPANCY RESOLUTION
8	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	31	TRH	TEH	720-RB	MAI	TEH	2.98	.00	1	1.77	24	117	>> POSITIVE ID ESTABLISHED <<
8	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

SG - 13 LISTING OF ALL INDICATIONS

D. C. Cook UIR95

AEP -13/51

INSPECTION: August 95

22-Sep-95 2:11

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
15	31	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	3.89	47	17	RESULT OF DISCREPANCY RESOLUTION
15	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	31	TRH	TEH	720-RB	MAI	TEH	2.67	.00	1	.57	26	103	>> POSITIVE ID ESTABLISHED <<
15	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	31	TSH	TEH	720-WC	CRI	TRH	.00	.00	C22	5.80	31	17	RESULT OF DISCREPANCY RESOLUTION
20	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	31	TRH	TEH	720-RB	MAI	TEH	2.63	.00	1	.80	28	103	>> POSITIVE ID ESTABLISHED <<
20	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	31	TSH	TEH	720-WC	CRI	TRH	.00	.00	C17	3.54	41	17	RESULT OF DISCREPANCY RESOLUTION
23	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	31	TRH	TEH	720-RB	MAI	TEH	2.64	.00	1	.88	29	103	>> POSITIVE ID ESTABLISHED <<
23	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	31	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	8.56	38	17	RESULT OF DISCREPANCY RESOLUTION
25	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	31	TRH	TEH	720-RB	MAI	TEH	2.54	.00	1	2.05	23	103	>> POSITIVE ID ESTABLISHED <<
25	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	31	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	3.44	40	17	RESULT OF DISCREPANCY RESOLUTION
29	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	31	TRH	TEH	720-RB	MAI	TEH	2.71	.00	1	.78	15	101	>> POSITIVE ID ESTABLISHED <<
29	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	31	TSH	TEH	720-WC	CRI	TRH	.00	.00	C24	1.28	190	17	RESULT OF DISCREPANCY RESOLUTION
33	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	31	TRH	TEH	720-RB	MAI	TEH	2.61	.00	1	.28	56	101	>> POSITIVE ID ESTABLISHED <<
33	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	32	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	5.53	32	19	RESULT OF DISCREPANCY RESOLUTION
1	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	32	TH	TEH	720-EL	DRI	TEH	2.15	.00	M1	36.47	185	87	RESULT OF DISCREPANCY RESOLUTION
1	32	TRH	TEH	720-RB	MAI	TEH	2.56	.00	1	.81	19	105	>> POSITIVE ID ESTABLISHED <<
1	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	32	TSH	TEH	720-WC	CRI	TRH	.00	.00	C19	4.54	14	19	RESULT OF DISCREPANCY RESOLUTION
2	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	32	TH	TEH	720-EL	DRI	TEH	2.16	.00	M1	47.88	188	87	RESULT OF DISCREPANCY RESOLUTION
2	32	TRH	TEH	720-RB	MAI	TEH	2.36	.00	1	1.13	12	105	>> POSITIVE ID ESTABLISHED <<
2	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	32	TSH	TEH	720-WC	CRI	TRH	.00	.00	C8	4.27	63	19	RESULT OF DISCREPANCY RESOLUTION
9	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	32	TRH	TEH	720-RB	MAI	TEH	2.78	.00	1	.89	28	103	>> POSITIVE ID ESTABLISHED <<
9	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------



ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
11	32	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	3.92	33	19	RESULT OF DISCREPANCY RESOLUTION
11	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	32	TRH	TEH	720-RB	SAI	TEH	2.78	.00	1	1.29	18	103	>> POSITIVE ID ESTABLISHED <<
11	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	32	TSH	TEH	720-WC	CRI	TRH	.00	.00	C15	5.79	29	19	RESULT OF DISCREPANCY RESOLUTION
14	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	32	TEH	TEC	720-EL	DRI	TEH	1.27	.00	M1	52.41	180	36	RESULT OF DISCREPANCY RESOLUTION
14	32	TRH	TEH	720-RB	MAI	TEH	2.55	.00	1	.52	28	103	>> POSITIVE ID ESTABLISHED <<
14	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	32	TSH	TEH	720-WC	CRI	TRH	.00	.00	C10	3.37	47	19	RESULT OF DISCREPANCY RESOLUTION
15	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	32	TRH	TEH	720-RB	SAI	TEH	2.63	.00	1	.27	109	103	>> POSITIVE ID ESTABLISHED <<
15	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
35	32	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.66	48	36	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
2	33	7H	TEH	720-EL	INR	TEH	2.82	.00	M1	6.65	19	87	RESULT OF DISCREPANCY RESOLUTION
7	33	TSH	TEH	720-WC	CRI	TRH	.00	.00	C7	3.48	29	19	RESULT OF DISCREPANCY RESOLUTION
7	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	33	TRH	TEH	720-RB	SAI	TEH	2.39	.00	1	1.21	15	105	>> POSITIVE ID ESTABLISHED <<
7	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	33	TSH	TEH	720-WC	CRI	TRH	.00	.00	C7	2.65	22	19	RESULT OF DISCREPANCY RESOLUTION
9	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	33	TRH	TEH	720-RB	MAI	TEH	2.65	.00	1	.72	21	103	>> POSITIVE ID ESTABLISHED <<
9	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	33	TSH	TEH	720-WC	CRI	TRH	.00	.00	C2	3.98	45	19	RESULT OF DISCREPANCY RESOLUTION
10	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	33	TRH	TEH	720-RB	MAI	TEH	2.49	.00	1	.29	20	103	>> POSITIVE ID ESTABLISHED <<
10	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	33	TSH	TEH	720-WC	CRI	TRH	.00	.00	C6	2.90	40	19	RESULT OF DISCREPANCY RESOLUTION
12	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	33	TRH	TEH	720-RB	MAI	TEH	2.60	.00	1	.61	31	103	>> POSITIVE ID ESTABLISHED <<
12	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	33	TSH	TEH	720-WC	CRI	TRH	.00	.00	C2	3.98	53	19	RESULT OF DISCREPANCY RESOLUTION
18	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	33	TRH	TEH	720-RB	SAI	TEH	2.57	.00	1	2.07	8	103	>> POSITIVE ID ESTABLISHED <<
18	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	33	TSH	TEH	720-WC	CRI	TRH	.00	.00	C21	2.37	43	19	RESULT OF DISCREPANCY RESOLUTION
24	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	33	TRH	TEH	720-RB	MAI	TEH	2.65	.00	1	.86	14	103	>> POSITIVE ID ESTABLISHED <<
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
24	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	33	TSH	TEH	720-WC	CRI	TRH	.00	.00	C14	5.46	35	19	RESULT OF DISCREPANCY RESOLUTION
25	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	33	TRH	TEH	720-RB	MAI	TEH	2.64	.00	1	1.46	20	103	>> POSITIVE ID ESTABLISHED <<
25	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	33	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	5.12	34	19	RESULT OF DISCREPANCY RESOLUTION
29	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	33	TRH	TEH	720-RB	MAI	TEH	2.53	.00	1	1.36	17	103	>> POSITIVE ID ESTABLISHED <<
29	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	33	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	4.33	43	19	RESULT OF DISCREPANCY RESOLUTION
30	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	33	TRH	TEH	720-RB	MAI	TEH	2.42	.00	1	1.28	18	103	>> POSITIVE ID ESTABLISHED <<
30	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	33	TSH	TEH	720-WC	CRI	TRH	.00	.00	C21	2.33	17	19	RESULT OF DISCREPANCY RESOLUTION
32	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	33	TRH	TEH	720-RB	MAI	TEH	2.29	.00	1	.26	9	103	>> POSITIVE ID ESTABLISHED <<
32	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
34	33	TEH	TEC	720-EL	INR	TEH	14.20	.00	M1			26	RESULT OF DISCREPANCY RESOLUTION
42	33	TEH	TEC	720-EL	23	1C	.07	.00	M1	.89	116	26	RESULT OF DISCREPANCY RESOLUTION
3	34	TSH	TEH	720-WC	CRI	TRH	.00	.00	C22	5.47	17	21	RESULT OF DISCREPANCY RESOLUTION
3	34												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	34	TRH	TEH	720-RB	SAI	TEH	2.41	.00	1	1.23	17	105	>> POSITIVE ID ESTABLISHED <<
3	34												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	34	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	8.56	30	21	RESULT OF DISCREPANCY RESOLUTION
6	34												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	34	TRH	TEH	720-RB	MAI	TEH	2.57	.00	1	2.60	13	105	>> POSITIVE ID ESTABLISHED <<
6	34												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	34	TSH	TEH	720-WC	CRI	TRH	.00	.00	C12	9.01	50	21	RESULT OF DISCREPANCY RESOLUTION
8	34												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	34	TRH	TEH	720-RB	SAI	TEH	2.48	.00	1	10.88	2	105	>> POSITIVE ID ESTABLISHED <<
8	34												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	34	TEH	TEC	720-EL	DRI	TEH	2.58	.00	M1	45.59	174	118	RESULT OF DISCREPANCY RESOLUTION
14	34	TSH	TEH	720-WC	CRI	TRH	.00	.00	C21	7.48	18	19	RESULT OF DISCREPANCY RESOLUTION
14	34												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	34	TEH	TEC	720-EL	DRI	TEH	1.55	.00	M1	53.08	180	36	RESULT OF DISCREPANCY RESOLUTION
14	34	TRH	TEH	720-RB	MAI	TEH	2.54	.00	1	.74	44	103	>> POSITIVE ID ESTABLISHED <<
14	34												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

SG - 13 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

22-Sep-95 2:11

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
18	34	TSH	TEH	720-WC	CRI	TRH	.00	.00	C14	1.70	17	19	RESULT OF DISCREPANCY RESOLUTION
18	34												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	34	TRH	TEH	720-RB	MAI	TEH	2.50	.00	1	.44	26	103	>> POSITIVE ID ESTABLISHED <<
18	34												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	34	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.74	114	36	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
29	34	TSH	TEH	720-WC	CRI	TRH	.00	.00	C2	4.39	60	19	RESULT OF DISCREPANCY RESOLUTION
29	34												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	34	TEH	TEC	720-EL	DRI	TEH	1.14	.00	M1	52.80	178	36	RESULT OF DISCREPANCY RESOLUTION
29	34	TRH	TEH	720-RB	MAI	TEH	2.61	.00	1	1.86	11	103	>> POSITIVE ID ESTABLISHED <<
29	34												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	34	TSH	TEH	720-WC	CRI	TRH	.00	.00	C2	2.84	43	19	RESULT OF DISCREPANCY RESOLUTION
32	34												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	34	TRH	TEH	720-RB	MAI	TEH	2.38	.00	1	.52	26	103	>> POSITIVE ID ESTABLISHED <<
32	34												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
44	34	TEH	TEC	720-EL	44	2C	.12	.00	M1	4.13	99	26	RETEST - RETEST FOR POSITIVE ID
2	35	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	2.74	35	21	RESULT OF DISCREPANCY RESOLUTION
2	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	35	7H	TEH	720-EL	DRI	TEH	2.25	.00	M1	41.94	187	87	RESULT OF DISCREPANCY RESOLUTION
2	35	TRH	TEH	720-RB	SAI	TEH	2.41	.00	1	.74	18	105	>> POSITIVE ID ESTABLISHED <<
2	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	35	TSH	TEH	720-WC	CRI	TRH	.00	.00	C17	3.05	64	21	RESULT OF DISCREPANCY RESOLUTION
3	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	35	7H	TEH	720-EL	DRI	TEH	2.28	.00	M1	42.48	187	91	
3	35	TRH	TEH	720-RB	MAI	TEH	2.41	.00	1	1.29	19	105	>> POSITIVE ID ESTABLISHED <<
3	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	35	TSH	TEH	720-WC	CRI	TRH	.00	.00	C23	2.68	35	21	RESULT OF DISCREPANCY RESOLUTION
5	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	35	TRH	TEH	720-RB	SAI	TEH	2.45	.00	1	1.00	18	105	>> POSITIVE ID ESTABLISHED <<
5	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	35	TSH	TEH	720-WC	CRI	TRH	.00	.00	C10	3.69	35	21	RESULT OF DISCREPANCY RESOLUTION
8	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	35	TRH	TEH	720-RB	SAI	TEH	2.49	.00	1	.51	25	105	>> POSITIVE ID ESTABLISHED <<
8	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	35	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	3.96	58	21	RESULT OF DISCREPANCY RESOLUTION
15	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	35	TRH	TEH	720-RB	MAI	TEH	2.60	.00	1	.86	22	105	>> POSITIVE ID ESTABLISHED <<
15	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	35	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	3.64	52	21	RESULT OF DISCREPANCY RESOLUTION

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
23	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	35	TRH	TEH	720-RB	SAI	TEH	2.57	.00	1	1.78	20	103	>> POSITIVE ID ESTABLISHED <<
23	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	35	TSH	TEH	720-WC	CRI	TRH	.00	.00	C12	6.38	26	21	RESULT OF DISCREPANCY RESOLUTION
24	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	35	TRH	TEH	720-RB	MAI	TEH	2.53	.00	1	1.26	21	103	>> POSITIVE ID ESTABLISHED <<
24	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	35	TSH	TEH	720-WC	CRI	TRH	.00	.00	C10	3.16	65	21	RESULT OF DISCREPANCY RESOLUTION
25	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	35	TRH	TEH	720-RB	MAI	TEH	2.54	.00	1	1.59	21	103	>> POSITIVE ID ESTABLISHED <<
25	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	35	TSH	TEH	720-WC	CRI	TRH	.00	.00	C22	2.31	39	21	RESULT OF DISCREPANCY RESOLUTION
33	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	35	TRH	TEH	720-RB	MAI	TEH	2.60	.00	1	.67	28	103	>> POSITIVE ID ESTABLISHED <<
33	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
36	35	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.39	105	26	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
4	36	TSH	TEH	720-WC	CRI	TRH	.00	.00	C4	14.34	25	21	RESULT OF DISCREPANCY RESOLUTION
4	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	36	TRH	TEH	720-RB	MAI	TEH	2.51	.00	1	2.71	18	105	>> POSITIVE ID ESTABLISHED <<
4	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	36	TSH	TEH	720-WC	CRI	TRH	.00	.00	C15	1.19	47	21	RESULT OF DISCREPANCY RESOLUTION
7	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	36	TRH	TEH	720-RB	MAI	TEH	2.68	.00	1	.50	16	105	>> POSITIVE ID ESTABLISHED <<
7	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	36	TSH	TEH	720-WC	CRI	TRH	.00	.00	C10	2.42	84	21	RESULT OF DISCREPANCY RESOLUTION
8	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	36	TRH	TEH	720-RB	SAI	TEH	2.59	.00	1	.46	29	105	>> POSITIVE ID ESTABLISHED <<
8	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	36	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	3.61	33	21	RESULT OF DISCREPANCY RESOLUTION
14	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	36	TRH	TEH	720-RB	SAI	TEH	2.38	.00	1	.84	22	105	>> POSITIVE ID ESTABLISHED <<
14	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	36	TSH	TEH	720-WC	CRI	TRH	.00	.00	C15	1.87	39	21	RESULT OF DISCREPANCY RESOLUTION
18	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	36	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.54	44	44	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
18	36	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.47	82	44	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
18	36	TRH	TEH	720-RB	MAI	TEH	2.79	.00	1	.30	31	117	>> POSITIVE ID ESTABLISHED <<
18	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
23	36	TSH	TEH	720-WC	CRI	TRH	.00	.00	C10	2.57	34	21	RESULT OF DISCREPANCY RESOLUTION
23	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	36	TRH	TEH	720-RB	MAI	TEH	2.51	.00	1	.59	25	103	>> POSITIVE ID ESTABLISHED <<
23	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	36	TSH	TEH	720-WC	CRI	TRH	.00	.00	C14	2.40	26	21	RESULT OF DISCREPANCY RESOLUTION
26	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	36	TRH	TEH	720-RB	SAI	TEH	2.48	.00	1	.59	23	103	>> POSITIVE ID ESTABLISHED <<
26	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	36	TSH	TEH	720-WC	CRI	TRH	.00	.00	C21	4.11	26	21	RESULT OF DISCREPANCY RESOLUTION
27	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	36	TRH	TEH	720-RB	MAI	TEH	2.52	.00	1	.62	21	103	>> POSITIVE ID ESTABLISHED <<
27	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	36	TSH	TEH	720-WC	CRI	TRH	.00	.00	C17	3.30	67	21	RESULT OF DISCREPANCY RESOLUTION
28	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	36	TRH	TEH	720-RB	MAI	TEH	2.53	.00	1	1.51	18	103	>> POSITIVE ID ESTABLISHED <<
28	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	36	TSH	TEH	720-WC	CRI	TRH	.00	.00	C17	1.23	107	21	RESULT OF DISCREPANCY RESOLUTION
30	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	36	TRH	TEH	720-RB	MAI	TEH	2.56	.00	1	.28	88	103	>> POSITIVE ID ESTABLISHED <<
30	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	36	TEH	TEC	720-EL	DRI	TEH	2.14	.00	M1	43.98	179	44	RESULT OF DISCREPANCY RESOLUTION
32	36	TSH	TEH	720-WC	CRI	TRH	.00	.00	C15	2.75	34	21	RESULT OF DISCREPANCY RESOLUTION
32	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	36	TRH	TEH	720-RB	MAI	TEH	2.57	.00	1	.66	32	103	>> POSITIVE ID ESTABLISHED <<
32	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
44	36	TEH	TEC	720-EL	24	2C	-.22	.00	M1	1.87	119	44	RESULT OF DISCREPANCY RESOLUTION
2	37	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	4.30	35	21	RESULT OF DISCREPANCY RESOLUTION
2	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	37	7H	TEH	720-EL	DRI	TEH	2.16	.00	M1	39.27	186	87	RESULT OF DISCREPANCY RESOLUTION
2	37	TRH	TEH	720-RB	SAI	TEH	2.54	.00	1	1.04	15	105	>> POSITIVE ID ESTABLISHED <<
2	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	37	7H	TEH	720-EL	INR	TEH	2.75	.00	M1			91	RESULT OF DISCREPANCY RESOLUTION
4	37	TSH	TEH	720-WC	CRI	TRH	.00	.00	C10	3.90	39	21	RESULT OF DISCREPANCY RESOLUTION
4	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	37	TRH	TEH	720-RB	MAI	TEH	2.77	.00	1	1.02	17	105	>> POSITIVE ID ESTABLISHED <<
4	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	37	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	3.25	49	23	RESULT OF DISCREPANCY RESOLUTION
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

SG - 13 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

22-Sep-95 2:12

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
5	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	37	TRH	TEH	720-RB	COI	TEH	2.61	.00	1	.91	23	105	>> POSITIVE ID ESTABLISHED <<
5	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	37	TSH	TEH	720-WC	CRI	TRH	.00	.00	C4	3.22	21	23	RESULT OF DISCREPANCY RESOLUTION
7	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	37	TRH	TEH	720-RB	SAI	TEH	2.64	.00	4	.47	8	105	>> POSITIVE ID ESTABLISHED <<
7	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	37	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	4.99	78	23	RESULT OF DISCREPANCY RESOLUTION
9	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	37	TRH	TEH	720-RB	MAI	TEH	2.62	.00	1	1.04	37	105	>> POSITIVE ID ESTABLISHED <<
9	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	37	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	3.25	48	23	RESULT OF DISCREPANCY RESOLUTION
14	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	37	TRH	TEH	720-RB	MAI	TEH	2.12	.00	1	.99	18	105	>> POSITIVE ID ESTABLISHED <<
14	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	37	TSH	TEH	720-WC	CRI	TRH	.00	.00	C4	6.86	38	23	RESULT OF DISCREPANCY RESOLUTION
15	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	37	TRH	TEH	720-RB	MAI	TEH	2.65	.00	1	1.43	23	105	>> POSITIVE ID ESTABLISHED <<
15	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	37	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	2.28	28	23	RESULT OF DISCREPANCY RESOLUTION
20	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	37	TRH	TEH	720-RB	MAI	TEH	2.64	.00	1	.51	33	103	>> POSITIVE ID ESTABLISHED <<
20	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	37	TSH	TEH	720-WC	CRI	TRH	.00	.00	C18	1.85	45	23	RESULT OF DISCREPANCY RESOLUTION
25	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	37	TRH	TEH	720-RB	MAI	TEH	2.56	.00	1	.23	142	103	>> POSITIVE ID ESTABLISHED <<
25	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	37	TSH	TEH	720-WC	CRI	TRH	.00	.00	C17	4.63	57	23	RESULT OF DISCREPANCY RESOLUTION
28	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	37	TRH	TEH	720-RB	MAI	TEH	2.48	.00	1	1.54	22	103	>> POSITIVE ID ESTABLISHED <<
28	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	37	TSH	TEH	720-WC	CRI	TRH	.00	.00	C12	5.30	39	23	RESULT OF DISCREPANCY RESOLUTION
32	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	37	TRH	TEH	720-RB	MAI	TEH	2.71	.00	1	1.49	28	103	>> POSITIVE ID ESTABLISHED <<
32	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	38	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	.90	92	23	RESULT OF DISCREPANCY RESOLUTION
2	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	38	TRH	TEH	720-RB	SAI	TEH	2.48	.00	1	.46	13	105	>> POSITIVE ID ESTABLISHED <<
2	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

22-Sep-95 2:12

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
3	38	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	12.74	44	23	RESULT OF DISCREPANCY RESOLUTION
3	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	38	7H	TEH	720-EL	DRI	TEH	2.45	.00	M1	31.76	181	91	
3	38	TRH	TEH	720-RB	MAI	TEH	2.66	.00	1	2.12	26	105	>> POSITIVE ID ESTABLISHED <<
3	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	38	TSH	TEH	720-WC	CRI	TRH	.00	.00	C4	7.44	27	23	RESULT OF DISCREPANCY RESOLUTION
4	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	38	TRH	TEH	720-RB	MAI	TEH	2.57	.00	1	1.26	27	105	>> POSITIVE ID ESTABLISHED <<
4	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	38	TSH	TEH	720-WC	CRI	TRH	.00	.00	C6	3.43	48	23	RESULT OF DISCREPANCY RESOLUTION
5	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	38	TRH	TEH	720-RB	MAI	TEH	2.60	.00	1	.95	16	105	>> POSITIVE ID ESTABLISHED <<
5	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	38	TSH	TEH	720-WC	CRI	TRH	.00	.00	C1	2.43	22	23	RESULT OF DISCREPANCY RESOLUTION
10	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	38	TRH	TEH	720-RB	MAI	TEH	2.72	.00	1	1.28	13	105	>> POSITIVE ID ESTABLISHED <<
10	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	38	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	4.30	38	23	RESULT OF DISCREPANCY RESOLUTION
15	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	38	TRH	TEH	720-RB	MAI	TEH	2.66	.00	1	.89	22	105	>> POSITIVE ID ESTABLISHED <<
15	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	38	TSH	TEH	720-WC	CRI	TRH	.00	.00	C8	.78	62	23	RESULT OF DISCREPANCY RESOLUTION
16	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	38	TRH	TEH	720-RB	MAI	TEH	2.71	.00	1	.28	34	105	>> POSITIVE ID ESTABLISHED <<
16	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	38	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.91	50	44	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
29	38	TEH	TEC	720-EL	DRI	TEH	2.59	.00	M1	47.13	179	44	RESULT OF DISCREPANCY RESOLUTION
31	38	TSH	TEH	720-WC	CRI	TRH	.00	.00	C10	3.62	28	23	RESULT OF DISCREPANCY RESOLUTION
31	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	38	TRH	TEH	720-RB	MAI	TEH	2.70	.00	1	.93	20	103	>> POSITIVE ID ESTABLISHED <<
31	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	38	TSH	TEH	720-WC	CRI	TRH	.00	.00	C5	.91	40	23	RESULT OF LAR
32	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	38	TSH	TEH	720-WC	CRI	TRH	.00	.00	C5	1.31	47	25	RESULT OF DISCREPANCY RESOLUTION
32	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	38	TRH	TEH	720-RB	MAI	TEH	2.13	.00	1	1.09	17	103	>> POSITIVE ID ESTABLISHED <<
32	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

SG - 13 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

22-Sep-95 2:12

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
39	38	TSH	TEH	720-WC	CDI	TEH	20.41	.00	C6	2.26	71	23	RESULT OF DISCREPANCY RESOLUTION
39	38												RETEST - RETEST FOR POSITIVE ID
39	38	TEH	TEC	720-EL	DI	TEH	20.62	.00	M1	.29	85	44	RESULT OF DISCREPANCY RESOLUTION
39	38	TSH	TSH	720-ZC	SAI	TSH	-1.18	.00	4	.36	45	119	>> POSITIVE ID ESTABLISHED <<
41	38	TEH	TEC	720-EL	17	AV3	.00	.00	M2	.46		44	RESULT OF DISCREPANCY RESOLUTION
41	38	TEH	TEC	720-EL	27	AV4	.00	.00	M2	1.12		44	RESULT OF DISCREPANCY RESOLUTION
43	38	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.54	116	44	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
2	39	TSH	TEH	720-WC	CRI	TRH	.00	.00	C23	3.92	25	23	RESULT OF DISCREPANCY RESOLUTION
2	39												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	39	7H	TEH	720-EL	CRI	TEH	2.26	.00	M1	39.84	186	87	
2	39	TRH	TEH	720-RB	SAI	TEH	2.69	.00	1	.87	16	105	>> POSITIVE ID ESTABLISHED <<
2	39												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	39	TSH	TEH	720-WC	CRI	TRH	.00	.00	C21	2.45	50	23	RESULT OF DISCREPANCY RESOLUTION
3	39												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	39	TRH	TEH	720-RB	SAI	TEH	2.65	.00	1	.91	13	105	>> POSITIVE ID ESTABLISHED <<
3	39												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	39	TSH	TEH	720-WC	CRI	TRH	.00	.00	C23	3.01	34	23	RESULT OF DISCREPANCY RESOLUTION
7	39												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	39	TRH	TEH	720-RB	MAI	TEH	2.82	.00	1	.71	20	105	>> POSITIVE ID ESTABLISHED <<
7	39												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	39	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	4.50	30	23	RESULT OF DISCREPANCY RESOLUTION
8	39												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	39	TRH	TEH	720-RB	SAI	TEH	2.66	.00	1	.38	23	105	>> POSITIVE ID ESTABLISHED <<
8	39												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	39	TSH	TEH	720-WC	CRI	TRH	.00	.00	C15	3.92	41	23	RESULT OF DISCREPANCY RESOLUTION
9	39												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	39	TRH	TEH	720-RB	MAI	TEH	2.81	.00	1	.97	16	105	>> POSITIVE ID ESTABLISHED <<
9	39												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	39	TSH	TEH	720-WC	CRI	TRH	.00	.00	C2	3.13	48	23	RESULT OF DISCREPANCY RESOLUTION
14	39												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	39	TRH	TEH	720-RB	MAI	TEH	1.74	.00	1	.61	41	105	>> POSITIVE ID ESTABLISHED <<
14	39												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	39	TSH	TEH	720-WC	CRI	TRH	.00	.00	C15	2.66	26	23	RESULT OF DISCREPANCY RESOLUTION
15	39												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	39	TRH	TEH	720-RB	SAI	TEH	2.70	.00	1	.90	14	105	>> POSITIVE ID ESTABLISHED <<
15	39												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	39	TSH	TEH	720-WC	CRI	TRH	.00	.00	C17	1.41	89	25	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	39	TRH	TEH	720-RB	MAI	TEH	2.49	.00	1	.20	30	103	>> POSITIVE ID ESTABLISHED <<
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
25	39												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	39	TSH	TEH	720-WC	CRI	TRH	.00	.00	C21	13.87	40	25	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	39	TRH	TEH	720-RB	MAI	TEH	2.54	.00	1	2.65	29	103	>> POSITIVE ID ESTABLISHED <<
26	39												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	39	TSH	TEH	720-WC	CRI	TRH	.00	.00	C2	7.89	31	25	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	39	TRH	TEH	720-RB	MAI	TEH	2.64	.00	1	1.88	11	103	>> POSITIVE ID ESTABLISHED <<
31	39												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	39	TSH	TEH	720-WC	CRI	TRH	.00	.00	C20	1.55	26	63	RESULT OF DISCREPANCY RESOLUTION
32	39												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	39	TRH	TEH	720-RB	MAI	TEH	2.62	.00	1	1.77	10	103	>> POSITIVE ID ESTABLISHED <<
32	39												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	40	TSH	TEH	720-WC	CRI	TRH	.00	.00	C10	1.50	70	33	RESULT OF DISCREPANCY RESOLUTION
1	40												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	40	7H	TEH	720-EL	DRI	TEH	2.32	.00	M1	37.36	184	87	
1	40	TRH	TEH	720-RB	MAI	TEH	2.62	.00	1	.87	23	105	>> POSITIVE ID ESTABLISHED <<
1	40												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	40	TSH	TEH	720-WC	CRI	TRH	.00	.00	C2	4.85	37	27	RESULT OF DISCREPANCY RESOLUTION
4	40												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	40	TRH	TEH	720-RB	MAI	TEH	2.53	.00	1	2.82	15	105	>> POSITIVE ID ESTABLISHED <<
4	40												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	40	TSH	TEH	720-WC	CRI	TRH	.00	.00	C12	6.79	58	27	RESULT OF DISCREPANCY RESOLUTION
9	40												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	40	TRH	TEH	720-RB	SAI	TEH	2.67	.00	1	5.10	13	105	>> POSITIVE ID ESTABLISHED <<
9	40												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	40	TSH	TEH	720-WC	CRI	TRH	.00	.00	C15	4.63	39	25	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	40	TSH	TEH	720-WC	CRI	TRH	.00	.00	C6	3.08	28	27	RESULT OF DISCREPANCY RESOLUTION
11	40												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	40	TRH	TEH	720-RB	MAI	TEH	2.52	.00	1	.49	20	105	>> POSITIVE ID ESTABLISHED <<
11	40												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	40	TSH	TEH	720-WC	CRI	TRH	.00	.00	C7	2.87	37	25	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	40	TRH	TEH	720-RB	MAI	TEH	2.67	.00	1	.51	25	105	>> POSITIVE ID ESTABLISHED <<
13	40												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	40	TSH	TEH	720-WC	CRI	TRH	.00	.00	C6	7.08	27	25	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	40	TRH	TEH	720-RB	COI	TEH	2.04	.00	1	.64	32	105	>> POSITIVE ID ESTABLISHED <<
14	40												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	40	TSH	TEH	720-WC	CRI	TRH	.00	.00	C3	2.55	36	25	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	40	TRH	TEH	720-RB	MAI	TEH	2.44	.00	1	.71	21	105	>> POSITIVE ID ESTABLISHED <<
15	40												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

22-Sep-95 2:12

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
16	40	TEH	TEC	720-EL	INR	TSH	.00	.00	M1			48	RESULT OF DISCREPANCY RESOLUTION
24	40	TSH	TEH	720-WC	CRI	TRH	.00	.00	C10	11.26	44	25	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	40	TRH	TEH	720-RB	MAI	TEH	1.97	.00	1	2.58	20	103	>> POSITIVE ID ESTABLISHED <<
24	40												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	40	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	1.80	58	25	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	40	TRH	TEH	720-RB	MAI	TEH	2.61	.00	1	1.38	17	103	>> POSITIVE ID ESTABLISHED <<
25	40												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	40	TSH	TEH	720-WC	CRI	TRH	.00	.00	C23	2.83	36	25	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	40	TRH	TEH	720-RB	MAI	TEH	2.50	.00	1	.79	16	103	>> POSITIVE ID ESTABLISHED <<
26	40												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	40	TSH	TEH	720-WC	CRI	TRH	.00	.00	C6	2.57	44	25	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	40	TRH	TEH	720-RB	MAI	TEH	2.75	.00	1	.45	23	103	>> POSITIVE ID ESTABLISHED <<
31	40												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
35	40	TEH	TEC	720-EL	16	AV1	.00	.00	M2	.41	55	48	
41	40	TEH	TEC	720-EL	21	TSH	.73	.00	1	.28	147	44	RESULT OF DISCREPANCY RESOLUTION
41	40	TEH	TEC	720-EL	13	TSH	.73	.00	M1	.28	127	48	RESULT OF DISCREPANCY RESOLUTION
1	41	TSH	TEH	720-WC	CRI	TRH	.00	.00	C23	3.13	24	33	RESULT OF DISCREPANCY RESOLUTION
1	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	41	7H	TEH	720-EL	DRI	TEH	2.33	.00	M1	33.70	184	87	
1	41	TRH	TEH	720-RB	MAI	TEH	2.46	.00	1	1.31	13	105	>> POSITIVE ID ESTABLISHED <<
1	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	41	TSH	TEH	720-WC	CRI	TRH	.00	.00	C24	2.87	26	27	RESULT OF DISCREPANCY RESOLUTION
2	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	41	7H	TEH	720-EL	DRI	TEH	2.51	.00	M1	48.97	187	87	
2	41	TRH	TEH	720-RB	MAI	TEH	2.59	.00	1	.42	28	105	>> POSITIVE ID ESTABLISHED <<
2	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	41	TSH	TEH	720-WC	CRI	TRH	.00	.00	C21	3.68	33	27	RESULT OF DISCREPANCY RESOLUTION
5	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	41	TRH	TEH	720-RB	MAI	TEH	2.59	.00	1	2.78	15	105	>> POSITIVE ID ESTABLISHED <<
5	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	41	TSH	TEH	720-WC	CRI	TRH	.00	.00	C17	1.69	39	27	RESULT OF DISCREPANCY RESOLUTION
8	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	41	TRH	TEH	720-RB	SAI	TEH	2.75	.00	1	.22	42	105	>> POSITIVE ID ESTABLISHED <<
8	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	41	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	1.92	57	27	RESULT OF DISCREPANCY RESOLUTION
9	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
9	41	TRH	TEH	720-RB	SAI	TEH	2.79	.00	1	1.94	11	105	>> POSITIVE ID ESTABLISHED <<
9	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	41	TSH	TEH	720-WC	CRI	TRH	.00	.00	C14	2.32	29	27	RESULT OF DISCREPANCY RESOLUTION
11	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	41	TRH	TEH	720-RB	MAI	TEH	2.79	.00	1	.99	18	105	>> POSITIVE ID ESTABLISHED <<
11	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	41	TSH	TEH	720-WC	CRI	TRH	.00	.00	C22	2.48	43	27	RESULT OF DISCREPANCY RESOLUTION
13	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	41	TRH	TEH	720-RB	SAI	TEH	2.61	.00	1	2.02	17	105	>> POSITIVE ID ESTABLISHED <<
13	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	41	TEH	TEC	720-EL	PI	1H	.00	.00	M1	1.31	102	38	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
31	41	TSH	TEH	720-WC	CRI	TRH	.00	.00	C1	1.04	54	27	RESULT OF DISCREPANCY RESOLUTION
31	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	41	TRH	TEH	720-RB	MAI	TEH	2.74	.00	1	.69	14	103	>> POSITIVE ID ESTABLISHED <<
31	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	41	TEH	TEC	720-EL	16	AV1	.00	.00	M2	.37		38	
33	41	TSH	TEH	720-WC	CRI	TRH	.00	.00	C5	1.67	26	27	RESULT OF DISCREPANCY RESOLUTION
33	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	41	TRH	TEH	720-RB	SAI	TEH	2.48	.00	1	.35	26	103	>> POSITIVE ID ESTABLISHED <<
33	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
37	41	TEH	TEC	720-EL	12	AV1	.00	.00	M2	.22		38	
38	41	TEH	TEC	720-EL	10	AV4	.00	.00	M2	.17		38	
41	41	TEH	TEC	720-EL	17	AV1	.00	.00	M2	.41		34	RESULT OF DISCREPANCY RESOLUTION
2	42	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	9.44	44	27	RESULT OF DISCREPANCY RESOLUTION
2	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	42	7H	TEH	720-EL	DRI	TEH	2.11	.00	M1	41.48	184	87	RESULT OF DISCREPANCY RESOLUTION
2	42	TRH	TEH	720-RB	SAI	TEH	2.79	.00	1	4.69	13	105	>> POSITIVE ID ESTABLISHED <<
2	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	42	TSH	TEH	720-WC	CRI	TRH	.00	.00	C4	2.09	29	27	RESULT OF DISCREPANCY RESOLUTION
5	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	42	TRH	TEH	720-RB	MAI	TEH	2.63	.00	1	.50	31	105	>> POSITIVE ID ESTABLISHED <<
5	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	42	TSH	TEH	720-WC	CRI	TRH	.00	.00	C1	1.48	63	27	RESULT OF DISCREPANCY RESOLUTION
8	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	42	TRH	TEH	720-RB	MAI	TEH	2.66	.00	1	1.29	16	105	>> POSITIVE ID ESTABLISHED <<
8	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

22-Sep-95 2:12

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
10	42	TSH	TEH	720-WC	CRI	TRH	.00	.00	C1	1.26	55	27	RESULT OF DISCREPANCY RESOLUTION
10	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	42	TRH	TEH	720-RB	MAI	TEH	2.68	.00	1	.64	34	105	>> POSITIVE ID ESTABLISHED <<
10	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	42	TSH	TEH	720-WC	CRI	TRH	.00	.00	C23	4.25	45	27	RESULT OF DISCREPANCY RESOLUTION
11	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	42	TRH	TEH	720-RB	MAI	TEH	2.78	.00	1	.89	33	105	>> POSITIVE ID ESTABLISHED <<
11	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	42	TSH	TEH	720-WC	CRI	TRH	.00	.00	C3	2.50	32	27	RESULT OF DISCREPANCY RESOLUTION
20	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	42	TRH	TEH	720-RB	MAI	TEH	2.57	.00	1	.72	18	103	>> POSITIVE ID ESTABLISHED <<
20	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	42	TSH	TEH	720-WC	CRI	TRH	.00	.00	C3	2.55	21	27	RESULT OF DISCREPANCY RESOLUTION
23	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	42	TRH	TEH	720-RB	MAI	TEH	2.81	.00	1	.95	10	117	>> POSITIVE ID ESTABLISHED <<
23	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	42	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	1.98	37	27	RESULT OF DISCREPANCY RESOLUTION
27	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	42	TRH	TEH	720-RB	COI	TEH	2.67	.00	1	.63	24	105	>> POSITIVE ID ESTABLISHED <<
27	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	42	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	2.93	31	27	RESULT OF DISCREPANCY RESOLUTION
31	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	42	TRH	TEH	720-RB	SAI	TEH	2.66	.00	1	1.05	18	103	>> POSITIVE ID ESTABLISHED <<
31	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
38	42	TEH	TEC	720-EL	29	AV3	-.02	.00	M2	1.32	50	48	RESULT OF DISCREPANCY RESOLUTION
38	42	TEH	TEC	720-EL	15	AV3	.76	.00	M2	.35	99	48	RESULT OF DISCREPANCY RESOLUTION
38	42	TEH	TEC	720-EL	28	AV4	-.90	.00	M2	1.16	89	48	RESULT OF DISCREPANCY RESOLUTION
1	43	TSH	TEH	720-WC	CRI	TRH	.00	.00	C7	8.00	40	33	RESULT OF DISCREPANCY RESOLUTION
1	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	43	TH	TEH	720-EL	DRI	TEH	2.59	.00	M1	37.13	184	87	RESULT OF DISCREPANCY RESOLUTION
1	43	TRH	TEH	720-RB	SAI	TEH	2.58	.00	1	2.81	17	105	>> POSITIVE ID ESTABLISHED <<
1	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	43	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	3.70	57	27	RESULT OF DISCREPANCY RESOLUTION
4	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	43	TRH	TEH	720-RB	MAI	TEH	2.80	.00	1	2.91	13	105	>> POSITIVE ID ESTABLISHED <<
4	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	43	TEH	TEC	720-EL	DRI	TRH	.00	.00	5	17.69	14	8	RESULT OF DISCREPANCY RESOLUTION
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
7	43	TEH	TEC	720-EL	DRI	TRH	.00	.00	5	16.54	5	8	RESULT OF DISCREPANCY RESOLUTION
15	43	TSH	TEH	720-WC	CRI	TRH	.00	.00	C14	1.15	63	27	RESULT OF DISCREPANCY RESOLUTION
15	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	43	TRH	TEH	720-RB	MAI	TEH	2.51	.00	1	.71	17	105	>> POSITIVE ID ESTABLISHED <<
15	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	43	TSH	TEH	720-WC	CRI	TRH	.00	.00	C6	1.72	35	27	RESULT OF DISCREPANCY RESOLUTION
21	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	43	TRH	TEH	720-RB	SAI	TEH	2.54	.00	1	1.10	29	103	>> POSITIVE ID ESTABLISHED <<
21	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	43	TRH	TEH	720-RB	SAI	TEH	2.82	.00	1	1.01	33	105	>> POSITIVE ID ESTABLISHED <<
21	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	43	TSH	TEH	720-WC	CRI	TRH	.00	.00	C1	2.56	43	27	RESULT OF DISCREPANCY RESOLUTION
25	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	43	TRH	TEH	720-RB	MAI	TEH	2.76	.00	1	.75	16	105	>> POSITIVE ID ESTABLISHED <<
25	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	43	TSH	TEH	720-WC	CRI	TRH	.00	.00	C8	3.49	33	27	RESULT OF DISCREPANCY RESOLUTION
30	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	43	TRH	TEH	720-RB	MAI	TEH	2.57	.00	1	.91	39	103	>> POSITIVE ID ESTABLISHED <<
30	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
35	43	TSH	TEH	720-WC	CRI	TRH	.00	.00	C14	.86	81	27	RESULT OF DISCREPANCY RESOLUTION
35	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
35	43	TRH	TEH	720-RB	SAI	TEH	2.57	.00	1	1.16	21	103	>> POSITIVE ID ESTABLISHED <<
35	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
39	43	TEH	TEC	720-EL	12	AV2	.00	.00	M2	.21	47	38	
4	44	TSH	TEH	720-WC	CRI	TRH	.00	.00	C1	3.01	51	31	RESULT OF DISCREPANCY RESOLUTION
4	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	44	TRH	TEH	720-RB	MAI	TEH	2.60	.00	1	3.79	10	105	>> POSITIVE ID ESTABLISHED <<
4	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	44	TEH	TEC	720-EL	DRI	TRH	.00	.00	5	13.85	7	8	RESULT OF DISCREPANCY RESOLUTION
7	44	TSH	TEH	720-WC	CRI	TRH	.00	.00	C1	4.09	53	31	RESULT OF DISCREPANCY RESOLUTION
7	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	44	TRH	TEH	720-RB	SAI	TEH	2.75	.00	1	2.18	20	105	>> POSITIVE ID ESTABLISHED <<
7	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	44	TSH	TEH	720-WC	CRI	TRH	.00	.00	C19	1.75	32	31	RESULT OF DISCREPANCY RESOLUTION
12	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	44	TRH	TEH	720-RB	MAI	TEH	2.88	.00	1	.54	25	105	>> POSITIVE ID ESTABLISHED <<
12	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	44	TSH	TEH	720-WC	CRI	TRH	.00	.00	C12	1.06	53	31	RESULT OF DISCREPANCY RESOLUTION

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

22-Sep-95 2:12

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
20	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	44	TRH	TEH	720-RB	MAI	TEH	2.53	.00	1	.42	63	103	>> POSITIVE ID ESTABLISHED <<
20	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	44	TSH	TEH	720-WC	CRI	TRH	.00	.00	C24	2.73	23	29	RESULT OF DISCREPANCY RESOLUTION
21	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	44	TRH	TEH	720-RB	MAI	TEH	2.65	.00	1	.64	41	103	>> POSITIVE ID ESTABLISHED <<
21	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	44	TSH	TEH	720-WC	CRI	TRH	.00	.00	C12	1.87	43	29	RESULT OF DISCREPANCY RESOLUTION
26	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	44	TRH	TEH	720-RB	MAI	TEH	2.74	.00	1	1.09	24	105	>> POSITIVE ID ESTABLISHED <<
26	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	44	TSH	TEH	720-WC	CRI	TRH	.00	.00	C4	1.72	31	29	RESULT OF DISCREPANCY RESOLUTION
27	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	44	TRH	TEH	720-RB	SAI	TEH	2.65	.00	1	.58	18	105	>> POSITIVE ID ESTABLISHED <<
27	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	44	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	1.22	36	29	RESULT OF DISCREPANCY RESOLUTION
32	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	44	TRH	TEH	720-RB	MAI	TEH	2.38	.00	1	1.04	17	103	>> POSITIVE ID ESTABLISHED <<
32	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	44	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	1.64	54	29	RESULT OF DISCREPANCY RESOLUTION
33	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	44	TRH	TEH	720-RB	MAI	TEH	2.41	.00	1	.66	26	103	>> POSITIVE ID ESTABLISHED <<
33	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	45	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	5.38	41	31	RESULT OF DISCREPANCY RESOLUTION
2	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	45	7H	TEH	720-EL	DRI	TEH	2.46	.00	M1	23.76	173	97	
2	45	TRH	TEH	720-RB	MAI	TEH	2.70	.00	1	3.16	13	105	>> POSITIVE ID ESTABLISHED <<
2	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	45	TSH	TEH	720-WC	CRI	TRH	.00	.00	C21	4.02	34	31	RESULT OF DISCREPANCY RESOLUTION
3	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	45	7H	TEH	720-EL	DRI	TEH	2.65	.00	M1	58.36	185	97	
3	45	TRH	TEH	720-RB	MAI	TEH	2.72	.00	1	.67	30	105	>> POSITIVE ID ESTABLISHED <<
3	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	45	TSH	TEH	720-WC	CRI	TRH	.00	.00	C21	6.14	56	31	RESULT OF DISCREPANCY RESOLUTION
4	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	45	TRH	TEH	720-RB	MAI	TEH	2.36	.00	1	5.64	19	105	>> POSITIVE ID ESTABLISHED <<
4	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	45	TEH	TEC	720-EL	DRI	TRH	.00	.00	5	12.46	358	8	RESULT OF DISCREPANCY RESOLUTION
7	45	TSH	TEH	720-WC	CRI	TRH	.00	.00	C1	11.20	62	31	RESULT OF DISCREPANCY RESOLUTION
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
7	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	45	TRH	TEH	720-RB	MAI	TEH	2.86	.00	1	5.52	19	105	>> POSITIVE ID ESTABLISHED <<
7	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	45	TEH	TEC	720-EL	DRI	TRH	.00	.00	5	18.26	10	8	RESULT OF DISCREPANCY RESOLUTION
8	45	TSH	TEH	720-WC	CRI	TRH	.00	.00	C8	2.29	24	31	RESULT OF DISCREPANCY RESOLUTION
8	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	45	TRH	TEH	720-RB	MAI	TEH	2.60	.00	1	.50	21	105	>> POSITIVE ID ESTABLISHED <<
8	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	45	TEH	TEC	720-EL	DRI	TRH	.00	.00	5	15.60	5	8	RESULT OF DISCREPANCY RESOLUTION
9	45	TSH	TEH	720-WC	CRI	TRH	.00	.00	C12	4.87	50	31	RESULT OF DISCREPANCY RESOLUTION
9	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	45	TRH	TEH	720-RB	SAI	TEH	2.70	.00	1	2.98	13	105	>> POSITIVE ID ESTABLISHED <<
9	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	45	TEH	TEC	720-EL	DRI	TRH	.00	.00	5	11.99	7	8	RESULT OF DISCREPANCY RESOLUTION
11	45	TSH	TEH	720-WC	CRI	TRH	.00	.00	C14	2.39	47	31	RESULT OF DISCREPANCY RESOLUTION
11	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	45	TRH	TEH	720-RB	MAI	TEH	2.73	.00	4	.67	29	105	>> POSITIVE ID ESTABLISHED <<
11	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	45	TSH	TEH	720-WC	CRI	TRH	.00	.00	C1	1.91	44	31	RESULT OF DISCREPANCY RESOLUTION
15	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	45	TRH	TEH	720-RB	MAI	TEH	1.70	.00	1	.42	46	105	>> POSITIVE ID ESTABLISHED <<
15	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	45	STH	TEC	720-EL	4	TSC	1.67	.00	M1	.34	127	42	RESULT OF DISCREPANCY RESOLUTION
27	45	TSH	TEH	720-WC	CRI	TRH	.00	.00	C3	2.27	50	29	RESULT OF DISCREPANCY RESOLUTION
27	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	45	TRH	TEH	720-RB	SAI	TEH	2.67	.00	1	.86	13	105	>> POSITIVE ID ESTABLISHED <<
27	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	45	TSH	TEH	720-WC	CRI	TRH	.00	.00	C14	1.80	32	29	RESULT OF DISCREPANCY RESOLUTION
30	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	45	TRH	TEH	720-RB	MAI	TEH	2.55	.00	1	1.04	17	103	>> POSITIVE ID ESTABLISHED <<
30	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	46	TSH	TEH	720-WC	CRI	TRH	.00	.00	C10	2.06	67	31	RESULT OF DISCREPANCY RESOLUTION
9	46												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	46	TRH	TEH	720-RB	SAI	TEH	2.68	.00	1	1.46	13	105	>> POSITIVE ID ESTABLISHED <<
9	46												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	46	TSH	TEH	720-WC	CRI	TRH	.00	.00	C22	2.01	24	31	RESULT OF DISCREPANCY RESOLUTION
20	46												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	46	TRH	TEH	720-RB	MAI	TEH	2.68	.00	1	1.04	18	105	>> POSITIVE ID ESTABLISHED <<
20	46												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

22-Sep-95 2:12

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
25	46	TSH	TEH	720-WC	CRI	TRH	.00	.00	C6	1.35	30	29	RESULT OF DISCREPANCY RESOLUTION
25	46	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	46	TRH	TEH	720-RB	MAI	TEH	2.66	.00	4	.98	10	105	>> POSITIVE ID ESTABLISHED <<
25	46	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	46	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	3.04	56	29	RESULT OF DISCREPANCY RESOLUTION
30	46	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	46	TRH	TEH	720-RB	MAI	TEH	2.56	.00	1	1.07	24	103	>> POSITIVE ID ESTABLISHED <<
30	46	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	46	TRH	TEH	720-RB	MAI	TEH	2.55	.00	1	.93	29	103	>> POSITIVE ID ESTABLISHED <<
30	46	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	47	TSH	TEH	720-WC	CRI	TRH	.00	.00	C3	6.72	39	31	RESULT OF DISCREPANCY RESOLUTION
2	47	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	47	TRH	TEH	720-RB	MAI	TEH	2.54	.00	4	2.37	20	105	>> POSITIVE ID ESTABLISHED <<
2	47	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	47	TEH	TEC	720-EL	DRI	TRH	.00	.00	5	19.90	12	8	RESULT OF DISCREPANCY RESOLUTION
6	47	TSH	TEH	720-WC	CRI	TRH	.00	.00	C12	1.53	35	31	RESULT OF DISCREPANCY RESOLUTION
6	47	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	47	TRH	TEH	720-RB	MAI	TEH	2.65	.00	1	.61	19	105	>> POSITIVE ID ESTABLISHED <<
6	47	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	47	TEH	TEC	720-EL	29	TSH	2.14	.00	1	.47	137	46	RESULT OF LAR
15	47	TSH	TEH	720-WC	CRI	TRH	.00	.00	C19	1.75	29	31	RESULT OF DISCREPANCY RESOLUTION
15	47	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	47	TRH	TEH	720-RB	MAI	TEH	2.74	.00	4	.31	21	109	RESULT OF DISCREPANCY RESOLUTION
15	47	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	47	TSH	TEH	720-WC	CRI	TRH	.00	.00	C10	1.19	73	29	RESULT OF DISCREPANCY RESOLUTION
27	47	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	47	TRH	TEH	720-RB	SAI	TEH	2.65	.00	4	1.09	23	109	>> POSITIVE ID ESTABLISHED <<
27	47	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	47	TSH	TEH	720-WC	CRI	TRH	.00	.00	C3	1.77	63	29	RESULT OF DISCREPANCY RESOLUTION
28	47	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	47	TRH	TEH	720-RB	MAI	TEH	2.59	.00	4	1.08	14	109	>> POSITIVE ID ESTABLISHED <<
28	47	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	47	TSH	TEH	720-WC	CRI	TRH	.00	.00	C17	2.17	58	29	RESULT OF DISCREPANCY RESOLUTION
31	47	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	47	TRH	TEH	720-RB	SAI	TEH	2.51	.00	4	.60	11	109	>> POSITIVE ID ESTABLISHED <<
31	47	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
39	47	TEH	TEC	720-EL	26	AV3	-.02	.00	M2	.96		42	
39	47	TEH	TEC	720-EL	25	AV4	.00	.00	M2	.86	59	42	

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

SG - 13 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

22-Sep-95 2:12

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
40	47	TEH	TEC	720-EL	13	AV2	.00	.00	M2	.26		42	
8	48	TEH	TEC	720-EL	DRI	TRH	.00	.00	5	13.94	6	8	RESULT OF DISCREPANCY RESOLUTION
8	48	TSH	TEH	720-WC	CRI	TRH	.00	.00	C14	2.34	54	33	RESULT OF DISCREPANCY RESOLUTION
8	48												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	48	TRH	TEH	720-RB	SAI	TEH	2.87	.00	1	1.18	197	107	>> POSITIVE ID ESTABLISHED <<
8	48												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	48	TSH	TEH	720-WC	CRI	TRH	.00	.00	C1	1.10	57	33	RESULT OF DISCREPANCY RESOLUTION
9	48												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	48	TRH	TEH	720-RB	SAI	TEH	2.34	.00	1	1.15	21	107	>> POSITIVE ID ESTABLISHED <<
9	48												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	48	TSH	TEH	720-WC	CRI	TRH	.00	.00	C6	4.63	42	33	RESULT OF DISCREPANCY RESOLUTION
18	48												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	48	TRH	TEH	720-RB	COI	TEH	2.61	.00	4	2.99	14	109	>> POSITIVE ID ESTABLISHED <<
18	48												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	48	TEH	TEC	720-EL	DIN	TEH	21.28	.00	M1	1.14	30	56	RESULT OF DISCREPANCY RESOLUTION
24	48	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.59	44	56	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
26	48	TSH	TEH	720-WC	CRI	TRH	.00	.00	C6	3.35	36	29	RESULT OF DISCREPANCY RESOLUTION
26	48												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	48	TRH	TEH	720-RB	SAI	TEH	2.55	.00	4	1.11	23	109	>> POSITIVE ID ESTABLISHED <<
26	48												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	48	TSH	TEH	720-WC	CRI	TRH	.00	.00	C5	4.94	34	29	RESULT OF DISCREPANCY RESOLUTION
27	48												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	48	TRH	TEH	720-RB	SAI	TEH	2.60	.00	4	.65	68	109	>> POSITIVE ID ESTABLISHED <<
27	48												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
38	48	TEH	TEC	720-EL	20	AV3	.00	.00	M2	.56		56	
38	48	TEH	TEC	720-EL	31	AV4	.00	.00	M2	1.49		56	
42	48	TEH	TEC	720-EL	16	AV1	.00	.00	M2	.41		56	
42	48	TEH	TEC	720-EL	23	AV2	.00	.00	M2	.78		56	
2	49	TSH	TEH	720-WC	CRI	TRH	.00	.00	C23	5.50	46	33	RESULT OF DISCREPANCY RESOLUTION
2	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	49	TH	TEH	720-EL	DRI	TEH	2.45	.00	M1	39.57	180	97	
2	49	TRH	TEH	720-RB	MAI	TEH	2.61	.00	1	2.43	25	105	>> POSITIVE ID ESTABLISHED <<
2	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	49	TEH	TEC	720-EL	DRI	TEH	2.65	.00	M1	21.99	166	30	RESULT OF DISCREPANCY RESOLUTION
7	49	TSH	TEH	720-WC	CRI	TRH	.00	.00	C17	11.91	48	33	RESULT OF DISCREPANCY RESOLUTION
7	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	49	TRH	TEH	720-RB	SAI	TEH	2.62	.00	1	3.17	26	107	>> POSITIVE ID ESTABLISHED <<
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
7	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	49	TEH	TEC	720-EL	25	TSH	.70	.00	1	.33	140	46	RESULT OF DISCREPANCY RESOLUTION
19	49	TSH	TEH	720-WC	CRI	TRH	.00	.00	C5	2.10	56	33	RESULT OF DISCREPANCY RESOLUTION
19	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	49	TEH	TEC	720-EL	DRI	TEH	2.69	.00	M1	54.59	2	46	RESULT OF DISCREPANCY RESOLUTION
19	49	TRH	TEH	720-RB	COI	TEH	2.60	.00	4	1.54	17	109	>> POSITIVE ID ESTABLISHED <<
19	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	49	TSH	TEH	720-WC	CRI	TRH	.00	.00	C6	2.72	43	29	RESULT OF DISCREPANCY RESOLUTION
26	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	49	TRH	TEH	720-RB	SAI	TEH	2.46	.00	4	1.44	21	109	>> POSITIVE ID ESTABLISHED <<
26	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	49	TSH	TEH	720-WC	CRI	TRH	.00	.00	C12	2.44	27	29	RESULT OF DISCREPANCY RESOLUTION
27	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	49	TRH	TEH	720-RB	MAI	TEH	2.64	.00	4	.36	28	109	>> POSITIVE ID ESTABLISHED <<
27	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	49	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	3.83	22	29	RESULT OF DISCREPANCY RESOLUTION
29	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	49	TRH	TEH	720-RB	SAI	TEH	2.49	.00	4	.54	22	109	>> POSITIVE ID ESTABLISHED <<
29	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	49	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	3.75	32	29	RESULT OF DISCREPANCY RESOLUTION
30	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	49	TRH	TEH	720-RB	COI	TEH	2.51	.00	4	1.92	14	109	>> POSITIVE ID ESTABLISHED <<
30	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	49	TSH	TEH	720-WC	CRI	TRH	.00	.00	C2	2.72	73	79	RESULT OF DISCREPANCY RESOLUTION
32	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	49	TRH	TEH	720-RB	SAI	TEH	2.60	.00	4	1.71	25	109	>> POSITIVE ID ESTABLISHED <<
32	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	49	TEH	TEC	720-EL	DRI	TEH	2.54	.00	M1	50.02	179	46	RESULT OF DISCREPANCY RESOLUTION
33	49	TEH	TEC	720-EL	17	AV3	.00	.00	M2	.43		46	RESULT OF DISCREPANCY RESOLUTION
33	49	TSH	TEH	720-WC	CRI	TRH	.00	.00	C24	3.06	21	79	RESULT OF DISCREPANCY RESOLUTION
33	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	49	7H	TEH	720-EL	DRI	TEH	2.19	.00	M1	52.70	2	95	
33	49	TRH	TEH	720-RB	MAI	TEH	2.62	.00	4	1.61	7	109	>> POSITIVE ID ESTABLISHED <<
33	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	50	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	6.87	13	33	RESULT OF DISCREPANCY RESOLUTION
3	50												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	50	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	4.43	30	33	RESULT OF DISCREPANCY RESOLUTION
3	50												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	50	7H	TEH	720-EL	DRI	TEH	2.45	.00	M1	41.44	181	97	

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
3	50	TRH	TEH	720-RB	COI	TEH	2.56	.00	1	1.37	27	107	>> POSITIVE ID ESTABLISHED <<
3	50												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	50	TSH	TEH	720-WC	CRI	TRH	.00	.00	C20	13.43	49	33	RESULT OF DISCREPANCY RESOLUTION
4	50												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	50	TEH	TEC	720-EL	DRI	TEH	2.61	.00	M1	69.18	185	40	RESULT OF DISCREPANCY RESOLUTION
4	50	TRH	TEH	720-RB	MAI	TEH	2.56	.00	1	5.58	22	107	>> POSITIVE ID ESTABLISHED <<
4	50												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	50	STH	TEC	720-EL	PI	1H	.00	.00	M1	1.17	78	64	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
24	50	TEH	TEC	720-EL	DIN	TSH	-1.34	.00	M1	.18	52	66	RESULT OF DISCREPANCY RESOLUTION
27	50	TSH	TEH	720-WC	CRI	TRH	.00	.00	C8	3.49	37	29	RESULT OF DISCREPANCY RESOLUTION
27	50												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	50	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.65	24	66	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
27	50	TRH	TEH	720-RB	SAI	TEH	1.49	.00	4	2.87	18	109	>> POSITIVE ID ESTABLISHED <<
27	50												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	50	TSH	TEH	720-WC	CRI	TRH	.00	.00	C6	2.33	35	29	RESULT OF DISCREPANCY RESOLUTION
29	50												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	50	TRH	TEH	720-RB	SAI	TEH	2.61	.00	4	1.88	9	109	>> POSITIVE ID ESTABLISHED <<
29	50												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	50	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	2.65	27	79	RESULT OF DISCREPANCY RESOLUTION
32	50												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	50	TRH	TEH	720-RB	SAI	TEH	2.54	.00	4	1.23	12	109	>> POSITIVE ID ESTABLISHED <<
32	50												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
35	50	7H	TEH	720-EL	PI	1H	.00	.00	M1	.66	92	95	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
38	50	7H	TEH	720-EL	PI	1H	.00	.00	M1	.42	130	95	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
40	50	7H	TEC	720-EL	32	AV3	.00	.00	M2	1.58	92	110	
40	50	7H	TEC	720-EL	25	AV4	.00	.00	M2	.89	124	110	
41	50	7H	TEC	720-EL	39	AV3	.00	.00	M2	2.79		110	
41	50	7H	TEC	720-EL	18	AV3	.58	.00	M2	.45		110	
41	50	7H	TEC	720-EL	28	AV4	.00	.00	M2	1.12		110	
2	51	TSH	TEH	720-WC	CRI	TRH	.00	.00	C14	2.88	56	33	RESULT OF DISCREPANCY RESOLUTION
2	51												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	51	7H	TEH	720-EL	DRI	TEH	2.45	.00	M1	34.89	190	97	
2	51	TRH	TEH	720-RB	MAI	TEH	2.45	.00	1	2.57	18	105	>> POSITIVE ID ESTABLISHED <<
2	51												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	51	TSH	TEH	720-WC	CRI	TRH	.00	.00	C21	4.03	29	33	RESULT OF DISCREPANCY RESOLUTION
3	51												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



SG - 13 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

22-Sep-95 2:12

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
3	51	7H	TEH	720-EL	DRI	TEH	2.23	.00	M1	51.30	358	97	
3	51	TRH	TEH	720-RB	MAI	TEH	2.37	.00	4	4.13	5	107	RESULT OF DISCREPANCY RESOLUTION
3	51												>> POSITIVE ID ESTABLISHED <<
3	51												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	51	TEH	TEC	720-EL	DRI	TEH	2.38	.00	M1	57.12	183	30	RESULT OF DISCREPANCY RESOLUTION
6	51	TSH	TEH	720-WC	CRI	TRH	.00	.00	C12	3.39	53	33	RESULT OF DISCREPANCY RESOLUTION
6	51												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	51	TRH	TEH	720-RB	MAI	TEH	2.51	.00	4	3.02	26	107	RESULT OF DISCREPANCY RESOLUTION
6	51												>> POSITIVE ID ESTABLISHED <<
6	51												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	51	TEH	TEC	720-EL	DRI	TEH	2.22	.00	M1	42.95	178	30	RESULT OF DISCREPANCY RESOLUTION
8	51	TSH	TEH	720-WC	CRI	TRH	.00	.00	C20	1.64	18	33	RESULT OF DISCREPANCY RESOLUTION
8	51												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	51	TRH	TEH	720-RB	MAI	TEH	2.52	.00	1	.68	14	107	>> POSITIVE ID ESTABLISHED <<
8	51												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	51	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.47	134	62	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
18	51	TSH	TEH	720-WC	CRI	TRH	.00	.00	C6	3.48	30	33	RESULT OF DISCREPANCY RESOLUTION
18	51												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	51	TRH	TEH	720-RB	COI	TEH	2.56	.00	4	2.86	12	109	>> POSITIVE ID ESTABLISHED <<
18	51												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	51	TSH	TEH	720-WC	CRI	TRH	.00	.00	C17	2.89	41	29	RESULT OF DISCREPANCY RESOLUTION
23	51												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	51	TRH	TEH	720-RB	COI	TEH	2.45	.00	4	.90	14	109	>> POSITIVE ID ESTABLISHED <<
23	51												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	51	TSH	TEH	720-WC	CRI	TRH	.00	.00	C12	1.93	42	29	RESULT OF DISCREPANCY RESOLUTION
26	51												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	51	TRH	TEH	720-RB	MAI	TEH	2.40	.00	4	.71	201	109	>> POSITIVE ID ESTABLISHED <<
26	51												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
38	51	7H	TEC	720-EL	14	AV3	.00	.00	M2	.34		108	
38	51	7H	TEC	720-EL	24	AV4	.00	.00	M2	.83		108	
3	52	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	4.63	23	33	RESULT OF DISCREPANCY RESOLUTION
3	52												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	52	7H	TEH	720-EL	DRI	TEH	2.52	.00	M1	55.24	5	97	
3	52	TRH	TEH	720-RB	MAI	TEH	2.49	.00	1	5.58	22	107	>> POSITIVE ID ESTABLISHED <<
3	52												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	52	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	3.89	37	33	RESULT OF DISCREPANCY RESOLUTION
6	52												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	52	TEH	TEC	720-EL	DRI	TEH	2.58	.00	M1	51.46	178	40	RESULT OF DISCREPANCY RESOLUTION
6	52	TRH	TEH	720-RB	MAI	TEH	2.35	.00	4	4.74	2	107	RESULT OF DISCREPANCY RESOLUTION
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
6	52												>> POSITIVE ID ESTABLISHED <<
6	52												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	52	TSH	TEH	720-WC	CRI	TRH	.00	.00	C10	.76	113	33	RESULT OF DISCREPANCY RESOLUTION
9	52												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	52	TRH	TEH	720-RB	MAI	TEH	2.43	.00	1	.28	37	107	>> POSITIVE ID ESTABLISHED <<
9	52												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	52	TSH	TEH	720-WC	CRI	TRH	.00	.00	C4	2.45	35	33	RESULT OF DISCREPANCY RESOLUTION
10	52												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	52	TEH	TEC	720-EL	DRI	TEH	2.67	.00	M1	48.76	180	40	RESULT OF DISCREPANCY RESOLUTION
10	52	TRH	TEH	720-RB	COI	TEH	2.36	.00	1	.73	24	107	>> POSITIVE ID ESTABLISHED <<
10	52												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	52	TSH	TEH	720-WC	CRI	TRH	.00	.00	C24	3.20	37	33	RESULT OF DISCREPANCY RESOLUTION
12	52												RETEST - RETEST FOR POSITIVE ID
12	52												TUBE DID NOT MEET RE-ROLL DIAMETER REQUIREMENT
12	52	TRH	TEH	720-RB	MAI	TEH	2.60	.00	4	3.56	21	109	>> POSITIVE ID ESTABLISHED <<
13	52	TSH	TEH	720-WC	CRI	TRH	.00	.00	C12	1.58	42	33	RESULT OF DISCREPANCY RESOLUTION
13	52												RETEST - RETEST FOR POSITIVE ID
13	52												TUBE DID NOT MEET RE-ROLL DIAMETER REQUIREMENT
13	52	TRH	TEH	720-RB	SAI	TEH	2.47	.00	4	.52	25	109	RESULT OF DISCREPANCY RESOLUTION
13	52												>> POSITIVE ID ESTABLISHED <<
14	52	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.35	56	64	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
18	52	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	1.99	49	33	RESULT OF DISCREPANCY RESOLUTION
18	52												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	52	TRH	TEH	720-RB	COI	TEH	2.71	.00	4	.28	190	109	>> POSITIVE ID ESTABLISHED <<
18	52												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	52	TSH	TEH	720-WC	CRI	TRH	.00	.00	C12	1.61	23	31	RESULT OF DISCREPANCY RESOLUTION
23	52												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	52	TRH	TEH	720-RB	COI	TEH	2.55	.00	1	1.51	184	111	>> POSITIVE ID ESTABLISHED <<
23	52												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	52	TSH	TEH	720-WC	CRI	TRH	.00	.00	C8	.76	51	31	RESULT OF DISCREPANCY RESOLUTION
24	52												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	52	TEH	TEC	720-EL	DRI	TEH	3.32	.00	M1	48.60	177	70	RESULT OF DISCREPANCY RESOLUTION
24	52	TRH	TEH	720-RB	COI	TEH	2.52	.00	1	.91	12	111	>> POSITIVE ID ESTABLISHED <<
24	52												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	52	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	5.75	44	31	RESULT OF DISCREPANCY RESOLUTION
28	52												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	52	TRH	TEH	720-RB	SAI	TEH	2.49	.00	1	2.51	17	111	>> POSITIVE ID ESTABLISHED <<
28	52												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
2	53	TSH	TEH	720-WC	CRI	TRH	.00	.00	C24	1.75	40	33	RESULT OF DISCREPANCY RESOLUTION
2	53												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	53	TRH	TEH	720-RB	COI	TEH	2.54	.00	1	1.39	21	105	>> POSITIVE ID ESTABLISHED <<
2	53												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	53	TSH	TEH	720-WC	CRI	TRH	.00	.00	C22	3.94	31	33	RESULT OF DISCREPANCY RESOLUTION
4	53												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	53	TEH	TEC	720-EL	DIN	TEH	21.09	.00	M1	1.29	27	40	
4	53	TEH	TEC	720-EL	DRI	TEH	2.38	.00	M1	13.45	145	40	
4	53	TRH	TEH	720-RB	SAI	TEH	3.13	.00	1	.68	31	107	>> POSITIVE ID ESTABLISHED <<
4	53												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	53	TEH	TEC	720-EL	DRI	TEH	2.58	.00	M1	48.58	179	30	RESULT OF DISCREPANCY RESOLUTION
6	53	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	2.31	49	33	RESULT OF DISCREPANCY RESOLUTION
6	53												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	53	TRH	TEH	720-RB	COI	TEH	2.63	.00	1	.87	23	107	>> POSITIVE ID ESTABLISHED <<
6	53												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	53	TEH	TEC	720-EL	DRI	TEH	2.12	.00	M1	38.53	178	30	RESULT OF DISCREPANCY RESOLUTION
11	53	STH	TEC	720-EL	PI	1H	.00	.00	M1	1.17	72	40	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
11	53	STH	TEC	720-EL	PI	3H	.00	.00	M1	.78	19	40	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
16	53	STH	TEC	720-EL	PI	3H	.00	.00	M1	.42	51	62	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
21	53	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	4.27	36	31	RESULT OF DISCREPANCY RESOLUTION
21	53												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	53	TRH	TEH	720-RB	SAI	TEH	2.60	.00	1	1.51	20	111	>> POSITIVE ID ESTABLISHED <<
21	53												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	53	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	1.79	30	31	RESULT OF DISCREPANCY RESOLUTION
24	53												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	53	TRH	TEH	720-RB	COI	TEH	2.58	.00	1	.89	8	111	>> POSITIVE ID ESTABLISHED <<
24	53												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	53	TSH	TEH	720-WC	CRI	TRH	.00	.00	C4	3.22	42	31	RESULT OF DISCREPANCY RESOLUTION
27	53												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	53	TRH	TEH	720-RB	MAI	TEH	2.62	.00	1	2.08	21	111	>> POSITIVE ID ESTABLISHED <<
27	53												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	53	TSH	TEH	720-WC	CRI	TRH	.00	.00	C6	1.34	57	31	RESULT OF DISCREPANCY RESOLUTION
30	53												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	53	TRH	TEH	720-RB	COI	TEH	2.62	.00	1	.97	12	111	>> POSITIVE ID ESTABLISHED <<
30	53												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	53	TSH	TEH	720-WC	CRI	TRH	.00	.00	C21	2.07	40	79	RESULT OF DISCREPANCY RESOLUTION
33	53												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	53	TRH	TEH	720-RB	COI	TEH	2.61	.00	1	1.20	23	111	>> POSITIVE ID ESTABLISHED <<
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
33	53												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
34	53	TSH	TEH	720-WC	CRI	TRH	.00	.00	C21	2.07	38	79	RESULT OF DISCREPANCY RESOLUTION
34	53												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
34	53	TRH	TEH	720-RB	SAI	TEH	2.56	.00	1	1.14	18	111	>> POSITIVE ID ESTABLISHED <<
34	53												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
36	53	7H	TEC	720-EL	29	AV3	.00	.00	M2	1.28		108	
36	53	7H	TEC	720-EL	24	AV4	.50	.00	M2	.86		108	
46	53	7H	TEC	720-EL	12	1C	.10	.00	M1	.67	122	108	
1	54	TSH	TEH	720-WC	CRI	TRH	.00	.00	C24	1.47	35	33	RESULT OF DISCREPANCY RESOLUTION
1	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	54	7H	TEH	720-EL	DRI	TEH	1.97	.00	M1	44.58	1	89	RESULT OF DISCREPANCY RESOLUTION
1	54	TRH	TEH	720-RB	COI	TEH	2.30	.00	1	1.39	12	107	>> POSITIVE ID ESTABLISHED <<
1	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	54	TSH	TEH	720-WC	CRI	TRH	.00	.00	C3	1.73	48	33	RESULT OF DISCREPANCY RESOLUTION
3	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	54	TRH	TEH	720-RB	COI	TEH	2.44	.00	1	.38	18	107	>> POSITIVE ID ESTABLISHED <<
3	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	54	TEH	TEC	720-EL	DRI	TEH	2.35	.00	M1	3.58	25	118	RESULT OF LAR
5	54	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	1.60	51	33	RESULT OF DISCREPANCY RESOLUTION
5	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	54	TRH	TEH	720-RB	SAI	TEH	2.47	.00	1	.80	10	107	>> POSITIVE ID ESTABLISHED <<
5	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	54	TSH	TEH	720-WC	CRI	TRH	.00	.00	C24	1.19	24	33	RESULT OF DISCREPANCY RESOLUTION
6	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	54	TRH	TEH	720-RB	COI	TEH	2.72	.00	1	.34	38	107	>> POSITIVE ID ESTABLISHED <<
6	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	54	TSH	TEH	720-WC	CRI	TRH	.00	.00	C8	3.25	42	33	RESULT OF DISCREPANCY RESOLUTION
7	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	54	TEH	TEC	720-EL	DRI	TEH	1.55	.00	M1	46.79	179	40	RESULT OF DISCREPANCY RESOLUTION
7	54	TRH	TEH	720-RB	MAI	TEH	2.47	.00	4	4.80	16	107	RESULT OF DISCREPANCY RESOLUTION
7	54												>> POSITIVE ID ESTABLISHED <<
7	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	54	TSH	TEH	720-WC	CRI	TRH	.00	.00	C6	1.65	76	35	RESULT OF DISCREPANCY RESOLUTION
13	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	54	TRH	TEH	720-RB	SAI	TEH	2.63	.00	4	.28	76	109	>> POSITIVE ID ESTABLISHED <<
13	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	54	TSH	TEH	720-WC	CRI	TRH	.00	.00	C6	6.86	43	35	RESULT OF DISCREPANCY RESOLUTION
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

D. C. Cook UIR95

AEP -13/51

INSPECTION: August 95

22-Sep-95 2:12

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
18	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	54	TRH	TEH	720-RB	MAI	TEH	2.77	.00	4	1.90	25	109	>> POSITIVE ID ESTABLISHED <<
18	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	54	TSH	TEH	720-WC	CRI	TRH	.00	.00	C14	1.11	79	31	RESULT OF DISCREPANCY RESOLUTION
21	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	54	TRH	TEH	720-RB	SAI	TEH	2.48	.00	1	1.63	196	111	>> POSITIVE ID ESTABLISHED <<
21	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	54	TSH	TEH	720-WC	CRI	TRH	.00	.00	C2	5.04	18	31	RESULT OF DISCREPANCY RESOLUTION
23	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	54	TRH	TEH	720-RB	MAI	TEH	2.65	.00	1	1.17	18	111	>> POSITIVE ID ESTABLISHED <<
23	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	54	TSH	TEH	720-WC	CRI	TRH	.00	.00	C4	1.26	73	31	RESULT OF DISCREPANCY RESOLUTION
25	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	54	TRH	TEH	720-RB	SAI	TEH	2.60	.00	1	1.81	10	111	>> POSITIVE ID ESTABLISHED <<
25	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	54	TSH	TEH	720-WC	CRI	TRH	.00	.00	C20	2.94	35	79	RESULT OF DISCREPANCY RESOLUTION
33	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	54	7H	TEH	720-EL	DRI	TEH	2.43	.00	M1	46.37	188	93	
33	54	TRH	TEH	720-RB	SAI	TEH	2.50	.00	1	1.20	23	111	>> POSITIVE ID ESTABLISHED <<
33	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	55	TSH	TEH	720-WC	CRI	TRH	.00	.00	C7	1.57	29	35	RESULT OF DISCREPANCY RESOLUTION
9	55												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	55	TRH	TEH	720-RB	COI	TEH	2.64	.00	1	.55	13	107	>> POSITIVE ID ESTABLISHED <<
9	55												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	55	TEH	TEC	720-EL	7	TSH	1.59	.00	M1	.41	127	62	
15	55	TEH	TEC	720-EL	7	TSH	2.16	.00	M1	.27	127	62	
15	55	TEH	TEC	720-EL	DI	TSH	1.12	.00	M1	.53	55	62	RESULT OF DISCREPANCY RESOLUTION
15	55	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.61	88	62	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
24	55	TSH	TEH	720-WC	CRI	TRH	.00	.00	C16	2.27	33	31	RESULT OF DISCREPANCY RESOLUTION
24	55												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	55	TRH	TEH	720-RB	MAI	TEH	2.69	.00	1	1.72	204	111	>> POSITIVE ID ESTABLISHED <<
24	55												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	55	TSH	TEH	720-WC	CRI	TRH	.00	.00	C18	1.40	59	31	RESULT OF DISCREPANCY RESOLUTION
27	55												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	55	TRH	TEH	720-RB	COI	TEH	2.58	.00	1	.89	16	111	>> POSITIVE ID ESTABLISHED <<
27	55												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	55	TSH	TEH	720-WC	CRI	TRH	.00	.00	C10	.53	77	31	RESULT OF DISCREPANCY RESOLUTION
29	55												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	55	TRH	TEH	720-RB	MAI	TEH	2.60	.00	1	1.49	18	111	>> POSITIVE ID ESTABLISHED <<
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

22-Sep-95 2:12

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
29	55												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
37	55	7H	TEC	720-EL	17	AV1	.25	.00	M2	.45		112	
37	55	7H	TEC	720-EL	25	AV2	.00	.00	M2	.92		112	
40	55	7H	TEC	720-EL	35	AV3	.00	.00	M2	2.11		112	
40	55	7H	TEC	720-EL	20	AV4	.20	.00	M2	.58		112	
2	56	7H	TEH	720-EL		DRI TEH	2.31	.00	M1	37.90	186	89	RESULT OF DISCREPANCY RESOLUTION
3	56	TSH	TEH	720-WC		CRI TRH	.00	.00	C9	1.14	43	35	RESULT OF DISCREPANCY RESOLUTION
3	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	56	TRH	TEH	720-RB		MAI TEH	2.57	.00	4	.61	30	109	RESULT OF DISCREPANCY RESOLUTION
3	56												>> POSITIVE ID ESTABLISHED <<
3	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	56	TSH	TEH	720-WC		CRI TRH	.00	.00	C24	2.64	37	35	RESULT OF DISCREPANCY RESOLUTION
4	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	56	TEH	TEC	720-EL		DRI TKH	.00	.00	M1	7.97	7	102	RESULT OF DISCREPANCY RESOLUTION
4	56	TRH	TEH	720-RB		MAI TEH	2.57	.00	1	3.09	8	107	>> POSITIVE ID ESTABLISHED <<
4	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	56	TSH	TEH	720-WC		CRI TRH	.00	.00	C4	4.00	61	35	RESULT OF DISCREPANCY RESOLUTION
5	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	56	TRH	TEH	720-RB		MAI TEH	2.51	.00	4	1.89	27	109	>> POSITIVE ID ESTABLISHED <<
5	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	56	TSH	TEH	720-WC		CRI TRH	.00	.00	C9	2.42	53	35	RESULT OF DISCREPANCY RESOLUTION
6	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	56	TEH	TEC	720-EL		DRI TKH	.00	.00	M1	32.09	8	102	
6	56	TRH	TEH	720-RB		COI TEH	2.69	.00	4	1.51	169	109	>> POSITIVE ID ESTABLISHED <<
6	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	56	TSH	TEH	720-WC		CRI TRH	.00	.00	C13	3.15	33	35	RESULT OF DISCREPANCY RESOLUTION
10	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	56	TRH	TEH	720-RB		COI TEH	2.70	.00	1	.76	15	107	>> POSITIVE ID ESTABLISHED <<
10	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	56	TSH	TEH	720-WC		CRI TRH	.00	.00	C7	2.09	46	31	RESULT OF DISCREPANCY RESOLUTION
21	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	56	TRH	TEH	720-RB		COI TEH	2.62	.00	1	1.71	12	111	>> POSITIVE ID ESTABLISHED <<
21	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	56	TSH	TEH	720-WC		CRI TRH	.00	.00	C17	1.85	53	31	RESULT OF DISCREPANCY RESOLUTION
26	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	56	TRH	TEH	720-RB		SAI TEH	2.63	.00	1	1.33	25	111	>> POSITIVE ID ESTABLISHED <<
26	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

SG - 13 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

-22-Sep-95 2:12

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
29	56	TSH	TEH	720-WC	CRI	TRH	.00	.00	C1	1.81	66	31	RESULT OF DISCREPANCY RESOLUTION
29	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	56	TRH	TEH	720-RB	COI	TEH	2.51	.00	1	.92	19	111	>> POSITIVE ID ESTABLISHED <<
29	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	57	TSH	TEH	720-WC	CRI	TRH	.00	.00	C8	5.72	43	35	RESULT OF DISCREPANCY RESOLUTION
3	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	57	7H	TEH	720-EL	DRI	TEH	2.36	.00	M1	47.48	186	91	
3	57	TRH	TEH	720-RB	SAI	TEH	2.63	.00	4	1.49	23	109	>> POSITIVE ID ESTABLISHED <<
3	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	57	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	5.80	43	35	RESULT OF DISCREPANCY RESOLUTION
4	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	57	TRH	TEH	720-RB	SAI	TEH	2.55	.00	4	1.54	37	109	>> POSITIVE ID ESTABLISHED <<
4	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	57	TSH	TEH	720-WC	CRI	TRH	.00	.00	C6	2.43	34	35	RESULT OF DISCREPANCY RESOLUTION
5	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	57	TRH	TEH	720-RB	SAI	TEH	2.60	.00	4	.60	200	109	>> POSITIVE ID ESTABLISHED <<
5	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	57	TSH	TEH	720-WC	CRI	TRH	.00	.00	C22	4.81	41	35	RESULT OF DISCREPANCY RESOLUTION
7	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	57	TRH	TEH	720-RB	MAI	TEH	2.69	.00	4	1.40	200	109	>> POSITIVE ID ESTABLISHED <<
7	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	57	TSH	TEH	720-WC	CRI	TRH	.00	.00	C10	1.48	138	35	RESULT OF DISCREPANCY RESOLUTION
8	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	57	TRH	TEH	720-RB	SAI	TEH	2.61	.00	4	.96	208	109	>> POSITIVE ID ESTABLISHED <<
8	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	57	TEH	TEC	720-EL	INR	TSH	2.32	.00	M1			62	RESULT OF DISCREPANCY RESOLUTION
21	57	TSH	TEH	720-WC	CRI	TRH	.00	.00	C2	1.82	71	35	RESULT OF DISCREPANCY RESOLUTION
21	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	57	TRH	TEH	720-RB	COI	TEH	2.55	.00	4	1.84	18	109	>> POSITIVE ID ESTABLISHED <<
21	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	57	STH	TEC	720-EL	PI	1H	.00	.00	M1	.81	61	70	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
24	57	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.56	35	70	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
26	57	TSH	TEH	720-WC	CRI	TRH	.00	.00	C8	4.31	47	35	RESULT OF DISCREPANCY RESOLUTION
26	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	57	TRH	TEH	720-RB	MAI	TEH	2.55	.00	1	2.18	9	111	>> POSITIVE ID ESTABLISHED <<
26	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	57	TSH	TEH	720-WC	CRI	TRH	.00	.00	C15	1.99	56	31	RESULT OF DISCREPANCY RESOLUTION

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
27	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	57	TEH	TEC	720-EL	DRI	TEH	2.64	.00	M1	57.17	177	70	RESULT OF DISCREPANCY RESOLUTION
27	57	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.48	35	70	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
27	57	TRH	TEH	720-RB	SAI	TEH	2.53	.00	1	1.72	15	111	>> POSITIVE ID ESTABLISHED <<
27	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	57	TSH	TEH	720-WC	CRI	TRH	.00	.00	C23	1.68	30	81	RESULT OF DISCREPANCY RESOLUTION
32	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	57	TRH	TEH	720-RB	COI	TEH	2.52	.00	1	1.50	3	111	>> POSITIVE ID ESTABLISHED <<
32	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
36	57	7H	TEC	720-EL	40	AV3	.17	.00	M2	3.07		112	RESULT OF DISCREPANCY RESOLUTION
36	57												RETEST - RETEST FOR POSITIVE ID
36	57	7H	TEC	720-EL	32	AV3	31.77	.00	M2	1.74		112	
36	57	7H	TEC	720-EL	29	AV4	.07	.00	M2	1.31		112	
2	58	TSH	TEH	720-WC	CRI	TRH	.00	.00	C7	3.87	34	35	RESULT OF DISCREPANCY RESOLUTION
2	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	58	7H	TEH	720-EL	DRI	TEH	2.19	.00	M1	48.20	186	89	RESULT OF DISCREPANCY RESOLUTION
2	58	TRH	TEH	720-RB	MAI	TEH	2.55	.00	4	.63	22	109	>> POSITIVE ID ESTABLISHED <<
2	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	58	7H	TEH	720-EL	INR	TEH	2.50	.00	M1			91	RESULT OF DISCREPANCY RESOLUTION
5	58	TSH	TEH	720-WC	CRI	TRH	.00	.00	C5	3.15	40	35	RESULT OF DISCREPANCY RESOLUTION
5	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	58	TRH	TEH	720-RB	MAI	TEH	2.60	.00	4	.91	22	109	>> POSITIVE ID ESTABLISHED <<
5	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	58	TSH	TEH	720-WC	CRI	TRH	.00	.00	C8	3.18	42	35	RESULT OF DISCREPANCY RESOLUTION
6	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	58	TEH	TEC	720-EL	PI	1H	.00	.00	M1	1.17	77	102	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
6	58	TRH	TEH	720-RB	COI	TEH	2.53	.00	4	1.43	50	109	>> POSITIVE ID ESTABLISHED <<
6	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	58	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.46	53	102	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
10	58	8TH	TEC	720-EL	INR	1H	-.10	.00	M1	.59	113	104	RESULT OF DISCREPANCY RESOLUTION
11	58	TSH	TEH	720-WC	CRI	TRH	.00	.00	C19	3.91	35	35	RESULT OF DISCREPANCY RESOLUTION
11	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	58	TEH	TEC	720-EL	DIN	TEH	21.14	.00	M1	2.93	30	64	RESULT OF DISCREPANCY RESOLUTION
11	58	TRH	TEH	720-RB	MAI	TEH	2.51	.00	4	1.50	11	109	>> POSITIVE ID ESTABLISHED <<
11	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	58	TEH	TEC	720-EL	DI	TSH	1.27	.00	M1	1.21	44	64	RESULT OF DISCREPANCY RESOLUTION
15	58	TEH	TEC	720-EL	DI	TSH	2.35	.00	M1	.26	141	64	RESULT OF DISCREPANCY RESOLUTION
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
24	58	TSH	TEH	720-WC	CRI	TRH	.00	.00	C17	3.40	57	35	RESULT OF DISCREPANCY RESOLUTION
24	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	58	TRH	TEH	720-RB	MAI	TEH	2.48	.00	1	1.94	12	111	>> POSITIVE ID ESTABLISHED <<
24	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	58	TSH	TEH	720-WC	CRI	TRH	.00	.00	C15	4.67	50	35	RESULT OF DISCREPANCY RESOLUTION
26	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	58	TRH	TEH	720-RB	SAI	TEH	2.57	.00	1	2.99	10	111	>> POSITIVE ID ESTABLISHED <<
26	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	58	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	2.17	27	35	RESULT OF DISCREPANCY RESOLUTION
27	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	58	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.73	28	64	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
27	58	TRH	TEH	720-RB	COI	TEH	2.50	.00	1	2.44	3	111	>> POSITIVE ID ESTABLISHED <<
27	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	58	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	1.70	31	35	RESULT OF DISCREPANCY RESOLUTION
28	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	58	TRH	TEH	720-RB	SAI	TEH	2.59	.00	1	.92	21	111	>> POSITIVE ID ESTABLISHED <<
28	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
39	58	7H	TEC	720-EL	17	AV3	.00	.00	M2	.42		114	RESULT OF DISCREPANCY RESOLUTION
39	58	7H	TEC	720-EL	21	AV4	.00	.00	M2	.63		114	
5	59	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	1.98	47	37	RESULT OF DISCREPANCY RESOLUTION
5	59												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	59	TRH	TEH	720-RB	MAI	TEH	2.45	.00	4	1.64	18	109	>> POSITIVE ID ESTABLISHED <<
5	59												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	59	TSH	TEH	720-WC	CRI	TRH	.00	.00	C10	.94	150	37	RESULT OF DISCREPANCY RESOLUTION
7	59												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	59	TRH	TEH	720-RB	SAI	TEH	2.64	.00	4	.64	22	109	>> POSITIVE ID ESTABLISHED <<
7	59												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	59	TSH	TEH	720-WC	CRI	TRH	.00	.00	C3	10.78	47	37	RESULT OF DISCREPANCY RESOLUTION
10	59												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	59	TRH	TEH	720-RB	MAI	TEH	2.43	.00	4	3.34	18	109	>> POSITIVE ID ESTABLISHED <<
10	59												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	59	TSH	TEH	720-WC	CRI	TRH	.00	.00	C17	2.58	50	37	RESULT OF DISCREPANCY RESOLUTION
13	59												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	59	TRH	TEH	720-RB	COI	TEH	2.56	.00	4	.44	39	109	>> POSITIVE ID ESTABLISHED <<
13	59												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	59	TSH	TEH	720-WC	CRI	TRH	.00	.00	C7	4.00	36	37	RESULT OF DISCREPANCY RESOLUTION
24	59												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	59	TRH	TEH	720-RB	SAI	TEH	2.50	.00	1	1.59	14	111	>> POSITIVE ID ESTABLISHED <<
24	59												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
26	59	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	4.47	44	35	RESULT OF DISCREPANCY RESOLUTION
26	59												RETEST - RETEST FOR POSITIVE ID
26	59	TEH	TEC	720-EL	PIC	1H	.00	.00	M1	2.28	89	62	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
26	59												RETEST - RETEST FOR POSITIVE ID
26	59	TRH	TEH	720-RB	SAI	TEH	2.42	.00	1	1.89	11	111	>> POSITIVE ID ESTABLISHED <<
26	59	1H	1H	720-ZC	SAI	1H	.00	.00	4	1.11	119	119	>> POSITIVE ID ESTABLISHED <<
28	59	TSH	TEH	720-WC	CRI	TRH	.00	.00	C17	3.89	53	35	RESULT OF DISCREPANCY RESOLUTION
28	59												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	59	TRH	TEH	720-RB	MAI	TEH	2.63	.00	1	1.27	20	111	>> POSITIVE ID ESTABLISHED <<
28	59												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	59	TEH	TEC	720-EL	INR	TSC	.50	.00	M1	.34	137	108	RESULT OF DISCREPANCY RESOLUTION
39	59	7H	TEC	720-EL	15	AV1	.00	.00	M2	.35		114	RESULT OF DISCREPANCY RESOLUTION
2	60	TSH	TEH	720-WC	CRI	TRH	.00	.00	C4	2.46	35	37	RESULT OF DISCREPANCY RESOLUTION
2	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	60	7H	TEH	720-EL	DRI	TEH	1.91	.00	M1	56.33	187	89	
2	60	TRH	TEH	720-RB	MAI	TEH	2.46	.00	4	1.15	21	109	>> POSITIVE ID ESTABLISHED <<
2	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	60	STH	TEC	720-EL	PI	1H	.00	.00	M1	1.18	78	102	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
6	60	TSH	TEH	720-WC	CRI	TRH	.00	.00	C19	3.11	46	37	RESULT OF DISCREPANCY RESOLUTION
6	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	60	TRH	TEH	720-RB	COI	TEH	2.86	.00	4	.65	25	109	>> POSITIVE ID ESTABLISHED <<
6	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	60	TEH	TEC	720-EL	DRI	TEH	2.44	.00	M1	47.68	181	102	RESULT OF DISCREPANCY RESOLUTION
23	60	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	9.07	53	37	RESULT OF DISCREPANCY RESOLUTION
23	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	60	TRH	TEH	720-RB	SAI	TEH	2.57	.00	1	3.81	15	111	>> POSITIVE ID ESTABLISHED <<
23	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	60	TSH	TEH	720-WC	CRI	TRH	2.32	.00	C18	.30	96	37	RESULT OF DISCREPANCY RESOLUTION
24	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	60	TRH	TEH	720-RB	SAI	TEH	2.64	.00	1	1.16	18	111	>> POSITIVE ID ESTABLISHED <<
24	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	60	TSH	TEH	720-WC	CRI	TRH	.00	.00	C19	1.31	56	37	RESULT OF DISCREPANCY RESOLUTION
26	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	60	TRH	TEH	720-RB	COI	TEH	2.54	.00	1	.20	14	111	>> POSITIVE ID ESTABLISHED <<
26	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	60	TSH	TEH	720-WC	CRI	TRH	.00	.00	C12	.98	34	37	RESULT OF DISCREPANCY RESOLUTION

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

22-Sep-95 2:12

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
28	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	60	TRH	TEH	720-RB	SAI	TEH	2.47	.00	1	1.36	10	111	>> POSITIVE ID ESTABLISHED <<
28	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	60	TSH	TEH	720-WC	CRI	TRH	.00	.00	C17	4.29	54	37	RESULT OF DISCREPANCY RESOLUTION
29	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	60	TRH	TEH	720-RB	MAI	TEH	2.62	.00	1	2.49	14	111	>> POSITIVE ID ESTABLISHED <<
29	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	60	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	6.41	39	37	RESULT OF DISCREPANCY RESOLUTION
30	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	60	TRH	TEH	720-RB	SAI	TEH	2.56	.00	1	1.30	32	111	>> POSITIVE ID ESTABLISHED <<
30	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	60	TSH	TEH	720-WC	CRI	TRH	.00	.00	C2	2.79	67	81	RESULT OF DISCREPANCY RESOLUTION
33	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	60	7H	TEH	720-EL	DRI	TEH	2.47	.00	M1	49.63	189	93	
33	60	TRH	TEH	720-RB	MAI	TEH	2.54	.00	1	3.83	10	111	>> POSITIVE ID ESTABLISHED <<
33	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
34	60	7H	TEC	720-EL	21	AV3	.45	.00	M2	.64		112	RESULT OF DISCREPANCY RESOLUTION
34	60	7H	TEC	720-EL	19	AV4	.00	.00	M2	.52		112	
1	61	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	.71	102	39	RESULT OF DISCREPANCY RESOLUTION
1	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	61	7H	TEH	720-EL	DRI	TEH	2.16	.00	M1	37.38	185	89	
1	61	TRH	TEH	720-RB	MAI	TEH	2.42	.00	4	.92	8	107	RESULT OF DISCREPANCY RESOLUTION
1	61												>> POSITIVE ID ESTABLISHED <<
1	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	61	TSH	TEH	720-WC	CRI	TRH	.00	.00	C4	1.95	34	39	RESULT OF DISCREPANCY RESOLUTION
2	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	61	7H	TEH	720-EL	DRI	TEH	2.07	.00	M1	32.20	185	89	
2	61	TRH	TEH	720-RB	SAI	TEH	2.28	.00	1	1.53	7	115	>> POSITIVE ID ESTABLISHED <<
2	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	61	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	2.01	54	39	RESULT OF DISCREPANCY RESOLUTION
3	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	61	7H	TEH	720-EL	DRI	TEH	2.28	.00	M1	32.93	186	91	
3	61	TRH	TEH	720-RB	MAI	TEH	2.56	.00	1	1.08	17	115	>> POSITIVE ID ESTABLISHED <<
3	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	61	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	1.30	37	39	RESULT OF DISCREPANCY RESOLUTION
7	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	61	TRH	TEH	720-RB	SAI	TEH	2.33	.00	1	.78	21	115	>> POSITIVE ID ESTABLISHED <<
7	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	61	TSH	TEH	720-WC	CRI	TRH	.00	.00	C24	2.11	35	39	RESULT OF DISCREPANCY RESOLUTION

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
8	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	61	TRH	TEH	720-RB	SAI	TEH	1.88	.00	1	.90	7	115	>> POSITIVE ID ESTABLISHED <<
8	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	61	TSH	TEH	720-WC	CRI	TRH	.00	.00	C8	1.65	87	39	RESULT OF DISCREPANCY RESOLUTION
10	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	61	TRH	TEH	720-RB	COI	TEH	2.16	.00	1	2.94	6	115	>> POSITIVE ID ESTABLISHED <<
10	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	61	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	2.92	60	39	RESULT OF DISCREPANCY RESOLUTION
13	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	61	TRH	TEH	720-RB	SAI	TEH	2.63	.00	1	3.26	9	111	>> POSITIVE ID ESTABLISHED <<
13	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	61	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	2.24	53	39	RESULT OF DISCREPANCY RESOLUTION
19	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	61	TRH	TEH	720-RB	SAI	TEH	2.55	.00	1	1.53	6	111	>> POSITIVE ID ESTABLISHED <<
19	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	61	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.61	81	62	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
23	61	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	1.84	64	39	RESULT OF DISCREPANCY RESOLUTION
23	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	61	TRH	TEH	720-RB	SAI	TEH	2.74	.00	1	.96	37	111	>> POSITIVE ID ESTABLISHED <<
23	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	61	TSH	TEH	720-WC	CRI	TRH	.00	.00	C17	1.26	47	39	RESULT OF DISCREPANCY RESOLUTION
28	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	61	TRH	TEH	720-RB	SAI	TEH	2.50	.00	1	1.74	8	111	>> POSITIVE ID ESTABLISHED <<
28	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
34	61	TEH	TEC	720-EL	13	AV3	.00	.00	M2	.30		108	
34	61	TEH	TEC	720-EL	22	AV4	.00	.00	M2	.74		108	
36	61	TEH	TEC	720-EL	26	AV3	-.17	.00	M2	.99		108	RESULT OF DISCREPANCY RESOLUTION
36	61	TEH	TEC	720-EL	35	AV3	.17	.00	M2	2.18		108	RESULT OF DISCREPANCY RESOLUTION
36	61	TEH	TEC	720-EL	40	AV4	.22	.00	M2	3.21		108	RESULT OF DISCREPANCY RESOLUTION
36	61												RETEST - RETEST FOR POSITIVE ID
41	61	TEH	TEC	720-EL	26	AV3	.00	.00	M2	.99		110	
44	61	TEH	TEC	720-EL	34	1C	.14	.00	M1	2.12	107	110	RESULT OF DISCREPANCY RESOLUTION
1	62	TSH	TEH	720-WC	CRI	TRH	.00	.00	C2	2.80	53	39	RESULT OF DISCREPANCY RESOLUTION
1	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	62	7H	TEH	720-EL	DRI	TEH	2.11	.00	M1	34.67	185	89	
1	62	TRH	TEH	720-RB	MAI	TEH	2.41	.00	4	1.64	16	107	RESULT OF LAR
1	62												>> POSITIVE ID ESTABLISHED <<
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



SG - 13 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

22-Sep-95 2:13

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
1	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	62	TSH	TEH	720-WC	CRI	TRH	.00	.00	C7	4.32	39	39	RESULT OF DISCREPANCY RESOLUTION
5	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	62	TRH	TEH	720-RB	COI	TEH	2.51	.00	1	2.48	10	115	>> POSITIVE ID ESTABLISHED <<
5	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	62	TSH	TEH	720-WC	CRI	TRH	.00	.00	C17	3.06	37	39	RESULT OF DISCREPANCY RESOLUTION
7	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	62	TRH	TEH	720-RB	COI	TEH	2.80	.00	1	1.07	3	115	>> POSITIVE ID ESTABLISHED <<
7	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	62	TSH	TEH	720-WC	CRI	TRH	.00	.00	C15	2.04	33	39	RESULT OF DISCREPANCY RESOLUTION
23	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	62	TRH	TEH	720-RB	SAI	TEH	2.66	.00	1	.21	72	113	>> POSITIVE ID ESTABLISHED <<
23	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	62	TSH	TEH	720-WC	CRI	TRH	.00	.00	C5	2.52	39	39	RESULT OF DISCREPANCY RESOLUTION
24	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	62	TRH	TEH	720-RB	COI	TEH	2.65	.00	1	.51	20	113	>> POSITIVE ID ESTABLISHED <<
24	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	62	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	1.67	37	39	RESULT OF DISCREPANCY RESOLUTION
25	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	62	TRH	TEH	720-RB	COI	TEH	2.68	.00	1	.98	21	113	>> POSITIVE ID ESTABLISHED <<
25	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	62	TSH	TEH	720-WC	CRI	TRH	.00	.00	C20	5.23	17	39	RESULT OF DISCREPANCY RESOLUTION
26	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	62	TRH	TEH	720-RB	COI	TEH	2.61	.00	1	.38	27	113	>> POSITIVE ID ESTABLISHED <<
26	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	62	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	1.08	66	39	RESULT OF DISCREPANCY RESOLUTION
28	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	62	TRH	TEH	720-RB	COI	TEH	2.59	.00	1	.47	16	113	>> POSITIVE ID ESTABLISHED <<
28	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	62	TSH	TEH	720-WC	CRI	TRH	.00	.00	C18	2.07	50	39	RESULT OF DISCREPANCY RESOLUTION
29	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	62	TRH	TEH	720-RB	SAI	TEH	2.65	.00	1	.47	29	113	>> POSITIVE ID ESTABLISHED <<
29	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	62	TSH	TEH	720-WC	CRI	TRH	.00	.00	C18	1.09	55	39	RESULT OF DISCREPANCY RESOLUTION
32	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	62	TEH	TEC	720-EL	27	AV3	.00	.00	M2	1.08		68	
32	62	TEH	TEC	720-EL	15	AV4	.00	.00	M2	.36		68	
32	62	TRH	TEH	720-RB	SAI	TEH	2.48	.00	1	.72	185	113	>> POSITIVE ID ESTABLISHED <<
32	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

SG - 13 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

22-Sep-95 2:13

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
39	62	TEH	TEC	720-EL	DIN	TEH	20.99	.00	M1	.55	44	108	RESULT OF DISCREPANCY RESOLUTION
40	62	TEH	TEC	720-EL	16	AV1	.00	.00	M2	.42		108	
40	62	TEH	TEC	720-EL	32	AV2	.00	.00	M2	1.64		108	
40	62	TEH	TEC	720-EL	30	AV3	.10	.00	M2	1.45		108	
40	62	TEH	TEC	720-EL	26	AV4	-.12	.00	M2	1.01		108	
43	62	TEH	TEC	720-EL	2	1C	.00	.00	M1	.65	128	108	
6	63	STH	TEC	720-EL	PI	1H	.00	.00	M1	.91	81	100	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
7	63	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	2.53	96	41	RESULT OF DISCREPANCY RESOLUTION
7	63												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	63	TEH	TEC	720-EL	DRI	TEH	.98	.00	M1	41.94	178	100	RESULT OF DISCREPANCY RESOLUTION
7	63	TRH	TEH	720-RB	COI	TEH	2.83	.00	1	.35	29	115	>> POSITIVE ID ESTABLISHED <<
7	63												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	63	TSH	TEH	720-WC	CRI	TRH	.00	.00	C22	2.72	44	41	RESULT OF DISCREPANCY RESOLUTION
25	63												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	63	TRH	TEH	720-RB	MAI	TEH	2.54	.00	1	1.65	20	113	>> POSITIVE ID ESTABLISHED <<
25	63												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	63	TSH	TEH	720-WC	CRI	TRH	.00	.00	C4	.87	53	41	RESULT OF DISCREPANCY RESOLUTION
30	63												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	63	TRH	TEH	720-RB	MAI	TEH	2.52	.00	4	3.84	10	113	RESULT OF DISCREPANCY RESOLUTION
30	63												>> POSITIVE ID ESTABLISHED <<
30	63												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	63	TSH	TEH	720-WC	CRI	TRH	.00	.00	C8	.78	43	41	RESULT OF DISCREPANCY RESOLUTION
32	63												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	63	TRH	TEH	720-RB	COI	TEH	2.68	.00	1	.61	21	113	>> POSITIVE ID ESTABLISHED <<
32	63												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
39	63	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.62	43	110	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
39	63	TEH	TEC	720-EL	12	AV1	.00	.00	M2	.25		110	RESULT OF DISCREPANCY RESOLUTION
3	64	TSH	TEH	720-WC	CRI	TRH	.00	.00	C6	1.22	45	63	RESULT OF DISCREPANCY RESOLUTION
3	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	64	TRH	TEH	720-RB	COI	TEH	2.55	.00	4	.53	20	115	>> POSITIVE ID ESTABLISHED <<
3	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	64	TSH	TEH	720-WC	CRI	TRH	.00	.00	C2	3.65	34	41	RESULT OF DISCREPANCY RESOLUTION
5	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	64	TRH	TEH	720-RB	COI	TEH	2.53	.00	1	1.35	20	115	>> POSITIVE ID ESTABLISHED <<
5	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	64	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	2.74	36	41	RESULT OF DISCREPANCY RESOLUTION

D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

22-Sep-95 2:13

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
10	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	64	TRH	TEH	720-RB	COI	TEH	2.62	.00	1	.51	12	115	>> POSITIVE ID ESTABLISHED <<
10	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	64	TEH	TEC	720-EL	PI	1H	.00	.00	M1	1.16	63	66	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
27	64	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	2.97	61	41	RESULT OF DISCREPANCY RESOLUTION
27	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	64	TRH	TEH	720-RB	MAI	TEH	2.46	.00	1	.69	21	113	>> POSITIVE ID ESTABLISHED <<
27	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	64	TSH	TEH	720-WC	CRI	TRH	.00	.00	C16	2.11	29	41	RESULT OF DISCREPANCY RESOLUTION
31	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	64	TRH	TEH	720-RB	SAI	TEH	2.58	.00	1	.72	26	113	>> POSITIVE ID ESTABLISHED <<
31	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	64	TSH	TEH	720-WC	CRI	TRH	.00	.00	C18	1.51	32	41	RESULT OF DISCREPANCY RESOLUTION
32	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	64	TRH	TEH	720-RB	COI	TEH	2.69	.00	1	4.12	14	113	>> POSITIVE ID ESTABLISHED <<
32	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	64	TSH	TEH	720-WC	CRI	TRH	.00	.00	C16	1.05	52	41	RESULT OF DISCREPANCY RESOLUTION
33	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	64	TEH	TEC	720-EL	23	AV1	.00	.00	M2	.77		74	
33	64	TEH	TEC	720-EL	16	AV2	.00	.00	M2	.40		74	
33	64	TRH	TEH	720-RB	SAI	TEH	2.53	.00	1	.35	22	113	>> POSITIVE ID ESTABLISHED <<
33	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
36	64	TEH	TEC	720-EL	25	AV3	.00	.00	M2	.92		74	
36	64	TEH	TEC	720-EL	28	AV4	.00	.00	M2	1.14		74	RESULT OF DISCREPANCY RESOLUTION
39	64	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.62	59	74	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
40	64	TEH	TEC	720-EL	31	AV1	.00	.00	M2	1.50		108	
43	64	TEH	TEC	720-EL	11	1C	.00	.00	M1	.74	117	108	RESULT OF DISCREPANCY RESOLUTION
1	65	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	2.30	35	63	RESULT OF DISCREPANCY RESOLUTION
1	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	65	TRH	TEH	720-RB	SAI	TEH	2.57	.00	1	1.91	7	115	>> POSITIVE ID ESTABLISHED <<
1	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	65	TSH	TEH	720-WC	CRI	TRH	.00	.00	C17	.95	147	63	RESULT OF DISCREPANCY RESOLUTION
2	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	65	TRH	TEH	720-RB	COI	TEH	2.68	.00	4	1.13	6	115	>> POSITIVE ID ESTABLISHED <<
2	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	65	TSH	TEH	720-WC	CRI	TRH	.00	.00	10	20.93	15	43	RESULT OF DISCREPANCY RESOLUTION

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
3	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	65	7H	TEH	720-EL	DRI	TEH	1.60	.00	M1	53.94	188	91	
3	65	TRH	TEH	720-RB	SAI	TEH	2.61	.00	1	.81	16	115	>> POSITIVE ID ESTABLISHED <<
3	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	65	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	1.53	56	63	RESULT OF DISCREPANCY RESOLUTION
5	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	65	TRH	TEH	720-RB	COI	TEH	2.64	.00	1	1.59	17	115	>> POSITIVE ID ESTABLISHED <<
5	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	65	TSH	TEH	720-WC	CRI	TRH	.00	.00	C2	3.13	130	43	RESULT OF DISCREPANCY RESOLUTION
7	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	65	TRH	TEH	720-RB	SAI	TEH	2.56	.00	1	2.88	4	115	>> POSITIVE ID ESTABLISHED <<
7	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	65	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	2.85	37	43	RESULT OF DISCREPANCY RESOLUTION
8	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	65	TRH	TEH	720-RB	COI	TEH	2.60	.00	1	.35	24	115	>> POSITIVE ID ESTABLISHED <<
8	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	65	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	3.73	37	41	RESULT OF DISCREPANCY RESOLUTION
10	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	65	TRH	TEH	720-RB	COI	TEH	2.61	.00	1	.25	20	115	>> POSITIVE ID ESTABLISHED <<
10	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	65	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.32	69	68	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
24	65	STH	TEC	720-EL	PI	1H	.00	.00	M1	.39	65	68	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
25	65	TSH	TEH	720-WC	CRI	TRH	.00	.00	C24	1.77	22	41	RESULT OF DISCREPANCY RESOLUTION
25	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	65	TRH	TEH	720-RB	MAI	TEH	2.51	.00	4	1.03	12	113	RESULT OF DISCREPANCY RESOLUTION
25	65												>> POSITIVE ID ESTABLISHED <<
25	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	65	TSH	TEH	720-WC	CRI	TRH	.00	.00	C19	1.61	20	41	RESULT OF DISCREPANCY RESOLUTION
26	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	65	TRH	TEH	720-RB	SAI	TEH	2.65	.00	1	.42	166	113	>> POSITIVE ID ESTABLISHED <<
26	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	65	TSH	TEH	720-WC	CRI	TRH	.00	.00	C15	6.74	22	41	RESULT OF DISCREPANCY RESOLUTION
28	65												*** COMMENT 5140 CANNOT BE FOUND ! ***
28	65	TRH	TEH	720-RB	COI	TEH	2.47	.00	1	.88	16	113	>> POSITIVE ID ESTABLISHED <<
28	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	65	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	3.05	32	41	RESULT OF DISCREPANCY RESOLUTION
29	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	65	TRH	TEH	720-RB	MAI	TEH	2.50	.00	1	.84	188	113	>> POSITIVE ID ESTABLISHED <<
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

22-Sep-95 2:13

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
29	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	65	TSH	TEH	720-WC	CRI	TRH	.00	.00	C17	4.21	23	41	RESULT OF DISCREPANCY RESOLUTION
30	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	65	TRH	TEH	720-RB	SAI	TEH	2.60	.00	1	.54	27	113	>> POSITIVE ID ESTABLISHED <<
30	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
36	65	TEH	TEC	720-EL	26	AV3	.00	.00	M2	.98	68		
36	65	TEH	TEC	720-EL	26	AV4	.00	.00	M2	1.00	68		
39	65	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.34	104	108	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
39	65	TEH	TEC	720-EL	16	AV3	-.07	.00	M2	.39		108	
39	65	TEH	TEC	720-EL	10	AV3	.35	.00	M2	.20		108	
39	65	TEH	TEC	720-EL	26	AV4	.00	.00	M2	1.01		108	
40	65	TEH	TEC	720-EL	17	AV2	-.21	.00	M2	.43		108	
40	65	TEH	TEC	720-EL	18	AV2	.21	.00	M2	.47		108	
40	65	TEH	TEC	720-EL	23	AV3	-.05	.00	M2	.78		108	
2	66	TSH	TEH	720-WC	CRI	TRH	.00	.00	C16	13.58	35	43	RESULT OF DISCREPANCY RESOLUTION
2	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	66	7H	TEH	720-EL	DIN	TEH	21.02	.00	M1	.60	55	89	RESULT OF DISCREPANCY RESOLUTION
2	66	7H	TEH	720-EL	DIN	TEH	20.35	.00	M1	.87	73	89	RESULT OF DISCREPANCY RESOLUTION
2	66	7H	TEH	720-EL	DRI	TEH	2.15	.00	M1	44.85	195	89	
2	66	7H	TEH	720-EL	PI	1H	.00	.00	M1	1.12	79	89	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
2	66	TRH	TEH	720-RB	SAI	TEH	2.59	.00	1	2.75	20	115	>> POSITIVE ID ESTABLISHED <<
2	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	66	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	7.40	33	43	RESULT OF DISCREPANCY RESOLUTION
4	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	66	TRH	TEH	720-RB	MAI	TEH	2.77	.00	1	1.87	17	115	>> POSITIVE ID ESTABLISHED <<
4	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	66	TSH	TEH	720-WC	CRI	TRH	.00	.00	C1	2.05	16	43	RESULT OF DISCREPANCY RESOLUTION
12	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	66	TRH	TEH	720-RB	COI	TEH	2.77	.00	1	.85	196	113	>> POSITIVE ID ESTABLISHED <<
12	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	66	TSH	TEH	720-WC	CRI	TRH	.00	.00	C15	1.36	40	43	RESULT OF DISCREPANCY RESOLUTION
24	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	66	TRH	TEH	720-RB	COI	TEH	2.61	.00	1	.43	16	113	>> POSITIVE ID ESTABLISHED <<
24	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	66	TSH	TEH	720-WC	CRI	TRH	.00	.00	C20	3.31	14	43	RESULT OF DISCREPANCY RESOLUTION
26	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	66	TRH	TEH	720-RB	MAI	TEH	2.54	.00	1	.66	19	113	>> POSITIVE ID ESTABLISHED <<
26	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------



ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
27	66	TSH	TEH	720-WC	CRI	TRH	.00	.00	C18	3.45	39	53	RESULT OF DISCREPANCY RESOLUTION
27	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	66	TRH	TEH	720-RB	COI	TEH	2.50	.00	1	4.69	7	113	>> POSITIVE ID ESTABLISHED <<
27	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	66	TSH	TEH	720-WC	CRI	TRH	.00	.00	C21	4.86	25	53	RESULT OF DISCREPANCY RESOLUTION
29	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	66	TRH	TEH	720-RB	SAI	TEH	2.55	.00	1	.84	169	113	>> POSITIVE ID ESTABLISHED <<
29	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	66	TSH	TEH	720-WC	CRI	TRH	.00	.00	C12	2.74	31	53	RESULT OF DISCREPANCY RESOLUTION
30	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	66	TRH	TEH	720-RB	COI	TEH	2.43	.00	1	.69	16	113	>> POSITIVE ID ESTABLISHED <<
30	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	66	TSH	TEH	720-WC	CRI	TRH	.00	.00	C21	1.97	36	53	RESULT OF DISCREPANCY RESOLUTION
33	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	66	TRH	TEH	720-RB	MAI	TEH	2.67	.00	1	1.73	17	113	>> POSITIVE ID ESTABLISHED <<
33	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	67	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	3.05	40	43	RESULT OF DISCREPANCY RESOLUTION
2	67												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	67	7H	TEH	720-EL	DRI	TEH	2.26	.00	M1	44.54	188	89	RESULT OF DISCREPANCY RESOLUTION
2	67	TRH	TEH	720-RB	MAI	TEH	2.85	.00	1	.81	38	115	>> POSITIVE ID ESTABLISHED <<
2	67												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	67	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	5.74	43	43	RESULT OF DISCREPANCY RESOLUTION
3	67												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	67	7H	TEH	720-EL	DRI	TEH	1.77	.00	M1	59.33	189	91	RESULT OF DISCREPANCY RESOLUTION
3	67	TRH	TEH	720-RB	MAI	TEH	2.81	.00	1	1.16	29	115	>> POSITIVE ID ESTABLISHED <<
3	67												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	67	TSH	TEH	720-WC	CRI	TRH	.00	.00	C19	2.90	23	43	RESULT OF DISCREPANCY RESOLUTION
7	67												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	67	TRH	TEH	720-RB	SAI	TEH	2.71	.00	1	.72	9	115	>> POSITIVE ID ESTABLISHED <<
7	67												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	67	STH	TEC	720-EL	PI	1H	.00	.00	M1	.77	79	100	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
11	67	STH	TEC	720-EL	PI	2H	.00	.00	M1	.69	98	100	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
40	67	TEH	TEC	720-EL	S7	1C	.02	.00	M1	2.36	106	72	
2	68	TSH	TEH	720-WC	CRI	TRH	.00	.00	C6	6.98	26	43	RESULT OF DISCREPANCY RESOLUTION
2	68												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	68	7H	TEH	720-EL	DRI	TEH	2.22	.00	M1	43.49	188	89	RESULT OF DISCREPANCY RESOLUTION
2	68	TRH	TEH	720-RB	SAI	TEH	2.90	.00	1	3.20	11	115	>> POSITIVE ID ESTABLISHED <<
2	68												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
3	68	TSH	TEH	720-WC	CRI	TRH	.00	.00	C15	2.30	90	43	RESULT OF DISCREPANCY RESOLUTION
3	68												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	68	7H	TEH	720-EL	DRI	TEH	2.20	.00	M1	47.12	189	91	
3	68	TRH	TEH	720-RB	SAI	TEH	2.68	.00	1	2.25	17	115	>> POSITIVE ID ESTABLISHED <<
3	68												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	68	TSH	TEH	720-WC	CRI	TRH	.00	.00	C6	3.58	47	43	RESULT OF DISCREPANCY RESOLUTION
5	68												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	68	TRH	TEH	720-RB	COI	TEH	2.74	.00	1	2.54	6	115	>> POSITIVE ID ESTABLISHED <<
5	68												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	68	TSH	TEH	720-WC	CRI	TRH	.00	.00	C2	1.89	60	43	RESULT OF DISCREPANCY RESOLUTION
10	68												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	68	TRH	TEH	720-RB	MAI	TEH	2.85	.00	1	.59	9	115	>> POSITIVE ID ESTABLISHED <<
10	68												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	68	TSH	TEH	720-WC	CRI	TRH	.00	.00	C8	1.82	84	43	RESULT OF DISCREPANCY RESOLUTION
12	68												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	68	TRH	TEH	720-RB	COI	TEH	2.57	.00	1	1.10	18	113	>> POSITIVE ID ESTABLISHED <<
12	68												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	68	TEH	TEC	720-EL	DIN	TEH	21.03	.00	M1	1.00	43	78	
25	68	TSH	TEH	720-WC	CRI	TRH	.00	.00	C10	2.22	102	43	RESULT OF DISCREPANCY RESOLUTION
25	68												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	68	TRH	TEH	720-RB	SAI	TEH	2.52	.00	1	.56	10	113	>> POSITIVE ID ESTABLISHED <<
25	68												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	68	TSH	TEH	720-WC	CRI	TRH	.00	.00	C1	2.37	38	57	RESULT OF DISCREPANCY RESOLUTION
27	68												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	68	TRH	TEH	720-RB	MAI	TEH	2.58	.00	1	.82	11	113	>> POSITIVE ID ESTABLISHED <<
27	68												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
39	68	TEH	TEC	720-EL	41	1C	.00	.00	M1	3.44	100	78	RESULT OF DISCREPANCY RESOLUTION
39	68												RETEST - RETEST FOR POSITIVE ID
2	69	TSH	TEH	720-WC	CRI	TRH	.00	.00	C4	2.54	53	43	RESULT OF DISCREPANCY RESOLUTION
2	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	69	7H	TEH	720-EL	DRI	TEH	2.25	.00	M1	50.50	188	89	RESULT OF DISCREPANCY RESOLUTION
2	69	TRH	TEH	720-RB	SAI	TEH	2.68	.00	1	1.42	9	115	>> POSITIVE ID ESTABLISHED <<
2	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	69	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	3.87	57	43	RESULT OF DISCREPANCY RESOLUTION
3	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	69	7H	TEH	720-EL	DRI	TEH	1.90	.00	M1	58.01	189	91	
3	69	TRH	TEH	720-RB	SAI	TEH	2.72	.00	1	2.13	14	115	>> POSITIVE ID ESTABLISHED <<
3	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

SG - 13 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

22-Sep-95 2:13

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
5	69	TSH	TEH	720-WC	CRI	TRH	.00	.00	C12	4.50	18	43	RESULT OF DISCREPANCY RESOLUTION
5	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	69	TEH	TEC	720-EL	DRI	TEH	1.07	.00	5	16.12	199	100	RESULT OF DISCREPANCY RESOLUTION
5	69	TRH	TEH	720-RB	COI	TEH	2.72	.00	1	.73	16	115	>> POSITIVE ID ESTABLISHED <<
5	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	69	TSH	TEH	720-WC	CRI	TRH	.00	.00	C22	2.43	28	43	RESULT OF DISCREPANCY RESOLUTION
6	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	69	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.54	53	100	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
6	69	TRH	TEH	720-RB	SAI	TEH	2.95	.00	1	1.49	6	115	>> POSITIVE ID ESTABLISHED <<
6	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	69	TSH	TEH	720-WC	CRI	TRH	.00	.00	C17	2.82	70	43	RESULT OF DISCREPANCY RESOLUTION
8	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	69	TRH	TEH	720-RB	SAI	TEH	2.76	.00	1	.57	28	115	>> POSITIVE ID ESTABLISHED <<
8	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	69	TSH	TEH	720-WC	CRI	TRH	.00	.00	C17	3.00	80	43	RESULT OF DISCREPANCY RESOLUTION
10	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	69	TRH	TEH	720-RB	SAI	TEH	2.66	.00	1	.56	42	115	>> POSITIVE ID ESTABLISHED <<
10	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	69	TSH	TEH	720-WC	CRI	TRH	.00	.00	C15	1.40	86	43	RESULT OF DISCREPANCY RESOLUTION
18	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	69	TEH	TEC	720-EL	INR	TEH	20.76	.00	M1		76		RESULT OF DISCREPANCY RESOLUTION
18	69	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.49	90	76	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
18	69	TRH	TEH	720-RB	SAI	TEH	2.66	.00	1	1.25	15	113	>> POSITIVE ID ESTABLISHED <<
18	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	69	TSH	TEH	720-WC	CRI	TRH	.00	.00	C17	2.36	97	43	RESULT OF DISCREPANCY RESOLUTION
23	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	69	TRH	TEH	720-RB	COI	TEH	2.58	.00	1	3.22	11	113	>> POSITIVE ID ESTABLISHED <<
23	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	69	TSH	TEH	720-WC	CRI	TRH	.00	.00	C3	1.85	20	57	RESULT OF DISCREPANCY RESOLUTION
29	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	69	TSH	TEH	720-WC	CRI	TRH	.00	.00	C1	3.99	16	59	RESULT OF DISCREPANCY RESOLUTION
29	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	69	TRH	TEH	720-RB	SAI	TEH	2.54	.00	1	.47	36	113	>> POSITIVE ID ESTABLISHED <<
29	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	69	STH	TEC	720-EL	PI	1H	.00	.00	M1	.45	48	72	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
39	69	TEH	TEC	720-EL	DIN	TSH	-.36	.00	M1	.37	49	72	RESULT OF DISCREPANCY RESOLUTION
39	69	TEH	TEC	720-EL	24	3C	-.05	.00	M1	1.73	116	72	
3	70	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	4.99	40	43	RESULT OF DISCREPANCY RESOLUTION
3	70												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

22-Sep-95 2:13

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
3	70	7H	TEH	720-EL DRI	TEH		2.06	.00	M1	56.67	191	91	RESULT OF DISCREPANCY RESOLUTION
3	70	7H	TEH	720-EL PI	1H		.00	.00	M1	1.12	77	91	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
3	70	TRH	TEH	720-RB MAI	TEH		2.66	.00	1	2.86	21	115	>> POSITIVE ID ESTABLISHED <<
3	70												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	70	TSH	TEH	720-WC CRI	TRH		.00	.00	C23	1.36	39	45	RESULT OF DISCREPANCY RESOLUTION
23	70												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	70	TRH	TEH	720-RB COI	TEH		2.48	.00	1	1.12	12	113	>> POSITIVE ID ESTABLISHED <<
23	70												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	70	TSH	TEH	720-WC CRI	TRH		.00	.00	C21	.95	55	45	RESULT OF DISCREPANCY RESOLUTION
24	70												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	70	TRH	TEH	720-RB MAI	TEH		2.54	.00	4	4.39	14	113	RESULT OF DISCREPANCY RESOLUTION
24	70												>> POSITIVE ID ESTABLISHED <<
24	70												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	70	TSH	TEH	720-WC CRI	TRH		.00	.00	C17	3.80	197	57	RESULT OF DISCREPANCY RESOLUTION
27	70												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	70	TSH	TEH	720-WC CRI	TRH		.00	.00	C17	4.39	33	59	RESULT OF DISCREPANCY RESOLUTION
27	70												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	70	TRH	TEH	720-RB SAI	TEH		2.60	.00	1	2.08	7	113	>> POSITIVE ID ESTABLISHED <<
27	70												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	70	TSH	TEH	720-WC CRI	TRH		.00	.00	C16	2.93	25	59	RESULT OF DISCREPANCY RESOLUTION
28	70												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	70	TRH	TEH	720-RB COI	TEH		2.50	.00	1	1.95	12	113	>> POSITIVE ID ESTABLISHED <<
28	70												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
38	70	TEH	TEC	720-EL	12	3C	-.10	.00	M1	.75	121	82	
39	70	TEH	TEC	720-EL	26	3C	-.14	.00	M1	1.86	112	82	
3	71	7H	TEH	720-EL INR	TEH		2.50	.00	M1			91	RESULT OF DISCREPANCY RESOLUTION
4	71	TSH	TEH	720-WC CRI	TRH		.00	.00	C23	3.08	31	45	RESULT OF DISCREPANCY RESOLUTION
4	71												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	71	TEH	TEC	720-EL DRI	TEH		1.06	.00	M1	34.06	172	100	RESULT OF DISCREPANCY RESOLUTION
4	71	TRH	TEH	720-RB MAI	TEH		3.14	.00	1	3.60	28	115	>> POSITIVE ID ESTABLISHED <<
4	71												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	71	TSH	TEH	720-WC CRI	TRH		.00	.00	C8	3.15	27	45	RESULT OF DISCREPANCY RESOLUTION
5	71												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	71	TRH	TEH	720-RB MAI	TEH		3.00	.00	1	1.47	10	115	>> POSITIVE ID ESTABLISHED <<
5	71												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	71	TEH	TEC	720-EL DRI	TEH		2.76	.00	M1	40.23	180	100	RESULT OF DISCREPANCY RESOLUTION
9	71	TSH	TEH	720-WC CRI	TRH		.00	.00	C12	7.01	39	45	RESULT OF DISCREPANCY RESOLUTION

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------



SG - 13 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

22-Sep-95 2:13

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
9	71												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	71	TRH	TEH	720-RB	SAI	TEH	2.67	.00	1	1.74	27	115	>> POSITIVE ID ESTABLISHED <<
9	71												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	71	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.52	73	76	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
25	71	TSH	TEH	720-WC	CRI	TRH	.00	.00	C20	1.48	53	45	RESULT OF DISCREPANCY RESOLUTION
25	71												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	71	TRH	TEH	720-RB	COI	TEH	2.50	.00	1	.90	345	113	>> POSITIVE ID ESTABLISHED <<
25	71												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	71	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	1.92	45	59	RESULT OF DISCREPANCY RESOLUTION
27	71												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	71	TRH	TEH	720-RB	MAI	TEH	2.65	.00	4	.34	16	113	RESULT OF DISCREPANCY RESOLUTION
27	71												>> POSITIVE ID ESTABLISHED <<
27	71												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	71	TEH	TEC	720-EL	DRI	TEH	2.77	.00	M1	15.06	183	76	RESULT OF DISCREPANCY RESOLUTION
30	71	TEH	TEC	720-EL	DRI	TEH	2.57	.00	M1	3.45	37	76	RESULT OF DISCREPANCY RESOLUTION
36	71	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.31	109	76	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
40	71	TEH	TEC	720-EL	28	1C	.00	.00	M1	1.40	110	82	RESULT OF DISCREPANCY RESOLUTION
9	72	TSH	TEH	720-WC	CRI	TRH	.00	.00	C10	1.42	88	45	RESULT OF DISCREPANCY RESOLUTION
9	72												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	72	TRH	TEH	720-RB	SAI	TEH	2.86	.00	1	.47	41	115	>> POSITIVE ID ESTABLISHED <<
9	72												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	72	TEH	TEC	720-EL	INA	TEH	2.75	.00	M1	47.70	181	82	RESULT OF DISCREPANCY RESOLUTION
14	72	TEH	TEC	720-EL	DRI	TEH	2.74	.00	M1	47.70	181	82	RESULT OF DISCREPANCY RESOLUTION
31	72	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.52	102	82	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
39	72	TEH	TEC	720-EL	17	1C	.05	.00	M1	1.43	118	82	
4	73	TSH	TEH	720-WC	CRI	TRH	.00	.00	C8	3.98	45	45	RESULT OF DISCREPANCY RESOLUTION
4	73												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	73	TEH	TEC	720-EL	DRI	TEH	1.00	.00	M2	56.48	180	100	
4	73	TRH	TEH	720-RB	MAI	TEH	3.02	.00	1	1.46	35	115	>> POSITIVE ID ESTABLISHED <<
4	73												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	73	TSH	TEH	720-WC	CRI	TRH	.00	.00	C21	1.15	74	45	RESULT OF DISCREPANCY RESOLUTION
6	73												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	73	TRH	TEH	720-RB	MAI	TEH	2.83	.00	1	.98	21	115	>> POSITIVE ID ESTABLISHED <<
6	73												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

22-Sep-95 2:13

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
7	73	TSH	TEH	720-WC	CRI	TRH	.00	.00	C2	2.72	53	45	RESULT OF DISCREPANCY RESOLUTION
7	73												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	73	TRH	TEH	720-RB	SAI	TEH	2.89	.00	1	1.05	19	115	>> POSITIVE ID ESTABLISHED <<
7	73												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	73	TSH	TEH	720-WC	CRI	TRH	.00	.00	C24	2.20	30	45	RESULT OF DISCREPANCY RESOLUTION
8	73												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	73	TRH	TEH	720-RB	COI	TEH	2.87	.00	1	.41	8	115	>> POSITIVE ID ESTABLISHED <<
8	73												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	73	TEH	TEC	720-EL	INR	TEH	2.75	.00	M1			84	RESULT OF DISCREPANCY RESOLUTION
24	73	TEH	TEC	720-EL	INR	TEH	20.89	.00	M1	.49	24	84	RESULT OF DISCREPANCY RESOLUTION
24	73	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.76	83	84	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
39	73	TEH	TEC	720-EL	INR	1C	-.05	.00	M1	.33	97	84	RESULT OF DISCREPANCY RESOLUTION
3	74	TSH	TEH	720-WC	CRI	TRH	.00	.00	C19	2.58	60	45	RESULT OF DISCREPANCY RESOLUTION
3	74												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	74	7H	TEH	720-EL	DRI	TEH	1.75	.00	M1	50.04	187	91	RESULT OF DISCREPANCY RESOLUTION
3	74	7H	TEH	720-EL	DIN	TEH	20.17	.00	M1	.20	98	91	RESULT OF DISCREPANCY RESOLUTION
3	74	7H	TEH	720-EL	DIN	TEH	20.44	.00	M1	.17	93	91	RESULT OF DISCREPANCY RESOLUTION
3	74	TRH	TEH	720-RB	SAI	TEH	3.12	.00	1	3.66	8	115	>> POSITIVE ID ESTABLISHED <<
3	74												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	74	TSH	TEH	720-WC	CRI	TRH	.00	.00	C1	3.50	37	45	RESULT OF DISCREPANCY RESOLUTION
4	74												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	74	TRH	TEH	720-RB	SAI	TEH	3.16	.00	1	2.28	8	115	>> POSITIVE ID ESTABLISHED <<
4	74												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	74	TEH	TEC	720-EL	INR	TEH	2.49	.00	M1	4.73	25	98	RESULT OF DISCREPANCY RESOLUTION
12	74	TEH	TEC	720-EL	INR	TEH	2.18	.00	M1	3.22	26	80	RESULT OF DISCREPANCY RESOLUTION
15	74	TEH	TEC	720-EL	INR	TEH	2.34	.00	M1	6.86	170	80	RESULT OF DISCREPANCY RESOLUTION
37	74	TEH	TEC	720-EL	43	3C	-.25	.00	M1	3.15	101	80	RESULT OF DISCREPANCY RESOLUTION
37	74												RETEST - RETEST FOR POSITIVE ID
37	74	TEH	TEC	720-EL	27	2C	.12	.00	M1	3.10	114	80	
4	75	TSH	TEH	720-WC	CRI	TRH	.00	.00	C23	12.48	38	47	RESULT OF DISCREPANCY RESOLUTION
4	75												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	75	TEH	TEC	720-EL	DIN	TEH	19.82	.00	M2	.60	52	100	RESULT OF DISCREPANCY RESOLUTION
4	75	TEH	TEC	720-EL	DRI	TEH	1.66	.00	M1	55.09	184	100	RESULT OF DISCREPANCY RESOLUTION
4	75	TRH	TEH	720-RB	SAI	TEH	3.13	.00	1	1.86	21	115	>> POSITIVE ID ESTABLISHED <<
4	75												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------



ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
7	75	TSH	TEH	720-WC	CRI	TRH	.00	.00	C21	2.11	54	47	RESULT OF DISCREPANCY RESOLUTION
7	75												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	75	TRH	TEH	720-RB	SAI	TEH	3.01	.00	1	.32	44	115	>> POSITIVE ID ESTABLISHED <<
7	75												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	75	TEH	TEC	720-EL	DRI	TEH	2.43	.00	M1	39.27	179	100	RESULT OF DISCREPANCY RESOLUTION
12	75	TSH	TEH	720-WC	CRI	TRH	.00	.00	C4	1.24	28	47	RESULT OF DISCREPANCY RESOLUTION
12	75												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	75	TRH	TEH	720-RB	MAI	TEH	2.94	.00	4	2.11	16	113	RESULT OF DISCREPANCY RESOLUTION
12	75												>> POSITIVE ID ESTABLISHED <<
12	75												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	75	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.47	74	84	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
20	75	TSH	TEH	720-WC	CRI	TRH	.00	.00	C1	1.63	98	47	RESULT OF DISCREPANCY RESOLUTION
20	75												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	75	TRH	TEH	720-RB	COI	TEH	2.63	.00	1	.78	202	113	>> POSITIVE ID ESTABLISHED <<
20	75												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
34	75	TEH	TEC	720-EL	61	1C	-.05	.00	M1	4.66	82	84	RESULT OF DISCREPANCY RESOLUTION
34	75												RETEST - RETEST FOR POSITIVE ID
2	76	TSH	TEH	720-WC	CRI	TRH	.00	.00	C14	2.86	39	47	RESULT OF DISCREPANCY RESOLUTION
2	76												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	76	7H	TEH	720-EL	DIN	TEH	20.44	.00	M1	.33	105	89	RESULT OF DISCREPANCY RESOLUTION
2	76	7H	TEH	720-EL	DIN	TEH	20.00	.00	M1	.45	113	89	RESULT OF DISCREPANCY RESOLUTION
2	76	7H	TEH	720-EL	DRI	TEH	1.90	.00	M1	49.74	188	89	RESULT OF DISCREPANCY RESOLUTION
2	76	TRH	TEH	720-RB	SAI	TEH	3.26	.00	4	3.45	4	115	>> POSITIVE ID ESTABLISHED <<
2	76												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	76	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	2.31	21	47	RESULT OF DISCREPANCY RESOLUTION
3	76												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	76	TRH	TEH	720-RB	MAI	TEH	2.53	.00	1	.42	10	117	RESULT OF DISCREPANCY RESOLUTION
3	76												>> POSITIVE ID ESTABLISHED <<
3	76												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	76	STH	TEC	720-EL	PI	1H	.00	.00	M1	.94	52	94	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
13	76	TSH	TEH	720-WC	CRI	TRH	.00	.00	C24	1.43	41	47	RESULT OF DISCREPANCY RESOLUTION
13	76												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	76	TRH	TEH	720-RB	MAI	TEH	2.80	.00	4	2.73	17	113	RESULT OF LAR.
13	76												>> POSITIVE ID ESTABLISHED <<
13	76												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	76	TSH	TEH	720-WC	CRI	TRH	.00	.00	C1	1.77	57	47	RESULT OF DISCREPANCY RESOLUTION
15	76												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	76	TRH	TEH	720-RB	COI	TEH	2.71	.00	1	.26	12	113	>> POSITIVE ID ESTABLISHED <<
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

SG - 13 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

22-Sep-95 2:13

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
15	76												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	76	TEH	TEC	720-EL	INR	1H	.00	.00	M1	.31	67	80	RESULT OF DISCREPANCY RESOLUTION
25	76	TSH	TEH	720-WC	CRI	TRH	.00	.00	C1	1.29	86	47	RESULT OF DISCREPANCY RESOLUTION
25	76												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	76	TRH	TEH	720-RB	SAI	TEH	2.61	.00	1	.86	193	113	>> POSITIVE ID ESTABLISHED <<
25	76												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	76	TSH	TEH	720-WC	CRI	TRH	.00	.00	C14	9.19	49	59	RESULT OF DISCREPANCY RESOLUTION
29	76												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	76	TRH	TEH	720-RB	SAI	TEH	2.51	.00	1	2.66	18	113	>> POSITIVE ID ESTABLISHED <<
29	76												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
34	76	TEH	TEC	720-EL	23	2C	.25	.00	M1	1.55	117	80	
36	76	TEH	TEC	720-EL	13	AV2	.00	.00	M2	.25		80	RESULT OF LAR
36	76	TEH	TEC	720-EL	24	AV3	.00	.00	M2	.81		80	
37	76	TEH	TEC	720-EL	50	1C	-.22	.00	M1	2.69	95	80	RESULT OF DISCREPANCY RESOLUTION
37	76												RETEST - RETEST FOR POSITIVE ID
1	77	7H	TEH	720-EL	PI	2H	.00	.00	M1	.50	82	89	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
2	77	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	6.44	43	47	RESULT OF DISCREPANCY RESOLUTION
2	77												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	77	7H	TEH	720-EL	DIN	TEH	20.91	.00	M1	.56	68	89	RESULT OF DISCREPANCY RESOLUTION
2	77	7H	TEH	720-EL	DIN	TEH	20.42	.00	M1	.42	84	89	RESULT OF DISCREPANCY RESOLUTION
2	77	7H	TEH	720-EL	DRI	TEH	2.12	.00	M1	46.81	188	89	RESULT OF DISCREPANCY RESOLUTION
2	77	TRH	TEH	720-RB	SAI	TEH	3.16	.00	1	1.47	14	115	>> POSITIVE ID ESTABLISHED <<
2	77												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	77	TSH	TEH	720-WC	CDI	TEH	20.03	.00	C24	2.18	80	47	RESULT OF LAR
4	77												RETEST - RETEST FOR POSITIVE ID
4	77	TSH	TEH	720-WC	CRI	TRH	.00	.00	C3	2.94	48	47	RESULT OF DISCREPANCY RESOLUTION
4	77												RETEST - RETEST FOR POSITIVE ID
4	77	TRH	TEH	720-RB	SAI	TEH	3.01	.00	1	.23	47	115	>> POSITIVE ID ESTABLISHED <<
4	77	TSH	TSH	720-RB	MAI	TSH	-2.09	.00	1	.87	115	117	>> POSITIVE ID ESTABLISHED <<
4	77	TSH	TSH	720-ZC	MAI	TSH	-1.47	.00	4	1.11	86	119	RESULT OF DISCREPANCY RESOLUTION
4	77												>> POSITIVE ID ESTABLISHED <<
5	77	TSH	TEH	720-WC	CRI	TRH	.00	.00	C15	5.03	37	47	RESULT OF DISCREPANCY RESOLUTION
5	77												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	77	TRH	TEH	720-RB	SAI	TEH	2.98	.00	1	3.27	10	115	>> POSITIVE ID ESTABLISHED <<
5	77												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	77	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	1.34	58	47	RESULT OF DISCREPANCY RESOLUTION
7	77												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
7	77	TRH	TEH	720-RB	SAI	TEH	2.83	.00	1	.86	10	115	>> POSITIVE ID ESTABLISHED <<
7	77												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	77	TSH	TEH	720-WC	CRI	TRH	.00	.00	C24	2.35	34	47	RESULT OF DISCREPANCY RESOLUTION
9	77												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	77	TRH	TEH	720-RB	SAI	TEH	3.06	.00	1	.30	14	115	>> POSITIVE ID ESTABLISHED <<
9	77												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	77	TSH	TEH	720-WC	CRI	TRH	.00	.00	C10	1.09	130	47	RESULT OF DISCREPANCY RESOLUTION
12	77												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	77	TRH	TEH	720-RB	SAI	TEH	2.73	.00	1	.68	190	113	>> POSITIVE ID ESTABLISHED <<
12	77												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	77	TSH	TEH	720-WC	CRI	TRH	.00	.00	C18	3.59	17	59	RESULT OF DISCREPANCY RESOLUTION
29	77												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	77	TRH	TEH	720-RB	SAI	TEH	2.59	.00	1	.80	13	113	>> POSITIVE ID ESTABLISHED <<
29	77												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	78	TSH	TEH	720-WC	CRI	TRH	.00	.00	C23	1.88	27	47	RESULT OF DISCREPANCY RESOLUTION
5	78												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	78	TRH	TEH	720-RB	COI	TEH	2.98	.00	4	.36	32	115	>> POSITIVE ID ESTABLISHED <<
5	78												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	78	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.64	82	80	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
32	78	TEH	TEC	720-EL	24	1C	-.15	.00	M1	1.38	116	80	
3	79	TSH	TEH	720-WC	CRI	TRH	.00	.00	C10	2.35	59	49	RESULT OF DISCREPANCY RESOLUTION
3	79												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	79	TH	TEH	720-EL	DRI	TEH	2.04	.00	M1	41.55	188	91	
3	79	TRH	TEH	720-RB	MAI	TEH	3.09	.00	1	1.21	22	115	>> POSITIVE ID ESTABLISHED <<
3	79												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	80	TH	TEH	720-EL	PI	1H	.00	.00	M1	.30	148	89	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
4	80	TSH	TEH	720-WC	CRI	TRH	.00	.00	C15	4.80	29	49	RESULT OF DISCREPANCY RESOLUTION
4	80												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	80	TRH	TEH	720-RB	SAI	TEH	3.24	.00	1	7.86	3	115	>> POSITIVE ID ESTABLISHED <<
4	80												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	80	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.96	51	94	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
8	80	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.25	81	94	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
10	80	TSH	TEH	720-WC	CRI	TRH	.00	.00	C22	1.31	50	49	RESULT OF DISCREPANCY RESOLUTION
10	80												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	80	TRH	TEH	720-RB	SAI	TEH	2.51	.00	1	.60	22	115	>> POSITIVE ID ESTABLISHED <<
10	80												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

D. C. Cook UIR95

AEP -13/51

INSPECTION: August 95

22-Sep-95 2:13

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
11	80	TSH	TEH	720-WC	CRI	TRH	.00	.00	C20	1.36	55	49	RESULT OF DISCREPANCY RESOLUTION
11	80												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	80	TRH	TEH	720-RB	MAI	TEH	2.49	.00	1	.71	22	115	>> POSITIVE ID ESTABLISHED <<
11	80												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	80	TEH	TEC	720-EL	39	4C	.00	.00	M1	2.36	104	86	RESULT OF DISCREPANCY RESOLUTION
31	80	TEH	TEC	720-EL	38	3C	.05	.00	M1	1.89	105	86	RESULT OF DISCREPANCY RESOLUTION
1	81	TSH	TEH	720-WC	CRI	TRH	.00	.00	C12	1.74	39	53	RESULT OF DISCREPANCY RESOLUTION
1	81												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	81	TRH	TEH	720-RB	SAI	TEH	2.82	.00	1	.69	22	115	>> POSITIVE ID ESTABLISHED <<
1	81												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	81	TSH	TEH	720-WC	CRI	TRH	.00	.00	C8	3.37	41	49	RESULT OF DISCREPANCY RESOLUTION
2	81												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	81	TRH	TEH	720-RB	SAI	TEH	1.77	.00	1	2.43	7	115	>> POSITIVE ID ESTABLISHED <<
2	81												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	81	TSH	TEH	720-WC	CRI	TRH	.00	.00	C8	1.80	38	49	RESULT OF DISCREPANCY RESOLUTION
3	81												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	81	TRH	TEH	720-RB	SAI	TEH	1.93	.00	4	3.90	1	115	>> POSITIVE ID ESTABLISHED <<
3	81												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	81	TEH	TEC	720-EL	DRI	TEH	1.16	.00	M1	38.70	179	96	RESULT OF DISCREPANCY RESOLUTION
11	81	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	1.84	315	49	RESULT OF DISCREPANCY RESOLUTION
11	81												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	81	TRH	TEH	720-RB	SAI	TEH	2.55	.00	1	.60	35	115	>> POSITIVE ID ESTABLISHED <<
11	81												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	81	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.44	85	88	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
30	81	TEH	TEC	720-EL	58	3C	-.12	.00	M1	5.35	86	88	RETEST - RETEST FOR POSITIVE ID
30	81	TEH	TEC	720-EL	35	2C	-.10	.00	M1	2.35	107	88	
30	81	TEH	TEC	720-EL	55	1C	-.05	.00	M1	5.28	89	88	RETEST - RETEST FOR POSITIVE ID
6	82	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.78	99	94	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
23	82	TEH	TEC	720-EL	13	1C	-.02	.00	M1	.75	124	86	
5	83	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.63	71	96	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
10	83	TEH	TEC	720-EL	DRI	TEH	2.36	.00	M1	55.58	181	96	
10	83	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.89	84	96	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
28	83	TEH	TEC	720-EL	44	1C	.00	.00	M1	1.96	99	88	RETEST - RETEST FOR POSITIVE ID

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
2	84	7H	TEH	720-EL	PI	1H	.00	.00	M1	.26	150	87	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
11	84	TEH	TEC	720-EL	PI	1H	.00	.00	M1	1.08	80	86	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
15	84	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.37	46	86	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
29	84	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.80	64	86	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
29	84	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.70	61	86	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
2	85	7H	TEH	720-EL	PI	2H	.00	.00	M1	.41	49	87	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
4	86	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.74	92	94	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
6	86	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.53	49	94	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
9	87	TEH	TEC	720-EL	DRI	TEH	2.37	.00	M1	47.19	179	96	RESULT OF DISCREPANCY RESOLUTION
11	87	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.93	115	92	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
6	88	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.41	60	94	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
6	89	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.49	63	96	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
7	89	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.62	67	96	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
8	92	TEH	TEC	720-EL	32	1C	.15	.00	M1	2.69	110	90	
10	92	TEH	TEC	720-EL	27	1C	.00	.00	M1	3.21	114	90	
7	93	TEH	TEC	720-EL	28	1C	-.27	.00	M1	1.40	112	92	RESULT OF DISCREPANCY RESOLUTION
10	93	TEH	TEC	720-EL	50	1C	-.50	.00	M1	5.88	94	90	RESULT OF DISCREPANCY RESOLUTION
10	93	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	RETEST - RETEST FOR POSITIVE ID
12	93	TEH	TEC	720-EL	14	1C	.02	.00	M1	1.02	123	90	
4	94	TEC	TEH	720-EL	PI	1H	.00	.00	M1	.58	92	91	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
4	94	TEC	TEH	720-EL	PI	2H	.00	.00	M1	1.40	79	91	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
7	94	TEH	TEC	720-EL	42	1C	-.15	.00	M2	3.44	102	92	RESULT OF DISCREPANCY RESOLUTION
7	94	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	RETEST - RETEST FOR POSITIVE ID
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



Attachment 2 TO AEP:NRC:1147F

**ATTACHMENT 2
STEAM GENERATOR ANNUAL OPERATING REPORT**

SECTION 1: Unit 1 Inspection Results

d. SG #14 Imperfections



SG - 14 INDICATION DISTRIBUTION

MOST SEVERE INDICATION PER TUBE

D. C. Cook U1R95

AEP-14 SERIES 51

09-22-1995

05:05 HRS.

SUPERTUBIN

▽ : 6 CECCO DI
/ : 112 CECCO DRI
R : 5 DISTORTED ROLL INDICATION


6 : 1 INDICATION 60 TO 69%
5 : 4 INDICATION 50 TO 59%
4 : 11 INDICATION 40 TO 49%

3 : 17 INDICATION 30 TO 39%
2 : 20 INDICATION 20 TO 29%
1 : 28 INDICATION 01 TO 19%

D : 2 DISTORTED INDICATION
P : 148 POSSIBLE INDICATION

N : 15 DI NON-CONFIRMED WITH RPC

□ : 271 PLUGGED TUBE

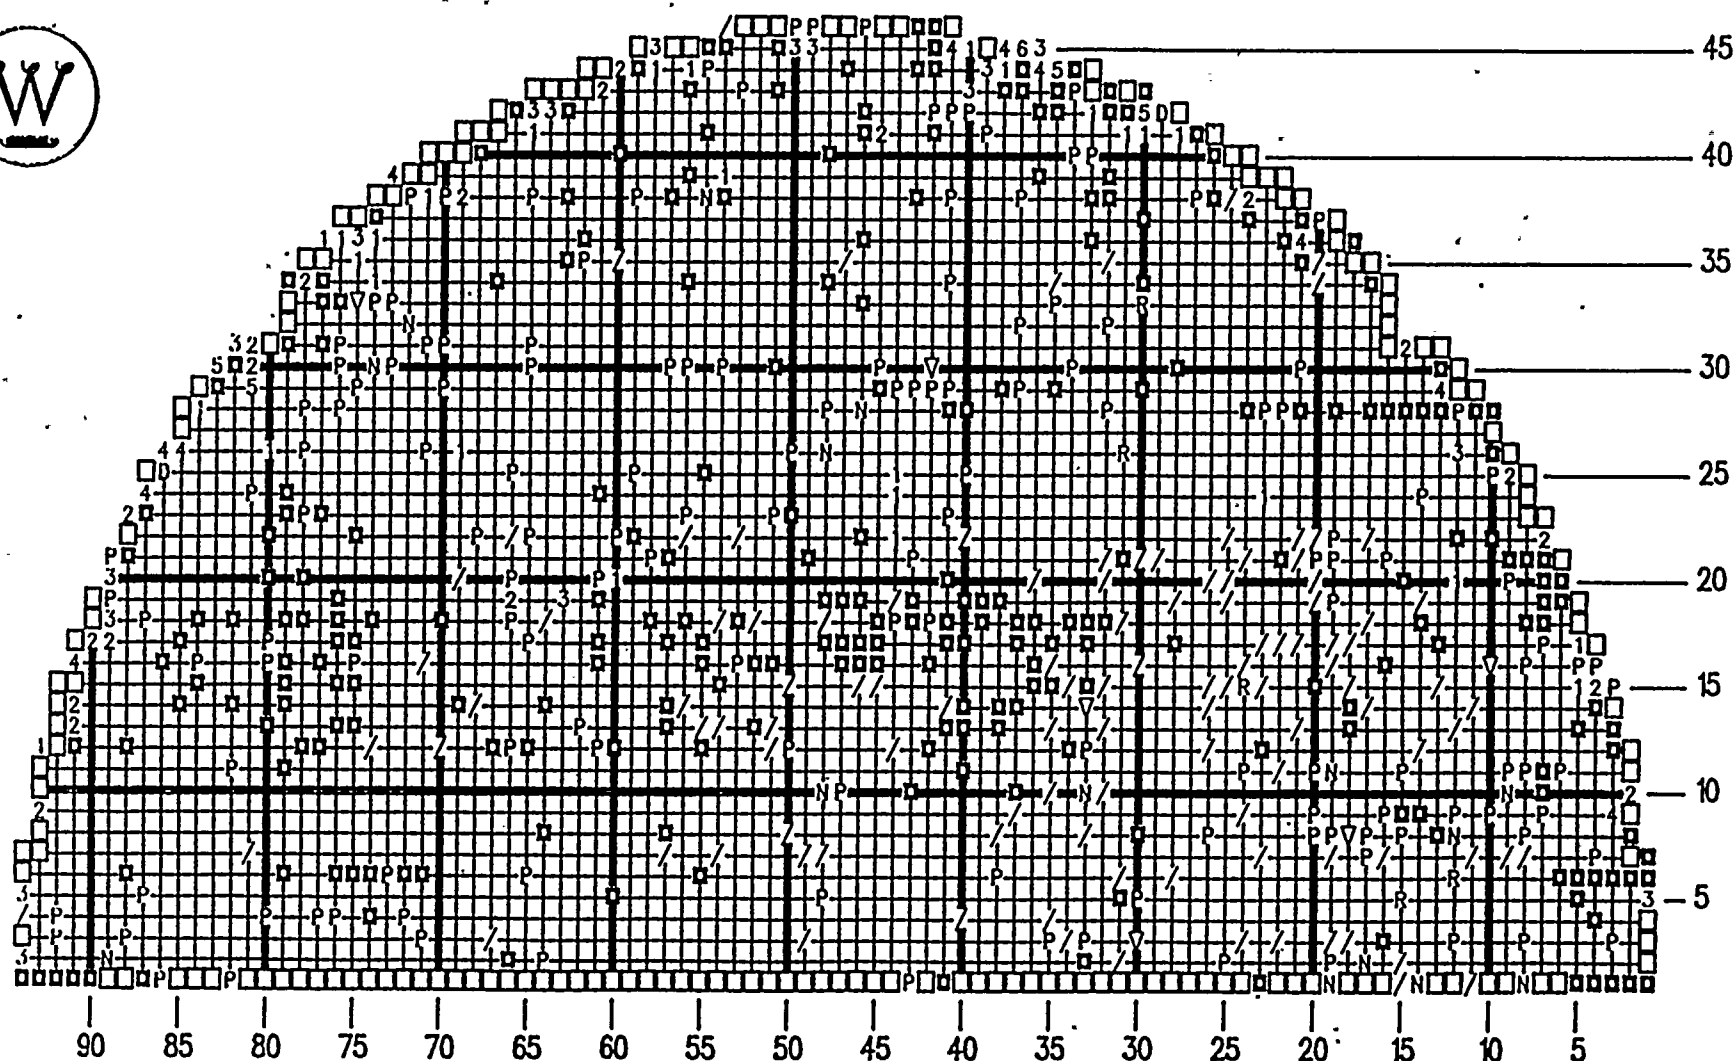



SG - 14 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -14/51

INSPECTION: August 95

22-Sep-95 2:19

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
5	1	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.42	129	60	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
5	1	TEH	TEC	720-EL	35	1C	-.26	.00	M1	.80	109	60	
9	2	TEH	TEC	720-EL	INR	TEH	21.20	.00	1			68	RESULT OF DISCREPANCY RESOLUTION
10	2	TEH	TEC	720-EL	25	1C	.13	.00	M1	.68	118	68	RESULT OF DISCREPANCY RESOLUTION
3	3	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.65	96	64	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
5	3	TEH	TEC	720-EL	INR	2H	-.09	.00	M1			64	RESULT OF DISCREPANCY RESOLUTION
5	3	TEH	TEC	720-EL	INR	5H	-.04	.00	M1			64	RESULT OF DISCREPANCY RESOLUTION
9	3	TEH	TEC	720-EL	42	1C	.02	.00	M1	3.13	105	66	RESULT OF DISCREPANCY RESOLUTION
9	3												RETEST - RETEST FOR POSITIVE ID
15	3	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.63	93	66	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
7	4	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.64	97	66	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
15	4	TEH	TEC	720-EL	26	2C	-.09	.00	M1	.66	117	68	RESULT OF DISCREPANCY RESOLUTION
16	4	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.77	44	68	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
17	4	TEH	TEC	720-EL	INR	3H	.13	.00	M1			66	RESULT OF DISCREPANCY RESOLUTION
15	5	TEH	TEC	720-EL	9	1C	-.18	.00	M1	.36	129	62	
16	5	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.29	77	62	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
17	5	TEH	TEC	720-EL	2	1C	-.15	.00	M1	1.29	133	62	
11	6	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.82	70	64	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
11	6	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.44	119	64	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
9	7	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.29	57	64	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
17	7	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.61	62	64	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
22	7	TEH	TEC	720-EL	21	1C	.02	.00	M1	1.34	121	62	
1	8	7H	TEH	720-EL	DIN	TEH	19.95	.00	M1	.15	111	135	RESULT OF DISCREPANCY RESOLUTION
3	8	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.28	89	62	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
7	8	TSH	TEH	720-WC	CRI	TRH	.00	.00	C12	1.78	39	19	RESULT OF DISCREPANCY RESOLUTION
7	8												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	8	TRH	TEH	720-RB	MAI	TEH	2.38	.00	1	.79	17	147	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

SG - 14 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -14/51

INSPECTION: August 95

22-Sep-95 2:19

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
8	8	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.68	97	62	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
11	8	TEH	TEC	720-EL	PI	2H	.00	.00	M1	1.32	90	62	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
11	8	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.45	118	62	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
16	8	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.68	116	62	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
4	9	TEH	TEC	720-EL	INR	2H	-.07	.00	M1			64	RESULT OF DISCREPANCY RESOLUTION
7	9	TSH	TEH	720-WC	CRI	TRH	.00	.00	C15	3.88	23	19	RESULT OF DISCREPANCY RESOLUTION
7	9												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	9	TRH	TEH	720-RB	SAI	TEH	2.50	.00	1	.34	24	147	>> POSITIVE ID ESTABLISHED <<
7	9												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	9	TEH	TEC	720-EL	DIN	TEH	20.73	.00	M1	.20	85	62	RESULT OF DISCREPANCY RESOLUTION
11	9	TEH	TEC	720-EL	DIN	TEH	20.79	.00	M1	1.21	32	62	RESULT OF DISCREPANCY RESOLUTION
11	9	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.75	87	62	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
11	9	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.28	55	62	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
20	9	STH	TEC	720-EL	PI	3H	.00	.00	M1	.49	66	58	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
25	9	TEH	TEC	720-EL	24	1C	.00	.00	M1	1.46	119	58	RESULT OF DISCREPANCY RESOLUTION
9	10	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.37	43	62	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
16	10	TSH	TEH	720-WC	COI	TSH	-.91	.00	C8	5.69	66	21	RESULT OF DISCREPANCY RESOLUTION
16	10												RETEST - RETEST FOR POSITIVE ID
16	10	TEH	TEC	720-EL	DIC	TEH	20.33	.00	M1	2.18	68	64	RETEST - RETEST FOR POSITIVE ID
16	10	TEH	TEC	720-EL	PI	2H	.00	.00	M1	1.00	86	64	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
16	10	TSH	TSH	720-ZC	MAI	TSH	-1.10	.00	4	3.61	19	173	RESULT OF DISCREPANCY RESOLUTION
16	10												>> POSITIVE ID ESTABLISHED <<
25	10	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.65	74	60	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
1	11	TSH	TEH	720-WC	CRI	TRH	.00	.00	C17	4.02	24	21	RESULT OF LAR
1	11												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	11	7H	TEH	720-EL	DRI	TEH	1.62	.00	M1	56.62	1	135	RESULT OF DISCREPANCY RESOLUTION
1	11	TRH	TEH	720-RB	MAI	TEH	2.29	.00	1	.54	143	147	>> POSITIVE ID ESTABLISHED <<
1	11												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	11	TSH	TEH	720-WC	CRI	TRH	.00	.00	C5	3.00	46	21	RESULT OF DISCREPANCY RESOLUTION
7	11												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	11	TRH	TEH	720-RB	MAI	TEH	1.96	.00	1	.67	24	147	>> POSITIVE ID ESTABLISHED <<
7	11												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	11	TSH	TEH	720-WC	CRI	TRH	.00	.00	C6	11.56	120	21	RESULT OF DISCREPANCY RESOLUTION

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

SG - 14 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -14/51

INSPECTION: August 95

22-Sep-95 2:19

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
14	11												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	11	TRH	TEH	720-RB	MAI	TEH	2.18	.00	1	3.07	18	147	>> POSITIVE ID ESTABLISHED <<
14	11												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	12	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.59	131	58	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
6	12	TEH	TEC	720-EL	DRI	TEH	2.66	.00	M1	46.22	178	58	RESULT OF DISCREPANCY RESOLUTION
8	12	TEH	TEC	720-EL	DIN	TEH	20.52	.00	M1	.33	67	58	RESULT OF DISCREPANCY RESOLUTION
9	12	STH	TEC	720-EL	PI	2H	.00	.00	M1	.38	76	58	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
13	12	TSH	TEH	720-WC	CRI	TRH	.00	.00	C3	2.52	50	21	RESULT OF LAR
13	12												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	12	TEH	TEC	720-EL	DRI	TEH	2.68	.00	M1	63.26	181	58	RESULT OF DISCREPANCY RESOLUTION
13	12	TRH	TEH	720-RB	MAI	TEH	2.21	.00	1	1.07	7	147	>> POSITIVE ID ESTABLISHED <<
13	12												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	12	STH	TEC	720-EL	18	6H	34.89	.00	1	1.40	149	58	
20	12	STH	TEC	720-EL	7	4C	33.76	.00	1	1.14	157	58	
26	12	TEH	TEC	720-EL	33	1C	-.07	.00	M1	1.14	111	60	
28	12	TEH	TEC	720-EL	DIN	TEH	20.97	.00	M1	.92	79	60	RESULT OF DISCREPANCY RESOLUTION
28	12	TEH	TEC	720-EL	PI	5H	.00	.00	M1	.73	97	60	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
15	13	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	1.06	56	23	RESULT OF LAR
15	13												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	13	TEH	TEC	720-EL	DRI	TEH	2.78	.00	M1	49.91	179	58	RESULT OF DISCREPANCY RESOLUTION
15	13	TRH	TEH	720-RB	MAI	TEH	2.15	.00	1	1.02	8	147	RESULT OF LAR
15	13												>> POSITIVE ID ESTABLISHED <<
15	13												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	13	TEH	TEC	720-EL	41	1C	.02	.00	M1	1.97	106	58	RESULT OF DISCREPANCY RESOLUTION
29	13												RETEST - RETEST FOR POSITIVE ID
1	14	7H	TEH	720-EL	DIN	TEH	20.40	.00	M1	.44	31	135	RESULT OF DISCREPANCY RESOLUTION
12	14	TSH	TEH	720-WC	CRI	TRH	.00	.00	C3	4.47	45	23	RESULT OF LAR
12	14												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	14	TEH	TEC	720-EL	DRI	TEH	1.45	.00	M1	58.32	182	60	RESULT OF DISCREPANCY RESOLUTION
12	14	TRH	TEH	720-RB	MAI	TEH	2.41	.00	1	.93	20	147	>> POSITIVE ID ESTABLISHED <<
12	14												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	14	TEH	TEC	720-EL	INR	TEH	20.52	.00	M1			60	RESULT OF DISCREPANCY RESOLUTION
19	14	TSH	TEH	720-WC	CRI	TRH	.00	.00	C21	4.63	30	23	RESULT OF LAR
19	14												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

D. C. Cook U1R95

AEP -14/51

INSPECTION: August 95

22-Sep-95 2:19

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
19	14	TEH	TEC	720-EL	DRI	TEH	2.63	.00	M1	43.72	182	60	RESULT OF DISCREPANCY RESOLUTION
19	14	TRH	TEH	720-RB	MAI	TEH	2.20	.00	1	1.72	14	147	>> POSITIVE ID ESTABLISHED <<
19	14												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	14	STH	TEC	720-EL	PI	2H	.00	.00	M1	.75	66	60	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
1	15	TSH	TEH	720-WC	CRI	TKH	.00	.00	C6	28.35	22	25	RESULT OF DISCREPANCY RESOLUTION
1	15												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	15	7H	TEH	720-EL	DRI	TEH	.65	.00	M1	47.90	23	135	RESULT OF DISCREPANCY RESOLUTION
1	15	TRH	TEH	720-RB	MAI	TEH	.89	.00	1	4.23	19	147	>> POSITIVE ID ESTABLISHED <<
1	15												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	15	TSH	TEH	720-WC	CRI	TKH	.00	.00	29	7.95	31	25	RESULT OF DISCREPANCY RESOLUTION
2	15												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	15	TRH	TEH	720-RB	MAI	TEH	1.08	.00	1	.35	46	147	>> POSITIVE ID ESTABLISHED <<
2	15												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	15	TEH	TEC	720-EL	DRI	TEH	1.00	.00	M1	46.50	199	68	RESULT OF DISCREPANCY RESOLUTION
8	15	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.71	90	68	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
11	15	TEH	TEC	720-EL	PI	1H	.00	.00	M1	1.29	89	66	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
11	15	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.73	83	66	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
31	15	TEH	TEC	720-EL	26	1C	-.18	.00	M1	1.68	118	68	
7	16	TSH	TEH	720-WC	CRI	TRH	.00	.00	C2	5.48	31	25	RESULT OF LAR
7	16												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	16	TRH	TEH	720-RB	SAI	TEH	2.54	.00	1	.55	22	147	>> POSITIVE ID ESTABLISHED <<
7	16												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	16	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.27	78	66	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
11	16	TEH	TEC	720-EL	INR	TEH	20.85	.00	1			68	RESULT OF DISCREPANCY RESOLUTION
21	16	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.71	59	68	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
2	17	7H	TEH	720-EL	DIN	TEH	21.02	.00	M1	1.11	99	135	RESULT OF DISCREPANCY RESOLUTION
7	17	TSH	TEC	720-EL	PI	2H	.00	.00	M1	.29	97	68	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
7	17	TEH	TEC	720-EL	PI	2H	.07	.00	M1	.31	96	134	RESULT OF DISCREPANCY RESOLUTION
8	17	TEH	TEC	720-EL	DIN	TEH	21.04	.00	M1	1.72	50	68	
8	17	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.41	88	68	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
14	17	TSH	TEH	720-WC	CRI	TRH	.00	.00	C14	4.69	35	25	RESULT OF DISCREPANCY RESOLUTION
14	17												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	17	TRH	TEH	720-RB	MAI	TEH	2.48	.00	1	2.06	10	147	>> POSITIVE ID ESTABLISHED <<

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

SG - 14 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -14/51

INSPECTION: August 95

22-Sep-95 2:19

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
14	17												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	17	TSH	TEH	720-WC	CRI	TRH	.00	.00	C12	12.92	148	25	RESULT OF DISCREPANCY RESOLUTION
18	17												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	17	TRH	TEH	720-RB	MAI	TEH	2.53	.00	1	.76	7	147	>> POSITIVE ID ESTABLISHED <<
18	17												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	17	TSH	TEH	720-WC	CRI	TRH	.00	.00	C15	1.39	45	25	RESULT OF DISCREPANCY RESOLUTION
22	17												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	17	TRH	TEH	720-RB	MAI	TEH	2.25	.00	1	.83	188	147	>> POSITIVE ID ESTABLISHED <<
22	17												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	17	TEH	TEC	720-EL	INR	TEH	20.77	.00	M1			70	RESULT OF DISCREPANCY RESOLUTION
3	18	TSH	TEH	720-WC	CRI	TRH	.00	.00	C17	2.57	40	25	RESULT OF LAR
3	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	18	TRH	TEH	720-RB	SAI	TEH	2.39	.00	1	1.28	12	147	>> POSITIVE ID ESTABLISHED <<
3	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	18	TSH	TEH	720-WC	CDI	TSH	.47	.00	C6	3.38	33	25	RESULT OF LAR
8	18												RETEST - RETEST FOR POSITIVE ID
8	18	TEH	TEC	720-EL	DIC	TEH	20.65	.00	M1	2.08	29	66	RESULT OF DISCREPANCY RESOLUTION
8	18												RETEST - RETEST FOR POSITIVE ID
8	18	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.58	53	66	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
8	18	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.89	84	66	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
8	18	TSH	TSH	720-ZC	MAI	TSH	.88	.00	4	.73	14	173	RESULT OF DISCREPANCY RESOLUTION
8	18												>> POSITIVE ID ESTABLISHED <<
15	18	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	3.28	28	25	RESULT OF DISCREPANCY RESOLUTION
15	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	18	TEH	TEC	720-EL	OPI	TEH	2.50	.00	M1	54.76	180	66	RESULT OF DISCREPANCY RESOLUTION
15	18	TRH	TEH	720-RB	SAI	TEH	2.51	.00	1	.54	14	147	>> POSITIVE ID ESTABLISHED <<
15	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	18	TSH	TEH	720-WC	CRI	TRH	.00	.00	C1	2.80	45	27	RESULT OF DISCREPANCY RESOLUTION
17	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	18	TRH	TEH	720-RB	MAI	TEH	2.48	.00	1	1.13	15	147	RESULT OF DISCREPANCY RESOLUTION
17	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	18	TEH	TEC	720-EL	INR	TEH	20.99	.00	1			72	RESULT OF DISCREPANCY RESOLUTION
1	19	7H	TEH	720-EL	DIN	TEH	21.20	.00	M1	1.22	105	135	RESULT OF DISCREPANCY RESOLUTION
2	19	7H	TEH	720-EL	PI	2H	.00	.00	M1	1.11	84	135	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
3	19	TSH	TEH	720-WC	CRI	TRH	.00	.00	C5	4.05	42	27	RESULT OF DISCREPANCY RESOLUTION
3	19												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	19	TRH	TEH	720-RB	MAI	TEH	2.31	.00	1	.99	23	147	>> POSITIVE ID ESTABLISHED <<

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

SG - 14 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -14/51

INSPECTION: August 95

22-Sep-95 2:19

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
3	19												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	19	TSH	TEH	720-WC	CRI	TRH	.00	.00	C15	2.19	39	27	RESULT OF DISCREPANCY RESOLUTION
7	19												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	19	TRH	TEH	720-RB	MAI	TEH	2.62	.00	1	.29	29	147	>> POSITIVE ID ESTABLISHED <<
7	19												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	19	TEH	TEC	720-EL	PI	3H	.00	.00	M1	1.13	72	76	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
11	19	TEH	TEC	720-EL	DIN	TEH	20.90	.00	M1	3.10	41	76	RESULT OF DISCREPANCY RESOLUTION
16	19	TSH	TEH	720-WC	CRI	TRH	.00	.00	C14	12.36	35	27	RESULT OF DISCREPANCY RESOLUTION
16	19												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	19	TEH	TEC	720-EL	DRI	TEH	2.04	.00	M1	12.26	139	70	
16	19	TRH	TEH	720-RB	MAI	TEH	2.65	.00	1	1.21	17	147	>> POSITIVE ID ESTABLISHED <<
16	19												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	19	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	2.01	35	27	RESULT OF DISCREPANCY RESOLUTION
17	19												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	19	TRH	TEH	720-RB	MAI	TEH	2.80	.00	1	.76	5	147	>> POSITIVE ID ESTABLISHED <<
17	19												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	19	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.39	92	70	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
21	19	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.51	88	70	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
21	19	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.53	54	70	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
21	19	TEH	TEC	720-EL	PI	1H	-.02	.00	M1	.91	94	76	
21	19	TEH	TEC	720-EL	PI	2H	.02	.00	M1	.88	63	76	
22	19	STH	TEC	720-EL	PI	1H	.00	.00	M1	.67	95	70	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
22	19	STH	TEC	720-EL	PI	2H	.00	.00	M1	.31	92	70	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
22	19	STH	TEC	720-EL	PI	3H	.00	.00	M1	.61	83	70	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
22	19	STH	TEC	720-EL	PI	1H	-.02	.00	M1	1.08	102	76	
22	19	STH	TEC	720-EL	PI	2H	.13	.00	M1	.44	105	76	
22	19	STH	TEC	720-EL	PI	3H	.02	.00	M1	.90	85	76	
8	20	STH	TEC	720-EL	PI	1H	.00	.00	M1	.62	69	74	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
8	20	STH	TEC	720-EL	PI	3H	.00	.00	M1	.77	77	74	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
9	20	STH	TEC	720-EL	PI	1H	.00	.00	M1	.68	89	74	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
11	20	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.39	118	74	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
19	20	TSH	TEH	720-WC	CRI	TRH	.00	.00	C16	4.38	60	27	RESULT OF DISCREPANCY RESOLUTION
19	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	20	TRH	TEH	720-RB	MAI	TEH	2.82	.00	1	.81	11	147	>> POSITIVE ID ESTABLISHED <<
19	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------



SG - 14 LISTING OF ALL INDICATIONS

D. C. Cook-U1R95

AEP -14/51

INSPECTION: August 95

22-Sep-95 2:19

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
20	20	TSH	TEH	720-WC	CRI	TRH	.00	.00	C14	7.07	47	27	RESULT OF DISCREPANCY RESOLUTION
20	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	20	TRH	TEH	720-RB	MAI	TEH	2.77	.00	1	1.52	14	147	>> POSITIVE ID ESTABLISHED <<
20	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	20	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.58	94	76	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
22	20	TSH	TEH	720-WC	CRI	TRH	.00	.00	C12	6.99	19	27	RESULT OF DISCREPANCY RESOLUTION
22	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	20	TRH	TEH	720-RB	SAI	TEH	2.02	.00	1	1.38	8	147	>> POSITIVE ID ESTABLISHED <<
22	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	20	TEH	TEC	720-EL	INR	TSH	-.76	.00	1			72	RESULT OF DISCREPANCY RESOLUTION
34	20	TSH	TEH	720-WC	CRI	TRH	.00	.00	C20	3.71	48	29	RESULT OF DISCREPANCY RESOLUTION
34	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
34	20	TRH	TEH	720-RB	MAI	TEH	2.20	.00	1	1.61	14	147	>> POSITIVE ID ESTABLISHED <<
34	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
35	20	TSH	TEH	720-WC	CRI	TRH	.00	.00	C23	4.91	46	29	RESULT OF DISCREPANCY RESOLUTION
35	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
35	20	TRH	TEH	720-RB	MAI	TEH	2.16	.00	1	2.23	13	147	>> POSITIVE ID ESTABLISHED <<
35	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
37	20	TSH	TEC	720-EL	PI	1H	-.04	.00	M1	.40	54	72	RESULT OF LAR
37	20	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.49	49	136	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
13	21	TSH	TEH	720-WC	CRI	TRH	.00	.00	C12	22.74	31	29	RESULT OF DISCREPANCY RESOLUTION
13	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	21	TRH	TEH	720-RB	MAI	TEH	2.53	.00	1	2.17	25	147	RESULT OF DISCREPANCY RESOLUTION
13	21												>> POSITIVE ID ESTABLISHED <<
13	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	21	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	3.96	54	29	RESULT OF DISCREPANCY RESOLUTION
17	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	21	TEH	TEC	720-EL	DRI	TEH	2.56	.00	M1	21.42	166	76	RESULT OF DISCREPANCY RESOLUTION
17	21	TRH	TEH	720-RB	MAI	TEH	2.62	.00	1	1.96	21	147	>> POSITIVE ID ESTABLISHED <<
17	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	21	TSH	TEH	720-WC	CRI	TRH	.00	.00	C7	2.56	28	29	RESULT OF DISCREPANCY RESOLUTION
21	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	21	TRH	TEH	720-RB	SAI	TEH	2.70	.00	1	.74	20	147	>> POSITIVE ID ESTABLISHED <<
21	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	21	TSH	TEH	720-WC	CRI	TRH	.00	.00	C23	2.26	47	29	RESULT OF DISCREPANCY RESOLUTION
22	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	21	TRH	TEH	720-RB	MAI	TEH	2.75	.00	1	.94	16	147	>> POSITIVE ID ESTABLISHED <<
22	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

SG - 14 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -14/51

INSPECTION: August 95

22-Sep-95 2:19

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
30	21	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.50	82	80	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
36	21	TEH	TEC	720-EL	40	1C	.00	.00	M1	2.01	103	78	RESULT OF DISCREPANCY RESOLUTION
36	21												RETEST - RETEST FOR POSITIVE ID
3	22	TSH	TEH	720-WC	CRI	TRH	.00	.00	C5	1.58	94	29	RESULT OF DISCREPANCY RESOLUTION
3	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	22	TRH	TEH	720-RB	SAI	TEH	2.34	.00	1	.20	55	147	>> POSITIVE ID ESTABLISHED <<
3	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	22	TSH	TEH	720-WC	CRI	TRH	.00	.00	C15	2.62	43	31	RESULT OF DISCREPANCY RESOLUTION
11	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	22	TEH	TEC	720-EL	PI	1H	.00	.00	M1	1.46	102	74	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
11	22	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.90	103	74	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
11	22	TRH	TEH	720-RB	SAI	TEH	2.83	.00	1	.72	15	147	>> POSITIVE ID ESTABLISHED <<
11	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	22	TSH	TEH	720-WC	CRI	TRH	.00	.00	C7	7.01	39	31	RESULT OF DISCREPANCY RESOLUTION
17	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	22	TEH	TEC	720-EL	ORI	TEH	1.96	.00	M1	31.61	168	74	
17	22	TRH	TEH	720-RB	MAI	TEH	2.64	.00	1	1.50	23	147	>> POSITIVE ID ESTABLISHED <<
17	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	22	TEH	TEC	720-EL	DIN	TEH	20.39	.00	M1	.44	100	78	
28	22	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.90	87	78	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
28	22	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.54	93	78	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
7	23	TSH	TEH	720-WC	CRI	TRH	.00	.00	C1	1.57	118	31	RESULT OF DISCREPANCY RESOLUTION
7	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	23	TRH	TEH	720-RB	SAI	TEH	2.68	.00	1	.67	21	147	>> POSITIVE ID ESTABLISHED <<
7	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	23	TSH	TEH	720-WC	CRI	TRH	.00	.00	C3	8.58	45	31	RESULT OF DISCREPANCY RESOLUTION
15	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	23	TRH	TEH	720-RB	MAI	TEH	2.84	.00	1	1.70	24	147	>> POSITIVE ID ESTABLISHED <<
15	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	23	TSH	TEH	720-WC	CRI	TRH	.00	.00	C21	7.69	50	31	RESULT OF DISCREPANCY RESOLUTION
17	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	23	TEH	TEC	720-EL	ORI	TEH	1.53	.00	M1	46.94	176	76	
17	23	TRH	TEH	720-RB	MAI	TEH	2.76	.00	1	3.41	19	147	>> POSITIVE ID ESTABLISHED <<
17	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	23	TEH	TEC	720-EL	15	AV2	.00	.00	M2	.26		80	
28	23	STH	TEC	720-EL	PI	3H	.00	.00	M1	.56	99	80	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

D. C. Cook U1R95

AEP -14/51

INSPECTION: August 95

22-Sep-95 2:19

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
3	24	TSH	TEH	720-WC	CRI	TRH	.00	.00	C3	2.33	62	31	RESULT OF DISCREPANCY RESOLUTION
3	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	24	TRH	TEH	720-RB	MAI	TEH	2.55	.00	1	.45	40	147	>> POSITIVE ID ESTABLISHED <<
3	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	24	TSH	TEH	720-WC	CRI	TRH	.00	.00	C12	5.25	39	31	RESULT OF DISCREPANCY RESOLUTION
9	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	24	TEH	TEC	720-EL	DRI	TEH	2.46	.00	M1	58.32	177	74	RESULT OF DISCREPANCY RESOLUTION
9	24	TRH	TEH	720-RB	MAI	TEH	2.69	.00	1	.91	19	147	>> POSITIVE ID ESTABLISHED <<
9	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	24	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.33	77	74	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
15	24	TEH	TEC	720-EL	DRI	TEH	2.60	.00	M1	61.09	176	74	RESULT OF DISCREPANCY RESOLUTION
16	24	TSH	TEH	720-WC	CRI	TRH	.00	.00	C3	3.10	46	31	RESULT OF DISCREPANCY RESOLUTION
16	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	24	TRH	TEH	720-RB	MAI	TEH	2.56	.00	1	.87	20	147	>> POSITIVE ID ESTABLISHED <<
16	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	24	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	1.24	52	33	RESULT OF DISCREPANCY RESOLUTION
21	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	24	TRH	TEH	720-RB	MAI	TEH	2.55	.00	1	.68	20	147	>> POSITIVE ID ESTABLISHED <<
21	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
38	24	TEH	TEC	720-EL	23	1C	.13	.00	M1	1.20	123	80	RESULT OF DISCREPANCY RESOLUTION
2	25	7H	TEH	720-EL	PI	2H	.00	.00	M1	.44	98	135	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
15	25	TSH	TEH	720-WC	CRI	TRH	.00	.00	C16	3.15	39	33	RESULT OF DISCREPANCY RESOLUTION
15	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	25	TRH	TEH	720-RB	SAI	TEH	2.70	.00	1	.54	14	147	>> POSITIVE ID ESTABLISHED <<
15	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	25	TSH	TEH	720-WC	CRI	TRH	.00	.00	C14	6.02	37	33	RESULT OF DISCREPANCY RESOLUTION
19	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	25	TRH	TEH	720-RB	MAI	TEH	2.49	.00	1	1.93	27	147	RESULT OF LAR
19	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	25	TSH	TEH	720-WC	CRI	TRH	.00	.00	C1	1.82	59	33	RESULT OF DISCREPANCY RESOLUTION
20	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	25	TEH	TEC	720-EL	DRI	TRH	.00	.00	5	16.70	176	80	RESULT OF DISCREPANCY RESOLUTION
20	25	TRH	TEH	720-RB	MAI	TEH	2.69	.00	1	3.64	16	147	>> POSITIVE ID ESTABLISHED <<
20	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	25	TSH	TEH	720-WC	CRI	TRH	.00	.00	C19	2.07	42	33	RESULT OF DISCREPANCY RESOLUTION
22	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	25	TEH	TEC	720-EL	DRI	TRH	.00	.00	5	16.24	356	80	RESULT OF DISCREPANCY RESOLUTION
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

SG - 14 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -14/51

INSPECTION: August 95

22-Sep-95 2:19

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
22	25	TRH	TEH	720-RB	MAI	TEH	2.79	.00	1	1.09	15	147	>> POSITIVE ID ESTABLISHED <<
22	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
38	25	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	2.84	43	33	RESULT OF DISCREPANCY RESOLUTION
38	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
38	25	TRH	TEH	720-RB	MAI	TEH	2.16	.00	1	1.08	190	147	>> POSITIVE ID ESTABLISHED <<
38	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	26	STH	TEC	720-EL	PI	2H	.00	.00	M1	.27	37	78	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
12	26	TSH	TEH	720-WC	CRI	TRH	.00	.00	C12	6.18	53	33	RESULT OF DISCREPANCY RESOLUTION
12	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	26	TRH	TEH	720-RB	MAI	TEH	2.49	.00	1	1.55	17	147	>> POSITIVE ID ESTABLISHED <<
12	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	26	TSH	TEH	720-WC	CRI	TRH	.00	.00	C15	3.47	28	33	RESULT OF DISCREPANCY RESOLUTION
14	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	26	TRH	TEH	720-RB	MAI	TEH	2.74	.00	1	.18	43	147	>> POSITIVE ID ESTABLISHED <<
14	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	26	TSH	TEH	720-WC	CRI	TRH	.00	.00	C14	6.08	41	127	RESULT OF DISCREPANCY RESOLUTION
15	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	26	TSC	TEH	720-EL	DIN	TEH	20.75	.00	M1	.58	52	135	
15	26	TRH	TEH	720-RB	MAI	TEH	2.66	.00	1	1.81	24	147	>> POSITIVE ID ESTABLISHED <<
15	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	26	TSH	TEH	720-WC	CRI	TRH	.00	.00	C3	1.77	31	33	RESULT OF DISCREPANCY RESOLUTION
20	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	26	TRH	TEH	720-RB	SAI	TEH	2.39	.00	1	1.10	15	151	>> POSITIVE ID ESTABLISHED <<
20	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
38	27	TEH	TEC	720-EL	DIN	TEH	20.35	.00	M1	.56	39	86	RESULT OF DISCREPANCY RESOLUTION
38	27	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.84	97	86	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
6	28	TSH	TEH	720-WC	CRI	TRH	.00	.00	C18	8.68	33	127	RESULT OF DISCREPANCY RESOLUTION
6	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	28	7H	TEH	720-EL	DIN	TEH	20.79	.00	M1	.27	69	135	
6	28	7C	GH	700-EL	DRI	TEH	1.77	.00	M1	64.95	3	141	RESULT OF DISCREPANCY RESOLUTION
6	28	7C	GH	700-EL	DIN	TEH	20.84	.00	M1	.33	65	141	RESULT OF DISCREPANCY RESOLUTION
6	28	TRH	TEH	720-RB	MAI	TEH	2.59	.00	1	1.10	27	147	>> POSITIVE ID ESTABLISHED <<
6	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	28	TSH	TEH	720-WC	CRI	TRH	.00	.00	C22	6.24	43	129	RESULT OF DISCREPANCY RESOLUTION
19	28												RETEST - RETEST FOR POSITIVE ID
19	28	TSH	TEH	720-WC	COI	TSH	-1.00	.00	C8	1.02	81	129	RESULT OF DISCREPANCY RESOLUTION
19	28												RETEST - RETEST FOR POSITIVE ID
19	28	TSC	TEH	720-EL	DIC	TEH	20.40	.00	M1	.76	49	135	RETEST - RETEST FOR POSITIVE ID
19	28	TSH	TSH	720-ZC	MAI	TSH	-1.06	.00	4	.74	110	173	RESULT OF DISCREPANCY RESOLUTION
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

D. C. Cook UIR95

AEP -14/51

INSPECTION: August 95

22-Sep-95 2:19

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
19	28												>> POSITIVE ID ESTABLISHED <<
19	28	TSH	TSH	720-ZC	MAI	TSH	-1.02	.00	4	.69	98	177	>> POSITIVE ID ESTABLISHED <<
41	28	TEH	TEC	720-EL	15	1C	.13	.00	M1	.91	140	84	
41	28	TEH	TEC	720-EL	18	1C	.09	.00	M1	.91	138	88	RESULT OF DISCREPANCY RESOLUTION
21	29	TSH	TEH	720-WC	CRI	TRH	.00	.00	C12	6.35	16	39	RESULT OF DISCREPANCY RESOLUTION
21	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	29	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.45	70	92	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
21	29	TRH	TEH	720-RB	SAI	TEH	2.18	.00	1	.58	22	145	>> POSITIVE ID ESTABLISHED <<
21	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
40	29	TEH	TEC	720-EL	INR	1H	.07	.00	M1			90	RESULT OF DISCREPANCY RESOLUTION
42	29	TEH	TEC	720-EL	DI	1C	-.26	.00	M1	.47	108	144	RESULT OF DISCREPANCY RESOLUTION
3	30	TSH	TEH	720-WC	CDI	TSH	.00	.00	C3	1.53	130	39	RESULT OF DISCREPANCY RESOLUTION
3	30												RETEST - RETEST FOR POSITIVE ID
3	30	TSH	TSH	720-ZC	SAI	TSH	-.95	.00	4	.27	82	173	RESULT OF DISCREPANCY RESOLUTION
3	30												>> POSITIVE ID ESTABLISHED <<
5	30	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.57	92	86	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
5	30	TEH	TEC	720-EL	PI	2H	.00	.00	M1	1.36	100	86	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
5	30	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.96	88	86	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
5	30	TEH	TEC	720-EL	PI	4H	.00	.00	M1	.44	64	86	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
16	30	TSH	TEH	720-WC	CRI	TRH	.00	.00	C12	40.58	37	39	RESULT OF DISCREPANCY RESOLUTION
16	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	30	TRH	TEH	720-RB	SAI	TEH	2.30	.00	1	5.02	12	145	>> POSITIVE ID ESTABLISHED <<
16	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	30	TRH	TEH	720-RB	SAI	TEH	2.72	.00	1	4.16	20	147	>> POSITIVE ID ESTABLISHED <<
16	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	30	TSH	TEH	720-WC	CRI	TRH	.00	.00	C21	2.80	32	39	RESULT OF DISCREPANCY RESOLUTION
21	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	30	TRH	TEH	720-RB	MAI	TEH	2.61	.00	1	.95	14	145	>> POSITIVE ID ESTABLISHED <<
21	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	30	TEH	TEC	720-EL	INR	1H	-.02	.00	M1			90	RESULT OF DISCREPANCY RESOLUTION
33	30	TEH	TEC	720-EL	DRI	TEH	2.62	.00	M1	30.20	185	90	RESULT OF DISCREPANCY RESOLUTION
41	30	TEH	TEC	720-EL	9	1C	.04	.00	M1	.64	145	92	
42	30	TEH	TEC	720-EL	51	1C	.07	.00	M1	4.01	106	92	RESULT OF DISCREPANCY RESOLUTION
42	30												RETEST - RETEST FOR POSITIVE ID
2	31	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	5.01	31	41	RESULT OF DISCREPANCY RESOLUTION



SG - 14 LISTING OF ALL INDICATIONS

D. C. Cook UIR95

AEP -14/51

INSPECTION: August 95

22-Sep-95 2:19

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
2	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	31	7H	TEH	720-EL	DRI	TEH	1.78	.00	M1	61.12	3	135	RESULT OF DISCREPANCY RESOLUTION
2	31	TRH	TEH	720-RB	MAI	TEH	2.33	.00	1	1.14	25	147	>> POSITIVE ID ESTABLISHED <<
2	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	31	TSH	TEH	720-WC	CRI	TRH	.00	.00	C16	3.88	67	41	RESULT OF DISCREPANCY RESOLUTION
6	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	31	TRH	TEH	720-RB	SAI	TEH	2.49	.00	1	1.04	15	147	>> POSITIVE ID ESTABLISHED <<
6	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	31	TSH	TEH	720-WC	CRI	TRH	.00	.00	C10	11.76	21	39	RESULT OF DISCREPANCY RESOLUTION
18	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	31	TEH	TEC	720-EL	DRI	TRH	.00	.00	M1	39.08	178	98	RESULT OF DISCREPANCY RESOLUTION
18	31	TRH	TEH	720-RB	SAI	TEH	2.70	.00	1	1.15	177	181	>> POSITIVE ID ESTABLISHED <<
18	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	31	TEH	TEC	720-EL	DRI	TEH	1.45	.00	M1	43.46	179	94	
41	31	TEH	TEC	720-EL	18	1C	.07	.00	M1	.54	138	92	RESULT OF LAR
10	32	TSH	TEH	720-WC	CRI	TRH	.00	.00	C22	7.21	22	41	RESULT OF DISCREPANCY RESOLUTION
10	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	32	TEH	TEC	720-EL	DRI	TEH	2.34	.00	M1	41.57	1	102	RESULT OF DISCREPANCY RESOLUTION
10	32	TRH	TEH	720-RB	MAI	TEH	2.57	.00	1	.29	21	147	>> POSITIVE ID ESTABLISHED <<
10	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	32	TSH	TEH	720-WC	CRI	TRH	.00	.00	C24	2.27	59	41	RESULT OF DISCREPANCY RESOLUTION
13	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	32	TEH	TEC	720-EL	DRI	TEH	2.56	.00	M1	41.47	178	102	RESULT OF DISCREPANCY RESOLUTION
13	32	TRH	TEH	720-RB	MAI	TEH	2.30	.00	1	1.04	10	147	>> POSITIVE ID ESTABLISHED <<
13	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	32	TSH	TEH	720-WC	CRI	TRH	.00	.00	C14	4.30	30	41	RESULT OF DISCREPANCY RESOLUTION
15	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	32	TEH	TEC	720-EL	DRI	TEH	2.57	.00	M1	55.16	179	102	RESULT OF DISCREPANCY RESOLUTION
15	32	TRH	TEH	720-RB	SAI	TEH	2.31	.00	1	.34	15	147	>> POSITIVE ID ESTABLISHED <<
15	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	32	TSH	TEH	720-WC	CRI	TRH	.00	.00	C23	3.35	36	41	RESULT OF DISCREPANCY RESOLUTION
20	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	32	TEH	TEC	720-EL	DRI	TRH	.00	.00	M1	22.28	168	98	RESULT OF DISCREPANCY RESOLUTION
20	32	TRH	TEH	720-RB	MAI	TEH	2.96	.00	1	1.75	17	181	>> POSITIVE ID ESTABLISHED <<
20	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	32	TSH	TEH	720-WC	CRI	TRH	.00	.00	C5	6.03	45	41	RESULT OF DISCREPANCY RESOLUTION
21	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	32	TRH	TEH	720-RB	MAI	TEH	2.48	.00	1	2.53	14	145	>> POSITIVE ID ESTABLISHED <<
21	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

D. C. Cook U1R95

AEP -14/51

INSPECTION: August 95

22-Sep-95 2:19

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
28	32	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.36	44	96	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
32	32	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.77	55	96	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
35	32	TSH	TEH	720-WC	CRI	TRH	.00	.00	C22	2.48	83	41	RESULT OF DISCREPANCY RESOLUTION
35	32	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
35	32	TRH	TEH	720-RB	MAI	TEH	2.50	.00	1	1.17	13	147	>> POSITIVE ID ESTABLISHED <<
35	32	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	33	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.64	73	132	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
8	33	TSH	TEH	720-WC	CRI	TRH	.00	.00	C5	1.88	47	41	RESULT OF DISCREPANCY RESOLUTION
8	33	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	33	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.63	84	104	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
8	33	TRH	TEH	720-RB	SAI	TEH	2.30	.00	1	.72	10	147	>> POSITIVE ID ESTABLISHED <<
8	33	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	33	TEH	TEC	720-EL	DIN	TEH	20.59	.00	M1	.83	24	104	RESULT OF DISCREPANCY RESOLUTION
12	33	STH	TEC	720-EL	PI	2H	.00	.00	M1	.94	96	104	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
14	33	TSH	TEH	720-WC	CDI	TSH	-.03	.00	C18	6.35	81	41	RESULT OF DISCREPANCY RESOLUTION
14	33	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	RETEST - RETEST FOR POSITIVE ID
14	33	TSH	TSH	720-ZC	MAI	TSH	-.02	.00	4	.23	34	173	RESULT OF DISCREPANCY RESOLUTION
14	33	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	>> POSITIVE ID ESTABLISHED <<
40	33	STH	TEC	720-EL	PI	3H	.00	.00	M1	.59	125	94	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
42	33	TEH	TEC	720-EL	9	1C	-.11	.00	M1	.60	127	94	
44	33	TEH	TEC	720-EL	INR	1C	-.07	.00	M1			94	RESULT OF LAR
3	34	TSH	TEH	720-WC	CRI	TRH	.00	.00	C24	3.80	48	41	RESULT OF DISCREPANCY RESOLUTION
3	34	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	34	TRH	TEH	720-RB	SAI	TEH	2.63	.00	1	1.72	12	147	>> POSITIVE ID ESTABLISHED <<
3	34	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	34	TSH	TEH	720-WC	CRI	TRH	.00	.00	C14	3.16	104	45	RESULT OF DISCREPANCY RESOLUTION
15	34	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	34	TEH	TEC	720-EL	DRI	TRH	.00	.00	M1	17.85	170	98	RESULT OF DISCREPANCY RESOLUTION
15	34	TRH	TEH	720-RB	MAI	TEH	2.44	.00	1	.93	12	147	>> POSITIVE ID ESTABLISHED <<
15	34	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	34	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.38	62	96	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
30	34	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.52	59	96	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
40	34	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.63	42	96	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



SG - 14 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -14/51

INSPECTION: August 95

22-Sep-95 2:19

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
42	34	TEH	TEC	720-EL	INR	TEH	20.80	.00	M1			96	RESULT OF DISCREPANCY RESOLUTION
43	34	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.38	66	96	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
3	35	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.96	79	132	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
4	35	TSH	TEH	720-WC	CRI	TRH	.00	.00	C17	1.71	42	45	RESULT OF DISCREPANCY RESOLUTION
4	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	35	TRH	TEH	720-RB	MAI	TEH	2.31	.00	1	.49	22	147	>> POSITIVE ID ESTABLISHED <<
4	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	35	TSH	TEH	720-WC	CRI	TRH	.00	.00	C18	3.41	83	45	RESULT OF DISCREPANCY RESOLUTION
10	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	35	TRH	TEH	720-RB	SAI	TEH	2.49	.00	1	.99	9	147	>> POSITIVE ID ESTABLISHED <<
10	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	35	TSH	TEH	720-WC	CRI	TRH	.00	.00	C23	6.47	43	45	RESULT OF DISCREPANCY RESOLUTION
13	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	35	TEH	TEC	720-EL	DRI	TRH	.00	.00	M1	.19	186	104	RESULT OF DISCREPANCY RESOLUTION
13	35	TRH	TEH	720-RB	MAI	TEH	2.57	.00	1	4.54	9	147	>> POSITIVE ID ESTABLISHED <<
13	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	35	TSH	TEH	720-WC	CRI	TRH	.00	.00	C14	17.94	35	45	RESULT OF DISCREPANCY RESOLUTION
16	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	35	TEH	TEC	720-EL	DRI	TRH	.00	.00	M1	17.97	158	98	RESULT OF DISCREPANCY RESOLUTION
16	35	TRH	TEH	720-RB	MAI	TEH	2.71	.00	1	3.65	22	147	>> POSITIVE ID ESTABLISHED <<
16	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	35	TSC	TEH	720-EL	DIN	TEH	20.14	.00	M1	.75	63	135	RESULT OF DISCREPANCY RESOLUTION
33	35	TSC	TEH	720-EL	PI	1H	.00	.00	M1	1.04	84	135	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
34	35	TSH	TEH	720-WC	CRI	TRH	.00	.00	C12	8.11	40	45	RESULT OF DISCREPANCY RESOLUTION
34	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
34	35	TEH	TEC	720-EL	DRI	TEH	2.40	.00	M1	22.30	172	94	RESULT OF DISCREPANCY RESOLUTION
34	35	TRH	TEH	720-RB	MAI	TEH	2.74	.00	1	1.28	18	147	>> POSITIVE ID ESTABLISHED <<
34	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
44	35	TEH	TEC	720-EL	52	1C	.00	.00	M1	4.78	98	46	RESULT OF DISCREPANCY RESOLUTION
44	35												RETEST - RETEST FOR POSITIVE ID
20	36	TSH	TEH	720-WC	CRI	TRH	.00	.00	C14	5.82	33	45	RESULT OF DISCREPANCY RESOLUTION
20	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	36	TRH	TEH	720-RB	MAI	TEH	2.63	.00	1	.78	13	147	>> POSITIVE ID ESTABLISHED <<
20	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	36	TEH	TEC	720-EL	INR	1H	-.13	.00	M1			96	RESULT OF DISCREPANCY RESOLUTION

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

SG - 14 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -14/51

INSPECTION: August 95

22-Sep-95 2:19

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
44	36	TEH	TEC	720-EL	41	1C	.07	.00	M1	2.39	107	46	RESULT OF DISCREPANCY RESOLUTION
44	36												RETEST - RETEST FOR POSITIVE ID
45	36	TEH	TEC	720-EL	34	1C	.00	.00	M1	2.22	112	46	RESULT OF DISCREPANCY RESOLUTION
9	37	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	4.90	15	47	RESULT OF LAR
9	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	37	TRH	TEH	720-RB	MAI	TEH	2.67	.00	1	1.10	11	147	>> POSITIVE ID ESTABLISHED <<
9	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	37	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.80	110	94	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
32	37	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.64	84	94	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
38	37	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.27	79	46	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
38	37	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.79	81	46	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
45	37	TEH	TEC	720-EL	31	2C	.00	.00	M1	2.74	114	46	
45	37	TEH	TEC	720-EL	68	1C	.00	.00	M1	4.77	83	46	RESULT OF DISCREPANCY RESOLUTION
45	37												RETEST - RETEST FOR POSITIVE ID
6	38	7H	TEH	720-EL	PI	1H	.00	.00	M1	.47	107	135	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
6	38	7C	6H	700-EL	PI	1H	.07	.00	M1	.48	94	141	RESULT OF DISCREPANCY RESOLUTION
8	38	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	4.52	30	47	RESULT OF DISCREPANCY RESOLUTION
8	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	38	TRH	TEH	720-RB	MAI	TEH	2.54	.00	1	2.25	12	147	>> POSITIVE ID ESTABLISHED <<
8	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	38	TEH	TEC	720-EL	INR	TSH	.24	.00	M1			100	RESULT OF DISCREPANCY RESOLUTION
44	38	TEH	TEC	720-EL	11	1C	.02	.00	M1	.66	124	48	
45	38	TEH	TEC	720-EL	DIN	TEH	20.13	.00	M1	.26	52	98	RESULT OF DISCREPANCY RESOLUTION
45	38	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.58	114	98	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
45	38	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.61	104	98	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
45	38	TEH	TEC	720-EL	45	2C	.00	.00	M1	1.51	102	98	RETEST - RETEST FOR POSITIVE ID
45	38	TEH	TEC	720-EL	37	1C	.00	.00	M1	1.01	108	98	
29	39	TEH	TEC	720-EL	INR	1H	.07	.00	M1	.87	85	98	RESULT OF DISCREPANCY RESOLUTION
41	39	STH	TEC	720-EL	PI	2H	.00	.00	M1	.39	82	98	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
44	39	TEH	TEC	720-EL	31	4C	.00	.00	M1	.69	109	138	RESULT OF DISCREPANCY RESOLUTION
4	40	TSH	TEH	720-WC	CRI	TRH	.00	.00	C14	10.22	43	49	RESULT OF DISCREPANCY RESOLUTION
4	40												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	40	TRH	TEH	720-RB	MAI	TEH	2.55	.00	1	.67	14	147	>> POSITIVE ID ESTABLISHED <<
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

SG - 14 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -14/51

INSPECTION: August 95

22-Sep-95 2:20

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
4	40												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	40	TSH	TEH	720-WC	CRI	TRH	.00	.00	C7	1.44	33	49	RESULT OF DISCREPANCY RESOLUTION
22	40												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	40	TEH	TEC	720-EL	DRI	TRH	.00	.00	M1	40.69	98		RESULT OF DISCREPANCY RESOLUTION
22	40	TRH	TEH	720-RB	MAI	TEH	2.30	.00	1	.43	18	147	>> POSITIVE ID ESTABLISHED <<
22	40												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	40	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.75	90	100	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
42	40	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.84	47	100	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
43	40	TEH	TEC	720-EL	34	2C	.00	.00	M1	.70	117	100	RESULT OF DISCREPANCY RESOLUTION
45	40	TEH	TEC	720-EL	11	1C	.11	.00	M1	.65	143	100	
14	41	TSH	TEH	720-WC	CRI	TRH	.00	.00	C7	5.08	33	51	RESULT OF DISCREPANCY RESOLUTION
14	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	41	TRH	TEH	720-RB	MAI	TEH	2.76	.00	1	1.61	20	147	>> POSITIVE ID ESTABLISHED <<
14	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	41	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.99	99	108	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
29	41	STH	TEC	720-EL	PI	1H	.00	.00	M1	.98	79	106	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
34	41	STH	TEC	720-EL	PI	1H	.00	.00	M1	.38	42	106	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
38	41	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.52	94	106	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
42	41	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.60	91	106	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
45	41	TEH	TEC	720-EL	46	2C	.00	.00	M1	3.83	105	106	RESULT OF DISCREPANCY RESOLUTION
45	41												RETEST - RETEST FOR POSITIVE ID
46	41	TEH	TEC	720-EL	INR	2C	.00	.00	M1	.97	138	106	RESULT OF DISCREPANCY RESOLUTION
18	42	STH	TEC	720-EL	PI	1H	.00	.00	M1	1.03	97	106	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
29	42	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.66	96	106	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
29	42	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.36	128	106	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
30	42	TSH	TEH	720-WC	COI	TEH	20.83	.00	C1	6.04	31	51	RESULT OF LAR
30	42												RETEST - RETEST FOR POSITIVE ID
30	42	TEH	TEC	720-EL	DIC	TEH	20.63	.00	M1	1.68	35	106	RETEST - RETEST FOR POSITIVE ID
30	42	TSH	TSH	720-ZC	SAI	TSH	.93	.00	4	1.06	40	173	RESULT OF DISCREPANCY RESOLUTION
30	42												>> POSITIVE ID ESTABLISHED <<
39	42	TEH	TEC	720-EL	INR	1H	.13	.00	M1	.16	105	108	RESULT OF DISCREPANCY RESOLUTION

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

D. C. Cook U1R95

AEP -14/51

INSPECTION: August 95

22-Sep-95 2:20

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
42	42	STH	TEC	720-EL	PI	1H	.00	.00	M1	.66	138	108	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
42	42	STH	TEC	720-EL	PI	4H	.00	.00	M1	.69	111	108	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
1	43	7H	TEH	720-EL	PI	2H	.00	.00	M1	.54	131	135	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
21	43	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.73	94	112	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
23	43	TEH	TEC	720-EL	INR	TEH	21.07	.00	M1	2.84	17	112	RESULT OF DISCREPANCY RESOLUTION
29	43	TEH	TEC	720-EL	PI	1H	.00	.00	M1	1.03	86	112	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
12	44	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	3.96	63	129	RESULT OF DISCREPANCY RESOLUTION
12	44	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	44	TSC	TEH	720-EL	DRI	TEH	1.73	.00	M1	5.83	21	135	
12	44	TRH	TEH	720-RB	MAI	TEH	2.67	.00	1	.97	13	147	>> POSITIVE ID ESTABLISHED <<
12	44	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	44	TEH	TEC	720-EL	INR	TSH	1.27	.00	M1	1.04	48	110	RESULT OF DISCREPANCY RESOLUTION
18	44	STH	TEC	720-EL	PI	1H	.00	.00	M1	.53	82	110	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
19	44	TSH	TEH	720-WC	CRI	TRH	.00	.00	C22	13.26	56	53	RESULT OF DISCREPANCY RESOLUTION
19	44	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	44	TEH	TEC	720-EL	DRI	TRH	.00	.00	M1	40.15	180	110	RESULT OF DISCREPANCY RESOLUTION
19	44	TRH	TEH	720-RB	MAI	TEH	2.62	.00	1	3.19	192	147	>> POSITIVE ID ESTABLISHED <<
19	44	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	44	TEH	TEC	720-EL	15	AV2	.00	.00	M2	.27		110	
24	44	TEH	TEC	720-EL	11	AV2	.00	.00	M2	.18		110	
25	44	TEH	TEC	720-EL	11	AV2	.00	.00	M2	.19		110	
29	44	TEH	TEC	720-EL	PI	1H	.00	.00	M1	1.33	91	110	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
41	44	TEH	TEC	720-EL	INR	TEH	20.84	.00	M1			124	RESULT OF DISCREPANCY RESOLUTION
1	45	7H	TEH	720-EL	INR	1H	-.11	.00	M1	.62	97	135	RESULT OF LAR
15	45	TSH	TEH	720-WC	CRI	TRH	.00	.00	C22	10.79	52	53	RESULT OF DISCREPANCY RESOLUTION
15	45	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	45	TRH	TEH	720-RB	MAI	TEH	2.58	.00	1	2.65	20	147	>> POSITIVE ID ESTABLISHED <<
15	45	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	45	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.42	100	110	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
30	45	TEH	TEC	720-EL	PI	2H	-.02	.00	M1	.37	86	116	RESULT OF LAR
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

SG - 14 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -14/51

INSPECTION: August 95

22-Sep-95 2:20

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
41	45	STH	TEC	720-EL	26	AV3	.00	.00	M2	.87	122		
41	45	STH	TEC	720-EL	21	AV4	.00	.00	M2	.56	122		
15	46	TSH	TEH	720-WC	CRI	TRH	.00	.00	C24	3.71	56	129	RESULT OF DISCREPANCY RESOLUTION
15	46												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	46	TSC	TEH	720-EL	ORI	TEH	1.59	.00	M1	42.69	179	135	RESULT OF DISCREPANCY RESOLUTION
15	46	TRH	TEH	720-RB	MAI	TEH	2.34	.00	1	2.59	20	147	>> POSITIVE ID ESTABLISHED <<
15	46												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	46	TEH	TEC	720-EL	DIN	TSH	.06	.00	M1	2.27	67	114	RESULT OF DISCREPANCY RESOLUTION
46	46	TEH	TEC	720-EL	PI	1H	.00	.00	M1	1.15	92	122	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
46	46	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.62	102	122	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
10	47	TEH	TEC	720-EL	PI	2H	.00	.00	M1	1.12	105	150	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
35	47	TSH	TEH	720-WC	CRI	TRH	.00	.00	C21	11.26	45	55	RESULT OF DISCREPANCY RESOLUTION
35	47												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
35	47	TRH	TEH	720-RB	MAI	TEH	2.53	.00	1	2.28	18	149	>> POSITIVE ID ESTABLISHED <<
35	47												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	48	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.43	86	148	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
7	48	TSH	TEH	720-WC	CRI	TRH	.00	.00	C22	7.58	23	97	RESULT OF DISCREPANCY RESOLUTION
7	48												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	48	TRH	TEH	720-RB	SAI	TEH	2.39	.00	1	1.37	20	145	>> POSITIVE ID ESTABLISHED <<
7	48												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	48	TEH	TEC	720-EL	DIN	TSH	.00	.00	M1	2.19	141	148	RESULT OF DISCREPANCY RESOLUTION
18	48	TSH	TEH	720-WC	CRI	TRH	.00	.00	C14	8.41	39	55	RESULT OF DISCREPANCY RESOLUTION
18	48												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	48	TRH	TEH	720-RB	MAI	TEH	2.49	.00	1	1.72	4	145	>> POSITIVE ID ESTABLISHED <<
18	48												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	48	TEH	TEC	720-EL	DIN	TSH	.15	.00	M1	3.03	84	114	
28	48	TEH	TEC	720-EL	PI	1H	.00	.00	M1	1.10	103	118	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
3	49	TSH	TEH	720-WC	CRI	TRH	.00	.00	C3	3.37	61	131	RESULT OF DISCREPANCY RESOLUTION
3	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	49	TRH	TEH	720-RB	MAI	TEH	2.40	.00	1	1.28	26	145	>> POSITIVE ID ESTABLISHED <<
3	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	49	TSH	TEH	720-WC	CRI	TRH	.00	.00	C21	4.70	30	97	RESULT OF DISCREPANCY RESOLUTION
7	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	49	TRH	TEH	720-RB	SAI	TEH	2.39	.00	1	2.00	14	145	>> POSITIVE ID ESTABLISHED <<
7	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

SG - 14 LISTING OF ALL INDICATIONS

D. C. Cook.U1R95

AEP -14/51

INSPECTION: August 95

22-Sep-95 2:20

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
45	49	TEH	TEC	720-EL	39	2C	.00	.00	M1	1.35	109	122	
46	49	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.92	62	138	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
46	49	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.45	84	138	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
8	50	TSH	TEH	720-WC	CDI	TEH	21.34	.00	C21	2.89	83	133	RESULT OF LAR
8	50												RETEST - RETEST FOR POSITIVE ID
8	50	TSH	TEH	720-WC	CRI	TRH	.00	.00	C14	9.69	33	133	RESULT OF DISCREPANCY RESOLUTION
8	50												RETEST - RETEST FOR POSITIVE ID
8	50	TSC	TEH	720-EL	DIC	TEH	21.06	.00	M1	3.65	76	135	RESULT OF DISCREPANCY RESOLUTION
8	50												RETEST - RETEST FOR POSITIVE ID
8	50	TSC	TEH	720-EL	PI	2H	.00	.00	M1	.67	90	135	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
8	50	TSH	TSH	720-ZC	MAI	TSH	-.41	.00	4	.56	93	175	RESULT OF DISCREPANCY RESOLUTION
8	50												>> POSITIVE ID ESTABLISHED <<
8	50	TSH	TSH	720-ZC	MAI	TSH	-.31	.00	4	1.28	107	177	>> POSITIVE ID ESTABLISHED <<
12	50	STH	TEC	720-EL	PI	1H	.00	.00	M1	.39	94	156	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
15	50	TSH	TEH	720-WC	CRI	TRH	.00	.00	C3	2.54	19	95	RESULT OF DISCREPANCY RESOLUTION
15	50												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	50	TRH	TEH	720-RB	MAI	TEH	2.43	.00	1	1.49	10	145	>> POSITIVE ID ESTABLISHED <<
15	50												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	50	TEH	TEC	720-EL	PI	4H	.00	.00	M1	.55	90	140	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
45	50	TEH	TEC	720-EL	32	1C	.00	.00	M1	.78	114	138	RESULT OF DISCREPANCY RESOLUTION
46	50	TSC	TEH	720-EL	PI	1H	.00	.00	M1	1.22	76	137	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
46	50	TSC	TEH	720-EL	PI	2H	.00	.00	M1	.99	91	137	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
46	50	TSC	TEH	720-EL	PI	3H	.00	.00	M1	.62	126	137	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
46	50	TSC	TEH	720-EL	PI	4H	.00	.00	M1	1.09	84	137	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
46	50	TSC	TEH	720-EL	PI	5H	.00	.00	M1	.53	108	137	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
12	51	TSH	TEH	720-WC	CRI	TRH	.00	.00	C15	1.69	46	95	RESULT OF DISCREPANCY RESOLUTION
12	51												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	51	TRH	TEH	720-RB	SAI	TEH	2.42	.00	1	.90	10	145	>> POSITIVE ID ESTABLISHED <<
12	51												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	51	TSH	TEH	720-WC	CRI	TRH	.00	.00	C5	3.99	43	95	RESULT OF DISCREPANCY RESOLUTION
13	51												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	51	TRH	TEH	720-RB	MAI	TEH	2.56	.00	1	1.76	26	145	>> POSITIVE ID ESTABLISHED <<
13	51												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	51	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.63	95	126	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
18	52	TSH	TEH	720-WC	CRI	TRH	.00	.00	C18	5.43	67	127	RESULT OF DISCREPANCY RESOLUTION
18	52												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

SG - 14 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -14/51

INSPECTION: August 95

22-Sep-95 2:20

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
18	52	TSH	TEH	720-WC	CRI	TRH	.00	.00	C21	7.35	41	129	RESULT OF DISCREPANCY RESOLUTION
18	52												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	52	TSC	TEH	720-EL	DRI	TEH	2.08	.00	M1	7.34	11	137	RESULT OF DISCREPANCY RESOLUTION
18	52	TRH	TEH	720-RB	MAI	TEH	2.36	.00	1	2.71	13	145	>> POSITIVE ID ESTABLISHED <<
18	52												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	53	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.70	99	128	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
22	53	TSH	TEH	720-WC	CRI	TRH	.00	.00	C14	16.08	37	59	RESULT OF DISCREPANCY RESOLUTION
22	53												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	53	TRH	TEH	720-RB	SAI	TEH	2.59	.00	1	2.36	19	145	>> POSITIVE ID ESTABLISHED <<
22	53												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
43	53	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.30	54	54	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
7	54	TSH	TEH	720-WC	CRI	TRH	.00	.00	C3	6.18	31	93	RESULT OF DISCREPANCY RESOLUTION
7	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	54	TRH	TEH	720-RB	COI	TEH	2.45	.00	1	1.24	25	145	>> POSITIVE ID ESTABLISHED <<
7	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	54	TSH	TEH	720-WC	CRI	TRH	.00	.00	C15	1.40	97	93	RESULT OF LAR
13	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	54	TRH	TEH	720-RB	SAI	TEH	2.43	.00	1	1.33	10	145	>> POSITIVE ID ESTABLISHED <<
13	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	54	TSH	TEH	720-WC	CRI	TRH	.00	.00	C18	6.08	48	127	RESULT OF DISCREPANCY RESOLUTION
18	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	54	TSC	TEH	720-EL	DRI	TEH	2.60	.00	M1	63.45	12	137	RESULT OF DISCREPANCY RESOLUTION
18	54	TRH	TEH	720-RB	MAI	TEH	2.39	.00	1	2.65	13	145	>> POSITIVE ID ESTABLISHED <<
18	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	54	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.41	68	56	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
39	54	STH	TEC	720-EL	15	TSC	1.27	.00	M1	.19	122	56	
46	54	TSH	TEH	720-WC	CRI	TKH	.00	.00	C9	15.43	17	129	RESULT OF DISCREPANCY RESOLUTION
46	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
46	54	TSC	TEH	720-EL	DIN	TEH	20.63	.00	M1	1.13	153	137	RESULT OF DISCREPANCY RESOLUTION
46	54	TSC	TEH	720-EL	PI	3H	.00	.00	M1	.94	107	137	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
46	54	TSC	TEH	720-EL	PI	4H	.00	.00	M1	1.42	111	137	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
46	54	TRH	TEH	720-RB	MAI	TEH	1.24	.00	1	8.99	201	145	>> POSITIVE ID ESTABLISHED <<
46	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	55	TSH	TEH	720-WC	CRI	TRH	.00	.00	C12	8.35	18	93	RESULT OF DISCREPANCY RESOLUTION
13	55												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	55	TRH	TEH	720-RB	MAI	TEH	2.32	.00	1	1.20	9	145	>> POSITIVE ID ESTABLISHED <<
13	55												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
38	55	TEH	TEC	720-EL	DIN	TEH	20.93	.00	M1	.66	46	50	RESULT OF LAR
44	55	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.67	108	54	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
44	55	TEH	TEC	720-EL	PI	7H	.00	.00	M1	.36	105	54	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
14	56	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	7.07	43	65	RESULT OF DISCREPANCY RESOLUTION
14	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	56	TRH	TEH	720-RB	MAI	TEH	2.34	.00	1	2.68	11	145	>> POSITIVE ID ESTABLISHED <<
14	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	56	TSH	TEH	720-WC	CRI	TRH	.00	.00	C24	12.15	53	61	RESULT OF DISCREPANCY RESOLUTION
22	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	56	TRH	TEH	720-RB	MAI	TEH	2.32	.00	1	2.65	18	145	>> POSITIVE ID ESTABLISHED <<
22	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	56	TEH	TEC	720-EL	PI	1H	.00	.00	M1	1.20	81	50	RESULT OF DISCREPANCY RESOLUTION
23	56	TEH	TEC	720-EL	PI	1H	.00	.00	M1	1.03	91	52	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
30	56	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.91	77	52	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
44	56	TEH	TEC	720-EL	4	2C	-.33	.00	M1	3.02	131	54	
7	57	TSH	TEH	720-WC	CRI	TRH	.00	.00	C23	3.92	46	93	RESULT OF DISCREPANCY RESOLUTION
7	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	57	TRH	TEH	720-RB	MAI	TEH	2.23	.00	1	1.73	18	145	>> POSITIVE ID ESTABLISHED <<
7	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	57	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.77	47	50	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
30	57	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.38	100	50	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
21	58	TEH	TEC	720-EL	PI	1H	.00	.00	M1	1.29	68	52	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
44	58	TEH	TEC	720-EL	9	2C	-.22	.00	M1	.64	125	52	
44	58	TEH	TEC	720-EL	2	1C	.09	.00	M1	.91	129	52	RESULT OF DISCREPANCY RESOLUTION
45	58	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.45	69	50	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
45	58	TEH	TEC	720-EL	38	2C	.00	.00	M1	1.73	108	50	
25	59	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.44	71	44	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
38	59	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.18	73	50	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
20	60	TEH	TEC	720-EL	15	3H	41.93	.00	1	1.10	151	42	
20	60	TEH	TEC	720-EL	11	6H	9.84	.00	1	.59	154	42	
22	60	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.53	73	42	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
35	60	TSH	TEH	720-WC	CRI	TRH	.00	.00	C3	3.12	35	65	RESULT OF DISCREPANCY RESOLUTION

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

D. C. Cook U1R95

AEP -14/51

INSPECTION: August 95

22-Sep-95 2:20

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
35	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
35	60	TRH	TEH	720-RB	MAI	TEH	2.56	.00	1	.86	20	145	>> POSITIVE ID ESTABLISHED <<
35	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
44	60	TEH	TEC	720-EL	25	3C	-.07	.00	M1	1.91	116	52	
12	61	STH	TEC	720-EL	PI	1H	.00	.00	M1	.68	100	8	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
20	61	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.70	61	8	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
38	61	TEH	TEC	720-EL	INR	TEH	20.75	.00	M1	.76	52	50	RESULT OF DISCREPANCY RESOLUTION
43	61	TEH	TEC	720-EL	21	AV1	.00	.00	M2	.60		50	
43	61	TEH	TEC	720-EL	12	1C	.07	.00	M1	1.18	126	50	RESULT OF LAR
13	62	STH	TEC	720-EL	PI	1H	.00	.00	M1	.53	87	6	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
35	62	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.57	47	52	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
19	63	STH	TEC	720-EL	18	AV1	.00	.00	M2	.42		8	
19	63	STH	TEC	720-EL	30	AV2	.00	.00	M2	1.29		8	
19	63	STH	TEC	720-EL	24	AV3	.00	.00	M2	.73		8	
19	63	STH	TEC	720-EL	22	AV4	.00	.00	M2	.66		8	
26	63	TEH	TEC	720-EL	INR	1H	.00	.00	M1	.81	84	8	RESULT OF LAR
2	64	7H	TEH	720-EL	DIN	TEH	20.88	.00	M1	1.11	30	137	RESULT OF DISCREPANCY RESOLUTION
2	64	7H	TEH	720-EL	PI	3H	.00	.00	M1	.28	79	137	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
18	64	TEH	TEC	720-EL	DRI	TRH	.00	.00	5	10.44	157	6	RESULT OF DISCREPANCY RESOLUTION
18	64	TSH	TEH	720-WC	CRI	TRH	.00	.00	C3	4.90	49	69	RESULT OF DISCREPANCY RESOLUTION
18	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	64	TRH	TEH	720-RB	MAI	TEH	2.50	.00	1	1.37	16	145	>> POSITIVE ID ESTABLISHED <<
18	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
42	64	TEH	TEC	720-EL	30	1C	.00	.00	M1	1.71	113	52	
6	65	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.51	62	44	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
17	65	TEH	TEC	720-EL	PI	1H	.00	.00	M1	1.10	77	136	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
22	65	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.94	52	134	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
30	65	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.63	112	134	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
31	65	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.52	32	134	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
38	65	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.31	79	134	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



SG - 14 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -14/51

INSPECTION: August 95

22-Sep-95 2:20

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
41	65	TEH	TEC	720-EL	17	2C	.18	.00	M1	.61	121	2	RESULT OF DISCREPANCY RESOLUTION
42	65	TEH	TEC	720-EL	30	1C	.00	.00	M1	1.43	112	2	
12	66	STH	TEC	720-EL	PI	1H	.00	.00	M1	.37	98	6	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
18	66	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.68	99	4	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
19	66	TEH	TEC	720-EL	20	AV1	.00	.00	M2	.52		4	RESULT OF DISCREPANCY RESOLUTION
19	66	TEH	TEC	720-EL	24	AV2	.00	.00	M2	.75		4	
19	66	TEH	TEC	720-EL	27	AV3	.00	.00	M2	1.02		4	
19	66	TEH	TEC	720-EL	18	AV4	.00	.00	M2	.45		4	
20	66	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.97	95	4	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
22	66	TSH	TEH	720-WC	CRI	TRH	.00	.00	C24	6.77	52	71	RESULT OF DISCREPANCY RESOLUTION
22	66	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	66	TRH	TEH	720-RB	MAI	TEH	2.53	.00	1	1.92	13	145	>> POSITIVE ID ESTABLISHED <<
22	66	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	66	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.97	80	4	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
3	67	TSH	TEH	720-WC	CRI	TRH	.00	.00	C23	1.98	54	71	RESULT OF DISCREPANCY RESOLUTION
3	67	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	67	TSH	TEH	720-WC	CRI	TRH	.00	.00	C20	3.56	83	73	RESULT OF DISCREPANCY RESOLUTION
3	67	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	67	TRH	TEH	720-RB	SAI	TEH	2.41	.00	1	1.16	11	145	>> POSITIVE ID ESTABLISHED <<
3	67	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	68	TEH	TEC	720-EL	DRI	TEH	2.52	.00	M1	39.87	175	6	RESULT OF LAR
14	68	TSH	TEH	720-WC	CRI	TRH	.00	.00	C22	3.54	40	73	RESULT OF DISCREPANCY RESOLUTION
14	68	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	68	TRH	TEH	720-RB	MAI	TEH	2.26	.00	1	.86	16	145	>> POSITIVE ID ESTABLISHED <<
14	68	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	68	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.63	35	6	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
20	69	TEH	TEC	720-EL	DRI	TEH	2.49	.00	M1	46.15	3	10	RESULT OF LAR
20	69	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	1.43	44	75	RESULT OF LAR
20	69	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	69	TRH	TEH	720-RB	MAI	TEH	2.22	.00	1	2.31	11	145	>> POSITIVE ID ESTABLISHED <<
20	69	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-----	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	69	TEH	TEC	720-EL	13	AV1	.26	.00	M2	.26		10	
26	69	TEH	TEC	720-EL	18	AV2	.05	.00	M2	.42		10	
38	69	TEH	TEC	720-EL	22	2C	-.27	.00	M1	.66	118	2	
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

D. C. Cook U1R95

AEP -14/51

INSPECTION: August 95

22-Sep-95 2:20

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
12	70	TSH	TEH	720-WC	CRI	TRH	.00	.00	C18	3.15	39	75	RESULT OF LAR
12	70												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	70	TRH	TEH	720-RB	SAI	TEH	2.50	.00	1	.82	10	145	>> POSITIVE ID ESTABLISHED <<
12	70												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	70	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.42	96	12	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
31	70	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.74	81	10	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
38	70	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.55	48	4	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
3	71	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.61	98	12	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
16	71	TEH	TEC	720-EL	DIC	TEH	20.44	.00	M1	1.18	31	12	RESULT OF DISCREPANCY RESOLUTION
16	71												RETEST - RETEST FOR POSITIVE ID
16	71	TEH	TEC	720-EL	DRI	TRH	.00	.00	M1	42.84	176	12	RESULT OF DISCREPANCY RESOLUTION
16	71	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	3.09	133	77	RESULT OF DISCREPANCY RESOLUTION
16	71												RETEST - RETEST FOR POSITIVE ID
16	71	TSH	TEH	720-WC	CDI	TSH	-.66	.00	C9	1.77	48	77	RESULT OF DISCREPANCY RESOLUTION
16	71												RETEST - RETEST FOR POSITIVE ID
16	71	TSH	TSH	720-ZC	MAI	TSH	-.73	.00	1	1.35	23	175	RESULT OF DISCREPANCY RESOLUTION
16	71												>> POSITIVE ID ESTABLISHED <<
16	71	TSH	TSH	720-ZC	MAI	TSH	-.69	.00	4	1.07	43	177	>> POSITIVE ID ESTABLISHED <<
26	71	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.34	100	12	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
31	71	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.56	32	12	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
38	71	TEH	TEC	720-EL		7 1C	-.22	.00	M1	1.25	127	2	
4	72	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.82	119	10	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
32	72	TEH	TEC	720-EL	DIN	TEH	20.78	.00	M1	.83	29	10	RESULT OF DISCREPANCY RESOLUTION
38	72	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.51	44	4	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
6	73	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.82	101	14	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
30	73	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.50	44	12	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
33	73	TEH	TEC	720-EL	INR	TEH	20.79	.00	M1	.93	32	18	RESULT OF DISCREPANCY RESOLUTION
33	73	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.82	57	18	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
39	73	TEH	TEC	720-EL	43	2C	.00	.00	M1	3.87	102	2	RESULT OF DISCREPANCY RESOLUTION
39	73												RETEST - RETEST FOR POSITIVE ID
12	74	TSH	TEH	720-WC	CRI	TRH	.00	.00	C17	6.21	45	129	RESULT OF DISCREPANCY RESOLUTION

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

D. C. Cook U1R95

AEP -14/51

INSPECTION: August 95

22-Sep-95 2:20

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
12	74												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	74	TSC	TEH	720-EL	DRI	TEH	2.42	.00	M1	38.77	154	137	
12	74	TRH	TEH	720-RB	MAI	TEH	2.15	.00	1	1.76	15	145	>> POSITIVE ID ESTABLISHED <<
12	74												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	74	TEH	TEC	720-EL	DIN	TEH	21.04	.00	M1	1.15	30	10	RESULT OF DISCREPANCY RESOLUTION
30	74	TEH	TEC	720-EL	INR	1H	-.10	.00	M1			10	
33	74	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.73	63	4	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
33	74	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.71	72	4	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
34	74	TEH	TEC	720-EL	17	TSH	8.51	.00	1	.37	141	138	RESULT OF DISCREPANCY RESOLUTION
36	74	TEH	TEC	720-EL	12	1C	-.22	.00	M1	.91	124	2	
16	75	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.91	83	14	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
29	75	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.64	47	134	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
33	75	TSH	TEH	720-WC	COI	TSH	-.59	.00	C18	1.79	78	129	RESULT OF DISCREPANCY RESOLUTION
33	75												RETEST - RETEST FOR POSITIVE ID
33	75	TSC	TEH	720-EL	DIC	TEH	20.86	.00	M1	.67	49	137	RETEST - RETEST FOR POSITIVE ID
33	75	TSC	TEH	720-EL	PI	1H	.00	.00	M1	1.27	75	137	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
33	75	TSC	TEH	720-EL	PI	2H	.00	.00	M1	1.23	92	137	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
33	75	TSH	TSH	720-ZC	MAI	TSH	-.55	.00	4	.25	125	175	>> POSITIVE ID ESTABLISHED <<
35	75	TEH	TEC	720-EL	9	2C	-.09	.00	M1	.98	125	4	
36	75	TEH	TEC	720-EL	33	2C	.04	.00	M1	3.00	111	4	
4	76	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.95	83	18	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
4	76	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.34	107	18	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
28	76	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.55	33	18	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
30	76	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.34	109	20	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
31	76	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.60	104	20	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
36	76	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.25	57	18	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
36	76	TEH	TEC	720-EL	14	1C	.09	.00	M1	.82	123	18	
4	77	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.45	51	20	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
36	77	TEH	TEC	720-EL	15	1C	-.20	.00	M1	.97	122	18	RESULT OF DISCREPANCY RESOLUTION
23	78	STH	TEC	720-EL	PI	3H	.00	.00	M1	.74	78	20	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



D. C. Cook UIR95

AEP -14/51

INSPECTION: August 95

22-Sep-95 2:20

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
26	78	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.51	44	20	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
28	78	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.64	60	20	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
34	78	TEH	TEC	720-EL	28	1C	-.26	.00	M1	.80	116	20	RESULT OF DISCREPANCY RESOLUTION
10	79	TEH	TEC	720-EL	INR	1H	-.26	.00	M1	.35	83	20	RESULT OF DISCREPANCY RESOLUTION
4	80	TEH	TEC	720-EL	PI	2H	.00	.00	M1	1.16	54	18	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
16	80	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.77	47	18	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
17	80	TEH	TEC	720-EL	INR	TEH	20.97	.00	M1	2.19	18	18	RESULT OF DISCREPANCY RESOLUTION
17	80	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.91	75	18	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
26	80	TEH	TEC	720-EL	19	AV3	.00	.00	M2	.47		22	
26	80	TEH	TEC	720-EL	15	AV4	.00	.00	M2	.31		22	
7	81	TSH	TEH	720-WC	CRI	TRH	.00	.00	C21	4.51	30	129	RESULT OF DISCREPANCY RESOLUTION
7	81												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	81	TSC	TEH	720-EL	DRI	TEH	2.10	.00	M1	7.50	8	137	RESULT OF DISCREPANCY RESOLUTION
7	81	TRH	TEH	720-RB	SAI	TEH	2.71	.00	1	2.42	10	181	>> POSITIVE ID ESTABLISHED <<
7	81												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	81	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.97	76	22	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
26	81	TEH	TEC	720-EL	INR	1H	.02	.00	M1	.68	62	22	RESULT OF LAR
29	81	TEH	TEC	720-EL	55	2C	.00	.00	M1	3.56	91	22	RESULT OF DISCREPANCY RESOLUTION
29	81												RETEST - RETEST FOR POSITIVE ID
30	81	TEH	TEC	720-EL	29	2C	.00	.00	M1	.93	111	22	
31	81	TEH	TEC	720-EL	22	1C	-.09	.00	M1	.80	116	22	
1	82	7H	TEH	720-EL	PI	2H	.00	.00	M1	.86	66	137	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
11	82	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.57	79	26	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
31	82	TEH	TEC	720-EL	39	4C	.00	.00	M1	1.53	104	22	
31	82	TEH	TEC	720-EL	20	3C	-.04	.00	M1	.52	117	22	RESULT OF DISCREPANCY RESOLUTION
30	83	TEH	TEC	720-EL	51	2C	.09	.00	M1	4.56	97	24	RESULT OF DISCREPANCY RESOLUTION
30	83												RETEST - RETEST FOR POSITIVE ID
8	84	TEH	TEC	720-EL	INR	TEH	20.67	.00	M1			32	RESULT OF DISCREPANCY RESOLUTION
16	84	STH	TEC	720-EL	PI	2H	.00	.00	M1	.80	79	26	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
28	84	TEH	TEC	720-EL	3	1C	-.07	.00	M1	.82	126	30	
26	85	TEH	TEC	720-EL	45	1C	.00	.00	M1	1.66	98	30	RETEST - RETEST FOR POSITIVE ID
1	86	7H	TEH	720-EL	PI	4H	.00	.00	M1	.48	67	137	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
25	86	TEH	TEC	720-EL	DI	1C	.13	.00	M1	.34	71	32	RESULT OF DISCREPANCY RESOLUTION
26	86	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.73	63	30	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
26	86	TEH	TEC	720-EL	48	2C	.00	.00	M1	3.48	95	30	RETEST - RETEST FOR POSITIVE ID
5	87	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.87	36	40	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
18	87	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.73	46	34	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
24	87	TEH	TEC	720-EL	17	AV2	.00	.00	M2	.41		34	
24	87	TEH	TEC	720-EL	25	2C	-.27	.00	M1	1.57	120	34	
24	87	TEH	TEC	720-EL	47	1C	-.18	.00	M1	1.68	103	34	RESULT OF DISCREPANCY RESOLUTION
24	87												RETEST - RETEST FOR POSITIVE ID
3	88	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.26	96	38	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
23	88	TEH	TEC	720-EL	28	2C	-.22	.00	M1	1.65	114	36	
2	89	7H	TEH	720-EL	DIN	TEH	20.70	.00	M1	.23	75	137	
17	89	TEH	TEC	720-EL	25	1C	.00	.00	M1	1.18	120	34	RESULT OF DISCREPANCY RESOLUTION
18	89	TEH	TEC	720-EL	38	1C	-.11	.00	M1	1.28	110	34	RESULT OF DISCREPANCY RESOLUTION
19	89	TEH	TEC	720-EL	PI	2H	.00	.00	M1	1.01	94	34	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
20	89	TEH	TEC	720-EL	39	1C	-.13	.00	M1	1.37	109	38	RESULT OF DISCREPANCY RESOLUTION
21	89	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.39	115	142	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
14	90	TEH	TEC	720-EL	INR	1C	-.50	.00	M1			36	RESULT OF LAR
17	90	TEH	TEC	720-EL	26	1C	.15	.00	M1	2.06	115	36	
13	91	TEH	TEC	720-EL	21	1C	-.18	.00	M1	1.00	122	38	
14	91	TEH	TEC	720-EL	20	1C	-.09	.00	M1	.89	123	38	RESULT OF DISCREPANCY RESOLUTION
16	91	TEH	TEC	720-EL	47	2C	-.09	.00	M1	3.33	102	38	RETEST - RETEST FOR POSITIVE ID
16	91	TEH	TEC	720-EL	45	1C	.00	.00	M1	1.51	104	38	RESULT OF DISCREPANCY RESOLUTION
16	91												RETEST - RETEST FOR POSITIVE ID
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



SG - 14 LISTING OF ALL INDICATIONS

D. C. Cook U1R95

AEP -14/51

INSPECTION: August 95

22-Sep-95 2:20

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
3	92	7H	TEH	720-EL	PI	2H	.00	.00	M1	.49	52	137	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
3	92	7C	TEH	700-EL	PI	2H	.00	.00	M1	.49	52	139	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
4	92	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.48	74	38	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
9	93	TEH	TEC	720-EL	28	1C	-.18	.00	M1	1.81	116	42	
12	93	TEH	TEC	720-EL	4	1C	-.04	.00	M1	.37	128	40	RESULT OF DISCREPANCY RESOLUTION
2	94	7C	TEC	720-EL	35	1C	-.15	.00	M1	1.03	112	38	
2	94	7H	TEH	720-EL	PI	2H	.00	.00	M1	.53	109	137	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
2	94	7H	TEH	720-EL	PI	4H	.00	.00	M1	.31	79	137	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
4	94	TSH	TEH	720-WC	CRI	TRH	.00	.00	C4	5.51	16	129	RESULT OF DISCREPANCY RESOLUTION
4	94												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	94	TRH	TEH	720-RB	MAI	TEH	2.74	.00	1	1.13	12	153	>> POSITIVE ID ESTABLISHED <<
4	94												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	94	TEH	TEC	720-EL	38	1C	.00	.00	M1	2.87	109	42	RESULT OF DISCREPANCY RESOLUTION
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

PAGE 28

TOTAL TUBES 397



Attachment 2 TO AEP:NRC:1147F

ATTACHMENT 2
STEAM GENERATOR ANNUAL OPERATING REPORT

SECTION 2: Unit 1 Tube Repairs

a.1 New Plugs Installed in SG #11



D.C. COOK UNIT 1

SG - 11 U1R95

LIST OF TUBES PLUGGED IN HOT LEG

Row	Col	Plug Description
13	13	- Mech. Plug
21	16	- Mech. Plug
34	18	- Mech. Plug
35	19	- Mech. Plug
7	20	- Sleeve Plug
37	21	- Mech. Plug
14	35	- Mech. Plug
16	36	- Mech. Plug
18	39	- Mech. Plug
2	41	- Mech. Plug
45	47	- Mech. Plug
1	49	- Mech. Plug
1	52	- Mech. Plug
13	52	- Mech. Plug
19	52	- Mech. Plug
44	58	- Mech. Plug
45	59	- Mech. Plug
1	61	- Mech. Plug
42	67	- Mech. Plug
2	70	- Mech. Plug
8	70	- Mech. Plug
37	75	- Mech. Plug
32	79	- Mech. Plug
27	84	- Mech. Plug
26	85	- Mech. Plug

>> Total Tubes = 25

END



D.C. COOK UNIT 1

SG - 11 U1R95

LIST OF TUBES PLUGGED IN COLD LEG

Row	Col	Plug Description
13	13	- Mech. Plug
21	16	- Mech. Plug
34	18	- Mech. Plug
35	19	- Mech. Plug
7	20	- Mech. Plug
37	21	- Mech. Plug
14	35	- Mech. Plug
16	36	- Mech. Plug
18	39	- Mech. Plug
2	41	- Mech. Plug
45	47	- Mech. Plug
1	49	- Mech. Plug
1	52	- Mech. Plug
13	52	- Mech. Plug
19	52	- Mech. Plug
44	58	- Mech. Plug
45	59	- Mech. Plug
1	61	- Mech. Plug
42	67	- Mech. Plug
2	70	- Mech. Plug
8	70	- Mech. Plug
37	75	- Mech. Plug
32	79	- Mech. Plug
27	84	- Mech. Plug
26	85	- Mech. Plug

>> Total Tubes = 25

END

D. C. Cook U1R95

AEP -11/51

INSPECTION: August 95

20-Sep-95 19: 5

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
	13	13	TEH	TEC	720-EL	91	TEH	20.17	.00	M1	.80	46	14	RESULT OF DISCREPANCY RESOLUTION
	13	13												RETEST - RETEST FOR POSITIVE ID
	13	13	TEH	TEC	720-EL	DRI	TEH	2.56	.00	M1	23.88	166	14	RESULT OF DISCREPANCY RESOLUTION
	13	13	TSH	TEH	720-WC	CRI	TRH	.00	.00	C23	1.54	106	27	RESULT OF DISCREPANCY RESOLUTION
	13	13												>> POSITIVE ID ESTABLISHED <<
	13	13	TSH	TEH	720-WC	CDI	TSH	.00	.00	C19	2.58	55	27	RESULT OF DISCREPANCY RESOLUTION
	13	13												>> POSITIVE ID ESTABLISHED <<
	13	13	TRH	TEH	720-RB	MAI	TEH	2.04	.00	1	1.27	22	131	>> POSITIVE ID ESTABLISHED <<
	13	13	TRH	TEH	720-RB	BRT	TEH	1.85	.00	1			131	
	13	13	TRH	TEH	720-RB	CRT	TEH	2.20	.00	1			131	
	13	13	TSH	TSH	720-RB	SAI	TSH	-1.36	.00	1	1.01	20	131	>> POSITIVE ID ESTABLISHED <<
	13	13	TSH	TSH	720-ZC	SAI	TSH	-1.35	.00	4	.94	26	153	RETEST - RETEST FOR POSITIVE ID
	13	13	TSH	TSH	720-ZC	DIM	TSH	457.00	.00	0	100.00	36	153	
94-Feb	13	13	TSH	TSH	720-ZC	NDO				1			12	
94-Feb	13	13	TEH	TEC	720-EC	NDO				1			23	
	21	16	TEH	TEC	720-EL	DIC	TEH	20.55	.00	M1	.52	31	22	RESULT OF DISCREPANCY RESOLUTION
	21	16												RETEST - RETEST FOR POSITIVE ID
	21	16	TSH	TEH	720-WC	CDI	TSH	-.68	.00	C13	.77	66	29	RESULT OF LAR
	21	16												RETEST - RETEST FOR POSITIVE ID
	21	16	TSH	TSH	720-ZC	SAI	TSH	-.90	.00	4	.28	84	153	>> POSITIVE ID ESTABLISHED <<
	21	16	TSH	TSH	720-ZC	DIM	TSH	505.00	.00	0	100.00	34	153	
94-Feb	21	16	TSH	TSH	720-ZC	NDO				1			12	
94-Feb	21	16	TEH	TEC	720-EC	NDO				1			25	
	34	18	TEH	TEC	720-EL	45	2C	.05	.00	M1	3.35	97	22	RETEST - RETEST FOR POSITIVE ID
	34	18	TEH	TEC	720-EL	6	1C	.00	.00	M1	.82	125	22	
	34	18	TSH	TEH	720-WC	NDO				1			77	
	34	18	TEC	TEH	720-EL	PID	2C	.02	.00	M1	3.54	103	97	>> POSITIVE ID ESTABLISHED <<
94-Feb	34	18	TSH	TSH	720-ZC	NDO				1			14	
94-Feb	34	18	TEH	TEC	720-EC	INR	TSH	-.37	.00	M1			27	
94-Feb	34	18	TEH	TEC	720-EC	39	2C	.00	.00	M1	1.88	105	27	
	35	19	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.40	76	24	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
	35	19	TEH	TEC	720-EL	47	2C	-.15	.00	M1	2.93	98	24	RESULT OF DISCREPANCY RESOLUTION
	35	19												RETEST - RETEST FOR POSITIVE ID
	35	19	TSH	TEH	720-WC	NDO				1			29	
DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

D. C. Cook UIR95

AEP -11/51

INSPECTION: August 95

20-Sep-95 19: 5

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
	35	19	TEC	TEH	720-EL	PID	2C	-.07	.00	M1	2.91	99	93	RESULT OF DISCREPANCY RESOLUTION
	35	19												>> POSITIVE ID ESTABLISHED <<
94-Feb	35	19	TSH	TSH	720-ZC	NDO				1			14	
94-Feb	35	19	TEH	TEC	720-EC	PI	1H	.00	.00	M1	.44	67	27	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
	7	20	STH	TEH	620-WC	NDO				1			13	
	7	20	6C	TEC	720-EL	RST	7C	.00	.00	1			34	+TUBE ADDED TO PLUG LIST - RESTRICTION ABOVE SLV
	7	20	1H	1H	620-ZW	NDO	1H	.00	.00	1			127	
	7	20			620-ZW	RST	2H	.00	.00	1			127	RESULT OF LAR
	7	20	1H	TEH	640-AW	RST	2H	.00	.00	1			129	
	7	20	2H	TEC	720-EL	NDO				1			158	RESULT OF DISCREPANCY RESOLUTION
94-Feb	7	20	7C	TEC	720-EC	RST	UB	.00	.00	1			27	
94-Feb	7	20	7C	TEC	720-EC	RST	UB	.00	.00	1			71	
94-Feb	7	20	STH	TEC	700-EC	NDO				1			75	RESULT OF DISCREPANCY RESOLUTION
94-Feb	7	20	7H	TEH	640-ZU	NDO				1			86	
94-Feb	7	20	7H	1H	620-Z8	NDO				1			100	
	37	21	TSH	TEH	720-WC	NDO				1			31	
	37	21	TEH	TEC	720-EL	43	2C	.12	.00	M1	3.47	102	32	RESULT OF DISCREPANCY RESOLUTION
	37	21												RETEST - RETEST FOR POSITIVE ID
	37	21	TEC	TEH	720-EL	PID	2C	.00	.00	M1	4.17	98	97	RESULT OF DISCREPANCY RESOLUTION
	37	21												>> POSITIVE ID ESTABLISHED <<
94-Feb	37	21	TSH	TSH	720-ZC	NDO				1			16	
94-Feb	37	21	TEH	TEC	720-EC	26	2C	.10	.00	M1	1.65	117	29	
	14	35	TSH	TEH	720-WC	CDI	TEH	20.21	.00	C16	1.87	97	39	RESULT OF LAR
	14	35												RETEST - RETEST FOR POSITIVE ID
	14	35	TSH	TEH	720-WC	CRI	TRH	.00	.00	C2	7.08	57	39	RESULT OF DISCREPANCY RESOLUTION
	14	35												RETEST - RETEST FOR POSITIVE ID
	14	35	TEH	TEC	720-EL	DIC	TEH	20.47	.00	M1	1.26	98	68	RESULT OF DISCREPANCY RESOLUTION
	14	35												RETEST - RETEST FOR POSITIVE ID
	14	35	TEH	TEC	720-EL	DRI	TEH	2.48	.00	M1	19.94	158	68	RESULT OF DISCREPANCY RESOLUTION
	14	35	TRH	TEH	720-RB	MAI	TEH	1.15	.00	1	1.21	25	131	>> POSITIVE ID ESTABLISHED <<
	14	35	TRH	TEH	720-RB	CRT	TEH	1.25	.00	1			131	
	14	35	TRH	TEH	720-RB	HRM	TRH	.00	.00	1			131	
	14	35	TSH	TSH	720-RB	MAI	TSH	-.41	.00	1	.39	153	131	>> POSITIVE ID ESTABLISHED <<
	14	35	TSH	TSH	720-ZC	MAI	TSH	-.36	.00	4	.30	112	153	>> POSITIVE ID ESTABLISHED <<
	14	35	TSH	TSH	720-ZC	DIM	TSH	1087.00	.00	0	100.00	185	153	
94-Feb	14	35	TSH	TSH	720-ZC	NDO				1			24	
94-Feb	14	35	TEH	TEC	720-EC	NDO				1			41	RESULT OF DISCREPANCY RESOLUTION

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
------	-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

D. C. Cook U1R95

AEP -11/51

INSPECTION: August 95

20-Sep-95 19: 6

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
	16	36	TSH	TEH	720-WC	CDI	TEH	20.57	.00	C12	2.10	67	39	RESULT OF LAR
	16	36												RETEST - RETEST FOR POSITIVE ID
	16	36	TSH	TEH	720-WC	CRI	TRH	.00	.00	C13	4.39	54	39	RESULT OF DISCREPANCY RESOLUTION
	16	36												RETEST - RETEST FOR POSITIVE ID
	16	36	TEH	TEC	720-EL	DIC	TEH	20.52	.00	M1	.28	104	60	RESULT OF LAR
	16	36												RETEST - RETEST FOR POSITIVE ID
	16	36	TEH	TEC	720-EL	DRI	TRH	.00	.00	5	17.17	11	60	RESULT OF DISCREPANCY RESOLUTION
	16	36	TRH	TEH	720-RB	MAI	TEH	1.42	.00	1	2.03	22	131	>> POSITIVE ID ESTABLISHED <<
	16	36	TRH	TEH	720-RB	CRT	TEH	1.54	.00	1			131	
	16	36	TRH	TEH	720-RB	HRM	TRH	.00	.00	1			131	
	16	36	TSH	TSH	720-RB	MAI	TSH	-.88	.00	1	.36	112	131	>> POSITIVE ID ESTABLISHED <<
	16	36	1H	1H	720-ZC	NDO	1H	.00	.00	1			153	
	16	36	TSH	TSH	720-ZC	MAI	TSH	-.83	.00	1	.66	93	159	>> POSITIVE ID ESTABLISHED <<
94-Feb	16	36	TSH	TSH	720-ZC	NDO				1			24	
94-Feb	16	36	TEH	TEC	720-EC	NDO				1			41	
	18	39	TSH	TEH	720-WC	CRI	TRH	.00	.00	C11	3.62	25	43	RESULT OF LAR
	18	39												-DO NOT REPAIR - 1.31" F* DISTANCE ACHIEVED
	18	39												1994 REROLL SUCCESSFUL
	18	39	TSH	TEH	720-WC	CDI	TSH	-.97	.00	C16	1.33	113	43	RESULT OF DISCREPANCY RESOLUTION
	18	39												RETEST - RETEST FOR POSITIVE ID
	18	39	TEH	TEC	720-EL	DRI	TEH	2.65	.00	M1	20.65	176	62	
	18	39	TRH	TEH	720-RB	NRT	TEH	3.81	.00	1			131	
	18	39	TRH	TEH	720-RB	NDO	TEH	3.81	.00	1			131	
	18	39	TSH	TSH	720-RB	MAI	TSH	-.42	.00	1	.54	15	131	>> POSITIVE ID ESTABLISHED <<
	18	39	TSH	TSH	720-ZC	MAI	TSH	-.77	.00	4	.26	57	155	RESULT OF DISCREPANCY RESOLUTION
	18	39												>> POSITIVE ID ESTABLISHED <<
	18	39	TSH	TSH	720-ZC	DIM	TSH	1389.00	.00	0	100.00	53	155	RESULT OF DISCREPANCY RESOLUTION
94-Feb	18	39	TSH	TSH	720-ZC	NDO				1			24	
94-Feb	18	39	TEH	TEC	720-EC	DRI	TEH	2.60	.00	M1	52.57	176	45	RESULT OF DISCREPANCY RESOLUTION
94-Feb	18	39												-THIS TUBE REMOVED FROM PLUG LIST
94-Feb	18	39	TEH	TEC	720-EC	PID	TEH	2.37	.00	M1	27.17	170	71	>> POSITIVE ID ESTABLISHED <<
94-Feb	18	39	TRH	TEH	720-ZC	MAI	TEH	1.50	.00	4	1.64	22	84	RESULT OF DISCREPANCY RESOLUTION
94-Feb	18	39	TRH	TEH	720-ZC	DIM	TEH	382.00	.00	1	100.00	116	84	RESULT OF DISCREPANCY RESOLUTION
94-Feb	18	39	TSH	TSH	720-ZC	NDO				1			96	POST ROLL EVALUATION - NDO AT NEW ROLL LOCATION
94-Feb	18	39	TRH	TEH	720-ZC	MAI	TEH	2.49	.00	4	.30	47	96	POST ROLL EVALUATION - NDO AT NEW ROLL LOCATION
94-Feb	18	39	TRH	TEH	720-ZC	DIM	TEH	382.00	.00	1	100.00	103	96	POST ROLL EVALUATION - NDO AT NEW ROLL LOCATION
94-Feb	18	39	TSH	TEH	720-EC	NDO				1			102	POST ROLL EVALUATION - NDO AT NEW ROLL LOCATION
	2	41	TSH	TEH	720-WC	CDI	TEH	21.03	.00	C21	.48	83	87	RESULT OF LAR
	2	41												RETEST - RETEST FOR POSITIVE ID
	2	41	TSH	TEH	720-WC	CRI	TRH	.00	.00	C14	6.09	34	87	RESULT OF DISCREPANCY RESOLUTION
	2	41												RETEST - RETEST FOR POSITIVE ID
	2	41	7H	TEH	720-EL	DIC	TEH	21.05	.00	M1	1.28	49	89	RESULT OF DISCREPANCY RESOLUTION

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
------	-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------



D. C. Cook U1R95

AEP -11/51

INSPECTION: August 95

20-Sep-95 19: 6

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
	2	41												RETEST - RETEST FOR POSITIVE ID
	2	41	7H	TEH	720-EL PCN 2H			.00	.00	M1	1.78	112	89	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
	2	41	7H	TEH	720-EL DRI TEH			1.70	.00	M1	50.31	359	107	
	2	41	7H	TEH	720-EL PCN 2H			-.19	.00	M1	1.86	112	107	
	2	41	7C	TEH	720-EL DRI TEH			2.78	.00	M1	46.70	179	111	
	2	41	7C	TEH	720-EL DIC TSH			-.85	.00	M1	.42	80	111	RESULT OF DISCREPANCY RESOLUTION
	2	41												RETEST - RETEST FOR POSITIVE ID
	2	41	7C	TEH	720-EL DIC TSH			-.43	.00	M1	1.01	50	111	RESULT OF DISCREPANCY RESOLUTION
	2	41												RETEST - RETEST FOR POSITIVE ID
	2	41	7C	TEH	720-EL PCN 2H			-.13	.00	M1	1.86	110	111	
	2	41	TRH	TEH	720-RB MAI TEH			2.98	.00	1	1.69	15	131	>> POSITIVE ID ESTABLISHED <<
	2	41	TRH	TEH	720-RB BRT TEH			2.65	.00	1			131	
	2	41	TRH	TEH	720-RB CRT TEH			3.18	.00	1			131	
	2	41	TSH	TSH	720-RB MAI TSH			-.65	.00	1	.34	22	131	>> POSITIVE ID ESTABLISHED <<
	2	41	TSH	TSH	720-ZC MAI TSH			-.51	.00	4	.26	84	155	RESULT OF DISCREPANCY RESOLUTION
	2	41												>> POSITIVE ID ESTABLISHED <<
	2	41	TSH	TSH	720-ZC DIM TSH	1097.00		.00	0	100.00	51	155		RESULT OF DISCREPANCY RESOLUTION
	2	41	2H	2H	720-ZC MAI 2H	-.21		.00	4	.45	45	155		RESULT OF DISCREPANCY RESOLUTION
	2	41												>> POSITIVE ID ESTABLISHED <<
	2	41	2H	2H	720-ZC DIM 2H	603.00		.00	0	100.00	137	155		RESULT OF DISCREPANCY RESOLUTION
	2	41	7C	TEC	720-EL NDD					1			176	
	2	41	7H	TEC	680-EJ NDD					1			178	
94-Feb	2	41			0 PLG TEH	.00		.00					2	
94-Feb	2	41			0 PLG TEC	.00		.00					13	
94-Feb	2	41			0 PLG TEH	.00		.00					26	RESULT OF DISCREPANCY RESOLUTION
	45	47	TSH	TEH	720-WC NDD					1			47	
	45	47	TEH	TEC	720-EL 57 1C	-.07		.00	M1	1.04	88	76		RESULT OF DISCREPANCY RESOLUTION
	45	47												RETEST - RETEST FOR POSITIVE ID
	45	47	1C	TEC	720-EL PID 1C	-.09		.00	M1	.89	91	146		RESULT OF DISCREPANCY RESOLUTION
	45	47												>> POSITIVE ID ESTABLISHED <<
94-Feb	45	47	TEH	TEC	720-EC NDD					1			49	
94-Feb	45	47	TSH	TSH	720-ZC NDD					1			52	
	1	49	TSH	TEH	720-WC CRI TRH	.00		.00	C1	4.15	108	87		RESULT OF DISCREPANCY RESOLUTION
	1	49												RETEST - RETEST FOR POSITIVE ID
	1	49	TSH	TEH	720-WC CDI TSH	-.08		.00	C1	3.35	111	87		RESULT OF DISCREPANCY RESOLUTION
	1	49												RETEST - RETEST FOR POSITIVE ID
	1	49	7H	TEH	720-EL DIC TSH	-.23		.00	M1	3.31	116	89		RESULT OF DISCREPANCY RESOLUTION
	1	49												RETEST - RETEST FOR POSITIVE ID
	1	49	7H	TEH	720-EL DRI TEH	2.55		.00	M1	121.10	15	105		RESULT OF DISCREPANCY RESOLUTION
	1	49	7H	TEH	720-EL DRI TEH	2.35		.00	M1	123.50	15	111		
	1	49	7H	TEH	720-EL DIC TSH	.00		.00	M1	3.11	116	111		RESULT OF DISCREPANCY RESOLUTION
	1	49												RETEST - RETEST FOR POSITIVE ID
DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

D. C. Cook U1R95

AEP -11/51

INSPECTION: August 95

20-Sep-95 19: 6

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
	1	49	TSH	TSH	720-RB	MAI	TSH	-.29	.00	1	.29	166	131	>> POSITIVE ID ESTABLISHED <<
	1	49	TRH	TEH	720-RB	MBM	TEH	.38	.00	17	5.80	17	133	RESULT OF DISCREPANCY RESOLUTION
	1	49	TRH	TEH	720-RB	HRM	TRH	.00	.00	17			133	
	1	49	TSH	TSH	720-ZC	MAI	TSH	-.23	.00	4	.24	65	155	RESULT OF DISCREPANCY RESOLUTION
	1	49												>> POSITIVE ID ESTABLISHED <<
	1	49	TSH	TSH	720-ZC	DIW	TSH	732.00	.00	0	100.00	178	155	RESULT OF DISCREPANCY RESOLUTION
	1	49	7C	TEC	720-EL	NDO				1			176	RESULT OF DISCREPANCY RESOLUTION
	1	49	7H	6C	680-EJ	NDO				1			178	
94-Feb	1	49			0	PLG	TEH	.00	.00				2	
94-Feb	1	49			0	PLG	TEC	.00	.00				21	
94-Feb	1	49			0	PLG	TEH	.00	.00				30	RESULT OF DISCREPANCY RESOLUTION
=====														
	1	52	TSH	TEH	720-WC	CDI	TEH	20.54	.00	C18	2.16	92	87	RESULT OF LAR
	1	52												RETEST - RETEST FOR POSITIVE ID
	1	52	TSH	TEH	720-WC	CRI	TRH	.00	.00	C4	14.13	47	87	RESULT OF DISCREPANCY RESOLUTION
	1	52												RETEST - RETEST FOR POSITIVE ID
	1	52	7H	TEH	720-EL	DIC	TEH	20.50	.00	M1	.75	80	89	RESULT OF DISCREPANCY RESOLUTION
	1	52												RETEST - RETEST FOR POSITIVE ID
	1	52	7H	TEH	720-EL	DRI	TEH	2.31	.00	M1	17.14	76	89	RESULT OF DISCREPANCY RESOLUTION
	1	52	7H	TEH	720-EL	DRI	TEH	1.59	.00	M1	14.94	71	105	
	1	52	7H	TEH	720-EL	DIC	TEH	20.80	.00	M1	.68	74	105	RESULT OF DISCREPANCY RESOLUTION
	1	52												RETEST - RETEST FOR POSITIVE ID
	1	52	7H	TEH	720-EL	DRI	TEH	2.26	.00	M1	16.34	103	111	
	1	52	7H	TEH	720-EL	DIC	TSH	-.62	.00	M1	.67	65	111	RETEST - RETEST FOR POSITIVE ID
	1	52	TRH	TEH	720-RB	MAI	TEH	1.66	.00	1	2.43	29	131	>> POSITIVE ID ESTABLISHED <<
	1	52	TRH	TEH	720-RB	BRT	TEH	1.42	.00	1			131	
	1	52	TRH	TEH	720-RB	CRT	TEH	1.76	.00	1			131	
	1	52	TSH	TSH	720-RB	MAI	TSH	-1.44	.00	1	.52	150	131	>> POSITIVE ID ESTABLISHED <<
	1	52	TSH	TSH	720-ZC	MAI	TSH	-.82	.00	4	.62	107	155	RESULT OF DISCREPANCY RESOLUTION
	1	52												>> POSITIVE ID ESTABLISHED <<
	1	52	TSH	TSH	720-ZC	DIW	TSH	1512.00	.00	0	100.00	214	155	RESULT OF DISCREPANCY RESOLUTION
	1	52	7C	TEC	720-EL	NDO				1			176	RESULT OF DISCREPANCY RESOLUTION
	1	52	7H	6C	680-EJ	NDO				1			178	
94-Feb	1	52			0	PLG	TEH	.00	.00				2	
94-Feb	1	52			0	PLG	TEC	.00	.00				21	
94-Feb	1	52			0	PLG	TEH	.00	.00				32	
=====														
	13	52	TSH	TEH	720-WC	CDI	TEH	12.09	.00	C17	4.01	66	87	RESULT OF LAR
	13	52												RETEST - RETEST FOR POSITIVE ID
	13	52	TSH	TEH	720-WC	CRI	TRH	.00	.00	C17	4.96	51	87	RESULT OF DISCREPANCY RESOLUTION
	13	52												RETEST - RETEST FOR POSITIVE ID
	13	52	TSC	TEH	720-EL	DIC	TEH	11.91	.00	M1	1.30	76	89	RESULT OF DISCREPANCY RESOLUTION
	13	52												RETEST - RETEST FOR POSITIVE ID
	13	52	TSC	TEH	720-EL	DNT	TSH	.03	.00	M1	41.06	185	89	

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
------	-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
	13	52	TRH	TEH	720-RB	MAI	TEH	2.07	.00	1	2.11	31	131	>> POSITIVE ID ESTABLISHED <<
	13	52	TRH	TEH	720-RB	BRT	TEH	1.80	.00	1			131	
	13	52	TRH	TEH	720-RB	CRT	TEH	2.15	.00	1			131	
	13	52	TSH	TSH	720-RB	NDD	TSH	.00	.00	1			131	
	13	52	TSH	TEH	720-EL	LXH	TEH	.00	.00	2	789.90		149	
	13	52	TSH	TEH	720-EL	UXH	TEH	.00	.00	2	781.60		149	
	13	52	TSH	TEH	720-ZC	MAI	TEH	11.31	.00	4	1.14	111	157	RESULT OF DISCREPANCY RESOLUTION
	13	52												>> POSITIVE ID ESTABLISHED <<
	13	52	TSH	TEH	720-ZC	DIW	TEH	4111.00	.00	0	100.00	63	157	RESULT OF DISCREPANCY RESOLUTION
	13	52	TSH	TEH	720-ZC	MAI	TEH	2.84	.00	4	6.73	28	157	RESULT OF DISCREPANCY RESOLUTION
	13	52												RETEST - RETEST FOR POSITIVE ID
	13	52	TSH	TEH	720-ZC	DIW	TEH	326.00	.00	0	100.00	40	157	RESULT OF DISCREPANCY RESOLUTION
	13	52	1C	TEC	720-EL	NDD				1			176	
94-Feb	13	52			0	PLG	TEC	.00	.00				19	
94-Feb	13	52			0	PLG	TEH	.00	.00				28	RESULT OF DISCREPANCY RESOLUTION
	19	52	TSH	TEH	720-WC	CDI	TSH	-1.72	.00	C1	3.37	68	51	RESULT OF DISCREPANCY RESOLUTION
	19	52												RETEST - RETEST FOR POSITIVE ID
	19	52	TEH	TEC	720-EL	NDD				1			144	
	19	52	TEH	TEC	720-EL	DNT	TSH	-.34	.00	M1	13.74	182	144	
	19	52	TSH	TSH	720-ZC	SAI	TSH	-1.50	.00	4	.49	66	155	RESULT OF DISCREPANCY RESOLUTION
	19	52												>> POSITIVE ID ESTABLISHED <<
	19	52	TSH	TSH	720-ZC	DIW	TSH	945.00	.00	0	100.00	42	155	RESULT OF DISCREPANCY RESOLUTION
94-Feb	19	52	TSH	TSH	720-ZC	NDD				1			30	
94-Feb	19	52	TEH	TEC	720-EC	NDD				1			51	
94-Feb	19	52	TEH	TEC	720-EC	DNT	TSH	.00	.00	M1	13.62	179	51	
	44	58	TSH	TEH	720-WC	NDD				1			55	
	44	58	TEH	TEC	720-EL	49	1C	-.10	.00	M1	6.73	96	118	RESULT OF DISCREPANCY RESOLUTION
	44	58												RETEST - RETEST FOR POSITIVE ID
	44	58	2C	TEC	720-EL	PID	1C	.07	.00	M1	7.54	94	148	RESULT OF DISCREPANCY RESOLUTION
	44	58												>> POSITIVE ID ESTABLISHED <<
94-Feb	44	58	TEH	TEC	720-EC	24	1C	.00	.00	M1	2.73	115	51	
94-Feb	44	58	TSH	TSH	720-ZC	NDD				1			54	
	45	59	TSH	TEH	720-WC	NDD				1			55	
	45	59	TEH	TEC	720-EL	DNT	7H	-.25	.00	M1	4.23	179	114	
	45	59	TEH	TEC	720-EL	50	2C	-.15	.00	M1	5.30	97	114	RESULT OF DISCREPANCY RESOLUTION
	45	59												RETEST - RETEST FOR POSITIVE ID
	45	59	3C	TEC	720-EL	PID	2C	-.22	.00	M1	4.57	99	148	RESULT OF DISCREPANCY RESOLUTION
	45	59												>> POSITIVE ID ESTABLISHED <<
94-Feb	45	59	TEH	TEC	720-EC	31	2C	.00	.00	M1	2.77	110	51	

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
------	-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------



DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
94-Feb	45	59	TSH	TSH	720-ZC	NDD				1		54		
	1	61	TSH	TEH	720-WC	CDI	TEH	20.47	.00	C11	1.63	85	87	RESULT OF LAR
	1	61												RETEST - RETEST FOR POSITIVE ID
	1	61	TSH	TEH	720-WC	CRI	TRH	.00	.00	C22	5.09	41	87	RESULT OF DISCREPANCY RESOLUTION
	1	61												RETEST - RETEST FOR POSITIVE ID
	1	61	7H	TEH	720-EL	DIC	TEH	20.11	.00	M1	.38	52	91	RESULT OF DISCREPANCY RESOLUTION
	1	61												RETEST - RETEST FOR POSITIVE ID
	1	61	7H	TEH	720-EL	DRI	TRH	.00	.00	M1	42.11	181	91	RESULT OF DISCREPANCY RESOLUTION
	1	61	7H	TEH	720-EL	DRI	TEH	.40	.00	M1	9.00	13	105	
	1	61	7H	TEH	720-EL	DRI	TEH	2.30	.00	M1	40.17	181	111	
	1	61	TRH	TEH	720-RB	MAI	TEH	1.11	.00	1	1.91	15	131	>> POSITIVE ID ESTABLISHED <<
	1	61	TRH	TEH	720-RB	CRT	TEH	1.20	.00	1			131	
	1	61	TRH	TEH	720-RB	HRM	TRH	.00	.00	1			131	
	1	61	TSH	TSH	720-RB	MAI	TSH	-.87	.00	1	.27	148	131	>> POSITIVE ID ESTABLISHED <<
	1	61	TSH	TSH	720-ZC	MAI	TSH	-.88	.00	4	.46	95	155	RESULT OF DISCREPANCY RESOLUTION
	1	61												>> POSITIVE ID ESTABLISHED <<
	1	61	TSH	TSH	720-ZC	DIM	TSH	1182.00	.00	0	100.00	42	155	RESULT OF DISCREPANCY RESOLUTION
	1	61	7C	TEC	720-EL	NDD				1			176	RESULT OF DISCREPANCY RESOLUTION
	1	61	7H	6C	680-EJ	NDD				1			178	
94-Feb	1	61			0	PLG	TEH	.00	.00				34	
94-Feb	1	61			0	PLG	TEC	.00	.00				77	
	42	67	TSH	TEH	720-WC	NDD				1			59	
	42	67	TEH	TEC	720-EL	DNT	7H	-.35	.00	M1	5.78	178	82	
	42	67	TEH	TEC	720-EL	41	1C	.00	.00	M1	1.90	103	82	RESULT OF DISCREPANCY RESOLUTION
	42	67												RETEST - RETEST FOR POSITIVE ID
	42	67	TEC	TEH	720-EL	PID	1C	.15	.00	M1	1.77	104	99	RESULT OF DISCREPANCY RESOLUTION
	42	67												>> POSITIVE ID ESTABLISHED <<
	42	67	7H	7H	720-ZC	NDD	7H	.00	.00	1			157	
94-Feb	42	67	TSH	TSH	720-ZC	NDD				1			38	
94-Feb	42	67	TEH	TEC	720-EC	DNT	7H	.00	.00	M1	6.16	175	61	
94-Feb	42	67	TEH	TEC	720-EC	26	1C	.00	.00	M1	.74	112	61	
94-Feb	42	67	7H	7H	720-ZC	NDD				1			88	
	2	70	TSH	TEH	720-WC	CDI	TEH	20.58	.00	C19	1.01	86	61	RESULT OF DISCREPANCY RESOLUTION
	2	70												RETEST - RETEST FOR POSITIVE ID
	2	70	7H	TEH	720-EL	NDD				1			89	
	2	70	7C	TEC	720-EL	NDD				1			100	
	2	70	TSH	TSH	720-ZC	SAI	TSH	-1.04	.00	4	.15	68	155	RESULT OF DISCREPANCY RESOLUTION
	2	70												>> POSITIVE ID ESTABLISHED <<
	2	70	TSH	TSH	720-ZC	DIM	TSH	331.00	.00	0	100.00	21	155	RESULT OF DISCREPANCY RESOLUTION
DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

D. C. Cook U1R95

AEP -11/51

INSPECTION: August 95

20-Sep-95 19: 6

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
	2	70	7H	6C	680-EJ	NDO				1		170		
94-Feb	2	70	7H	TEH	720-EC	NDO				1		4		
94-Feb	2	70	TSH	TSH	720-ZC	NDO				1		38		
94-Feb	2	70	7H	TEC	720-EC	NDO				1		69		
94-Feb	2	70	7C	6H	680-EJ	NDO				1		78		
	8	70	TSH	TEH	720-WC	CDI	TEH	20.74	.00	C4	.71	78	61	RESULT OF DISCREPANCY RESOLUTION
	8	70												RETEST - RETEST FOR POSITIVE ID
	8	70	TEH	TEC	720-EL	NDO				1		100		
	8	70	TSH	TSH	720-ZC	SAI	TSH	-.99	.00	4	.12	38	155	RESULT OF DISCREPANCY RESOLUTION
	8	70												>> POSITIVE ID ESTABLISHED <<
	8	70	TSH	TSH	720-ZC	DIW	TSH	656.00	.00	0	100.00	28	155	RESULT OF DISCREPANCY RESOLUTION
94-Feb	8	70	TSH	TSH	720-ZC	NDO				1		38		
94-Feb	8	70	TEC	TEH	720-EC	NDO				1		74		
	37	75	TSH	TEH	720-WC	NDO				1		63		
	37	75	TEH	TEC	720-EL	43	2C	.00	.00	M1	3.04	101	78	RESULT OF DISCREPANCY RESOLUTION
	37	75												RETEST - RETEST FOR POSITIVE ID
	37	75	TEC	TEH	720-EL	PID	2C	.13	.00	M1	3.30	108	99	>> POSITIVE ID ESTABLISHED <<
94-Feb	37	75	TSH	TSH	720-ZC	NDO				1		42		
94-Feb	37	75	TEC	TEH	720-EC	24	2C	.00	.00	M1	1.75	117	64	
	32	79	TSH	TEH	720-WC	NDO				1		67		
	32	79	TEH	TEC	720-EL	PI	4H	.00	.00	M1	.65	58	90	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
	32	79	TEH	TEC	720-EL	55	1C	.00	.00	M1	2.21	92	90	RESULT OF DISCREPANCY RESOLUTION
	32	79												RETEST - RETEST FOR POSITIVE ID
	32	79	TEC	TEH	720-EL	PID	1C	.00	.00	M1	2.66	88	95	RESULT OF DISCREPANCY RESOLUTION
	32	79												>> POSITIVE ID ESTABLISHED <<
94-Feb	32	79	TSH	TSH	720-ZC	NDO				1		46		
94-Feb	32	79	TEC	TEH	720-EC	25	1C	.00	.00	M1	.99	113	68	RESULT OF DISCREPANCY RESOLUTION
	27	84	TSH	TEH	720-WC	NDO				1		69		
	27	84	TEH	TEC	720-EL	45	2C	.00	.00	M1	3.85	100	88	RESULT OF DISCREPANCY RESOLUTION
	27	84												RETEST - RETEST FOR POSITIVE ID
	27	84	TEC	TEH	720-EL	PID	2C	.00	.00	M1			95	RESULT OF DISCREPANCY RESOLUTION
	27	84												>> POSITIVE ID ESTABLISHED <<
94-Feb	27	84	TSH	TSH	720-ZC	NDO				1		58		
94-Feb	27	84	TEC	TEH	720-EC	33	2C	.00	.00	M1	2.48	107	70	
DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
	26	85	TSH	TEH	720-WC	NDO				1		71		
	26	85	TEH	TEC	720-EL	23	2C	.00	.00	M1	2.20	121	90	
	26	85	TEH	TEC	720-EL	41	1C	.03	.00	M1	4.52	106	90	RESULT OF DISCREPANCY RESOLUTION
	26	85												RETEST - RETEST FOR POSITIVE ID
	26	85	TEC	TEH	720-EL	PID	1C	.15	.00	M1		95		RESULT OF DISCREPANCY RESOLUTION
	26	85												>> POSITIVE ID ESTABLISHED <<
94-Feb	26	85	TSH	TSH	720-ZC	NDO				1		46		
94-Feb	26	85	TEC	TEH	720-EC	32	2C	.00	.00	M1	1.35	108	70	
94-Feb	26	85	TEC	TEH	720-EC	34	1C	.00	.00	M1	4.22	106	70	

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
------	-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

Attachment 2 TO AEP:NRC:1147F

ATTACHMENT 2
STEAM GENERATOR ANNUAL OPERATING REPORT

SECTION 2: Unit 1 Tube Repairs

a.2 Tubes Repaired Using F* Reroll Technique in SG #11

09-18-1995 13:29:17

SG - 11

Row	Col	TUBES RECOVERED VIA RE-ROLL
1	9	
4	10	
12	10	
4	13	
24	14	
2	16	
8	16	
9	16	
6	17	
24	17	
7	18	
10	18	
4	19	
8	19	
16	19	
10	20	
11	21	
19	21	
30	21	
2	22	
20	22	
9	23	
13	23	
16	23	
2	24	
3	24	
4	24	
8	24	
20	24	
17	25	
6	26	
8	26	
15	26	
17	26	
1	27	
3	27	
4	27	
17	27	
1	28	
2	28	
3	28	
4	28	
22	28	
1	29	
14	29	
15	29	
21	29	
23	29	
1	30	
2	30	

SG - 11

09-18-1995 13:29:17

Row Col

TUBES RECOVERED VIA RE-ROLL,

5	30
7	30
8	30
9	30
17	30
20	30
21	30
4	31
11	31
16	31
23	31
32	31
4	32
10	32
11	32
14	32
31	32
14	33
27	33
4	34
5	34
16	34
24	34
1	35
9	35
10	35
11	35
25	35
29	35
31	35
1	37
2	37
7	37
15	37
18	37
28	37
3	38
5	38
9	38
14	38
23	38
1	39
4	39
15	40
4	41
6	41
17	41
20	41
27	41
3	42



09-18-1995 13:29:17

SG - 11

Row Col

TUBES RECOVERED VIA RE-ROLL

8	42
9	42
11	42
21	42
28	42
1	43
3	43
4	43
6	43
11	43
24	43
28	43
1	44
2	44
5	44
11	44
19	44
31	44
1	45
2	46
21	46
1	47
2	47
14	47
9	48
30	48
8	49
16	49
30	49
1	50
20	50
23	50
4	51
6	51
8	51
32	51
2	52
13	52
16	52
32	52
3	53
9	53
1	54
5	54
6	54
21	54
25	54
5	55
12	55
23	55
25	55

THIS TUBE PLUGGED DUE TO 1995 ECT INDICATION W/IN TSH



09-18-1995 13:29:17

SG - 11

Row Col

TUBES RECOVERED VIA RE-ROLL

32	55
8	56
12	56
31	56
4	57
5	57
12	57
2	58
4	58
6	58
12	58
14	58
25	58
9	59
13	59
29	59
1	60
4	60
13	60
7	61
23	61
30	61
33	61
1	62
5	62
25	62
10	63
13	63
29	63
5	64
13	64
15	64
16	64
17	64
3	65
13	65
16	65
23	65
25	65
1	66
3	66
4	66
20	66
24	66
1	67
24	67
25	67
1	68
18	68
1	69



09-18-1995 13:29:17

SG - 11

Row Col TUBES RECOVERED VIA RE-ROLL

5	69
16	69
24	69
6	70
7	70
24	70
15	71
20	71
31	71
1	72
15	72
19	72
1	74
10	74
16	74
5	75
10	75
7	77
1	78
4	78
13	78
2	79
14	80
21	80
14	81
2	82
9	82
14	82
11	83
1	84
17	84

>> Total Tubes = 232



ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
1	9	TRH	TEH	720-RB	SAI	TEH	1.36	.00	1	5.70	5	115	>> POSITIVE ID ESTABLISHED <<
1	9												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	10	TRH	TEH	720-RB	MAI	TEH	2.37	.00	1	2.69	7	115	RESULT OF DISCREPANCY RESOLUTION.
4	10												>> POSITIVE ID ESTABLISHED <<
4	10												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	10	TRH	TEH	720-RB	SAI	TEH	2.35	.00	1	1.41	19	115	>> POSITIVE ID ESTABLISHED <<
12	10												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	13	TRH	TEH	720-RB	SAI	TEH	2.49	.00	1	3.10	12	115	>> POSITIVE ID ESTABLISHED <<
4	13												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	13	TRH	TEH	720-RB	MAI	TEH	2.04	.00	1	1.27	22	131	>> POSITIVE ID ESTABLISHED <<
13	13	TSH	TSH	720-RB	SAI	TSH	-1.36	.00	1	1.01	20	131	>> POSITIVE ID ESTABLISHED <<
13	13	TSH	TSH	720-ZC	SAI	TSH	-1.35	.00	4	.94	26	153	RETEST - RETEST FOR POSITIVE ID
24	14	TRH	TEH	720-RB	MAI	TEH	2.34	.00	1	3.78	8	115	>> POSITIVE ID ESTABLISHED <<
24	14												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	16	TRH	TEH	720-RB	SAI	TEH	2.47	.00	1	1.89	14	115	>> POSITIVE ID ESTABLISHED <<
2	16												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	16	TRH	TEH	720-RB	SAI	TEH	2.38	.00	1	6.11	11	115	>> POSITIVE ID ESTABLISHED <<
8	16												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	16	TRH	TEH	720-RB	SAI	TEH	2.37	.00	1	2.03	10	115	>> POSITIVE ID ESTABLISHED <<
9	16												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	16	TSH	TSH	720-ZC	SAI	TSH	-.90	.00	4	.28	84	153	>> POSITIVE ID ESTABLISHED <<
6	17	TRH	TEH	720-RB	SAI	TEH	2.36	.00	1	4.01	19	115	RESULT OF DISCREPANCY RESOLUTION
6	17												>> POSITIVE ID ESTABLISHED <<
6	17												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	17	TRH	TEH	720-RB	SAI	TEH	2.25	.00	1	1.23	6	115	>> POSITIVE ID ESTABLISHED <<
24	17												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	18	TRH	TEH	720-RB	MAI	TEH	2.30	.00	1	3.91	23	115	RESULT OF DISCREPANCY RESOLUTION
7	18												>> POSITIVE ID ESTABLISHED <<
7	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	18	TRH	TEH	720-RB	MAI	TEH	2.42	.00	1	5.20	13	115	>> POSITIVE ID ESTABLISHED <<
10	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	19	TRH	TEH	720-RB	MAI	TEH	2.44	.00	4	5.40	14	115	>> POSITIVE ID ESTABLISHED <<
4	19												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

D. C. Cook U1R95

AEP -11/51

INSPECTION: August 95

21-Sep-95 17:27

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
8	19	TRH	TEH	720-RB MAI	TEH		2.32	.00	4	12.47	15	115	>> POSITIVE ID ESTABLISHED <<
8	19												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	19	TRH	TEH	720-RB SAI	TEH		2.60	.00	1	2.00	1	115	>> POSITIVE ID ESTABLISHED <<
16	19												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	20	TRH	TEH	720-RB MAI	TEH		2.44	.00	1	2.12	6	115	>> POSITIVE ID ESTABLISHED <<
10	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	21	TRH	TEH	720-RB MAI	TEH		2.48	.00	1	4.38	11	115	>> POSITIVE ID ESTABLISHED <<
11	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	21	TRH	TEH	720-RB SAI	TEH		2.52	.00	1	2.02	25	115	>> POSITIVE ID ESTABLISHED <<
19	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	21	TRH	TEH	720-RB MAI	TEH		2.45	.00	1	2.02	25	115	>> POSITIVE ID ESTABLISHED <<
30	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	22	TRH	TEH	720-RB MAI	TEH		2.46	.00	4	6.40	11	125	>> POSITIVE ID ESTABLISHED <<
2	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	22	TRH	TEH	720-RB MAI	TEH		2.70	.00	1	1.15		115	>> POSITIVE ID ESTABLISHED <<
20	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	23	TRH	TEH	720-RB MAI	TEH		2.35	.00	1	2.70	20	115	>> POSITIVE ID ESTABLISHED <<
9	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	23	TRH	TEH	720-RB MAI	TEH		2.42	.00	1	3.90	8	115	>> POSITIVE ID ESTABLISHED <<
13	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	23	TRH	TEH	720-RB SAI	TEH		2.56	.00	1	2.38	12	115	>> POSITIVE ID ESTABLISHED <<
16	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	24	TRH	TEH	720-RB SAI	TEH		2.45	.00	1	4.30	12	115	>> POSITIVE ID ESTABLISHED <<
2	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	24	TRH	TEH	720-RB MAI	TEH		2.30	.00	1	2.52	11	115	>> POSITIVE ID ESTABLISHED <<
3	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	24	TRH	TEH	720-RB MAI	TEH		2.59	.00	1	3.56	16	115	>> POSITIVE ID ESTABLISHED <<
4	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	24	TRH	TEH	720-RB MAI	TEH		2.48	.00	1	3.88	11	115	>> POSITIVE ID ESTABLISHED <<
8	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	24	TRH	TEH	720-RB MAI	TEH		2.48	.00	1	2.73	25	115	>> POSITIVE ID ESTABLISHED <<
20	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
17	25	TRH	TEH	720-RB MAI	TEH		2.45	.00	1	4.03	17	115	>> POSITIVE ID ESTABLISHED <<
17	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	26	TRH	TEH	720-RB SAI	TEH		2.78	.00	1	2.31	16	115	>> POSITIVE ID ESTABLISHED <<
6	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	26	TRH	TEH	720-RB MAI	TEH		2.60	.00	1	4.15	12	115	>> POSITIVE ID ESTABLISHED <<
8	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	26	TRH	TEH	720-RB MAI	TEH		2.46	.00	1	3.00	15	115	>> POSITIVE ID ESTABLISHED <<
15	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	26	TRH	TEH	720-RB MAI	TEH		2.26	.00	1	8.69	32	115	>> POSITIVE ID ESTABLISHED <<
17	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	27	TRH	TEH	720-RB SAI	TEH		2.60	.00	1	2.74	15	115	>> POSITIVE ID ESTABLISHED <<
1	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	27	TRH	TEH	720-RB SAI	TEH		2.58	.00	1	1.15	29	115	>> POSITIVE ID ESTABLISHED <<
3	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	27	TRH	TEH	720-RB MAI	TEH		2.28	.00	1	3.74	25	115	>> POSITIVE ID ESTABLISHED <<
4	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	27	TRH	TEH	720-RB MAI	TEH		2.36	.00	1	4.02	15	115	>> POSITIVE ID ESTABLISHED <<
17	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	28	TRH	TEH	720-RB MAI	TEH		2.77	.00	4	2.92	24	125	>> POSITIVE ID ESTABLISHED <<
1	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	28	TRH	TEH	720-RB SAI	TEH		2.87	.00	4	1.23	198	125	>> POSITIVE ID ESTABLISHED <<
2	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	28	TRH	TEH	720-RB MAI	TEH		2.56	.00	4	12.84	17	115	RESULT OF LAR
3	28												>> POSITIVE ID ESTABLISHED <<
3	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	28	TRH	TEH	720-RB MAI	TEH		2.92	.00	1	2.93	28	115	>> POSITIVE ID ESTABLISHED <<
4	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	28	TRH	TEH	720-RB MAI	TEH		2.60	.00	1	1.06	17	115	>> POSITIVE ID ESTABLISHED <<
22	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	29	TRH	TEH	720-RB MAI	TEH		2.23	.00	1	5.03	26	115	>> POSITIVE ID ESTABLISHED <<
1	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	29	TRH	TEH	720-RB MAI	TEH		2.62	.00	1	1.65	29	115	>> POSITIVE ID ESTABLISHED <<
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

D. C. Cook U1R95

AEP -11/51

INSPECTION: August 95

21-Sep-95 17:27

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
14	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	29	TRH	TEH	720-RB MAI	TEH		2.66	.00	1	2.58	5	115	>> POSITIVE ID ESTABLISHED <<
15	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	29	TRH	TEH	720-RB SAI	TEH		2.57	.00	1	2.68	13	115	>> POSITIVE ID ESTABLISHED <<
21	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	29	TRH	TEH	720-RB MAI	TEH		2.57	.00	1	4.03	17	115	>> POSITIVE ID ESTABLISHED <<
23	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	30	TRH	TEH	720-RB MAI	TEH		2.45	.00	1	14.60	16	115	>> POSITIVE ID ESTABLISHED <<
1	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	30	TRH	TEH	720-RB MAI	TEH		2.29	.00	1	2.22	13	115	>> POSITIVE ID ESTABLISHED <<
2	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	30	TRH	TEH	720-RB MAI	TEH		2.36	.00	1	5.08	22	115	>> POSITIVE ID ESTABLISHED <<
5	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	30	TRH	TEH	720-RB MAI	TEH		2.83	.00	1	.92	9	115	>> POSITIVE ID ESTABLISHED <<
7	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	30	TRH	TEH	720-RB MAI	TEH		2.76	.00	1	.51	24	115	>> POSITIVE ID ESTABLISHED <<
8	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	30	TRH	TEH	720-RB MAI	TEH		2.61	.00	1	2.09	16	115	>> POSITIVE ID ESTABLISHED <<
9	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	30	TRH	TEH	720-RB SAI	TEH		2.60	.00	1	1.36	16	115	>> POSITIVE ID ESTABLISHED <<
17	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	30	TRH	TEH	720-RB SAI	TEH		2.75	.00	1	1.62	14	115	>> POSITIVE ID ESTABLISHED <<
20	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	30	TRH	TEH	720-RB SAI	TEH		2.71	.00	1	2.67	7	115	>> POSITIVE ID ESTABLISHED <<
21	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	31	TRH	TEH	720-RB MAI	TEH		2.66	.00	1	10.44	16	115	>> POSITIVE ID ESTABLISHED <<
4	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	31	TRH	TEH	720-RB SAI	TEH		2.64	.00	1	1.18	16	115	>> POSITIVE ID ESTABLISHED <<
11	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	31	TRH	TEH	720-RB MAI	TEH		2.63	.00	1	7.86	5	115	>> POSITIVE ID ESTABLISHED <<
16	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	31	TRH	TEH	720-RB SAI	TEH		2.65	.00	1	1.86	13	115	>> POSITIVE ID ESTABLISHED <<
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

D. C. Cook U1R95

AEP -11/51

INSPECTION: August 95

21-Sep-95 17:27

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
23	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	31	TRH	TEH	720-RB	MAI	TEH	2.69	.00	1	4.81	9	115	>> POSITIVE ID ESTABLISHED <<
32	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	32	TRH	TEH	720-RB	SAI	TEH	2.97	.00	1	2.29	20	115	>> POSITIVE ID ESTABLISHED <<
4	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	32	TRH	TEH	720-RB	SAI	TEH	2.55	.00	1	.75	28	115	>> POSITIVE ID ESTABLISHED <<
10	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	32	TRH	TEH	720-RB	MAI	TEH	2.46	.00	1	.75	28	115	>> POSITIVE ID ESTABLISHED <<
11	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	32	TRH	TEH	720-RB	MAI	TEH	2.43	.00	1	1.66	12	115	>> POSITIVE ID ESTABLISHED <<
14	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	32	TRH	TEH	720-RB	MAI	TEH	2.39	.00	1	16.10	7	115	>> POSITIVE ID ESTABLISHED <<
31	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	33	TRH	TEH	720-RB	MAI	TEH	2.17	.00	1	5.82	25	115	>> POSITIVE ID ESTABLISHED <<
14	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	33	TRH	TEH	720-RB	MAI	TEH	2.57	.00	1	3.14	186	115	>> POSITIVE ID ESTABLISHED <<
27	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	34	TRH	TEH	720-RB	MAI	TEH	2.59	.00	1	2.97	8	115	>> POSITIVE ID ESTABLISHED <<
4	34												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	34	TRH	TEH	720-RB	SAI	TEH	2.64	.00	1	2.21	10	115	>> POSITIVE ID ESTABLISHED <<
5	34												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	34	TRH	TEH	720-RB	MAI	TEH	2.26	.00	1	10.19	12	115	>> POSITIVE ID ESTABLISHED <<
16	34												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	34	TRH	TEH	720-RB	MAI	TEH	2.21	.00	1	8.09	16	115	>> POSITIVE ID ESTABLISHED <<
24	34												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	35	TRH	TEH	720-RB	MAI	TEH	2.58	.00	1	1.92	39	117	>> POSITIVE ID ESTABLISHED <<
1	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	35	TRH	TEH	720-RB	MAI	TEH	2.24	.00	1	7.41	15	115	>> POSITIVE ID ESTABLISHED <<
9	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	35	TRH	TEH	720-RB	MAI	TEH	2.52	.00	1	5.43	11	115	>> POSITIVE ID ESTABLISHED <<
10	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	35	TRH	TEH	720-RB	MAI	TEH	2.23	.00	1	10.19	12	115	>> POSITIVE ID ESTABLISHED <<
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



D. C. Cook U1R95

AEP -11/51

INSPECTION: August 95

21-Sep-95 17:27

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
11	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	35	TRH	TEH	720-RB MAI	TEH		1.15	.00	1	1.21	25	131	>> POSITIVE ID ESTABLISHED <<
14	35	TSH	TSH	720-RB MAI	TSH		-.41	.00	1	.39	153	131	>> POSITIVE ID ESTABLISHED <<
14	35	TSH	TSH	720-ZC MAI	TSH		-.36	.00	4	.30	112	153	>> POSITIVE ID ESTABLISHED <<
25	35	TRH	TEH	720-RB SAI	TEH		2.57	.00	1	.91	10	117	>> POSITIVE ID ESTABLISHED <<
25	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	35	TRH	TEH	720-RB MAI	TEH		2.60	.00	1	.80	17	117	>> POSITIVE ID ESTABLISHED <<
29	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	35	TRH	TEH	720-RB MAI	TEH		2.55	.00	1	.55	21	117	>> POSITIVE ID ESTABLISHED <<
31	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	36	TRH	TEH	720-RB MAI	TEH		1.42	.00	1	2.03	22	131	>> POSITIVE ID ESTABLISHED <<
16	36	TSH	TSH	720-RB MAI	TSH		-.88	.00	1	.36	112	131	>> POSITIVE ID ESTABLISHED <<
16	36	TSH	TSH	720-ZC MAI	TSH		-.83	.00	1	.66	93	159	>> POSITIVE ID ESTABLISHED <<
1	37	TRH	TEH	720-RB SAI	TEH		2.68	.00	1	1.10	21	117	>> POSITIVE ID ESTABLISHED <<
1	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	37	TRH	TEH	720-RB SAI	TEH		2.80	.00	4	1.95	12	125	>> POSITIVE ID ESTABLISHED <<
2	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	37	TRH	TEH	720-RB MAI	TEH		2.55	.00	1	2.15	16	117	>> POSITIVE ID ESTABLISHED <<
7	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	37	TRH	TEH	720-RB MAI	TEH		2.67	.00	1	.52	26	117	>> POSITIVE ID ESTABLISHED <<
15	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	37	TRH	TEH	720-RB MAI	TEH		2.70	.00	1	1.35	37	117	>> POSITIVE ID ESTABLISHED <<
18	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	37	TRH	TEH	720-RB MAI	TEH		2.59	.00	1	.54	24	117	>> POSITIVE ID ESTABLISHED <<
28	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	38	TRH	TEH	720-RB MAI	TEH		2.66	.00	4	2.03	14	125	>> POSITIVE ID ESTABLISHED <<
3	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	38	TRH	TEH	720-RB SAI	TEH		2.62	.00	1	1.52	11	117	>> POSITIVE ID ESTABLISHED <<
5	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	38	TRH	TEH	720-RB MAI	TEH		2.68	.00	1	.74	21	117	>> POSITIVE ID ESTABLISHED <<
9	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	38	TRH	TEH	720-RB MAI	TEH		2.52	.00	1	1.77	15	117	>> POSITIVE ID ESTABLISHED <<
14	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
23	38	TRH	TEH	720-RB SAI	TEH		2.58	.00	1	.52	20	117	>> POSITIVE ID ESTABLISHED <<
23	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	39	TRH	TEH	720-RB MAI	TEH		2.61	.00	1	2.64	20	117	>> POSITIVE ID ESTABLISHED <<
1	39												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	39	TRH	TEH	720-RB SAI	TEH		2.59	.00	1	.93	18	117	>> POSITIVE ID ESTABLISHED <<
4	39												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	39	TSH	TSH	720-RB MAI	TSH		-.42	.00	1	.54	15	131	>> POSITIVE ID ESTABLISHED <<
18	39	TSH	TSH	720-ZC MAI	TSH		-.77	.00	4	.26	57	155	RESULT OF DISCREPANCY RESOLUTION
18	39												>> POSITIVE ID ESTABLISHED <<
15	40	TRH	TEH	720-RB MAI	TEH		2.64	.00	1	.75	17	117	>> POSITIVE ID ESTABLISHED <<
15	40												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	41	TRH	TEH	720-RB MAI	TEH		2.98	.00	1	1.69	15	131	>> POSITIVE ID ESTABLISHED <<
2	41	TSH	TSH	720-RB MAI	TSH		-.65	.00	1	.34	22	131	>> POSITIVE ID ESTABLISHED <<
2	41	TSH	TSH	720-ZC MAI	TSH		-.51	.00	4	.26	84	155	RESULT OF DISCREPANCY RESOLUTION
2	41												>> POSITIVE ID ESTABLISHED <<
2	41	2H	2H	720-ZC MAI	2H		-.21	.00	4	.45	45	155	RESULT OF DISCREPANCY RESOLUTION
2	41												>> POSITIVE ID ESTABLISHED <<
4	41	TRH	TEH	720-RB SAI	TEH		2.75	.00	1	.15	10	117	>> POSITIVE ID ESTABLISHED <<
4	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	41	TRH	TEH	720-RB SAI	TEH		2.54	.00	1	.57	13	117	>> POSITIVE ID ESTABLISHED <<
6	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	41	TRH	TEH	720-RB MAI	TEH		2.70	.00	1	1.86	27	117	>> POSITIVE ID ESTABLISHED <<
17	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	41	TRH	TEH	720-RB MAI	TEH		2.66	.00	1	1.28	24	117	>> POSITIVE ID ESTABLISHED <<
20	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	41	TRH	TEH	720-RB MAI	TEH		2.54	.00	1	.70	23	117	>> POSITIVE ID ESTABLISHED <<
27	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	42	TRH	TEH	720-RB MAI	TEH		2.67	.00	1	.98	20	117	>> POSITIVE ID ESTABLISHED <<
3	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	42	TRH	TEH	720-RB SAI	TEH		2.58	.00	1	1.00	19	117	>> POSITIVE ID ESTABLISHED <<
8	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	42	TRH	TEH	720-RB MAI	TEH		2.67	.00	1	1.69	31	117	>> POSITIVE ID ESTABLISHED <<
9	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
11	42	TRH	TEH	720-RB	MAI	TEH	2.61	.00	1	1.84	206	117	>> POSITIVE ID ESTABLISHED <<
11	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	42	TRH	TEH	720-RB	SAI	TEH	2.67	.00	1	.93	17	117	>> POSITIVE ID ESTABLISHED <<
21	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	42	TRH	TEH	720-RB	MAI	TEH	2.64	.00	1	4.98	9	117	>> POSITIVE ID ESTABLISHED <<
28	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	43	TRH	TEH	720-RB	SAI	TEH	2.27	.00	1	.31	5	117	>> POSITIVE ID ESTABLISHED <<
1	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	43	TRH	TEH	720-RB	SAI	TEH	2.73	.00	1	.35	17	117	>> POSITIVE ID ESTABLISHED <<
3	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	43	TRH	TEH	720-RB	MAI	TEH	2.42	.00	1	.90	21	117	>> POSITIVE ID ESTABLISHED <<
4	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	43	TRH	TEH	720-RB	MAI	TEH	2.51	.00	1	.70	16	117	>> POSITIVE ID ESTABLISHED <<
6	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	43	TRH	TEH	720-RB	SAI	TEH	2.60	.00	1	1.24	17	117	>> POSITIVE ID ESTABLISHED <<
11	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	43	TRH	TEH	720-RB	SAI	TEH	2.51	.00	1	3.17	11	117	>> POSITIVE ID ESTABLISHED <<
24	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	43	TRH	TEH	720-RB	MAI	TEH	2.54	.00	1	.98	15	117	>> POSITIVE ID ESTABLISHED <<
28	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	44	TRH	TEH	720-RB	MAI	TEH	2.38	.00	1	2.64	29	117	>> POSITIVE ID ESTABLISHED <<
1	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	44	TRH	TEH	720-RB	MAI	TEH	2.44	.00	1	1.67	31	117	>> POSITIVE ID ESTABLISHED <<
2	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	44	TRH	TEH	720-RB	MAI	TEH	2.41	.00	1	2.24	27	117	>> POSITIVE ID ESTABLISHED <<
5	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	44	TRH	TEH	720-RB	SAI	TEH	2.59	.00	1	4.79	8	117	>> POSITIVE ID ESTABLISHED <<
11	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	44	TRH	TEH	720-RB	MAI	TEH	2.60	.00	1	.13	34	117	>> POSITIVE ID ESTABLISHED <<
19	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	44	TRH	TEH	720-RB	MAI	TEH	2.83	.00	4	1.99	9	125	>> POSITIVE ID ESTABLISHED <<
31	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



D. C. Cook U1R95

AEP -11/51

INSPECTION: August 95

21-Sep-95 17:27

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
1	45	TRH	TEH	720-RB SAI	TEH		2.49	.00	1	5.20	11	117	>> POSITIVE ID ESTABLISHED <<
1	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	46	TRH	TEH	720-RB MAI	TEH		2.57	.00	1	2.36	11	117	>> POSITIVE ID ESTABLISHED <<
2	46												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	46	TRH	TEH	720-RB MAI	TEH		2.61	.00	1	.84	5	117	>> POSITIVE ID ESTABLISHED <<
21	46												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	47	TRH	TEH	720-RB MAI	TEH		2.52	.00	1	2.70	23	117	>> POSITIVE ID ESTABLISHED <<
1	47												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	47	TRH	TEH	720-RB MAI	TEH		2.63	.00	1	1.26	27	117	>> POSITIVE ID ESTABLISHED <<
2	47												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	47	TRH	TEH	720-RB MAI	TEH		2.70	.00	1	.55	35	117	>> POSITIVE ID ESTABLISHED <<
14	47												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	48	TRH	TEH	720-RB MAI	TEH		2.52	.00	1	1.40	18	117	>> POSITIVE ID ESTABLISHED <<
9	48												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	48	TRH	TEH	720-RB SAI	TEH		2.44	.00	1	.43	184	117	>> POSITIVE ID ESTABLISHED <<
30	48												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	49	TSH	TSH	720-RB MAI	TSH		-.29	.00	1	.29	166	131	>> POSITIVE ID ESTABLISHED <<
1	49	TSH	TSH	720-ZC MAI	TSH		-.23	.00	4	.24	65	155	RESULT OF DISCREPANCY RESOLUTION
1	49												>> POSITIVE ID ESTABLISHED <<
8	49	TRH	TEH	720-RB MAI	TEH		2.52	.00	1	1.61	14	117	>> POSITIVE ID ESTABLISHED <<
8	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	49	1H	1H	620-ZC MAI	1H		.00	.00	4	.21	126	161	RESULT OF DISCREPANCY RESOLUTION
16	49	TRH	TEH	720-RB MAI	TEH		2.55	.00	1	4.50	11	117	>> POSITIVE ID ESTABLISHED <<
16	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	49	TRH	TEH	720-RB MAI	TEH		2.58	.00	1	.66	10	117	>> POSITIVE ID ESTABLISHED <<
30	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	50	TRH	TEH	720-RB MAI	TEH		2.35	.00	1	1.11	20	117	>> POSITIVE ID ESTABLISHED <<
1	50												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	50	TRH	TEH	720-RB MAI	TEH		2.56	.00	1	1.17	22	117	>> POSITIVE ID ESTABLISHED <<
20	50												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	50	TSH	TEH	720-RB SAI	TEH		2.45	.00	1	1.79	17	117	>> POSITIVE ID ESTABLISHED <<
23	50												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
4	51	TRH	TEH	720-RB SAI	TEH		2.35	.00	1	.39	36	117	>> POSITIVE ID ESTABLISHED <<
4	51												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	51	TRH	TEH	720-RB SAI	TEH		2.45	.00	1	.92	22	117	>> POSITIVE ID ESTABLISHED <<
6	51												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	51	TRH	TEH	720-RB MAI	TEH		2.59	.00	1	1.21	36	117	>> POSITIVE ID ESTABLISHED <<
8	51												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	51	TRH	TEH	720-RB MAI	TEH		2.66	.00	1	.66	13	117	>> POSITIVE ID ESTABLISHED <<
32	51												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	52	TRH	TEH	720-RB MAI	TEH		1.66	.00	1	2.43	29	131	>> POSITIVE ID ESTABLISHED <<
1	52	TSH	TSH	720-RB MAI	TSH		-1.44	.00	1	.52	150	131	>> POSITIVE ID ESTABLISHED <<
1	52	TSH	TSH	720-ZC MAI	TSH		-.82	.00	4	.62	107	155	RESULT OF DISCREPANCY RESOLUTION
1	52												>> POSITIVE ID ESTABLISHED <<
2	52	TRH	TEH	720-RB MAI	TEH		2.57	.00	1	1.19	10	117	>> POSITIVE ID ESTABLISHED <<
2	52												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	52	TRH	TEH	720-RB MAI	TEH		2.07	.00	1	2.11	31	131	>> POSITIVE ID ESTABLISHED <<
13	52	TSH	TEH	720-ZC MAI	TEH		11.31	.00	4	1.14	111	157	RESULT OF DISCREPANCY RESOLUTION
13	52												>> POSITIVE ID ESTABLISHED <<
13	52	TSH	TEH	720-ZC MAI	TEH		2.84	.00	4	6.73	28	157	RESULT OF DISCREPANCY RESOLUTION
13	52												RETEST - RETEST FOR POSITIVE ID
16	52	TRH	TEH	720-RB MAI	TEH		2.55	.00	1	1.12	25	117	>> POSITIVE ID ESTABLISHED <<
16	52												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	52	TSH	TSH	720-ZC SAI	TSH		-1.50	.00	4	.49	66	155	RESULT OF DISCREPANCY RESOLUTION
19	52												>> POSITIVE ID ESTABLISHED <<
32	52	TRH	TEH	720-RB MAI	TEH		2.60	.00	1	.79	25	117	>> POSITIVE ID ESTABLISHED <<
32	52												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	53	TRH	TEH	720-RB SAI	TEH		2.67	.00	1	.54	26	117	>> POSITIVE ID ESTABLISHED <<
3	53												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	53	TRH	TEH	720-RB MAI	TEH		2.21	.00	1	.17	52	119	>> POSITIVE ID ESTABLISHED <<
9	53												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	54	TRH	TEH	720-RB SAI	TEH		2.58	.00	1	3.14	21	117	>> POSITIVE ID ESTABLISHED <<
1	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	54	TRH	TEH	720-RB SAI	TEH		2.08	.00	1	3.05	17	119	>> POSITIVE ID ESTABLISHED <<
5	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	54	TRH	TEH	720-RB MAI	TEH		1.97	.00	1	1.56	9	119	>> POSITIVE ID ESTABLISHED <<
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
6	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	54	TRH	TEH	720-RB SAI	TEH		2.61	.00	1	.72	13	119	>> POSITIVE ID ESTABLISHED <<
21	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	54	TRH	TEH	720-RB MAI	TEH		2.74	.00	1	1.32	8	123	>> POSITIVE ID ESTABLISHED <<
25	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	54	TRH	TEH	720-RB MAI	TEH		2.77	.00	1	1.52	6	125	>> POSITIVE ID ESTABLISHED <<
25	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	55	TRH	TEH	720-RB MAI	TEH		2.22	.00	1	.50	16	119	>> POSITIVE ID ESTABLISHED <<
5	55												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	55	TRH	TEH	720-RB MAI	TEH		2.23	.00	1	1.24	13	119	>> POSITIVE ID ESTABLISHED <<
12	55												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	55	TRH	TEH	720-RB MAI	TEH		2.69	.00	1	1.42	17	123	>> POSITIVE ID ESTABLISHED <<
23	55												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	55	TRH	TEH	720-RB SAI	TEH		2.75	.00	1	1.92	9	125	>> POSITIVE ID ESTABLISHED <<
23	55												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	55	TRH	TEH	720-RB SAI	TEH		2.74	.00	1	3.36	4	123	>> POSITIVE ID ESTABLISHED <<
25	55												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	55	TRH	TEH	720-RB SAI	TEH		2.72	.00	4	2.30	18	125	>> POSITIVE ID ESTABLISHED <<
25	55												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	55	TRH	TEH	720-RB MAI	TEH		2.72	.00	1	2.01	20	121	>> POSITIVE ID ESTABLISHED <<
32	55												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	56	TRH	TEH	720-RB SAI	TEH		1.61	.00	1	2.13	182	119	>> POSITIVE ID ESTABLISHED <<
8	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	56	TRH	TEH	720-RB SAI	TEH		2.77	.00	1	1.73	23	119	>> POSITIVE ID ESTABLISHED <<
12	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	56	TRH	TEH	720-RB MAI	TEH		2.63	.00	1	1.03	18	121	>> POSITIVE ID ESTABLISHED <<
31	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	57	TRH	TEH	720-RB SAI	TEH		2.56	.00	1	1.82	13	119	>> POSITIVE ID ESTABLISHED <<
4	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	57	TRH	TEH	720-RB SAI	TEH		2.57	.00	1	.88	11	119	>> POSITIVE ID ESTABLISHED <<
5	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	57	TRH	TEH	720-RB MAI	TEH		2.54	.00	1	.82	5	119	>> POSITIVE ID ESTABLISHED <<
12	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	58	TRH	TEH	720-RB MAI	TEH		2.09	.00	1	.39	11	119	>> POSITIVE ID ESTABLISHED <<
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



D. C. Cook U1R95

AEP -11/51

INSPECTION: August 95

21-Sep-95 17:28

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
2	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	58	TRH	TEH	720-RB MAI	TEH		2.49	.00	1	2.44	18	119	>> POSITIVE ID ESTABLISHED <<
4	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	58	TRH	TEH	720-RB MAI	TEH		2.56	.00	1	.65	12	119	>> POSITIVE ID ESTABLISHED <<
6	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	58	TRH	TEH	720-RB MAI	TEH		1.78	.00	1	3.51	4	119	>> POSITIVE ID ESTABLISHED <<
12	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	58	TRH	TEH	720-RB MAI	TEH		2.66	.00	1	1.69	14	119	>> POSITIVE ID ESTABLISHED <<
14	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	58	TRH	TEH	720-RB MAI	TEH		2.73	.00	1	.62	20	123	>> POSITIVE ID ESTABLISHED <<
25	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	58	TRH	TEH	720-RB SAI	TEH		2.66	.00	1	.92	186	125	>> POSITIVE ID ESTABLISHED <<
25	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	59	TRH	TEH	720-RB MAI	TEH		2.65	.00	1	1.88	12	119	>> POSITIVE ID ESTABLISHED <<
9	59												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	59	TRH	TEH	720-RB MAI	TEH		2.58	.00	1	1.03	5	119	>> POSITIVE ID ESTABLISHED <<
13	59												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	59	TRH	TEH	720-RB MAI	TEH		2.58	.00	1	4.94	11	121	>> POSITIVE ID ESTABLISHED <<
29	59												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	60	TRH	TEH	720-RB MAI	TEH		2.64	.00	1	1.68	18	119	>> POSITIVE ID ESTABLISHED <<
1	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	60	TRH	TEH	720-RB SAI	TEH		2.58	.00	1	1.48	13	119	>> POSITIVE ID ESTABLISHED <<
4	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	60	TRH	TEH	720-RB MAI	TEH		2.77	.00	1	.59	11	119	>> POSITIVE ID ESTABLISHED <<
13	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	61	TRH	TEH	720-RB MAI	TEH		1.11	.00	1	1.91	15	131	>> POSITIVE ID ESTABLISHED <<
1	61	TSH	TSH	720-RB MAI	TSH		-.87	.00	1	.27	148	131	>> POSITIVE ID ESTABLISHED <<
1	61	TSH	TSH	720-ZC MAI	TSH		-.88	.00	4	.46	95	155	RESULT OF DISCREPANCY RESOLUTION
1	61												>> POSITIVE ID ESTABLISHED <<
7	61	TRH	TEH	720-RB MAI	TEH		2.47	.00	1	4.07	17	121	>> POSITIVE ID ESTABLISHED <<
7	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	61	TRH	TEH	720-RB SAI	TEH		2.30	.00	1	1.47	12	121	>> POSITIVE ID ESTABLISHED <<
23	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
30	61	TRH	TEH	720-RB MAI	TEH		2.66	.00	1	2.27	17	121	>> POSITIVE ID ESTABLISHED <<
30	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	61	TRH	TEH	720-RB MAI	TEH		2.52	.00	1	2.49	17	121	>> POSITIVE ID ESTABLISHED <<
33	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	62	TRH	TEH	720-RB MAI	TEH		2.42	.00	1	4.02	28	121	>> POSITIVE ID ESTABLISHED <<
1	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	62	TRH	TEH	720-RB MAI	TEH		2.44	.00	1	3.98	11	121	>> POSITIVE ID ESTABLISHED <<
5	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	62	TRH	TEH	720-RB MAI	TEH		2.45	.00	1	1.19	17	121	>> POSITIVE ID ESTABLISHED <<
25	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	63	TRH	TEH	720-RB SAI	TEH		2.51	.00	1	2.08	15	121	>> POSITIVE ID ESTABLISHED <<
10	63												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	63	TRH	TEH	720-RB SAI	TEH		2.45	.00	1	2.14	14	121	>> POSITIVE ID ESTABLISHED <<
13	63												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	63	TRH	TEH	720-RB MAI	TEH		2.42	.00	1	1.24	16	121	>> POSITIVE ID ESTABLISHED <<
29	63												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	64	TRH	TEH	720-RB SAI	TEH		2.47	.00	1	3.99	11	121	>> POSITIVE ID ESTABLISHED <<
5	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	64	TRH	TEH	720-RB MAI	TEH		2.43	.00	1	.82	12	121	>> POSITIVE ID ESTABLISHED <<
13	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	64	TRH	TEH	720-RB MAI	TEH		2.51	.00	1	1.29	15	121	>> POSITIVE ID ESTABLISHED <<
15	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	64	TRH	TEH	720-RB MAI	TEH		2.57	.00	1	2.73	19	121	>> POSITIVE ID ESTABLISHED <<
16	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	64	TRH	TEH	720-RB MAI	TEH		2.40	.00	1	1.92	14	121	>> POSITIVE ID ESTABLISHED <<
17	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	65	TRH	TEH	720-RB SAI	TEH		2.63	.00	1	2.30	14	121	>> POSITIVE ID ESTABLISHED <<
3	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	65	TRH	TEH	720-RB MAI	TEH		2.76	.00	1	3.31	19	121	>> POSITIVE ID ESTABLISHED <<
13	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	65	TRH	TEH	720-RB MAI	TEH		2.58	.00	1	1.09	13	121	>> POSITIVE ID ESTABLISHED <<
16	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

D. C. Cook U1R95

AEP -11/51

INSPECTION: August 95

21-Sep-95 17:28

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
23	65	TRH	TEH	720-RB	MAI	TEH	2.24	.00	1	2.07	9	121	>> POSITIVE ID ESTABLISHED <<
23	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	65	TRH	TEH	720-RB	MAI	TEH	2.42	.00	1	2.63	11	121	>> POSITIVE ID ESTABLISHED <<
25	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	66	TRH	TEH	720-RB	SAI	TEH	2.30	.00	1	4.46	13	121	>> POSITIVE ID ESTABLISHED <<
1	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	66	TRH	TEH	720-RB	MAI	TEH	2.54	.00	1	1.37	27	121	>> POSITIVE ID ESTABLISHED <<
3	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	66	TRH	TEH	720-RB	MAI	TEH	2.38	.00	1	1.84	26	121	>> POSITIVE ID ESTABLISHED <<
4	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	66	TRH	TEH	720-RB	SAI	TEH	2.55	.00	1	2.91	9	121	>> POSITIVE ID ESTABLISHED <<
20	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	66	TRH	TEH	720-RB	SAI	TEH	2.55	.00	1	1.45	17	121	>> POSITIVE ID ESTABLISHED <<
24	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	67	TRH	TEH	720-RB	SAI	TEH	2.50	.00	1	1.56	16	121	>> POSITIVE ID ESTABLISHED <<
1	67												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	67	TRH	TEH	720-RB	MAI	TEH	2.52	.00	1	2.38	12	121	>> POSITIVE ID ESTABLISHED <<
24	67												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	67	TRH	TEH	720-RB	MAI	TEH	2.49	.00	1	2.36	11	121	>> POSITIVE ID ESTABLISHED <<
24	67												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	67	TRH	TEH	720-RB	SAI	TEH	2.44	.00	1	.95	18	121	>> POSITIVE ID ESTABLISHED <<
25	67												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	68	TRH	TEH	720-RB	SAI	TEH	2.30	.00	1	1.47	20	121	>> POSITIVE ID ESTABLISHED <<
1	68												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	68	TRH	TEH	720-RB	SAI	TEH	2.39	.00	1	3.85	13	121	>> POSITIVE ID ESTABLISHED <<
18	68												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	69	TRH	TEH	720-RB	MAI	TEH	2.32	.00	1	3.49	17	121	>> POSITIVE ID ESTABLISHED <<
1	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	69	TRH	TEH	720-RB	MAI	TEH	2.49	.00	1	.80	28	121	>> POSITIVE ID ESTABLISHED <<
5	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	69	TRH	TEH	720-RB	MAI	TEH	2.46	.00	1	3.90	9	121	>> POSITIVE ID ESTABLISHED <<
16	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	69	TRH	TEH	720-RB	MAI	TEH	2.51	.00	1	3.06	11	121	>> POSITIVE ID ESTABLISHED <<
24	69												
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



D. C. Cook U1R95

AEP -11/51

INSPECTION: August 95

21-Sep-95 17:28

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
24	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	70	TSH	TSH	720-ZC SAI TSH			-1.04	.00	4	.15	68	155	RESULT OF DISCREPANCY RESOLUTION
2	70												>> POSITIVE ID ESTABLISHED <<
6	70	TRH	TEH	720-RB MAI TEH			2.38	.00	1	1.78	13	121	>> POSITIVE ID ESTABLISHED <<
6	70												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	70	TRH	TEH	720-RB MAI TEH			2.47	.00	1	2.39	17	121	>> POSITIVE ID ESTABLISHED <<
7	70												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	70	TSH	TSH	720-ZC SAI TSH			-.99	.00	4	.12	38	155	RESULT OF DISCREPANCY RESOLUTION
8	70												>> POSITIVE ID ESTABLISHED <<
24	70	TRH	TEH	720-RB MAI TEH			2.60	.00	1	1.47	27	121	>> POSITIVE ID ESTABLISHED <<
24	70												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	71	TRH	TEH	720-RB MAI TEH			2.55	.00	1	1.53	19	121	>> POSITIVE ID ESTABLISHED <<
15	71												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	71	TRH	TEH	720-RB MAI TEH			2.43	.00	1	7.48	16	121	>> POSITIVE ID ESTABLISHED <<
20	71												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	71	TRH	TEH	720-RB SAI TEH			2.37	.00	1	4.77	13	121	>> POSITIVE ID ESTABLISHED <<
31	71												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	72	TRH	TEH	720-RB MAI TEH			2.55	.00	1	2.09	21	121	>> POSITIVE ID ESTABLISHED <<
1	72												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	72	TRH	TEH	720-RB SAI TEH			2.45	.00	1	3.67	9	121	>> POSITIVE ID ESTABLISHED <<
15	72												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	72	TRH	TEH	720-RB MAI TEH			2.50	.00	1	5.20	20	121	>> POSITIVE ID ESTABLISHED <<
19	72												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	74	TRH	TEH	720-RB MAI TEH			2.32	.00	1	3.08	8	121	>> POSITIVE ID ESTABLISHED <<
1	74												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	74	TRH	TEH	720-RB MAI TEH			2.51	.00	1	1.72	9	121	>> POSITIVE ID ESTABLISHED <<
10	74												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	74	TRH	TEH	720-RB MAI TEH			2.31	.00	1	2.05	28	121	>> POSITIVE ID ESTABLISHED <<
16	74												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	75	TRH	TEH	720-RB MAI TEH			2.34	.00	1	1.23	21	121	>> POSITIVE ID ESTABLISHED <<
5	75												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	75	TRH	TEH	720-RB MAI TEH			1.23	.00	1	1.20	18	131	>> POSITIVE ID ESTABLISHED <<
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



D. C. Cook U1R95

AEP -11/51

INSPECTION: August 95

21-Sep-95 17:28

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
6	75												-DO NOT REPAIR - 1.31' F* DISTANCE ACHIEVED
6	75												-1994 REROLL SUCCESSFUL
10	75	TRH	TEH	720-RB	SAI	TEH	2.37	.00	1	.58	13	121	>> POSITIVE ID ESTABLISHED <<
10	75												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	76	1H	1H	720-ZC	SAI	1H	.00	.00	4	.67	88	155	RESULT OF DISCREPANCY RESOLUTION
7	77	TRH	TEH	720-RB	MAI	TEH	2.37	.00	1	2.54	23	121	>> POSITIVE ID ESTABLISHED <<
7	77												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	78	TRH	TEH	720-RB	MAI	TEH	2.46	.00	1	1.62	16	121	>> POSITIVE ID ESTABLISHED <<
1	78												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	78	TRH	TEH	720-RB	SAI	TEH	2.37	.00	1	2.08	15	121	>> POSITIVE ID ESTABLISHED <<
4	78												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	78	TRH	TEH	720-RB	MAI	TEH	2.52	.00	1	3.82	18	121	>> POSITIVE ID ESTABLISHED <<
13	78												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	79	TRH	TEH	720-RB	MAI	TEH	2.07	.00	1	1.60	19	121	>> POSITIVE ID ESTABLISHED <<
2	79												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	80	TRH	TEH	720-RB	MAI	TEH	2.45	.00	1	2.83	21	121	>> POSITIVE ID ESTABLISHED <<
14	80												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	80	TRH	TEH	720-RB	MAI	TEH	2.39	.00	1	2.29	11	121	>> POSITIVE ID ESTABLISHED <<
21	80												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	81	TRH	TEH	720-RB	SAI	TEH	2.44	.00	1	.74	29	131	>> POSITIVE ID ESTABLISHED <<
14	81												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	82	TRH	TEH	720-RB	MAI	TEH	2.29	.00	1	1.02	26	121	>> POSITIVE ID ESTABLISHED <<
2	82												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	82	TRH	TEH	720-RB	MAI	TEH	2.56	.00	1	1.92	13	121	>> POSITIVE ID ESTABLISHED <<
9	82												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	82	TRH	TEH	720-RB	SAI	TEH	2.55	.00	1	3.62	14	121	>> POSITIVE ID ESTABLISHED <<
14	82												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	83	TRH	TEH	720-RB	MAI	TEH	2.03	.00	1	1.60	10	121	>> POSITIVE ID ESTABLISHED <<
11	83												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	84	TRH	TEH	720-RB	MAI	TEH	2.55	.00	4	1.68	6	125	>> POSITIVE ID ESTABLISHED <<
1	84												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	84	TRH	TEH	720-RB	MAI	TEH	1.47	.00	1	3.96	18	121	>> POSITIVE ID ESTABLISHED <<
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



D. C. Cook U1R95

AEP -11/51

INSPECTION: August 95

21-Sep-95 17:28

ROW	COL	CEB	CEE	PROBE	IND LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
17	84											-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST

PAGE 17 TOTAL TUBES 247

Attachment 2 TO AEP:NRC:1147F

**ATTACHMENT 2
STEAM GENERATOR ANNUAL OPERATING REPORT**

SECTION 2: Unit 1 Tube Repairs

b.1. New Plugs Installed in SG #12



D.C. COOK UNIT 1

SG - 12 U1R95

LIST OF TUBES PLUGGED IN HOT LEG

Row	Col	Plug Description
13	3	- Mech. Plug
8	5	- Mech. Plug
8	6	- Mech. Plug
12	9	- Mech. Plug
2	13	- Mech. Plug
15	13	- Mech. Plug
2	14	- Mech. Plug
23	17	- Mech. Plug
38	24	- Mech. Plug
41	28	- Mech. Plug
14	30	- Mech. Plug
42	31	- Mech. Plug
12	40	- Mech. Plug
44	40	- Mech. Plug
13	46	- Mech. Plug
19	46	- Mech. Plug
38	47	- Mech. Plug
46	52	- Mech. Plug
3	55	- Mech. Plug
41	66	- Mech. Plug
39	70	- Mech. Plug
40	71	- Mech. Plug
36	74	- Mech. Plug
35	77	- Mech. Plug
31	79	- Mech. Plug
23	87	- Mech. Plug

>> Total Tubes = 26

END

D.C. COOK UNIT 1

SG - 12 U1R95

LIST OF TUBES PLUGGED IN COLD LEG

Row	Col	Plug Description
13	3	- Mech. Plug
8	5	- Mech. Plug
8	6	- Mech. Plug
12	9	- Mech. Plug
2	13	- Mech. Plug
15	13	- Mech. Plug
2	14	- Mech. Plug
23	17	- Mech. Plug
38	24	- Mech. Plug
41	28	- Mech. Plug
14	30	- Mech. Plug
42	31	- Mech. Plug
12	40	- Mech. Plug
44	40	- Mech. Plug
13	46	- Mech. Plug
19	46	- Mech. Plug
38	47	- Mech. Plug
46	52	- Mech. Plug
3	55	- Mech. Plug
41	66	- Mech. Plug
39	70	- Mech. Plug
40	71	- Mech. Plug
36	74	- Mech. Plug
35	77	- Mech. Plug
31	79	- Mech. Plug
23	87	- Mech. Plug

>> Total Tubes = 26

END

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
	13	3	TSH	TEH	720-WC	NDO				1			9	
	13	3	TEH	TEC	720-EL	DNT	7H	-.27	.00	M1	7.34	178	48	
	13	3	TEH	TEC	720-EL	DNT	7H	.32	.00	M1	10.14	182	48	
	13	3	TEH	TEC	720-EL	45	1C	.00	.00	M1	3.18	101	48	RESULT OF DISCREPANCY RESOLUTION
	13	3												RETEST - RETEST FOR POSITIVE ID
	13	3	TEH	TEC	720-EL	PID	1C	.00	.00	M1	3.06	102	118	<< POSITIVE ID ESTABLISHED >>
	13	3	7H	7H	720-ZC	NDO	7H	.00	.00	1			125	
94-Feb	13	3	TSH	TSH	720-ZC	NDO				1			10	
94-Feb	13	3	TEH	TEC	720-EC	DNT	7H	.00	.00	M1	14.70	175	55	
94-Feb	13	3	TEH	TEC	720-EC	37	1C	.00	.00	M1	2.67	105	55	RESULT OF DISCREPANCY RESOLUTION
94-Feb	13	3	7H	7H	720-ZC	NDO				1			84	
	8	5	TSC	TEH	720-EL	QI	TSH	-.45	.00	M1	2.36	98	83	
	8	5	TSC	TEH	720-EL	PCN	1H	.00	.00	M1	1.77	100	83	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
	8	5	TSH	TEH	720-WC	CDI	TSH	-.37	.00	C11	2.27	104	93	RESULT OF DISCREPANCY RESOLUTION
	8	5												RETEST - RETEST FOR POSITIVE ID
	8	5	TSH	TSH	720-ZC	MAI	TSH	-.40	.00	4	.58	51	125	RESULT OF DISCREPANCY RESOLUTION
	8	5												<< POSITIVE ID ESTABLISHED >>
	8	5	TSH	TSH	720-ZC	DIW	TSH	954.00	.00	0	100.00	105	125	RESULT OF DISCREPANCY RESOLUTION
	8	5	1H	1H	720-ZC	MAI	1H	.00	.00	4	1.00	56	125	
	8	5	1H	1H	720-ZC	DIW	1H	709.00	.00	0	100.00	67	125	
	8	5	1C	TEC	720-EL	NDO				1			152	
94-Feb	8	5			0	PLG	TEH	.00	.00				12	
94-Feb	8	5			0	PLG	TEC	.00	.00				55	
	8	6	TSC	TEH	720-EL	DI	TEH	20.89	.00	M1	.83	100	83	RESULT OF DISCREPANCY RESOLUTION
	8	6	TSC	TEH	720-EL	PI	1H	.00	.00	M1	1.42	91	83	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
	8	6	TSC	TEH	720-EL	PI	3H	.00	.00	M1	1.22	87	83	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
	8	6	TSH	TEH	720-WC	CDI	TSH	-.04	.00	C2	1.74	100	93	RESULT OF DISCREPANCY RESOLUTION
	8	6												RETEST - RETEST FOR POSITIVE ID
	8	6	TSH	TSH	720-ZC	SAI	TSH	-.56	.00	1	.56	46	125	RESULT OF DISCREPANCY RESOLUTION
	8	6												<< POSITIVE ID ESTABLISHED >>
	8	6	TSH	TSH	720-ZC	DIW	TSH	945.00	.00	0	100.00	128	125	RESULT OF DISCREPANCY RESOLUTION
	8	6	1C	TEC	720-EL	NDO				1			152	
94-Feb	8	6			0	PLG	TEH	.00	.00				12	
94-Feb	8	6			0	PLG	TEC	.00	.00				57	
DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

D. C. Cook U1R95

AEP -12/51

INSPECTION: August 95

20-Sep-95 19:15

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
	12	9	TSH	TEH	720-WC	CDI	TSH	-.72	.00	C21	2.66	46	11	RESULT OF DISCREPANCY RESOLUTION
	12	9												RETEST - RETEST FOR POSITIVE ID
	12	9	TEH	TEC	720-EL	DI	TEH	20.44	.00	M1	1.23	40	46	RESULT OF DISCREPANCY RESOLUTION
	12	9	TEH	TEC	720-EL	PI	1H	.00	.00	M1	1.33	76	46	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
	12	9	TEH	TEC	720-EL	PI	4H	.00	.00	M1	.58	67	46	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
	12	9	TSH	TSH	720-ZC	SAI	TSH	-.85	.00	4	1.22	21	125	<< POSITIVE ID ESTABLISHED >>
	12	9	TSH	TSH	720-ZC	DIM	TSH	397.00	.00	0	100.00	33	125	
94-Feb	12	9	TSH	TSH	720-ZC	NDO				1			12	
94-Feb	12	9	TEH	TEC	720-EC	PI	4H	.00	.00	M1	.53	83	57	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
	2	13	TSH	TEH	720-WC	CDI	TSH	-.95	.00	C2	1.12	77	13	RESULT OF DISCREPANCY RESOLUTION
	2	13												RETEST - RETEST FOR POSITIVE ID
	2	13	7H	TEH	720-EL	DI	TEH	20.80	.00	M1	.46	64	83	RESULT OF DISCREPANCY RESOLUTION
	2	13	7C	TEC	720-EL	NDO				1			116	
	2	13	TSH	TSH	720-ZC	MAI	TSH	-.85	.00	4	.29	52	125	RESULT OF DISCREPANCY RESOLUTION
	2	13												<< POSITIVE ID ESTABLISHED >>
	2	13	TSH	TSH	720-ZC	DIM	TSH	1978.00	.00	0	100.00	158	125	RESULT OF DISCREPANCY RESOLUTION
	2	13	6C	7H	680-EJ	NDO				1			148	
94-Feb	2	13	7H	TEH	720-EC	NDO				1			4	RESULT OF DISCREPANCY RESOLUTION
94-Feb	2	13	TSH	TSH	720-ZC	NDO				1			16	
94-Feb	2	13	7C	TEC	720-EC	RST	UB	.00	.00	1			61	RESULT OF DISCREPANCY RESOLUTION
94-Feb	2	13	7C	6H	680-EJ	NDO				1			74	
	15	13	TSH	TEH	720-WC	CDI	TSH	-.50	.00	C23	2.67	54	13	RESULT OF DISCREPANCY RESOLUTION
	15	13												RETEST --RETEST FOR POSITIVE ID
	15	13	TEH	TEC	720-EL	DI	TEH	20.71	.00	M1	1.83	43	46	RESULT OF DISCREPANCY RESOLUTION
	15	13	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.79	99	46	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
	15	13	TSH	TSH	720-ZC	SAI	TSH	-.65	.00	4	.65	33	125	RESULT OF DISCREPANCY RESOLUTION
	15	13												<< POSITIVE ID ESTABLISHED >>
	15	13	TSH	TSH	720-ZC	DIM	TSH	394.00	.00	0	100.00	36	125	RESULT OF DISCREPANCY RESOLUTION
94-Feb	15	13	TSH	TSH	720-ZC	NDO				1			16	
94-Feb	15	13	TEH	TEC	720-EC	PI	1H	.00	.00	M1	.58	108	77	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
	2	14	7H	TEH	720-EL	DI	TEH	21.10	.00	M1	1.99	110	83	RESULT OF DISCREPANCY RESOLUTION
	2	14	7H	TEH	720-EL	DI	TEH	20.82	.00	M1	1.22	86	83	RESULT OF DISCREPANCY RESOLUTION
	2	14	7H	TEH	720-EL	PCN	1H	.00	.00	M1	1.81	102	83	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
	2	14	TSH	TEH	720-WC	CDI	TSH	-.34	.00	C11	3.48	83	93	RESULT OF DISCREPANCY RESOLUTION
	2	14												RETEST - RETEST FOR POSITIVE ID
	2	14	TSH	TSH	720-ZC	MAI	TSH	-.50	.00	1	.52	113	125	RESULT OF DISCREPANCY RESOLUTION
	2	14												<< POSITIVE ID ESTABLISHED >>
	2	14	TSH	TSH	720-ZC	DIM	TSH	1224.00	.00	0	100.00	121	125	RESULT OF DISCREPANCY RESOLUTION
	2	14	1H	1H	720-ZC	SAI	1H	.00	.00	4	.97	43	125	RESULT OF DISCREPANCY RESOLUTION
DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

D. C. Cook U1R95

AEP -12/51

INSPECTION: August 95

20-Sep-95 19:15

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
	2	14	1H	1H	720-ZC DIM	1H		790.00	.00	0	100.00	102	125	RESULT OF DISCREPANCY RESOLUTION
	2	14	7C	TEC	720-EL NDO					1			152	
	2	14	7H	6C	700-EL NDO					1			156	
94-Feb	2	14			0	PLG	TEH	.00	.00				4	
94-Feb	2	14			0	PLG	TEH	.00	.00				16	
94-Feb	2	14			0	PLG	TEC	.00	.00				61	
	23	17	TSC	TEH	720-EL DI	TEH		20.00	.00	M1	1.46	102	83	RESULT OF DISCREPANCY RESOLUTION
	23	17	TSC	TEH	720-EL PI	1H		.00	.00	M1	1.18	88	83	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
	23	17	TSH	TEH	720-WC CDI	TSH		-.69	.00	C15	2.77	95	93	RESULT OF DISCREPANCY RESOLUTION
	23	17												RETEST - RETEST FOR POSITIVE ID
	23	17	TSH	TSH	720-ZC SAI	TSH		-.79	.00	4	1.14	112	123	RESULT OF DISCREPANCY RESOLUTION
	23	17												<< POSITIVE ID ESTABLISHED >>
	23	17	TSH	TSH	720-ZC DIM	TSH		868.00	.00	0	100.00	151	123	RESULT OF DISCREPANCY RESOLUTION
	23	17	1C	TEC	720-EL NDO					1			152	RESULT OF DISCREPANCY RESOLUTION
94-Feb	23	17			0	PLG	TEH	.00	.00				18	RESULT OF DISCREPANCY RESOLUTION
94-Feb	23	17			0	PLG	TEC	.00	.00				85	
	38	24	TSH	TEH	720-WC CDI	TSH		-.54	.00	C22	.74	80	21	RESULT OF LAR
	38	24												<< POSITIVE ID ESTABLISHED >>
	38	24	TEH	TEC	720-EL DIC	TEH		20.75	.00	M1	.79	38	42	RESULT OF DISCREPANCY RESOLUTION
	38	24												RETEST - RETEST FOR POSITIVE ID
	38	24	TEH	TEC	720-EL PI	1H		.00	.00	M1	.56	76	42	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
	38	24	TEH	TEC	720-EL 33	1C		.00	.00	M1	2.02	109	42	
	38	24	TSH	TSH	720-ZC SAI	TSH		-.86	.00	4	.47	22	123	<< POSITIVE ID ESTABLISHED >>
	38	24	TSH	TSH	720-ZC DIM	TSH		847.00	.00	0	100.00	41	123	
94-Feb	38	24	TSH	TSH	720-ZC NDO					1			20	
94-Feb	38	24	TEH	TEC	720-EC 11	1C		-.03	.00	M1	.75	123	83	
	41	28	TSH	TEH	720-WC NDO					1			25	
	41	28	TEH	TEC	720-EL 48	1C		.00	.00	M1	4.20	97	42	RESULT OF DISCREPANCY RESOLUTION
	41	28												RETEST - RETEST FOR POSITIVE ID
	41	28	2C	TEC	720-EL PID	1C		.02	.00	M1	3.89	96	120	<< POSITIVE ID ESTABLISHED >>
94-Feb	41	28	TSH	TSH	720-ZC NDO					1			22	
94-Feb	41	28	TEH	TEC	720-EC 33	1C		.00	.00	M1	2.31	108	75	
	14	30	TSC	TEH	720-EL DRI	TEH		1.59	.00	M1	48.80	185	83	RESULT OF DISCREPANCY RESOLUTION
	14	30	TSC	TEH	720-EL DI	TSH		1.24	.00	M1	.41	98	83	RESULT OF DISCREPANCY RESOLUTION
	14	30	TSC	TEH	720-EL DNT	TSH		-1.09	.00	M1	76.11	176	83	
	14	30	TSH	TEH	720-WC CRI	TRH		.00	.00	C2	8.05	16	93	RESULT OF DISCREPANCY RESOLUTION
DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

C. Cook U1R95

AEP -12/51

INSPECTION: August 95

20-Sep-95 19:15

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
	14	30												RETEST - RETEST FOR POSITIVE ID
	14	30	TSH	TEH	720-WC	CDI	TSH	.92	.00	C13	5.03	85	93	RESULT OF DISCREPANCY RESOLUTION
	14	30												RETEST - RETEST FOR POSITIVE ID
	14	30	TRH	TEH	720-RB	MAI	TEH	2.61	.00	1	1.19	14	109	RESULT OF LAR
	14	30												<< POSITIVE ID ESTABLISHED >>
	14	30	TRH	TEH	720-RB	BRT	TEH	2.47	.00	1			109	RESULT OF LAR
	14	30	TRH	TEH	720-RB	CRT	TEH	2.78	.00	1			109	RESULT OF LAR
	14	30	TSH	TSH	720-RB	SAI	TSH	.21	.00	1	.63	86	109	RESULT OF LAR
	14	30												<< POSITIVE ID ESTABLISHED >>
	14	30	TSH	TSH	720-ZC	SAI	TSH	-.10	.00	4	.89	61	125	RESULT OF DISCREPANCY RESOLUTION
	14	30												<< POSITIVE ID ESTABLISHED >>
	14	30	TSH	TSH	720-ZC	DIW	TSH	440.00	.00	0	100.00	104	125	RESULT OF DISCREPANCY RESOLUTION
	14	30	1C	TEC	720-EL	NDO				1			152	
94-Feb	14	30			0	PLG	TEC	.00	.00				69	
	42	31	TSH	TEH	720-WC	NDO				1			31	
	42	31	TEH	TEC	720-EL	DNT	7H	-.20	.00	M1	6.47	180	44	
	42	31	TEH	TEC	720-EL	DNT	7H	.25	.00	M1	4.01	181	44	
	42	31	TEH	TEC	720-EL	43	1C	.02	.00	M1	2.46	103	44	RESULT OF DISCREPANCY RESOLUTION
	42	31												RETEST - RETEST FOR POSITIVE ID
	42	31	2C	TEC	720-EL	PID	1C	.00	.00	M1	2.33	101	120	<< POSITIVE ID ESTABLISHED >>
	42	31	7H	7H	720-ZC	NDO	7H	.00	.00	1			123	
94-Feb	42	31	TSH	TSH	720-ZC	NDO				1			28	
94-Feb	42	31	TEH	TEC	720-EC	DNT	7H	.00	.00	M1	6.35	177	75	
94-Feb	42	31	TEH	TEC	720-EC	32	1C	.00	.00	M1	1.87	107	75	RESULT OF DISCREPANCY RESOLUTION
94-Feb	42	31	7H	7H	720-ZC	NDO				1			84	
	12	40	TSH	TEH	720-WC	CDI	TSH	.00	.00	41	3.51	92	37	RESULT OF LAR
	12	40												RETEST - RETEST FOR POSITIVE ID
	12	40	TEH	TEC	720-EL	INR	TSH	.81	.00	M1	1.63	63	54	RESULT OF DISCREPANCY RESOLUTION
	12	40	TEH	TEC	720-EL	DNT	TSH	-.15	.00	M1	31.02	184	54	
	12	40	TSH	TSH	720-ZC	SAI	TSH	.55	.00	4	.83	71	125	RESULT OF DISCREPANCY RESOLUTION
	12	40												<< POSITIVE ID ESTABLISHED >>
	12	40	TSH	TSH	720-ZC	DIW	TSH	878.00	.00	0	100.00	58	125	RESULT OF DISCREPANCY RESOLUTION
94-Feb	12	40	TEH	TEC	720-EC	DI	TSH	.77	.00	M1	1.08	58	15	RESULT OF DISCREPANCY RESOLUTION
94-Feb	12	40	TEH	TEC	720-EC	DNT	TSH	.00	.00	M1	62.65	181	15	
94-Feb	12	40	TSH	TSH	720-ZC	NDO				1			36	
	44	40	TSH	TEH	720-WC	NDO				1			35	
	44	40	TEH	TEC	720-EL	44	2C	.00	.00	M1	2.66	102	66	RESULT OF DISCREPANCY RESOLUTION
	44	40												RETEST - RETEST FOR POSITIVE ID
	44	40	3C	TEC	720-EL	PID	2C	.00	.00	M1	2.29	102	120	<< POSITIVE ID ESTABLISHED >>

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
------	-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

D. C. Cook U1R95

AEP -12/51

INSPECTION: August 95

20-Sep-95 19:15

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
94-Feb	44	40	TSH	TSH	720-ZC	NDO				1		32		
94-Feb	44	40	TEH	TEC	720-EC	31	2C	.00	.00	M1	1.49	109	59	
13	46	TSC	TEH	720-EL	DRI	TEH		1.41	.00	M1	1.06	109	83	
13	46	TSC	TEH	720-EL	DI	TSH		.49	.00	M1	1.09	112	83	RESULT OF DISCREPANCY RESOLUTION
13	46	TSC	TEH	720-EL	DNT	TSH		-1.61	.00	M1	20.24	180	83	
13	46	TSH	TEH	720-WC	CRI	TRH		.00	.00	C8	1.87	61	93	RESULT OF DISCREPANCY RESOLUTION
13	46													RETEST - RETEST FOR POSITIVE ID
13	46	TSH	TEH	720-WC	COI	TSH		.33	.00	C6	3.51	78	.93	RESULT OF DISCREPANCY RESOLUTION
13	46													RETEST - RETEST FOR POSITIVE ID
13	46	TRH	TEH	720-RB	MAI	TEH		2.45	.00	1	.77	13	111	RESULT OF DISCREPANCY RESOLUTION
13	46													<< POSITIVE ID ESTABLISHED >>
13	46	TRH	TEH	720-RB	BRT	TEH		2.33	.00	1			111	RESULT OF DISCREPANCY RESOLUTION
13	46	TRH	TEH	720-RB	CRT	TEH		2.61	.00	1			111	RESULT OF DISCREPANCY RESOLUTION
13	46	TSH	TSH	720-RB	SAI	TSH		.48	.00	1	.67	83	111	RESULT OF DISCREPANCY RESOLUTION
13	46													<< POSITIVE ID ESTABLISHED >>
13	46	TSH	TSH	720-ZC	SAI	TSH		.50	.00	4	.89	65	123	RESULT OF DISCREPANCY RESOLUTION
13	46													<< POSITIVE ID ESTABLISHED >>
13	46	TSH	TSH	720-ZC	DIM	TSH		485.00	.00	0	100.00	88	123	RESULT OF DISCREPANCY RESOLUTION
13	46	TSH	TSH	720-ZC	MAI	TSH		.11	.00	4	.57	114	123	RESULT OF DISCREPANCY RESOLUTION
13	46													<< POSITIVE ID ESTABLISHED >>
13	46	TSH	TSH	720-ZC	DIM	TSH		447.00	.00	0	100.00	176	123	RESULT OF DISCREPANCY RESOLUTION
13	46	1C	TEC	720-EL	NDO					1			152	
94-Feb	13	46	TEH	TEC	720-EC	DRI	TEH	2.44	.00	M1	51.65	178	15	RETEST - RETEST FOR POSITIVE ID
94-Feb	13	46	TEH	TEC	720-EC	DNT	TSH	.00	.00	M1	21.56	181	15	
94-Feb	13	46	TSH	TSH	720-ZC	NDO				1			38	
94-Feb	13	46	TSH	TEH	720-ZC	MAI	TEH	1.88	.00	4	.66	191	82	RESULT OF DISCREPANCY RESOLUTION
94-Feb	13	46	TSH	TEH	720-ZC	DIM	TEH	445.00	.00	I	80.00	291	82	RESULT OF DISCREPANCY RESOLUTION
94-Feb	13	46	TEH	TEC	720-EC	PID	TEH	2.48	.00	M1	53.56	7	97	<< POSITIVE ID ESTABLISHED >>
94-Feb	13	46	TEH	TEC	720-EC	DNT	TSH	.00	.00	M1	21.85	183	97	
19	46	TSH	TEH	720-WC	COI	TSH		.61	.00	C23	4.45	80	.41	RESULT OF DISCREPANCY RESOLUTION
19	46													RETEST - RETEST FOR POSITIVE ID
19	46	TEH	TEC	720-EL	DNT	TSH		-.59	.00	M1	11.64	185	58	
19	46	TEH	TEC	720-EL	DI	TSH		.57	.00	M1	.59	124	58	RESULT OF DISCREPANCY RESOLUTION
19	46	TSH	TSH	720-ZC	MAI	TSH		.25	.00	4	.44	51	123	RESULT OF DISCREPANCY RESOLUTION
19	46													<< POSITIVE ID ESTABLISHED >>
19	46	TSH	TSH	720-ZC	DIM	TSH		1583.00	.00	I	100.00	278	123	RESULT OF DISCREPANCY RESOLUTION
94-Feb	19	46	TSH	TSH	720-ZC	NDO				1			38	RESULT OF DISCREPANCY RESOLUTION
94-Feb	19	46	TEH	TEC	720-EC	NDO				1			59	
94-Feb	19	46	TEH	TEC	720-EC	DNT	TSH	.00	.00	M1	10.97	183	59	
DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



D. C. Cook U1R95

AEP -12/51

INSPECTION: August 95

20-Sep-95 19:15

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
	38	47	TSH	TEH	720-WC	CDI	TSH	.08	.00	C21	2.60	90	95	RESULT OF LAR
	38	47												RETEST - RETEST FOR POSITIVE ID
	38	47	TSH	TSH	720-ZC	MAI	TSH	-.66	.00	5	.80	105	123	<< POSITIVE ID ESTABLISHED >>
	38	47	TSH	TSH	720-ZC	DI	TSH	1255.00	.00	0	100.00	170	123	
	38	47	TEH	TEC	720-EL	DI	TEH	20.92	.00	M1	1.13	99	154	RESULT OF DISCREPANCY RESOLUTION
	38	47	TEH	TEC	720-EL	PI	2H	.00	.00	M1	1.17	85	154	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
94-Feb	38	47			0	PLG	TEC	.00	.00				5	
94-Feb	38	47			0	PLG	TEH	.00	.00				70	
	46	52	TSH	TEH	720-WC	NDO				1			39	
	46	52	TEH	TEC	720-EL	43	1C	.19	.00	M1	1.93	103	98	RESULT OF DISCREPANCY RESOLUTION
	46	52												RETEST - RETEST FOR POSITIVE ID
	46	52	2C	TEC	720-EL	PID	1C	.00	.00	M1	2.12	96	120	<< POSITIVE ID ESTABLISHED >>
94-Feb	46	52	TEH	TEC	720-EC	36	1C	.19	.00	M1	.90	105	31	RESULT OF DISCREPANCY RESOLUTION
94-Feb	46	52	TSH	TSH	720-ZC	NDO				1			70	RESULT OF DISCREPANCY RESOLUTION
	3	55	TSC	TEH	720-EL	DIN	TEH	20.60	.00	M1	.41	101	85	RESULT OF DISCREPANCY RESOLUTION
	3	55	TSC	TEH	720-EL	DIN	TEH	19.33	.00	M1	.28	116	85	RESULT OF DISCREPANCY RESOLUTION
	3	55	TSC	TEH	720-EL	PIC	1H	.00	.00	M1	2.45	102	85	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
	3	55												RETEST - RETEST FOR POSITIVE ID
	3	55	TSH	TEH	720-WC	CDN	TSH	-.78	.00	C23	1.32	95	93	RESULT OF DISCREPANCY RESOLUTION
	3	55	TSH	TSH	720-ZC	NDO	TSH	.00	.00	1			123	RESULT OF DISCREPANCY RESOLUTION
	3	55	1H	1H	720-ZC	MAI	1H	.00	.00	4	.93	104	123	<< POSITIVE ID ESTABLISHED >>
	3	55	1H	1H	720-ZC	DI	1H	746.00	.00	0	100.00	123	123	
	3	55	1C	TEC	720-EL	NDO				1			152	
94-Feb	3	55			0	PLG	TEH	.00	.00				2	
94-Feb	3	55			0	PLG	TEC	.00	.00				19	
94-Feb	3	55			0	PLG	TEH	.00	.00				40	
	41	66	TSH	TEH	720-WC	NDO				1			57	
	41	66	TEH	TEC	720-EL	34	2C	.07	.00	M1	1.99	111	76	
	41	66	TEH	TEC	720-EL	60	1C	-.05	.00	M1	2.00	86	76	RESULT OF DISCREPANCY RESOLUTION
	41	66												RETEST - RETEST FOR POSITIVE ID
	41	66	2C	TEC	720-EL	PID	1C	.00	.00	M1	2.26	84	118	<< POSITIVE ID ESTABLISHED >>
94-Feb	41	66	TEH	TEC	720-EC	11	2C	.08	.00	M1	1.12	123	41	
94-Feb	41	66	TEH	TEC	720-EC	19	1C	.11	.00	M1	1.09	118	41	RESULT OF DISCREPANCY RESOLUTION
94-Feb	41	66	TSH	TSH	720-ZC	NDO				1			46	
	39	70	TSH	TEH	720-WC	NDO				1			59	
	39	70	TEH	TEC	720-EL	43	2C	-.05	.00	M1	1.65	104	80	RESULT OF DISCREPANCY RESOLUTION
DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

D. C. Cook U1R95

AEP -12/51

INSPECTION: August 95

20-Sep-95 19:15

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
	39	70												RETEST - RETEST FOR POSITIVE ID
	39	70	3C	TEC	720-EL	PID	2C	.00	.00	M1	1.47	104	118	<< POSITIVE ID ESTABLISHED >>
94-Feb	39	70	TEH	TEC	720-EC	31	2C	.00	.00	M1	.84	109	43	
94-Feb	39	70	TSH	TSH	720-ZC	NDO				1			48	
	40	71	TSH	TEH	720-WC	NDO				1			59	
	40	71	TEH	TEC	720-EL	41	1C	.07	.00	M1	2.21	104	82	RESULT OF DISCREPANCY RESOLUTION
	40	71												RETEST - RETEST FOR POSITIVE ID
	40	71	2C	TEC	720-EL	PID	1C	.00	.00	M1	1.88	111	118	<< POSITIVE ID ESTABLISHED >>
94-Feb	40	71	TEH	TEC	720-EC	34	1C	.05	.00	M1	1.18	107	43	
94-Feb	40	71	TSH	TSH	720-ZC	NDO				1			48	
	36	74	TSH	TEH	720-WC	NDO				1			61	
	36	74	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.52	74	84	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
	36	74	TEH	TEC	720-EL	49	2C	.00	.00	M1	2.88	97	84	RESULT OF DISCREPANCY RESOLUTION
	36	74												RETEST - RETEST FOR POSITIVE ID
	36	74	TEH	TEC	720-EL	19	1C	.00	.00	M1	.25	121	84	
	36	74	TEH	TEC	720-EL	PID	2C	.00	.00	M1	2.86	97	120	<< POSITIVE ID ESTABLISHED >>
94-Feb	36	74	TEH	TEC	720-EC	PI	3H	.00	.00	M1	.48	64	29	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
94-Feb	36	74	TEH	TEC	720-EC	25	2C	.00	.00	M1	1.42	113	29	
94-Feb	36	74	TEH	TEC	720-EC	3	1C	.16	.00	M1	.47	129	29	RESULT OF DISCREPANCY RESOLUTION
94-Feb	36	74	TSH	TSH	720-ZC	NDO				1			50	
	35	77	TSH	TEH	720-WC	NDO				1			61	
	35	77	TEH	TEC	720-EL	9	2C	.10	.00	M1	.58	129	82	
	35	77	TEH	TEC	720-EL	53	1C	.07	.00	M1	4.67	93	82	RESULT OF DISCREPANCY RESOLUTION
	35	77												RETEST - RETEST FOR POSITIVE ID
	35	77	2C	TEC	720-EL	PID	1C	.00	.00	M1	5.60	94	118	<< POSITIVE ID ESTABLISHED >>
94-Feb	35	77	TEH	TEC	720-EC	7	2C	.00	.00	M1	.53	125	27	RESULT OF DISCREPANCY RESOLUTION
94-Feb	35	77	TEH	TEC	720-EC	34	1C	.00	.00	M1	1.56	107	27	
94-Feb	35	77	TSH	TSH	720-ZC	NDO				1			50	
	31	79	TSH	TEH	720-WC	NDO				1			61	
	31	79	TEH	TEC	720-EL	57	2C	.00	.00	M1	5.39	89	82	RESULT OF DISCREPANCY RESOLUTION
	31	79												RETEST - RETEST FOR POSITIVE ID
	31	79	TEH	TEC	720-EL	19	1C	.12	.00	M1	1.48	122	82	
	31	79	2C	TEC	720-EL	PID	2C	.00	.00	M1	5.29	90	118	<< POSITIVE ID ESTABLISHED >>
94-Feb	31	79	TEH	TEC	720-EC	33	2C	.21	.00	M1	2.28	109	21	
94-Feb	31	79	TEH	TEC	720-EC	5	1C	.03	.00	M1	1.05	127	21	
94-Feb	31	79	TSH	TSH	720-ZC	NDO				1			52	

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
------	-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------



D. C. Cook U1R95

AEP -12/51

INSPECTION: August 95

20-Sep-95 19:15

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
	23	87	TSH	TEH	720-WC	NDO				1		63		
	23	87	TEH	TEC	720-EL	49 1C		.00	.00	M1	2.95	98	86	RESULT OF DISCREPANCY RESOLUTION
	23	87												RETEST - RETEST FOR POSITIVE ID
	23	87	TEH	TEC	720-EL	PID 1C		.00	.00	M1	2.77	98	130	<< POSITIVE ID ESTABLISHED >>
94-Feb	23	87	TEH	TEC	720-EC	36 1C		.00	.00	M1	1.67	106	47	
94-Feb	23	87	TSH	TSH	720-ZC	NDO				1		54		
DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

PAGE 8

TOTAL TUBES 26



D. C. Cook U1R95

AEP -12/51

INSPECTION: August 95

21-Sep-95 17:31

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
8	5	TSH	TSH	720-ZC MAI	TSH		-.40	.00	4	.58	51	125	RESULT OF DISCREPANCY RESOLUTION
8	5												<< POSITIVE ID ESTABLISHED >>
8	5	1H	1H	720-ZC MAI	1H		.00	.00	4	1.00	56	125	
8	6	TSH	TSH	720-ZC SAI	TSH		-.56	.00	1	.56	46	125	RESULT OF DISCREPANCY RESOLUTION
8	6												<< POSITIVE ID ESTABLISHED >>
12	9	TSH	TSH	720-ZC SAI	TSH		-.85	.00	4	1.22	21	125	<< POSITIVE ID ESTABLISHED >>
2	13	TSH	TSH	720-ZC MAI	TSH		-.85	.00	4	.29	52	125	RESULT OF DISCREPANCY RESOLUTION
2	13												<< POSITIVE ID ESTABLISHED >>
12	13	TRH	TEH	720-RB SAI	TEH		2.53	.00	1	2.87	11	103	<< POSITIVE ID ESTABLISHED >>
12	13												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	13	TSH	TSH	720-ZC SAI	TSH		-.65	.00	4	.65	33	125	RESULT OF DISCREPANCY RESOLUTION
15	13												<< POSITIVE ID ESTABLISHED >>
2	14	TSH	TSH	720-ZC MAI	TSH		-.50	.00	1	.52	113	125	RESULT OF DISCREPANCY RESOLUTION
2	14												<< POSITIVE ID ESTABLISHED >>
2	14	1H	1H	720-ZC SAI	1H		.00	.00	4	.97	43	125	RESULT OF DISCREPANCY RESOLUTION
12	15	TRH	TEH	720-RB MAI	TEH		1.36	.00	1	5.34	20	103	<< POSITIVE ID ESTABLISHED >>
12	15												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	17	TRH	TEH	720-RB MAI	TEH		2.72	.00	1	2.50	18	103	<< POSITIVE ID ESTABLISHED >>
22	17												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	17	TSH	TSH	720-ZC SAI	TSH		-.79	.00	4	1.14	112	123	RESULT OF DISCREPANCY RESOLUTION
23	17												<< POSITIVE ID ESTABLISHED >>
5	18	1H	1H	720-ZC SAI	1H		.00	.00	4	.18	79	125	
20	18	TRH	TEH	720-RB SAI	TEH		2.44	.00	1	1.05	27	103	<< POSITIVE ID ESTABLISHED >>
20	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	18	TRH	TEH	720-RB MAI	TEH		2.32	.00	4	2.87	10	103	RESULT OF DISCREPANCY RESOLUTION
22	18												<< POSITIVE ID ESTABLISHED >>
22	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	19	TRH	TEH	720-RB MAI	TEH		2.42	.00	1	.97	13	103	<< POSITIVE ID ESTABLISHED >>
14	19												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	20	TRH	TEH	720-RB SAI	TEH		2.35	.00	1	2.08	18	103	<< POSITIVE ID ESTABLISHED >>
15	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	21	TRH	TEH	720-RB MAI	TEH		2.30	.00	1	.96	14	103	<< POSITIVE ID ESTABLISHED >>
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
4	25	TRH	TEH	720-RB SAI	TEH		2.38	.00	4	3.52	30	103	RESULT OF DISCREPANCY RESOLUTION
4	25												<< POSITIVE ID ESTABLISHED >>
4	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	25	TRH	TEH	720-RB MAI	TEH		2.47	.00	4	3.41	21	103	RESULT OF DISCREPANCY RESOLUTION
7	25												<< POSITIVE ID ESTABLISHED >>
7	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	25	TRH	TEH	720-RB MAI	TEH		2.34	.00	1	1.35	20	103	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	25	TRH	TEH	720-RB SAI	TEH		2.45	.00	1	3.13	13	103	<< POSITIVE ID ESTABLISHED >>
15	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	25	TRH	TEH	720-RB MAI	TEH		2.25	.00	1	1.32	18	103	<< POSITIVE ID ESTABLISHED >>
19	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	25	TRH	TEH	720-RB SAI	TEH		2.24	.00	1	3.62	19	103	<< POSITIVE ID ESTABLISHED >>
21	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	26	TRH	TEH	720-RB MAI	TEH		2.48	.00	1	.85	31	103	<< POSITIVE ID ESTABLISHED >>
2	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	26	TRH	TEH	720-RB SAI	TEH		2.50	.00	1	2.49	19	103	<< POSITIVE ID ESTABLISHED >>
7	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	26	TRH	TEH	720-RB MAI	TEH		2.47	.00	1	2.97	18	103	<< POSITIVE ID ESTABLISHED >>
14	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	26	TRH	TEH	720-RB MAI	TEH		2.31	.00	1	3.23	14	103	<< POSITIVE ID ESTABLISHED >>
15	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	26	TRH	TEH	720-RB MAI	TEH		2.43	.00	1	2.49	18	103	<< POSITIVE ID ESTABLISHED >>
16	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	26	TRH	TEH	720-RB SAI	TEH		2.30	.00	1	2.26	11	103	<< POSITIVE ID ESTABLISHED >>
17	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	26	TRH	TEH	720-RB SAI	TEH		2.25	.00	1	2.97	17	103	<< POSITIVE ID ESTABLISHED >>
19	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	26	TRH	TEH	720-RB MAI	TEH		2.33	.00	1	1.79	26	103	<< POSITIVE ID ESTABLISHED >>
20	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	27	TRH	TEH	720-RB MAI	TEH		2.52	.00	4	5.04	12	103	RESULT OF DISCREPANCY RESOLUTION
3	27												<< POSITIVE ID ESTABLISHED >>
3	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
15	30	TRH	TEH	720-RB SAI	TEH		2.26	.00	1	1.70	20	103	<< POSITIVE ID ESTABLISHED >>
15	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	30	TRH	TEH	720-RB MAI	TEH		2.10	.00	1	3.50	13	103	<< POSITIVE ID ESTABLISHED >>
21	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	30	TRH	TEH	720-RB MAI	TEH		2.25	.00	1	5.66	18	103	<< POSITIVE ID ESTABLISHED >>
31	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	31	TRH	TEH	720-RB SAI	TEH		2.19	.00	1	1.03	21	103	<< POSITIVE ID ESTABLISHED >>
3	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	31	TRH	TEH	720-RB SAI	TEH		2.46	.00	1	3.36	24	103	<< POSITIVE ID ESTABLISHED >>
14	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	32	TRH	TEH	720-RB MAI	TEH		2.33	.00	1	3.77	12	103	<< POSITIVE ID ESTABLISHED >>
14	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	32	TRH	TEH	720-RB MAI	TEH		2.60	.00	4	1.55	24	109	RESULT OF DISCREPANCY RESOLUTION
14	32												<< POSITIVE ID ESTABLISHED >>
14	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	32	TRH	TEH	720-RB MAI	TEH		2.54	.00	1	1.81	18	119	<< POSITIVE ID ESTABLISHED >>
14	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	32	TRH	TEH	720-RB MAI	TEH		2.42	.00	1	3.95	25	103	<< POSITIVE ID ESTABLISHED >>
22	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	33	TRH	TEH	720-RB MAI	TEH		2.41	.00	1	2.78	13	103	<< POSITIVE ID ESTABLISHED >>
7	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	33	TRH	TEH	720-RB MAI	TEH		2.27	.00	1	2.20	17	103	<< POSITIVE ID ESTABLISHED >>
12	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	34	TRH	TEH	720-RB SAI	TEH		2.36	.00	1	2.57	14	103	<< POSITIVE ID ESTABLISHED >>
31	34												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	35	TRH	TEH	720-RB MAI	TEH		2.34	.00	1	2.05	19	103	<< POSITIVE ID ESTABLISHED >>
14	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	36	TRH	TEH	720-RB MAI	TEH		2.30	.00	1	1.95	31	103	<< POSITIVE ID ESTABLISHED >>
3	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	36	TRH	TEH	720-RB MAI	TEH		2.18	.00	4	3.55	4	103	RESULT OF LAR
7	36												<< POSITIVE ID ESTABLISHED >>
7	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	36	TRH	TEH	720-RB MAI	TEH		2.14	.00	1	3.55	11	103	<< POSITIVE ID ESTABLISHED >>
14	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

D. C. Cook U1R95

AEP -12/51

INSPECTION: August 95

21-Sep-95 17:31

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
21	44	TRH	TEH	720-RB	MAI	TEH	2.36	.00	1	1.73	22	101	<< POSITIVE ID ESTABLISHED >>
21	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	44	TRH	TEH	720-RB	SAI	TEH	2.49	.00	1	.76	148	101	<< POSITIVE ID ESTABLISHED >>
22	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	45	TRH	TEH	720-RB	MAI	TEH	2.54	.00	1	1.31	29	101	<< POSITIVE ID ESTABLISHED >>
21	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	45	TRH	TEH	720-RB	MAI	TEH	1.99	.00	1	.92	24	105	<< POSITIVE ID ESTABLISHED >>
22	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	46	TRH	TEH	720-RB	MAI	TEH	2.45	.00	1	.77	13	111	RESULT OF DISCREPANCY RESOLUTION
13	46												<< POSITIVE ID ESTABLISHED >>
13	46	TSH	TSH	720-RB	SAI	TSH	.48	.00	1	.67	83	111	RESULT OF DISCREPANCY RESOLUTION
13	46												<< POSITIVE ID ESTABLISHED >>
13	46	TSH	TSH	720-ZC	SAI	TSH	.50	.00	4	.89	65	123	RESULT OF DISCREPANCY RESOLUTION
13	46												<< POSITIVE ID ESTABLISHED >>
13	46	TSH	TSH	720-ZC	MAI	TSH	.11	.00	4	.57	114	123	RESULT OF DISCREPANCY RESOLUTION
13	46												<< POSITIVE ID ESTABLISHED >>
19	46	TSH	TSH	720-ZC	MAI	TSH	.25	.00	4	.44	51	123	RESULT OF DISCREPANCY RESOLUTION
19	46												<< POSITIVE ID ESTABLISHED >>
22	46	TRH	TEH	720-RB	MAI	TEH	2.33	.00	1	2.08	17	101	<< POSITIVE ID ESTABLISHED >>
22	46												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	47	TRH	TEH	720-RB	SAI	TEH	2.24	.00	1	.95	36	101	<< POSITIVE ID ESTABLISHED >>
21	47												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
38	47	TSH	TSH	720-ZC	MAI	TSH	-.66	.00	5	.80	105	123	<< POSITIVE ID ESTABLISHED >>
14	48	TRH	TEH	720-RB	MAI	TEH	2.16	.00	1	1.81	14	101	<< POSITIVE ID ESTABLISHED >>
14	48												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	48	TRH	TEH	720-RB	MAI	TEH	2.46	.00	1	1.15	14	111	RESULT OF DISCREPANCY RESOLUTION
14	48												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	49	TRH	TEH	720-RB	MAI	TEH	2.53	.00	1	2.53	22	101	<< POSITIVE ID ESTABLISHED >>
12	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	49	TRH	TEH	720-RB	MAI	TEH	2.39	.00	1	.78	205	101	<< POSITIVE ID ESTABLISHED >>
21	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	50	TRH	TEH	720-RB	MAI	TEH	2.06	.00	1	3.50	211	101	<< POSITIVE ID ESTABLISHED >>
22	50												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	52	TRH	TEH	720-RB	SAI	TEH	2.44	.00	1	1.96	8	101	<< POSITIVE ID ESTABLISHED >>
7	52												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



ATTACHMENT 2
STEAM GENERATOR ANNUAL OPERATING REPORT

SECTION 2: Unit 1 Tube Repairs

b.2 Tubes Repaired Using F* Reroll Technique in SG #12



09-18-1995 13:25:23

SG - 12

Row	Col	TUBES RECOVERED VIA RE-ROLL
9	6	
12	13	
12	15	
22	17	
20	18	
22	18	
14	19	
15	20	
20	20	
20	21	
22	21	
14	22	
15	22	
17	22	
22	22	
7	23	
9	23	
14	23	
15	23	
16	23	
17	23	
18	23	
19	23	
20	23	
21	23	
6	24	
8	24	
9	24	
14	24	
19	24	
4	25	
7	25	
13	25	
15	25	
19	25	
21	25	
2	26	
7	26	
14	26	
15	26	
16	26	
17	26	
19	26	
20	26	
21	26	
3	27	
5	27	
12	27	
13	27	
15	27	



09-18-1995 13:25:23

SG - 12

Row Col

TUBES RECOVERED VIA RE-ROLL

21	27
22	27
14	28
15	28
18	28
21	28
22	28
14	29
21	29
15	30
21	30
22	30
31	30
3	31
14	31
14	32
22	32
7	33
12	33
31	34
14	35
3	36
7	36
14	36
7	37
22	37
3	38
21	38
31	38
3	39
31	39
3	40
3	41
9	42
13	42
22	42
7	43
22	43
21	44
22	44
21	45
22	45
22	46
21	47
14	48
12	49
21	49
22	50
7	52
21	53

SG - 12

Row	Col	TUBES RECOVERED VIA RE-ROLL
12	55	
22	56	
20	57	
21	58	
15	60	
15	61	
12	62	
15	62	
22	62	
15	64	
17	64	
19	64	
20	64	
14	68	
16	68	
12	69	
18	75	

>> Total Tubes = 117



SG - 12 LISTING OF COI CALLS

D. C. Cook U1R95

AEP -12/51

INSPECTION: August 95

21-Sep-95 17:33

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
9	6	TRH	TEH	720-RB COI TEH			2.47	.00	1	3.74	10	103	<< POSITIVE ID ESTABLISHED >>
9	6												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	20	TRH	TEH	720-RB COI TEH			2.55	.00	1	1.33	10	103	<< POSITIVE ID ESTABLISHED >>
20	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	22	TRH	TEH	720-RB COI TEH			2.38	.00	1	1.96	13	103	<< POSITIVE ID ESTABLISHED >>
14	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	23	TRH	TEH	720-RB COI TEH			2.22	.00	1	1.98	15	103	<< POSITIVE ID ESTABLISHED >>
18	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	23	TRH	TEH	720-RB COI TEH			2.22	.00	1	.86	20	103	<< POSITIVE ID ESTABLISHED >>
20	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	23	TRH	TEH	720-RB COI TEH			2.35	.00	1	1.41	14	103	<< POSITIVE ID ESTABLISHED >>
21	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	24	TRH	TEH	720-RB COI TEH			2.53	.00	1	9.33	5	103	<< POSITIVE ID ESTABLISHED >>
9	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	24	TRH	TEH	720-RB COI TEH			2.31	.00	1	3.23	9	103	RESULT OF DISCREPANCY RESOLUTION
19	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	26	TRH	TEH	720-RB COI TEH			2.39	.00	1	1.64	18	103	<< POSITIVE ID ESTABLISHED >>
21	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	30	TRH	TEH	720-RB COI TEH			2.17	.00	1	2.08	16	103	<< POSITIVE ID ESTABLISHED >>
22	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	75	TRH	TEH	720-RB COI TEH			2.14	.00	1	14.40	4	99	<< POSITIVE ID ESTABLISHED >>
18	75												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



Attachment 2 TO AEP:NRC:1147F

ATTACHMENT 2
STEAM GENERATOR ANNUAL OPERATING REPORT

SECTION 2: Unit 1 Tube Repairs.

c.1 New Plugs Installed in SG #13

D.C. COOK UNIT 1

SG - 13 U1R95

LIST OF TUBES PLUGGED IN HOT LEG

Row	Col	Plug Description
10	3	- Mech. Plug
14	3	- Mech. Plug
20	6	- Mech. Plug
19	7	- Mech. Plug
20	8	- Mech. Plug
22	8	- Mech. Plug
29	11	- Mech. Plug
29	12	- Mech. Plug
29	14	- Mech. Plug
2	18	- Mech. Plug
37	22	- Mech. Plug
34	24	- Mech. Plug
44	34	- Mech. Plug
39	38	- Mech. Plug
12	52	- Mech. Plug
13	52	- Mech. Plug
36	57	- Mech. Plug
26	59	- Mech. Plug
36	61	- Mech. Plug
39	68	- Mech. Plug
37	74	- Mech. Plug
34	75	- Mech. Plug
37	76	- Mech. Plug
4	77	- Mech. Plug
8	77	- Short Mech. Plug
30	81	- Mech. Plug
28	83	- Mech. Plug
10	93	- Mech. Plug
7	94	- Mech. Plug

>> Total Tubes = 29

END



D.C. COOK UNIT 1

SG - 13 U1R95

LIST OF TUBES PLUGGED IN COLD LEG

Row	Col	Plug Description
10	3	- Mech. Plug
14	3	- Mech. Plug
20	6	- Mech. Plug
19	7	- Mech. Plug
20	8	- Mech. Plug
22	8	- Mech. Plug
29	11	- Mech. Plug
29	12	- Mech. Plug
29	14	- Mech. Plug
2	18	- Mech. Plug
37	22	- Mech. Plug
34	24	- Mech. Plug
44	34	- Mech. Plug
39	38	- Mech. Plug
12	52	- Mech. Plug
13	52	- Mech. Plug
36	57	- Mech. Plug
26	59	- Mech. Plug
36	61	- Mech. Plug
39	68	- Mech. Plug
37	74	- Mech. Plug
34	75	- Mech. Plug
37	76	- Mech. Plug
4	77	- Mech. Plug
8	77	- Mech. Plug
30	81	- Mech. Plug
28	83	- Mech. Plug
10	93	- Mech. Plug
7	94	- Mech. Plug

>> Total Tubes = 29

END

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
	10	3	TEH	TEC	720-EL	46	2C	.00	.00	M1	4.14	100	24	RETEST - RETEST FOR POSITIVE ID
	10	3	TEH	TEC	720-EL	49	1C	-.17	.00	M1	3.58	97	24	RETEST - RETEST FOR POSITIVE ID
	10	3	TSH	TEH	720-WC	NDO				1			83	
	10	3	3C	TEC	720-EL	PID	1C	-.25	.00	M1	4.05	95	116	>> POSITIVE ID ESTABLISHED <<
94-Feb	10	3	TSH	TSH	720-ZC	NDO				1			12	
94-Feb	10	3	TEH	TEC	720-EC	23	2C	.00	.00	M1	1.63	118	53	
94-Feb	10	3	TEH	TEC	720-EC	26	1C	.00	.00	M1	1.45	116	53	
	14	3	TEH	TEC	720-EL	DNT	7C	.50	.00	M1	8.34	178	14	
	14	3	TEH	TEC	720-EL	DNT	7C	-.10	.00	M1	5.51	179	14	
	14	3	TEH	TEC	720-EL	50	2C	.00	.00	M1	3.12	95	14	RESULT OF DISCREPANCY RESOLUTION
	14	3												RETEST - RETEST FOR POSITIVE ID
	14	3	TEH	TEC	720-EL	17	1C	.00	.00	M1	1.18	120	14	
	14	3	TSH	TEH	720-WC	NDO				1			83	
	14	3	3C	TEC	720-EL	PID	2C	.00	.00	M1	3.59	97	116	>> POSITIVE ID ESTABLISHED <<
	14	3	7C	7C	720-ZC	NDO	7C	.00	.00	1			138	
94-Feb	14	3	TSH	TSH	720-ZC	NDO				1			12	
94-Feb	14	3	TEH	TEC	720-EC	DNT	7C	.00	.00	M1	8.48	181	53	
94-Feb	14	3	TEH	TEC	720-EC	29	2C	.00	.00	M1	1.16	114	53	
	20	6	TSH	TEH	720-WC	NDO				1			1	
	20	6	TEH	TEC	720-EL	54	2C	-.20	.00	M1	5.02	91	14	RESULT OF DISCREPANCY RESOLUTION
	20	6												RETEST - RETEST FOR POSITIVE ID
	20	6	TEH	TEC	720-EL	3	1C	.05	.00	M1	1.07	129	14	
	20	6	3C	TEC	720-EL	PID	2C	.02	.00	M1	5.44	93	116	>> POSITIVE ID ESTABLISHED <<
94-Feb	20	6	TSH	TSH	720-ZC	NDO				1			12	
94-Feb	20	6	TEH	TEC	720-EC	36	2C	.00	.00	M1	2.68	110	51	RESULT OF DISCREPANCY RESOLUTION
94-Feb	20	6	TEH	TEC	720-EC	11	1C	.00	.00	M1	.90	128	51	RESULT OF DISCREPANCY RESOLUTION
	19	7	TSH	TEH	720-WC	NDO				1			1	
	19	7	TEH	TEC	720-EL	44	1C	.00	.00	M1	3.60	100	14	RESULT OF DISCREPANCY RESOLUTION
	19	7												RETEST - RETEST FOR POSITIVE ID
	19	7	3C	TEC	720-EL	PID	1C	-.10	.00	M1	3.47	101	116	>> POSITIVE ID ESTABLISHED <<
94-Feb	19	7	TSH	TSH	720-ZC	NDO				1			14	
94-Feb	19	7	TEH	TEC	720-EC	17	1C	.00	.00	M1	1.43	124	51	
	20	8	TSH	TEH	720-WC	NDO				1			1	
	20	8	TEH	TEC	720-EL	42	1C	.12	.00	M1	3.31	101	14	RESULT OF DISCREPANCY RESOLUTION
	20	8												RETEST - RETEST FOR POSITIVE ID
	20	8	4C	TEC	720-EL	PID	1C	.02	.00	M1	3.14	102	116	>> POSITIVE ID ESTABLISHED <<
94-Feb	20	8	TSH	TSH	720-ZC	NDO				1			14	
94-Feb	20	8	TEH	TEC	720-EC	20	1C	.00	.00	M1	1.63	120	49	RESULT OF DISCREPANCY RESOLUTION
	22	8	TSH	TEH	720-WC	NDO				1			1	
	22	8	TEH	TEC	720-EL	47	2C	.00	.00	M1	3.33	97	10	RESULT OF DISCREPANCY RESOLUTION
	22	8												RETEST - RETEST FOR POSITIVE ID
	22	8	TEH	TEC	720-EL	47	1C	.00	.00	M1	2.92	97	10	RESULT OF DISCREPANCY RESOLUTION
DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

20-Sep-95 19:57

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
	22	8												RETEST - RETEST FOR POSITIVE ID
	22	8	3C	TEC	720-EL	PID	1C	-.12	.00	M1	2.73	95	116	>> POSITIVE ID ESTABLISHED <<
94-Feb	22	8	TSH	TSH	720-ZC	NDO				1			14	
94-Feb	22	8	TEH	TEC	720-EC	34	2C	.00	.00	M1	2.07	111	49	
	29	11	TSH	TEH	720-WC	NDO				1			3	
	29	11	TEH	TEC	720-EL	45	2C	.00	.00	M1	5.00	99	10	RESULT OF DISCREPANCY RESOLUTION
	29	11												RETEST - RETEST FOR POSITIVE ID
	29	11	3C	TEC	720-EL	PID	2C	.00	.00	M1	4.57	99	116	RESULT OF DISCREPANCY RESOLUTION
	29	11												>> POSITIVE ID ESTABLISHED <<
94-Feb	29	11	TSH	TSH	720-ZC	NDO				1			14	
94-Feb	29	11	TEH	TEC	720-EC	26	2C	.00	.00	M1	2.72	116	49	
	29	12	TSH	TEH	720-WC	NDO				1			3	
	29	12	TEH	TEC	720-EL	14	AV1	.40	.00	M2	.31		10	
	29	12	TEH	TEC	720-EL	16	AV2	.00	.00	M2	.36		10	
	29	12	TEH	TEC	720-EL	47	2C	.00	.00	M1	2.49	97	10	RESULT OF DISCREPANCY RESOLUTION
	29	12												RETEST - RETEST FOR POSITIVE ID
	29	12	3C	TEC	720-EL	PID	2C	-.07	.00	M1	2.62	99	116	>> POSITIVE ID ESTABLISHED <<
94-Feb	29	12	TSH	TSH	720-ZC	NDO				1			14	
94-Feb	29	12	TEH	TEC	720-EC	NDO				1			47	
	29	14	TSH	TEH	720-WC	CDI	TEH	20.76	.00	C13	1.50	67	5	RESULT OF LAR
	29	14												RETEST - RETEST FOR POSITIVE ID
	29	14	TEH	TEC	720-EL	DI	TEH	20.84	.00	M1	.80	53	12	
	29	14	TSH	TSH	720-ZC	MAI	TSH	-.81	.00	4	.63	162	119	RESULT OF DISCREPANCY RESOLUTION
	29	14												>> POSITIVE ID ESTABLISHED <<
	29	14	TSH	TSH	720-ZC	DIM	TSH	632.00	.00	0	80.00	85	119	RESULT OF DISCREPANCY RESOLUTION
94-Feb	29	14	TSH	TSH	720-ZC	NDO				1			16	
94-Feb	29	14	TEH	TEC	720-EC	DI	TEH	20.52	.00	M1	.71	60	45	RESULT OF DISCREPANCY RESOLUTION
	2	18	TSH	TEH	720-WC	CDI	TEH	21.03	.00	C11	1.39	76	7	RESULT OF LAR
	2	18												RETEST - RETEST FOR POSITIVE ID
	2	18	TSH	TEH	720-WC	CRN	TRH	.00	.00	33	4.16	24	7	RESULT OF LAR
	2	18												- DO NOT REPAIR - 1.31" F* DISTANCE ACHIEVED
	2	18												1994 REROLL SUCCESSFUL
	2	18	7H	TEC	720-EL	NDO				1			60	
	2	18	7H	TEH	720-EL	DI	TEH	20.45	.00	M1	.60	64	87	RESULT OF DISCREPANCY RESOLUTION
	2	18	7H	TEH	720-EL	INR	TEH	2.77	.00	M1	8.41	13	87	RESULT OF DISCREPANCY RESOLUTION
	2	18	TRH	TEH	720-RB	NAT	TEH	5.12	.00	1			117	
	2	18	TRH	TEH	720-RB	NDO	TEH	5.12	.00	1			117	
	2	18	TSH	TSH	720-RB	SAI	TSH	-.72	.00	1	.41	98	117	>> POSITIVE ID ESTABLISHED <<
	2	18	TSH	TSH	720-ZC	SAI	TSH	-.55	.00	4	.54	69	119	>> POSITIVE ID ESTABLISHED <<
	2	18	TSH	TSH	720-ZC	DIM	TSH	504.00	.00	0	80.00	21	119	
94-Feb	2	18	7H	TEH	720-EC	DAI	TEH	2.56	.00	M1	33.93	182	8	RESULT OF DISCREPANCY RESOLUTION
94-Feb	2	18												-THIS TUBE REMOVED FROM PLUG LIST
94-Feb	2	18	TSH	TSH	720-ZC	NDO				1			18	
94-Feb	2	18	7C	TEC	720-EC	NDO				1			43	
DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

20-Sep-95 19:57

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
94-Feb	2	18	7H	TEH	720-EC	PID	TEH	2.75	.00	M1	26.39	181	76	RESULT OF DISCREPANCY RESOLUTION
94-Feb	2	18												>> POSITIVE ID ESTABLISHED <<
94-Feb	2	18	TRH	TEH	720-ZC	MAI	TEH	2.43	.00	4	1.32	4	82	RESULT OF DISCREPANCY RESOLUTION
94-Feb	2	18	TRH	TEH	720-ZC	DIM	TEH	238.00	.00	I	100.00	78	82	RESULT OF DISCREPANCY RESOLUTION
94-Feb	2	18	7H	6C	680-EJ	NDO			1				91	
94-Feb	2	18	TSH	TEH	720-EC	NDO			1				94	POST ROLL EVALUATION - NDO AT NEW ROLL LOCATION
	37	22	TEH	TEC	720-EL	44	2C	.00	.00	M1	3.62	100	6	RETEST - RETEST FOR POSITIVE ID
	37	22	TSH	TEH	720-WC	NDO			1				11	
	37	22	TEH	TEC	720-EL	44	2C	.00	.00	M1	3.38	102	16	RETEST - RETEST FOR POSITIVE ID
	37	22	3C	TEC	720-EL	PID	2C	-.30	.00	M1	4.03	99	116	>> POSITIVE ID ESTABLISHED <<
94-Feb	37	22	TSH	TSH	720-ZC	NDO			1				18	
94-Feb	37	22	TEH	TEC	720-EC	39	2C	.00	.00	M1	2.34	105	39	RESULT OF DISCREPANCY RESOLUTION
	34	24	TSH	TEH	720-WC	CDI	TSH	-.75	.00	C9	7.54	48	11	RESULT OF DISCREPANCY RESOLUTION
	34	24												>> POSITIVE ID ESTABLISHED <<
	34	24	TEH	TEC	720-EL	95	TEH	20.57	.00	M1	3.73	39	28	RESULT OF DISCREPANCY RESOLUTION
	34	24												RETEST - RETEST FOR POSITIVE ID
	34	24	TEH	TEC	720-EL	SPR	1H	.00	.00	M1	2.07	50	28	
	34	24	TSH	TSH	720-ZC	SAI	TSH	-.80	.00	4	2.58	43	119	>> POSITIVE ID ESTABLISHED <<
	34	24	TSH	TSH	720-ZC	DIM	TSH	311.00	.00	0	80.00	29	119	
	34	24	1H	1H	720-ZC	NDO	1H	.00	.00	1			119	
94-Feb	34	24	TSH	TSH	720-ZC	NDO			1				18	RESULT OF DISCREPANCY RESOLUTION
94-Feb	34	24	TEH	TEC	720-EC	DI	TEH	20.44	.00	M1	1.58	40	37	
	44	34	TSH	TEH	720-WC	NDO			1				19	
	44	34	TEH	TEC	720-EL	44	2C	.12	.00	M1	4.13	99	26	RETEST - RETEST FOR POSITIVE ID
	44	34	3C	TEC	720-EL	PID	2C	.07	.00	M1	4.07	100	116	>> POSITIVE ID ESTABLISHED <<
94-Feb	44	34	TSH	TSH	720-ZC	NDO			1				24	
94-Feb	44	34	TEH	TEC	720-EC	39	2C	.00	.00	M1	2.77	105	25	
	39	38	TSH	TEH	720-WC	CDI	TEH	20.41	.00	C6	2.26	71	23	RESULT OF DISCREPANCY RESOLUTION
	39	38												RETEST - RETEST FOR POSITIVE ID
	39	38	TEH	TEC	720-EL	DI	TEH	20.62	.00	M1	.29	85	44	RESULT OF DISCREPANCY RESOLUTION
	39	38	TSH	TSH	720-ZC	SAI	TSH	-1.18	.00	4	.36	45	119	>> POSITIVE ID ESTABLISHED <<
	39	38	TSH	TSH	720-ZC	DIM	TSH	462.00	.00	0	80.00	37	119	
94-Feb	39	38	TEH	TEC	720-EC	DI	TEH	20.39	.00	M1	.23	75	21	RESULT OF DISCREPANCY RESOLUTION
94-Feb	39	38	TSH	TSH	720-ZC	NDO			1				26	
	12	52	TSH	TEH	720-WC	CRI	TRH	.00	.00	C24	3.20	37	33	RESULT OF DISCREPANCY RESOLUTION
	12	52												RETEST - RETEST FOR POSITIVE ID
	12	52												TUBE DID NOT MEET RE-ROLL DIAMETER REQUIREMENT
	12	52	TEH	TEC	720-EL	NDO			1				64	
	12	52	TEH	TEC	720-EL	DNT	TSH	-.10	.00	M1	53.57	179	64	
	12	52	TRH	TEH	720-RB	MAI	TEH	2.60	.00	4	3.56	21	109	>> POSITIVE ID ESTABLISHED <<
	12	52	TRH	TEH	720-RB	BRT	TEH	2.47	.00	4			109	
	12	52	TRH	TEH	720-RB	CRT	TEH	2.87	.00	4			109	
	12	52	TSH	TEH	720-EL	UXH	TEH	.00	.00	2	783.10		121	
DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

20-Sep-95 19:58

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
	12	52	TSH	TEH	720-EL	MOH	TEH	.00	.00	2	787.10	121		
	12	52	TSH	TEH	720-EL	LXH	TEH	.00	.00	2	801.70	121		
	12	52	TSH	TEH	720-EL	LXH	TEH	.00	.00	2	800.90	137		
	12	52	TSH	TEH	720-EL	MOH	TEH	.00	.00	2	789.10	137		
	12	52	TSH	TEH	720-EL	UXH	TEH	.00	.00	2	781.50	137		
	12	52	TSH	TEH	720-EL	UXH	TEH	.00	.00	2	778.90	141		RESULT OF DISCREPANCY RESOLUTION
	12	52	TSH	TEH	720-EL	MOH	TEH	.00	.00	2	786.00	141		RESULT OF DISCREPANCY RESOLUTION
	12	52	TSH	TEH	720-EL	LXH	TEH	.00	.00	2	798.40	141		RESULT OF DISCREPANCY RESOLUTION
	12	52	TRH	TEH	720-RB	NCT	TEH	2.88	.00	4		159		
	12	52	TRH	TEH	720-RB	NRT	TEH	4.46	.00	4		159		
	12	52	TRH	TEH	720-RB	NCT	TEH	2.83	.00	4		165		
	12	52	TRH	TEH	720-RB	NRT	TEH	4.31	.00	4		165		
	12	52	TSH	TEH	720-EL	LXH	TEH	.00	.00	2	799.60	167		
	12	52	TSH	TEH	720-EL	MOH	TEH	.00	.00	2	788.50	167		
	12	52	TSH	TEH	720-EL	UXH	TEH	.00	.00	2	783.30	167		
94-Feb	12	52			0	PLG	TEC	.00	.00			11		
94-Feb	12	52			0	PLG	TEH	.00	.00			32		
	13	52	TSH	TEH	720-WC	CRI	TRH	.00	.00	C12	1.58	42	33	RESULT OF DISCREPANCY RESOLUTION
	13	52												RETEST - RETEST FOR POSITIVE ID
	13	52												TUBE DID NOT MEET RE-ROLL DIAMETER REQUIREMENT
	13	52	TEH	TEC	720-EL	NDO				1		64		
	13	52	TEH	TEC	720-EL	DNT	TSH	-.33	.00	M1	68.76	178	64	
	13	52	TRH	TEH	720-RB	SAI	TEH	2.47	.00	4	.52	25	109	RESULT OF DISCREPANCY RESOLUTION
	13	52												>> POSITIVE ID ESTABLISHED <<
	13	52	TRH	TEH	720-RB	BRT	TEH	2.35	.00	4		109		RESULT OF DISCREPANCY RESOLUTION
	13	52	TRH	TEH	720-RB	CRT	TEH	2.54	.00	4		109		RESULT OF DISCREPANCY RESOLUTION
	13	52	TSH	TEH	720-EL	UXH	TEH	.00	.00	2	782.50	121		
	13	52	TSH	TEH	720-EL	LXH	TEH	.00	.00	2	797.50	121		
	13	52	TSH	TEH	720-EL	LXH	TEH	.00	.00	2	797.10	137		
	13	52	TSH	TEH	720-EL	UXH	TEH	.00	.00	2	781.80	137		
	13	52	TSH	TEH	720-EL	UXH	TEH	.00	.00	2	774.00	141		RESULT OF DISCREPANCY RESOLUTION
	13	52	TSH	TEH	720-EL	LXH	TEH	.00	.00	2	792.10	141		RESULT OF DISCREPANCY RESOLUTION
	13	52	TRH	TEH	720-RB	NCT	TEH	2.77	.00	4		159		
	13	52	TRH	TEH	720-RB	NRT	TEH	4.37	.00	4		159		
	13	52	TRH	TEH	720-RB	NCT	TEH	2.65	.00	4		165		
	13	52	TRH	TEH	720-RB	NRT	TEH	4.14	.00	4		165		
	13	52	TSH	TEH	720-EL	LXH	TEH	.00	.00	2	795.30	167		
	13	52	TSH	TEH	720-EL	MOH	TEH	.00	.00	2	780.00	167		
	13	52	TSH	TEH	720-EL	UXH	TEH	.00	.00	2	776.50	167		
94-Feb	13	52	TEH	TEC	720-EC	NDO				1		11		
94-Feb	13	52	TEH	TEC	720-EC	DNT	TSH	.00	.00	M1	69.62	181	11	
94-Feb	13	52	TSH	TSH	720-ZC	NDO				1		32		
	36	57	TSH	TEH	720-WC	NDO				1		81		
	36	57	7H	TEH	720-EL	NDO				1		93		
	36	57	7H	TEC	720-EL	40	AV3	.17	.00	M2	-3.07	112		RESULT OF DISCREPANCY RESOLUTION
	36	57												RETEST - RETEST FOR POSITIVE ID
DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
	36	57	7H	TEC	720-EL	32	AV3	31.77	.00	M2	1.74	112		
	36	57	7H	TEC	720-EL	29	AV4	.07	.00	M2	1.31	112		
	36	57	7H	TEC	720-EL	PID	AV3	.00	.00	M2	2.80	118		>> POSITIVE ID ESTABLISHED <<
94-Feb	36	57	TEH	TEC	720-EC	38	AV3	.00	.00	M2	2.43	9		
94-Feb	36	57	TEH	TEC	720-EC	29	AV4	.00	.00	M2	1.31	9		
94-Feb	36	57	TEH	TEC	720-EC	29	AV4	.57	.00	M2	1.22	9		RESULT OF DISCREPANCY RESOLUTION
94-Feb	36	57	TSH	TSH	720-ZC	NDO				1		58		
	26	59	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	4.47	44	35	RESULT OF DISCREPANCY RESOLUTION
	26	59												RETEST - RETEST FOR POSITIVE ID
	26	59	TEH	TEC	720-EL	PIC	1H	.00	.00	M1	2.28	89	62	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
	26	59												RETEST - RETEST FOR POSITIVE ID
	26	59	TRH	TEH	720-RB	SAI	TEH	2.42	.00	1	1.89	11	111	>> POSITIVE ID ESTABLISHED <<
	26	59	TRH	TEH	720-RB	BRT	TEH	2.26	.00	1			111	
	26	59	TRH	TEH	720-RB	CRT	TEH	2.57	.00	1			111	
	26	59	1H	1H	720-ZC	SAI	1H	.00	.00	4	1.11	119	119	>> POSITIVE ID ESTABLISHED <<
	26	59	1H	1H	720-ZC	DIM	1H	621.00	.00	0	80.00	100	119	
	26	59	TSH	TEH	720-EL	UXH	TEH	.00	.00	2	795.90		129	
	26	59	TSH	TEH	720-EL	LXH	TEH	.00	.00	2	802.70		129	
94-Feb	26	59			0	PLG	TEH	.00	.00				34	
94-Feb	26	59			0	PLG	TEC	.00	.00				63	
	36	61	TSH	TEH	720-WC	NDO				1			37	
	36	61	7H	TEH	720-EL	NDO				1			93	
	36	61	TEH	TEC	720-EL	26	AV3	-.17	.00	M2	.99	108		RESULT OF DISCREPANCY RESOLUTION
	36	61	TEH	TEC	720-EL	35	AV3	.17	.00	M2	2.18	108		RESULT OF DISCREPANCY RESOLUTION
	36	61	TEH	TEC	720-EL	40	AV4	.22	.00	M2	3.21	108		RESULT OF DISCREPANCY RESOLUTION
	36	61												RETEST - RETEST FOR POSITIVE ID
	36	61	6H	TEC	720-EL	PID	AV4	.00	.00	M2	3.11	118		>> POSITIVE ID ESTABLISHED <<
94-Feb	36	61	TSH	TSH	720-ZC	NDO				1			36	
94-Feb	36	61	TEH	TEC	720-EC	32	AV3	.29	.00	M2	1.47	65		RESULT OF DISCREPANCY RESOLUTION
94-Feb	36	61	TEH	TEC	720-EC	25	AV3	-.18	.00	M2	.88	65		RESULT OF DISCREPANCY RESOLUTION
94-Feb	36	61	TEH	TEC	720-EC	37	AV4	.03	.00	M2	2.21	65		RESULT OF DISCREPANCY RESOLUTION
	39	68	TSH	TEH	720-WC	NDO				1			57	
	39	68	TEH	TEC	720-EL	41	1C	.00	.00	M1	3.44	100	78	RESULT OF DISCREPANCY RESOLUTION
	39	68												RETEST - RETEST FOR POSITIVE ID
	39	68	3C	TEC	720-EL	PID	1C	.07	.00	M1	3.39	104	116	>> POSITIVE ID ESTABLISHED <<
94-Feb	39	68	TSH	TSH	720-ZC	NDO				1			42	
94-Feb	39	68	TEH	TEC	720-EC	38	1C	.00	.00	M1	2.47	107	73	
	37	74	TSH	TEH	720-WC	NDO				1			59	
	37	74	TEH	TEC	720-EL	43	3C	-.25	.00	M1	3.15	101	80	RESULT OF DISCREPANCY RESOLUTION
	37	74												RETEST - RETEST FOR POSITIVE ID
	37	74	TEH	TEC	720-EL	27	2C	.12	.00	M1	3.10	114	80	
	37	74	3C	TEC	720-EL	PID	3C	.00	.00	M1	2.97	101	116	>> POSITIVE ID ESTABLISHED <<
94-Feb	37	74	TSH	TSH	720-ZC	NDO				1			46	
94-Feb	37	74	TEC	TEH	720-EC	32	3C	.00	.00	M1	1.96	110	70	
DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

20-Sep-95 19:58

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
94-Feb	37	74	TEC	TEH	720-EC	26	2C	.00	.00	M1	2.20	115	70	
	34	75	TSH	TEH	720-WC	NDD				1			59	
	34	75	TEH	TEC	720-EL	61	1C	-.05	.00	M1	4.66	82	84	RESULT OF DISCREPANCY RESOLUTION
	34	75												RETEST - RETEST FOR POSITIVE ID
	34	75	3C	TEC	720-EL	PID	1C	-.10	.00	M1	4.62	85	118	>> POSITIVE ID ESTABLISHED <<
94-Feb	34	75	TSH	TSH	720-ZC	NDD				1			46	
94-Feb	34	75	TEC	TEH	720-EC	28	1C	.00	.00	M1	1.38	113	70	
	37	76	TSH	TEH	720-WC	NDD				1			59	
	37	76	TEH	TEC	720-EL	50	1C	-.22	.00	M1	2.69	95	80	RESULT OF DISCREPANCY RESOLUTION
	37	76												RETEST - RETEST FOR POSITIVE ID
	37	76	3C	TEC	720-EL	PID	1C	-.39	.00	M1	1.83	103	116	>> POSITIVE ID ESTABLISHED <<
94-Feb	37	76	TSH	TSH	720-ZC	NDD				1			46	
94-Feb	37	76	TEC	TEH	720-EC	26	1C	.00	.00	M1	1.42	115	70	
	4	77	TSH	TEH	720-WC	CDI	TEH	20.03	.00	C24	2.18	80	47	RESULT OF LAR
	4	77												RETEST - RETEST FOR POSITIVE ID
	4	77	TSH	TEH	720-WC	CRI	TRH	.00	.00	C3	2.94	48	47	RESULT OF DISCREPANCY RESOLUTION
	4	77												RETEST - RETEST FOR POSITIVE ID
	4	77	TEH	TEC	720-EL	NDD				1			96	RESULT OF DISCREPANCY RESOLUTION
	4	77	TRH	TEH	720-RB	SAI	TEH	3.01	.00	1	.23	47	115	>> POSITIVE ID ESTABLISHED <<
	4	77	TRH	TEH	720-RB	BAT	TEH	2.86	.00	1			115	
	4	77	TRH	TEH	720-RB	CRT	TEH	3.08	.00	1			115	
	4	77	TSH	TSH	720-RB	MAI	TSH	-2.09	.00	1	.87	115	117	>> POSITIVE ID ESTABLISHED <<
	4	77	TSH	TSH	720-ZC	MAI	TSH	-1.47	.00	4	1.11	86	119	RESULT OF DISCREPANCY RESOLUTION
	4	77												>> POSITIVE ID ESTABLISHED <<
	4	77	TSH	TSH	720-ZC	DIM	TSH	1198.00	.00	0	80.00	37	119	RESULT OF DISCREPANCY RESOLUTION
94-Feb	4	77			0	PLG	TEH	.00	.00				6	
94-Feb	4	77			0	PLG	TEC	.00	.00				79	
	8	77	4H	TEC	720-EL	RST	3H	.00	.00	1			96	
	8	77			0	SCM							999	+STUCK PLUG TOP - TUBE TO BE PLUGGED
	8	77												>> POSITIVE ID ESTABLISHED <<
94-Feb	8	77			0	PLG	TEH	.00	.00				48	
94-Feb	8	77			0	PLG	TEC	.00	.00				99	
	30	81	TSH	TEH	720-WC	NDD				1			61	
	30	81	TEH	TEC	720-EL	58	3C	-.12	.00	M1	5.35	86	88	RETEST - RETEST FOR POSITIVE ID
	30	81	TEH	TEC	720-EL	35	2C	-.10	.00	M1	2.35	107	88	
	30	81	TEH	TEC	720-EL	55	1C	-.05	.00	M1	5.28	89	88	RETEST - RETEST FOR POSITIVE ID
	30	81	3C	TEC	720-EL	PID	3C	-.15	.00	M1	5.36	85	118	>> POSITIVE ID ESTABLISHED <<
94-Feb	30	81	TSH	TSH	720-ZC	NDD				1			48	
94-Feb	30	81	TEH	TEC	720-EC	38	3C	.00	.00	M1	2.53	111	83	RESULT OF DISCREPANCY RESOLUTION
94-Feb	30	81	TEH	TEC	720-EC	17	2C	.00	.00	M1	1.17	126	83	
94-Feb	30	81	TEH	TEC	720-EC	30	1C	.00	.00	M1	2.52	117	83	
	28	83	TSH	TEH	720-WC	NDD				1			61	

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
------	-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
	28	83	TEH	TEC	720-EL	44	1C	.00	.00	M1	1.96	99	88	RETEST - RETEST FOR POSITIVE ID
	28	83	3C	TEC	720-EL	PID	1C	.05	.00	M1	1.83	103	116	>> POSITIVE ID ESTABLISHED <<
94-Feb	28	83	TSH	TSH	720-ZC	NDO				1			50	
94-Feb	28	83	TEH	TEC	720-EC	23	1C	.00	.00	M1	.91	122	83	RESULT OF DISCREPANCY RESOLUTION
	10	93	TSH	TEH	720-WC	NDO				1			53	
	10	93	TEH	TEC	720-EL	50	1C	-.50	.00	M1	5.88	94	90	RESULT OF DISCREPANCY RESOLUTION
	10	93												RETEST - RETEST FOR POSITIVE ID
	10	93	3C	TEC	720-EL	PID	1C	-.12	.00	M1	6.21	97	116	>> POSITIVE ID ESTABLISHED <<
94-Feb	10	93	TEH	TEC	720-EC	21	1C	.00	.00	M1	3.58	121	9	RESULT OF DISCREPANCY RESOLUTION
94-Feb	10	93	TSH	TSH	720-ZC	NDO				1			58	
	7	94	TSH	TEH	720-WC	NDO				1			53	
	7	94	TEH	TEC	720-EL	42	1C	-.15	.00	M2	3.44	102	92	RESULT OF DISCREPANCY RESOLUTION
	7	94												RETEST - RETEST FOR POSITIVE ID
	7	94	3C	TEC	720-EL	PID	1C	-.02	.00	M1	3.36	102	118	>> POSITIVE ID ESTABLISHED <<
94-Feb	7	94	TEH	TEC	720-EC	36	1C	.00	.00	M1	2.92	110	9	RESULT OF DISCREPANCY RESOLUTION
94-Feb	7	94	TSH	TSH	720-ZC	NDO				1			58	
DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

Attachment 2 TO AEP:NRC:1147F

**ATTACHMENT 2
STEAM GENERATOR ANNUAL OPERATING REPORT**

SECTION 2: Unit 1 Tube Repairs

c.2 Tubes Repaired Using F* Reroll Technique in SG #13



SG - .13

Row	Col	TUBES RECOVERED VIA RE-ROLL
10	11	
24	12	
2	13	
12	13	
25	14	
7	15	
9	15	
13	15	
18	15	
29	15	
3	16	
11	16	
12	16	
26	16	
29	16	
10	17	
3	18	
6	18	
7	18	
8	18	
10	18	
13	18	
23	18	
24	18	
31	18	
8	19	
9	19	
11	19	
29	19	
4	20	
11	20	
14	20	
19	20	
25	20	
27	20	
28	20	
30	20	
31	20	
6	21	
9	21	
10	21	
12	21	
13	21	
18	21	
33	21	
3	22	
6	22	
10	22	
11	22	
25	22	



SG - 13

Row	Col	TUBES RECOVERED VIA RE-ROLL
-----	-----	-----------------------------

28	22
29	22
30	22
10	23
14	23
17	23
28	23
30	23
3	24
14	24
19	24
20	24
23	24
24	24
30	24
3	25
7	25
8	25
10	25
20	25
26	25
31	25
1	26
2	26
6	26
11	26
15	26
24	26
27	26
2	27
5	27
7	27
8	27
9	27
12	27
15	27
31	27
4	28
10	28
18	28
19	28
23	28
29	28
30	28
31	28
32	28
2	29
3	29
4	29
5	29

09-18-1995 14:03:07

SG - 13

Row	Col	TUBES RECOVERED VIA RE-ROLL
9	29	
14	29	
15	29	
20	29	
23	29	
29	29	
1	30	
2	30	
5	30	
7	30	
15	30	
20	30	
24	30	
26	30	
27	30	
29	30	
30	30	
31	30	
1	31	
7	31	
8	31	
15	31	
20	31	
23	31	
25	31	
29	31	
33	31	
1	32	
2	32	
9	32	
11	32	
14	32	
15	32	
7	33	
9	33	
10	33	
12	33	
18	33	
24	33	
25	33	
29	33	
30	33	
32	33	
3	34	
6	34	
8	34	
14	34	
18	34	
29	34	
32	34	

09-18-1995 14:03:07

SG - 13

Row Col TUBES RECOVERED VIA RE-ROLL

2	35
3	35
5	35
8	35
15	35
23	35
24	35
25	35
33	35
4	36
7	36
8	36
14	36
18	36
23	36
26	36
27	36
28	36
30	36
32	36
2	37
4	37
5	37
7	37
9	37
14	37
15	37
20	37
25	37
28	37
32	37
2	38
3	38
4	38
5	38
10	38
15	38
16	38
31	38
32	38
2	39
3	39
7	39
8	39
9	39
14	39
15	39
25	39
26	39
31	39

SG - 13

Row	Col	TUBES RECOVERED VIA RE-ROLL
32	39	
1	40	
4	40	
9	40	
11	40	
13	40	
14	40	
15	40	
24	40	
25	40	
26	40	
31	40	
1	41	
2	41	
5	41	
8	41	
9	41	
11	41	
13	41	
31	41	
33	41	
2	42	
5	42	
8	42	
10	42	
11	42	
20	42	
23	42	
27	42	
31	42	
1	43	
4	43	
15	43	
21	43	
25	43	
30	43	
35	43	
4	44	
7	44	
12	44	
20	44	
21	44	
26	44	
27	44	
32	44	
33	44	
2	45	
3	45	
4	45	
7	45	



SG - 13

Row Col

TUBES RECOVERED VIA RE-ROLL

8	45
9	45
11	45
15	45
27	45
30	45
9	46
20	46
25	46
30	46
2	47
6	47
15	47
27	47
28	47
31	47
8	48
9	48
18	48
26	48
27	48
2	49
7	49
19	49
26	49
27	49
29	49
30	49
32	49
33	49
3	50
4	50
27	50
29	50
32	50
2	51
3	51
6	51
8	51
18	51
23	51
26	51
3	52
6	52
9	52
10	52
12	52
13	52
18	52
23	52

TUBE PLUGGED - DID NOT MEET RE-ROLL DIAMETER REQUIREMENTS
TUBE PLUGGED - DID NOT MEET RE-ROLL DIAMETER REQUIREMENTS



09-18-1995 14:03:07

SG - 13

Row Col TUBES RECOVERED VIA RE-ROLL

24	52
28	52
2	53
4	53
6	53
21	53
24	53
27	53
30	53
33	53
34	53
1	54
3	54
5	54
6	54
7	54
13	54
18	54
21	54
23	54
25	54
33	54
9	55
24	55
27	55
29	55
3	56
4	56
5	56
6	56
10	56
21	56
26	56
29	56
3	57
4	57
5	57
7	57
8	57
21	57
26	57
27	57
32	57
2	58
5	58
6	58
11	58
24	58
26	58
27	58



SG - 13

Row	Col	TUBES RECOVERED VIA RE-ROLL
28	58	
5	59	
7	59	
10	59	
13	59	
24	59	
28	59	
2	60	
6	60	
23	60	
24	60	
26	60	
28	60	
29	60	
30	60	
33	60	
1	61	
2	61	
3	61	
7	61	
8	61	
10	61	
13	61	
19	61	
23	61	
28	61	
1	62	
5	62	
7	62	
23	62	
24	62	
25	62	
26	62	
28	62	
29	62	
32	62	
7	63	
25	63	
30	63	
32	63	
3	64	
5	64	
10	64	
27	64	
31	64	
32	64	
33	64	
1	65	
2	65	
3	65	



09-18-1995 14:03:07

SG - 13

Row Col

TUBES RECOVERED VIA RE-ROLL

5	65
7	65
8	65
10	65
25	65
26	65
28	65
29	65
30	65
2	66
4	66
12	66
24	66
26	66
27	66
29	66
30	66
33	66
2	67
3	67
7	67
2	68
3	68
5	68
10	68
12	68
25	68
27	68
2	69
3	69
5	69
6	69
8	69
10	69
18	69
23	69
29	69
3	70
23	70
24	70
27	70
28	70
4	71
5	71
9	71
25	71
27	71
9	72
4	73
6	73

09-18-1995 14:03:07

SG - 13

Row	Col	TUBES RECOVERED VIA RE-ROLL
7	73	
8	73	
3	74	
4	74	
4	75	
7	75	
12	75	
20	75	
2	76	
3	76	
13	76	
15	76	
25	76	
29	76	
2	77	
5	77	
7	77	
9	77	
12	77	
29	77	
5	78	
3	79	
4	80	
10	80	
11	80	
1	81	
2	81	
3	81	
11	81	

>> Total Tubes = 479



D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

21-Sep-95 17:12

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
24	12	TRH	TEH	720-RB	COI	TEH	2.83	.00	1	1.10	14	99	>> POSITIVE ID ESTABLISHED <<
24	12												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	13	TRH	TEH	720-RB	COI	TEH	2.94	.00	1	.25	35	99	>> POSITIVE ID ESTABLISHED <<
12	13												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	14	TRH	TEH	720-RB	COI	TEH	2.80	.00	1	.74	14	99	>> POSITIVE ID ESTABLISHED <<
25	14												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	15	TRH	TEH	720-RB	COI	TEH	2.40	.00	1	1.02	10	99	>> POSITIVE ID ESTABLISHED <<
7	15												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	16	TRH	TEH	720-RB	COI	TEH	2.33	.00	1	.76	8	99	>> POSITIVE ID ESTABLISHED <<
3	16												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	16	TRH	TEH	720-RB	COI	TEH	2.45	.00	1	.60	27	99	>> POSITIVE ID ESTABLISHED <<
12	16												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	16	TRH	TEH	720-RB	COI	TEH	2.44	.00	1	.76	22	99	>> POSITIVE ID ESTABLISHED <<
26	16												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	16	TRH	TEH	720-RB	COI	TEH	2.24	.00	1	.56	18	99	>> POSITIVE ID ESTABLISHED <<
29	16												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	18	TRH	TEH	720-RB	COI	TEH	2.43	.00	1	.64	13	99	>> POSITIVE ID ESTABLISHED <<
13	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	20	TRH	TEH	720-RB	COI	TEH	2.53	.00	1	.74	28	99	>> POSITIVE ID ESTABLISHED <<
14	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	20	TRH	TEH	720-RB	COI	TEH	2.41	.00	1	.83	23	99	>> POSITIVE ID ESTABLISHED <<
19	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	21	TRH	TEH	720-RB	COI	TEH	2.08	.00	1	1.27	12	99	>> POSITIVE ID ESTABLISHED <<
33	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	25	TRH	TEH	720-RB	COI	TEH	2.32	.00	1	1.28	16	99	>> POSITIVE ID ESTABLISHED <<
3	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	27	TRH	TEH	720-RB	COI	TEH	2.30	.00	1	.33	35	101	>> POSITIVE ID ESTABLISHED <<
5	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	27	TRH	TEH	720-RB	COI	TEH	2.50	.00	1	.37	33	101	>> POSITIVE ID ESTABLISHED <<
7	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	29	TRH	TEH	720-RB	COI	TEH	2.61	.00	1	1.10	25	99	>> POSITIVE ID ESTABLISHED <<
3	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
5	37	TRH	TEH	720-RB	COI	TEH	2.61	.00	1	.91	23	105	>> POSITIVE ID ESTABLISHED <<
5	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	40	TRH	TEH	720-RB	COI	TEH	2.04	.00	1	.64	32	105	>> POSITIVE ID ESTABLISHED <<
14	40												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	42	TRH	TEH	720-RB	COI	TEH	2.67	.00	1	.63	24	105	>> POSITIVE ID ESTABLISHED <<
27	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	48	TRH	TEH	720-RB	COI	TEH	2.61	.00	4	2.99	14	109	>> POSITIVE ID ESTABLISHED <<
18	48												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	49	TRH	TEH	720-RB	COI	TEH	2.60	.00	4	1.54	17	109	>> POSITIVE ID ESTABLISHED <<
19	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	49	TRH	TEH	720-RB	COI	TEH	2.51	.00	4	1.92	14	109	>> POSITIVE ID ESTABLISHED <<
30	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	50	TRH	TEH	720-RB	COI	TEH	2.56	.00	1	1.37	27	107	>> POSITIVE ID ESTABLISHED <<
3	50												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	51	TRH	TEH	720-RB	COI	TEH	2.56	.00	4	2.86	12	109	>> POSITIVE ID ESTABLISHED <<
18	51												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	51	TRH	TEH	720-RB	COI	TEH	2.45	.00	4	.90	14	109	>> POSITIVE ID ESTABLISHED <<
23	51												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	52	TRH	TEH	720-RB	COI	TEH	2.36	.00	1	.73	24	107	>> POSITIVE ID ESTABLISHED <<
10	52												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	52	TRH	TEH	720-RB	COI	TEH	2.71	.00	4	.26	190	109	>> POSITIVE ID ESTABLISHED <<
18	52												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	52	TRH	TEH	720-RB	COI	TEH	2.55	.00	1	1.51	184	111	>> POSITIVE ID ESTABLISHED <<
23	52												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	52	TRH	TEH	720-RB	COI	TEH	2.52	.00	1	.91	12	111	>> POSITIVE ID ESTABLISHED <<
24	52												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	53	TRH	TEH	720-RB	COI	TEH	2.54	.00	1	1.39	21	105	>> POSITIVE ID ESTABLISHED <<
2	53												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	53	TRH	TEH	720-RB	COI	TEH	2.63	.00	1	.87	23	107	>> POSITIVE ID ESTABLISHED <<
6	53												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	53	TRH	TEH	720-RB	COI	TEH	2.58	.00	1	.89	8	111	>> POSITIVE ID ESTABLISHED <<
24	53												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

21-Sep-95 17:12

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
30	53	TRH	TEH	720-RB COI TEH			2.62	.00	1	.97	12	111	>> POSITIVE ID ESTABLISHED <<
30	53												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	53	TRH	TEH	720-RB COI TEH			2.61	.00	1	1.20	23	111	>> POSITIVE ID ESTABLISHED <<
33	53												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	54	TRH	TEH	720-RB COI TEH			2.30	.00	1	1.39	12	107	>> POSITIVE ID ESTABLISHED <<
1	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	54	TRH	TEH	720-RB COI TEH			2.44	.00	1	.38	18	107	>> POSITIVE ID ESTABLISHED <<
3	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	54	TRH	TEH	720-RB COI TEH			2.72	.00	1	.34	38	107	>> POSITIVE ID ESTABLISHED <<
6	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	55	TRH	TEH	720-RB COI TEH			2.64	.00	1	.55	13	107	>> POSITIVE ID ESTABLISHED <<
9	55												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	55	TRH	TEH	720-RB COI TEH			2.58	.00	1	.89	16	111	>> POSITIVE ID ESTABLISHED <<
27	55												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	56	TRH	TEH	720-RB COI TEH			2.69	.00	4	1.51	169	109	>> POSITIVE ID ESTABLISHED <<
6	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	56	TRH	TEH	720-RB COI TEH			2.70	.00	1	.76	15	107	>> POSITIVE ID ESTABLISHED <<
10	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	56	TRH	TEH	720-RB COI TEH			2.62	.00	1	1.71	12	111	>> POSITIVE ID ESTABLISHED <<
21	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	56	TRH	TEH	720-RB COI TEH			2.51	.00	1	.92	19	111	>> POSITIVE ID ESTABLISHED <<
29	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	57	TRH	TEH	720-RB COI TEH			2.55	.00	4	1.84	18	109	>> POSITIVE ID ESTABLISHED <<
21	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	57	TRH	TEH	720-RB COI TEH			2.52	.00	1	1.50	3	111	>> POSITIVE ID ESTABLISHED <<
32	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	58	TRH	TEH	720-RB COI TEH			2.53	.00	4	1.43	50	109	>> POSITIVE ID ESTABLISHED <<
6	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	58	TRH	TEH	720-RB COI TEH			2.50	.00	1	2.44	3	111	>> POSITIVE ID ESTABLISHED <<
27	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	59	TRH	TEH	720-RB COI TEH			2.56	.00	4	.44	39	109	>> POSITIVE ID ESTABLISHED <<
13	59												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
6	60	TRH	TEH	720-RB	COI	TEH	2.86	.00	4	.65	25	109	>> POSITIVE ID ESTABLISHED <<
6	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	60	TRH	TEH	720-RB	COI	TEH	2.54	.00	1	.20	14	111	>> POSITIVE ID ESTABLISHED <<
26	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	61	TRH	TEH	720-RB	COI	TEH	2.16	.00	1	2.94	6	115	>> POSITIVE ID ESTABLISHED <<
10	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	62	TRH	TEH	720-RB	COI	TEH	2.51	.00	1	2.48	10	115	>> POSITIVE ID ESTABLISHED <<
5	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	62	TRH	TEH	720-RB	COI	TEH	2.80	.00	1	1.07	3	115	>> POSITIVE ID ESTABLISHED <<
7	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	62	TRH	TEH	720-RB	COI	TEH	2.65	.00	1	.51	20	113	>> POSITIVE ID ESTABLISHED <<
24	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	62	TRH	TEH	720-RB	COI	TEH	2.68	.00	1	.98	21	113	>> POSITIVE ID ESTABLISHED <<
25	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	62	TRH	TEH	720-RB	COI	TEH	2.61	.00	1	.38	27	113	>> POSITIVE ID ESTABLISHED <<
26	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	62	TRH	TEH	720-RB	COI	TEH	2.59	.00	1	.47	16	113	>> POSITIVE ID ESTABLISHED <<
28	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	63	TRH	TEH	720-RB	COI	TEH	2.83	.00	1	.35	29	115	>> POSITIVE ID ESTABLISHED <<
7	63												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	63	TRH	TEH	720-RB	COI	TEH	2.66	.00	1	.61	21	113	>> POSITIVE ID ESTABLISHED <<
32	63												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	64	TRH	TEH	720-RB	COI	TEH	2.55	.00	4	.53	20	115	>> POSITIVE ID ESTABLISHED <<
3	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	64	TRH	TEH	720-RB	COI	TEH	2.53	.00	1	1.35	20	115	>> POSITIVE ID ESTABLISHED <<
5	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	64	TRH	TEH	720-RB	COI	TEH	2.62	.00	1	.51	12	115	>> POSITIVE ID ESTABLISHED <<
10	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	64	TRH	TEH	720-RB	COI	TEH	2.69	.00	1	4.12	14	113	>> POSITIVE ID ESTABLISHED <<
32	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	65	TRH	TEH	720-RB	COI	TEH	2.68	.00	4	1.13	6	115	>> POSITIVE ID ESTABLISHED <<
2	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
5	65	TRH	TEH	720-RB	COI	TEH	2.64	.00	1	1.59	17	115	>> POSITIVE ID ESTABLISHED <<
5	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	65	TRH	TEH	720-RB	COI	TEH	2.60	.00	1	.35	24	115	>> POSITIVE ID ESTABLISHED <<
8	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	65	TRH	TEH	720-RB	COI	TEH	2.61	.00	1	.25	20	115	>> POSITIVE ID ESTABLISHED <<
10	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	65	TRH	TEH	720-RB	COI	TEH	2.47	.00	1	.88	16	113	>> POSITIVE ID ESTABLISHED <<
28	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	66	TRH	TEH	720-RB	COI	TEH	2.77	.00	1	.85	196	113	>> POSITIVE ID ESTABLISHED <<
12	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	66	TRH	TEH	720-RB	COI	TEH	2.61	.00	1	.43	16	113	>> POSITIVE ID ESTABLISHED <<
24	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	66	TRH	TEH	720-RB	COI	TEH	2.50	.00	1	4.69	7	113	>> POSITIVE ID ESTABLISHED <<
27	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	66	TRH	TEH	720-RB	COI	TEH	2.43	.00	1	.69	16	113	>> POSITIVE ID ESTABLISHED <<
30	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	68	TRH	TEH	720-RB	COI	TEH	2.74	.00	1	2.54	6	115	>> POSITIVE ID ESTABLISHED <<
5	68												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	68	TRH	TEH	720-RB	COI	TEH	2.57	.00	1	1.10	18	113	>> POSITIVE ID ESTABLISHED <<
12	68												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	69	TRH	TEH	720-RB	COI	TEH	2.72	.00	1	.73	16	115	>> POSITIVE ID ESTABLISHED <<
5	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	69	TRH	TEH	720-RB	COI	TEH	2.58	.00	1	3.22	11	113	>> POSITIVE ID ESTABLISHED <<
23	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	70	TRH	TEH	720-RB	COI	TEH	2.48	.00	1	1.12	12	113	>> POSITIVE ID ESTABLISHED <<
23	70												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	70	TRH	TEH	720-RB	COI	TEH	2.50	.00	1	1.95	12	113	>> POSITIVE ID ESTABLISHED <<
28	70												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	71	TRH	TEH	720-RB	COI	TEH	2.50	.00	1	.90	345	113	>> POSITIVE ID ESTABLISHED <<
25	71												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	73	TRH	TEH	720-RB	COI	TEH	2.87	.00	1	.41	8	115	>> POSITIVE ID ESTABLISHED <<
8	73												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



SG - 13 LISTING OF COI CALLS

D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

21-Sep-95 17:12

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
20	75	TRH	TEH	720-RB	COI	TEH	2.63	.00	1	.78	202	113	>> POSITIVE ID ESTABLISHED <<
20	75												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	76	TRH	TEH	720-RB	COI	TEH	2.71	.00	1	.26	12	113	>> POSITIVE ID ESTABLISHED <<
15	76												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	78	TRH	TEH	720-RB	COI	TEH	2.98	.00	4	.36	32	115	>> POSITIVE ID ESTABLISHED <<
5	78												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

PAGE 6

TOTAL TUBES 83



ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
10	11	TRH	TEH	720-RB MAI	TEH		2.86	.00	1	1.70	21	99	>> POSITIVE ID ESTABLISHED <<
10	11												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	13	TRH	TEH	720-RB SAI	TEH		2.83	.00	1	.90	27	99	>> POSITIVE ID ESTABLISHED <<
2	13												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	14	TSH	TSH	720-ZC MAI	TSH		-.81	.00	4	.63	162	119	RESULT OF DISCREPANCY RESOLUTION
29	14												>> POSITIVE ID ESTABLISHED <<
9	15	TRH	TEH	720-RB SAI	TEH		2.37	.00	1	.59	22	99	>> POSITIVE ID ESTABLISHED <<
9	15												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	15	TRH	TEH	720-RB MAI	TEH		2.45	.00	1	1.05	22	99	>> POSITIVE ID ESTABLISHED <<
13	15												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	15	TRH	TEH	720-RB MAI	TEH		2.67	.00	1	.40	35	117	>> POSITIVE ID ESTABLISHED <<
18	15												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	15	TRH	TEH	720-RB MAI	TEH		3.04	.00	1	1.03	17	117	>> POSITIVE ID ESTABLISHED <<
29	15												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	16	TRH	TEH	720-RB MAI	TEH		2.43	.00	1	1.52	17	99	>> POSITIVE ID ESTABLISHED <<
11	16												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	17	TRH	TEH	720-RB MAI	TEH		2.28	.00	1	1.24	16	99	>> POSITIVE ID ESTABLISHED <<
10	17												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	18	TSH	TSH	720-RB SAI	TSH		-.72	.00	1	.41	98	117	>> POSITIVE ID ESTABLISHED <<
2	18	TSH	TSH	720-ZC SAI	TSH		-.55	.00	4	.54	69	119	>> POSITIVE ID ESTABLISHED <<
3	18	TRH	TEH	720-RB SAI	TEH		2.39	.00	1	.31	160	99	>> POSITIVE ID ESTABLISHED <<
3	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	18	TRH	TEH	720-RB SAI	TEH		2.44	.00	1	.42	19	99	>> POSITIVE ID ESTABLISHED <<
6	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	18	TRH	TEH	720-RB MAI	TEH		2.48	.00	1	.62	12	99	>> POSITIVE ID ESTABLISHED <<
7	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	18	TRH	TEH	720-RB SAI	TEH		2.43	.00	1	.46	24	99	>> POSITIVE ID ESTABLISHED <<
8	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	18	TRH	TEH	720-RB MAI	TEH		2.33	.00	1	1.16	17	99	>> POSITIVE ID ESTABLISHED <<
10	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	18	TRH	TEH	720-RB SAI	TEH		2.37	.00	1	2.01	12	99	>> POSITIVE ID ESTABLISHED <<
23	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

21-Sep-95 17: 7

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
24	18	TRH	TEH	720-RB SAI	TEH		2.43	.00	1	1.28	19	99	>> POSITIVE ID ESTABLISHED <<
24	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	18	TRH	TEH	720-RB MAI	TEH		2.59	.00	1	1.45	11	117	>> POSITIVE ID ESTABLISHED <<
31	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	19	TRH	TEH	720-RB SAI	TEH		2.15	.00	1	.55	17	99	>> POSITIVE ID ESTABLISHED <<
8	19												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	19	TRH	TEH	720-RB MAI	TEH		2.54	.00	1	1.51	19	99	>> POSITIVE ID ESTABLISHED <<
9	19												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	19	TRH	TEH	720-RB SAI	TEH		2.93	.00	1	.97	12	117	>> POSITIVE ID ESTABLISHED <<
11	19												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	19	TRH	TEH	720-RB MAI	TEH		2.37	.00	1	.73	17	99	>> POSITIVE ID ESTABLISHED <<
29	19												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	20	TRH	TEH	720-RB SAI	TEH		2.46	.00	1	.57	17	99	>> POSITIVE ID ESTABLISHED <<
4	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	20	TRH	TEH	720-RB MAI	TEH		2.60	.00	1	1.34	14	101	>> POSITIVE ID ESTABLISHED <<
11	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	20	TRH	TEH	720-RB MAI	TEH		2.30	.00	1	1.31	16	99	>> POSITIVE ID ESTABLISHED <<
25	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	20	TRH	TEH	720-RB SAI	TEH		2.30	.00	1	.64	40	99	>> POSITIVE ID ESTABLISHED <<
27	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	20	TRH	TEH	720-RB MAI	TEH		2.36	.00	1	1.36	28	99	>> POSITIVE ID ESTABLISHED <<
28	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	20	TRH	TEH	720-RB SAI	TEH		2.41	.00	1	1.67	19	99	>> POSITIVE ID ESTABLISHED <<
30	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	20	TRH	TEH	720-RB MAI	TEH		2.26	.00	1	1.10	25	99	>> POSITIVE ID ESTABLISHED <<
31	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	21	TRH	TEH	720-RB MAI	TEH		2.47	.00	1	.69	17	101	RESULT OF DISCREPANCY RESOLUTION
6	21												>> POSITIVE ID ESTABLISHED <<
6	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	21	TRH	TEH	720-RB MAI	TEH		2.34	.00	1	.45	46	101	>> POSITIVE ID ESTABLISHED <<
9	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	21	TRH	TEH	720-RB MAI	TEH		2.46	.00	1	.37	33	101	>> POSITIVE ID ESTABLISHED <<
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
10	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	21	TRH	TEH	720-RB SAI	TEH		2.23	.00	1	.34	11	101	>> POSITIVE ID ESTABLISHED <<
12	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	21	TRH	TEH	720-RB MAI	TEH		2.59	.00	1	.47	27	101	>> POSITIVE ID ESTABLISHED <<
13	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	21	TRH	TEH	720-RB MAI	TEH		2.53	.00	1	.83	20	99	>> POSITIVE ID ESTABLISHED <<
18	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	22	TRH	TEH	720-RB SAI	TEH		2.38	.00	1	2.61	16	99	>> POSITIVE ID ESTABLISHED <<
3	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	22	TRH	TEH	720-RB MAI	TEH		2.64	.00	4	2.24	6	101	RESULT OF LAR
6	22												>> POSITIVE ID ESTABLISHED <<
6	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	22	TRH	TEH	720-RB MAI	TEH		2.59	.00	1	1.35	16	101	>> POSITIVE ID ESTABLISHED <<
10	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	22	TRH	TEH	720-RB MAI	TEH		2.72	.00	1	.48	195	101	>> POSITIVE ID ESTABLISHED <<
11	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	22	TRH	TEH	720-RB MAI	TEH		2.43	.00	1	1.14	13	101	>> POSITIVE ID ESTABLISHED <<
25	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	22	TRH	TEH	720-RB MAI	TEH		2.36	.00	1	.62	33	101	>> POSITIVE ID ESTABLISHED <<
28	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	22	TRH	TEH	720-RB MAI	TEH		2.43	.00	1	.26	57	101	>> POSITIVE ID ESTABLISHED <<
29	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	22	TRH	TEH	720-RB MAI	TEH		2.32	.00	4	1.62	27	101	RESULT OF LAR
30	22												>> POSITIVE ID ESTABLISHED <<
30	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	23	TRH	TEH	720-RB MAI	TEH		2.42	.00	1	.37	33	101	>> POSITIVE ID ESTABLISHED <<
10	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	23	TRH	TEH	720-RB MAI	TEH		2.45	.00	1	.83	31	101	>> POSITIVE ID ESTABLISHED <<
14	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	23	TRH	TEH	720-RB MAI	TEH		2.50	.00	1	2.06	9	101	>> POSITIVE ID ESTABLISHED <<
17	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	23	TRH	TEH	720-RB MAI	TEH		2.58	.00	1	1.45	14	117	>> POSITIVE ID ESTABLISHED <<
28	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
30	23	TRH	TEH	720-RB MAI	TEH		2.57	.00	1	.63	31	101	>> POSITIVE ID ESTABLISHED <<
30	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	24	TRH	TEH	720-RB MAI	TEH		2.48	.00	1	1.51	29	99	>> POSITIVE ID ESTABLISHED <<
3	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	24	TRH	TEH	720-RB MAI	TEH		2.51	.00	1	.54	16	101	>> POSITIVE ID ESTABLISHED <<
14	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	24	TRH	TEH	720-RB MAI	TEH		2.49	.00	1	.33	33	101	>> POSITIVE ID ESTABLISHED <<
19	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	24	TRH	TEH	720-RB MAI	TEH		2.54	.00	1	.24	48	101	>> POSITIVE ID ESTABLISHED <<
20	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	24	TRH	TEH	720-RB MAI	TEH		2.61	.00	1	.88	18	101	>> POSITIVE ID ESTABLISHED <<
23	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	24	TRH	TEH	720-RB MAI	TEH		2.79	.00	1	1.98	22	101	>> POSITIVE ID ESTABLISHED <<
24	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	24	TRH	TEH	720-RB MAI	TEH		2.53	.00	1	1.25	10	101	RESULT OF DISCREPANCY RESOLUTION
30	24												>> POSITIVE ID ESTABLISHED <<
30	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
34	24	TSH	TSH	720-ZC SAI	TSH		-.80	.00	4	2.58	43	119	>> POSITIVE ID ESTABLISHED <<
7	25	TRH	TEH	720-RB MAI	TEH		2.54	.00	1	2.90	20	101	>> POSITIVE ID ESTABLISHED <<
7	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	25	TRH	TEH	720-RB MAI	TEH		2.49	.00	1	.75	24	101	>> POSITIVE ID ESTABLISHED <<
8	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	25	TRH	TEH	720-RB MAI	TEH		2.38	.00	1	.37	33	101	>> POSITIVE ID ESTABLISHED <<
10	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	25	TRH	TEH	720-RB MAI	TEH		2.57	.00	1	1.20	22	101	>> POSITIVE ID ESTABLISHED <<
20	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	25	TRH	TEH	720-RB MAI	TEH		2.47	.00	1	.54	27	101	>> POSITIVE ID ESTABLISHED <<
26	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	25	TRH	TEH	720-RB MAI	TEH		2.57	.00	1	1.54	15	101	>> POSITIVE ID ESTABLISHED <<
31	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	26	TRH	TEH	720-RB MAI	TEH		2.28	.00	1	.90	16	99	>> POSITIVE ID ESTABLISHED <<
1	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
2	26	TRH	TEH	720-RB MAI TEH			2.38	.00	1	2.85	15	99	>> POSITIVE ID ESTABLISHED <<
2	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	26	TRH	TEH	720-RB SAI TEH			2.58	.00	1	2.86	187	101	>> POSITIVE ID ESTABLISHED <<
6	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	26	TRH	TEH	720-RB MAI TEH			2.48	.00	1	1.11	12	101	>> POSITIVE ID ESTABLISHED <<
11	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	26	TRH	TEH	720-RB MAI TEH			2.55	.00	1	.42	13	101	>> POSITIVE ID ESTABLISHED <<
15	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	26	TRH	TEH	720-RB MAI TEH			2.50	.00	1	.66	23	101	>> POSITIVE ID ESTABLISHED <<
24	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	26	TRH	TEH	720-RB MAI TEH			2.48	.00	1	.52	22	101	>> POSITIVE ID ESTABLISHED <<
27	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	27	TRH	TEH	720-RB MAI TEH			2.47	.00	1	2.02	25	99	>> POSITIVE ID ESTABLISHED <<
2	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	27	TRH	TEH	720-RB MAI TEH			2.55	.00	1	2.05	7	101	>> POSITIVE ID ESTABLISHED <<
8	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	27	TRH	TEH	720-RB MAI TEH			2.45	.00	1	.37	33	101	>> POSITIVE ID ESTABLISHED <<
9	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	27	TRH	TEH	720-RB MAI TEH			2.58	.00	1	.73	33	101	>> POSITIVE ID ESTABLISHED <<
12	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	27	TRH	TEH	720-RB MAI TEH			2.44	.00	1	1.14	23	101	>> POSITIVE ID ESTABLISHED <<
15	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	27	TRH	TEH	720-RB MAI TEH			2.48	.00	1	.83	12	101	>> POSITIVE ID ESTABLISHED <<
31	27												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	28	TRH	TEH	720-RB MAI TEH			2.30	.00	1	.82	54	101	>> POSITIVE ID ESTABLISHED <<
4	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	28	TRH	TEH	720-RB SAI TEH			2.59	.00	1	.37	33	101	>> POSITIVE ID ESTABLISHED <<
10	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	28	TRH	TEH	720-RB MAI TEH			2.59	.00	1	.51	29	101	>> POSITIVE ID ESTABLISHED <<
18	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	28	TRH	TEH	720-RB MAI TEH			2.65	.00	1	.46	42	101	>> POSITIVE ID ESTABLISHED <<
19	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

21-Sep-95 17: 7

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
23	28	TRH	TEH	720-RB MAI TEH			2.69	.00	1	1.18	18	101	>> POSITIVE ID ESTABLISHED <<
23	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	28	TRH	TEH	720-RB MAI TEH			2.53	.00	1	.97	16	101	>> POSITIVE ID ESTABLISHED <<
29	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	28	TRH	TEH	720-RB MAI TEH			2.59	.00	1	.89	10	101	>> POSITIVE ID ESTABLISHED <<
30	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	28	TRH	TEH	720-RB MAI TEH			2.57	.00	1	1.66	15	101	>> POSITIVE ID ESTABLISHED <<
31	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	28	TRH	TEH	720-RB MAI TEH			2.50	.00	1	.39	19	101	>> POSITIVE ID ESTABLISHED <<
32	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	29	TRH	TEH	720-RB MAI TEH			2.49	.00	1	1.20	24	99	>> POSITIVE ID ESTABLISHED <<
2	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	29	TRH	TEH	720-RB MAI TEH			2.38	.00	1	2.39	18	99	>> POSITIVE ID ESTABLISHED <<
4	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	29	TRH	TEH	720-RB SAI TEH			2.37	.00	1	1.13	17	99	>> POSITIVE ID ESTABLISHED <<
5	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	29	TRH	TEH	720-RB MAI TEH			2.51	.00	1	1.95	9	101	>> POSITIVE ID ESTABLISHED <<
9	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	29	TRH	TEH	720-RB MAI TEH			2.61	.00	1	1.27	16	101	>> POSITIVE ID ESTABLISHED <<
14	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	29	TRH	TEH	720-RB MAI TEH			2.59	.00	1	1.13	15	101	>> POSITIVE ID ESTABLISHED <<
15	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	29	TRH	TEH	720-RB MAI TEH			2.65	.00	1	.78	30	101	>> POSITIVE ID ESTABLISHED <<
20	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	29	TRH	TEH	720-RB MAI TEH			2.69	.00	1	1.15	20	101	>> POSITIVE ID ESTABLISHED <<
23	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	29	TRH	TEH	720-RB MAI TEH			2.49	.00	1	1.02	19	101	>> POSITIVE ID ESTABLISHED <<
29	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	30	TRH	TEH	720-RB MAI TEH			2.43	.00	1	1.10	31	99	>> POSITIVE ID ESTABLISHED <<
1	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	30	TRH	TEH	720-RB SAI TEH			2.42	.00	1	1.02	16	99	>> POSITIVE ID ESTABLISHED <<
2	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
5	30	TRH	TEH	720-RB SAI	TEH		2.37	.00	1	2.02	7	99	>> POSITIVE ID ESTABLISHED <<
5	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	30	TRH	TEH	720-RB MAI	TEH		2.61	.00	1	1.01	20	101	>> POSITIVE ID ESTABLISHED <<
7	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	30	TRH	TEH	720-RB MAI	TEH		2.70	.00	1	.51	22	101	>> POSITIVE ID ESTABLISHED <<
15	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	30	TRH	TEH	720-RB MAI	TEH		2.67	.00	1	.39	38	101	>> POSITIVE ID ESTABLISHED <<
20	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	30	TRH	TEH	720-RB MAI	TEH		2.69	.00	1	.40	23	101	>> POSITIVE ID ESTABLISHED <<
24	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	30	TRH	TEH	720-RB MAI	TEH		2.67	.00	1	.30	56	101	>> POSITIVE ID ESTABLISHED <<
26	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	30	TRH	TEH	720-RB MAI	TEH		2.62	.00	1	1.03	16	101	>> POSITIVE ID ESTABLISHED <<
27	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	30	TRH	TEH	720-RB MAI	TEH		2.74	.00	1	.69	9	101	>> POSITIVE ID ESTABLISHED <<
29	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	30	TRH	TEH	720-RB MAI	TEH		2.77	.00	1	.46	26	101	>> POSITIVE ID ESTABLISHED <<
30	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	30	TRH	TEH	720-RB MAI	TEH		2.61	.00	1	.88	17	117	>> POSITIVE ID ESTABLISHED <<
31	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	31	TRH	TEH	720-RB MAI	TEH		2.55	.00	1	1.89	17	105	>> POSITIVE ID ESTABLISHED <<
1	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	31	TRH	TEH	720-RB MAI	TEH		3.08	.00	1	2.89	22	117	>> POSITIVE ID ESTABLISHED <<
7	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	31	TRH	TEH	720-RB MAI	TEH		2.98	.00	1	1.77	24	117	>> POSITIVE ID ESTABLISHED <<
8	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	31	TRH	TEH	720-RB MAI	TEH		2.67	.00	1	.57	26	103	>> POSITIVE ID ESTABLISHED <<
15	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	31	TRH	TEH	720-RB MAI	TEH		2.63	.00	1	.80	28	103	>> POSITIVE ID ESTABLISHED <<
20	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	31	TRH	TEH	720-RB MAI	TEH		2.64	.00	1	.88	29	103	>> POSITIVE ID ESTABLISHED <<
23	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
25	31	TRH	TEH	720-RB MAI	TEH		2.54	.00	1	2.05	23	103	>> POSITIVE ID ESTABLISHED <<
25	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	31	TRH	TEH	720-RB MAI	TEH		2.71	.00	1	.78	15	101	>> POSITIVE ID ESTABLISHED <<
29	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	31	TRH	TEH	720-RB MAI	TEH		2.61	.00	1	.28	56	101	>> POSITIVE ID ESTABLISHED <<
33	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	32	TRH	TEH	720-RB MAI	TEH		2.56	.00	1	.81	19	105	>> POSITIVE ID ESTABLISHED <<
1	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	32	TRH	TEH	720-RB SAI	TEH		2.36	.00	1	1.13	12	105	>> POSITIVE ID ESTABLISHED <<
2	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	32	TRH	TEH	720-RB MAI	TEH		2.78	.00	1	.89	28	103	>> POSITIVE ID ESTABLISHED <<
9	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	32	TRH	TEH	720-RB SAI	TEH		2.78	.00	1	1.29	18	103	>> POSITIVE ID ESTABLISHED <<
11	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	32	TRH	TEH	720-RB MAI	TEH		2.55	.00	1	.52	28	103	>> POSITIVE ID ESTABLISHED <<
14	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	32	TRH	TEH	720-RB SAI	TEH		2.63	.00	1	.27	109	103	>> POSITIVE ID ESTABLISHED <<
15	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	33	TRH	TEH	720-RB SAI	TEH		2.39	.00	1	1.21	15	105	>> POSITIVE ID ESTABLISHED <<
7	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	33	TRH	TEH	720-RB MAI	TEH		2.65	.00	1	.72	21	103	>> POSITIVE ID ESTABLISHED <<
9	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	33	TRH	TEH	720-RB MAI	TEH		2.49	.00	1	.29	20	103	>> POSITIVE ID ESTABLISHED <<
10	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	33	TRH	TEH	720-RB MAI	TEH		2.60	.00	1	.61	31	103	>> POSITIVE ID ESTABLISHED <<
12	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	33	TRH	TEH	720-RB SAI	TEH		2.57	.00	1	2.07	8	103	>> POSITIVE ID ESTABLISHED <<
18	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	33	TRH	TEH	720-RB MAI	TEH		2.65	.00	1	.86	14	103	>> POSITIVE ID ESTABLISHED <<
24	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	33	TRH	TEH	720-RB MAI	TEH		2.64	.00	1	1.46	20	103	>> POSITIVE ID ESTABLISHED <<
25	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
29	33	TRH	TEH	720-RB	MAI	TEH	2.53	.00	1	1.36	17	103	>> POSITIVE ID ESTABLISHED <<
29	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	33	TRH	TEH	720-RB	MAI	TEH	2.42	.00	1	1.28	18	103	>> POSITIVE ID ESTABLISHED <<
30	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	33	TRH	TEH	720-RB	MAI	TEH	2.29	.00	1	.26	9	103	>> POSITIVE ID ESTABLISHED <<
32	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	34	TRH	TEH	720-RB	SAI	TEH	2.41	.00	1	1.23	17	105	>> POSITIVE ID ESTABLISHED <<
3	34												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	34	TRH	TEH	720-RB	MAI	TEH	2.57	.00	1	2.60	13	105	>> POSITIVE ID ESTABLISHED <<
6	34												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	34	TRH	TEH	720-RB	SAI	TEH	2.48	.00	1	10.88	2	105	>> POSITIVE ID ESTABLISHED <<
8	34												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	34	TRH	TEH	720-RB	MAI	TEH	2.54	.00	1	.74	44	103	>> POSITIVE ID ESTABLISHED <<
14	34												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	34	TRH	TEH	720-RB	MAI	TEH	2.50	.00	1	.44	26	103	>> POSITIVE ID ESTABLISHED <<
18	34												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	34	TRH	TEH	720-RB	MAI	TEH	2.61	.00	1	1.86	11	103	>> POSITIVE ID ESTABLISHED <<
29	34												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	34	TRH	TEH	720-RB	MAI	TEH	2.38	.00	1	.52	26	103	>> POSITIVE ID ESTABLISHED <<
32	34												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	35	TRH	TEH	720-RB	SAI	TEH	2.41	.00	1	.74	18	105	>> POSITIVE ID ESTABLISHED <<
2	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	35	TRH	TEH	720-RB	MAI	TEH	2.41	.00	1	1.29	19	105	>> POSITIVE ID ESTABLISHED <<
3	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	35	TRH	TEH	720-RB	SAI	TEH	2.45	.00	1	1.00	18	105	>> POSITIVE ID ESTABLISHED <<
5	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	35	TRH	TEH	720-RB	SAI	TEH	2.49	.00	1	.51	25	105	>> POSITIVE ID ESTABLISHED <<
8	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	35	TRH	TEH	720-RB	MAI	TEH	2.60	.00	1	.86	22	105	>> POSITIVE ID ESTABLISHED <<
15	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	35	TRH	TEH	720-RB	SAI	TEH	2.57	.00	1	1.78	20	103	>> POSITIVE ID ESTABLISHED <<
23	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

D. C. Cook UIR95

AEP -13/51

INSPECTION: August 95

21-Sep-95 17: 8

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
24	35	TRH	TEH	720-RB MAI	TEH		2.53	.00	1	1.26	21	103	>> POSITIVE ID ESTABLISHED <<
24	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	35	TRH	TEH	720-RB MAI	TEH		2.54	.00	1	1.59	21	103	>> POSITIVE ID ESTABLISHED <<
25	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	35	TRH	TEH	720-RB MAI	TEH		2.60	.00	1	.67	28	103	>> POSITIVE ID ESTABLISHED <<
33	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	36	TRH	TEH	720-RB MAI	TEH		2.51	.00	1	2.71	18	105	>> POSITIVE ID ESTABLISHED <<
4	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	36	TRH	TEH	720-RB MAI	TEH		2.68	.00	1	.50	16	105	>> POSITIVE ID ESTABLISHED <<
7	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	36	TRH	TEH	720-RB SAI	TEH		2.59	.00	1	.46	29	105	>> POSITIVE ID ESTABLISHED <<
8	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	36	TRH	TEH	720-RB SAI	TEH		2.38	.00	1	.84	22	105	>> POSITIVE ID ESTABLISHED <<
14	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	36	TRH	TEH	720-RB MAI	TEH		2.79	.00	1	.30	31	117	>> POSITIVE ID ESTABLISHED <<
18	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	36	TRH	TEH	720-RB MAI	TEH		2.51	.00	1	.59	25	103	>> POSITIVE ID ESTABLISHED <<
23	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	36	TRH	TEH	720-RB SAI	TEH		2.48	.00	1	.59	23	103	>> POSITIVE ID ESTABLISHED <<
26	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	36	TRH	TEH	720-RB MAI	TEH		2.52	.00	1	.62	21	103	>> POSITIVE ID ESTABLISHED <<
27	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	36	TRH	TEH	720-RB MAI	TEH		2.53	.00	1	1.51	18	103	>> POSITIVE ID ESTABLISHED <<
28	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	36	TRH	TEH	720-RB MAI	TEH		2.56	.00	1	.28	88	103	>> POSITIVE ID ESTABLISHED <<
30	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	36	TRH	TEH	720-RB MAI	TEH		2.57	.00	1	.66	32	103	>> POSITIVE ID ESTABLISHED <<
32	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	37	TRH	TEH	720-RB SAI	TEH		2.54	.00	1	1.04	15	105	>> POSITIVE ID ESTABLISHED <<
2	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	37	TRH	TEH	720-RB MAI	TEH		2.77	.00	1	1.02	17	105	>> POSITIVE ID ESTABLISHED <<
4	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
7	37	TRH	TEH	720-RB	SAI	TEH	2.64	.00	4	.47	8	105	>> POSITIVE ID ESTABLISHED <<
7	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	37	TRH	TEH	720-RB	MAI	TEH	2.62	.00	1	1.04	37	105	>> POSITIVE ID ESTABLISHED <<
9	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	37	TRH	TEH	720-RB	MAI	TEH	2.12	.00	1	.99	18	105	>> POSITIVE ID ESTABLISHED <<
14	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	37	TRH	TEH	720-RB	MAI	TEH	2.65	.00	1	1.43	23	105	>> POSITIVE ID ESTABLISHED <<
15	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	37	TRH	TEH	720-RB	MAI	TEH	2.64	.00	1	.51	33	103	>> POSITIVE ID ESTABLISHED <<
20	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	37	TRH	TEH	720-RB	MAI	TEH	2.56	.00	1	.23	142	103	>> POSITIVE ID ESTABLISHED <<
25	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	37	TRH	TEH	720-RB	MAI	TEH	2.48	.00	1	1.54	22	103	>> POSITIVE ID ESTABLISHED <<
28	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	37	TRH	TEH	720-RB	MAI	TEH	2.71	.00	1	1.49	28	103	>> POSITIVE ID ESTABLISHED <<
32	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	38	TRH	TEH	720-RB	SAI	TEH	2.48	.00	1	.46	13	105	>> POSITIVE ID ESTABLISHED <<
2	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	38	TRH	TEH	720-RB	MAI	TEH	2.66	.00	1	2.12	26	105	>> POSITIVE ID ESTABLISHED <<
3	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	38	TRH	TEH	720-RB	MAI	TEH	2.57	.00	1	1.26	27	105	>> POSITIVE ID ESTABLISHED <<
4	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	38	TRH	TEH	720-RB	MAI	TEH	2.60	.00	1	.95	16	105	>> POSITIVE ID ESTABLISHED <<
5	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	38	TRH	TEH	720-RB	MAI	TEH	2.72	.00	1	1.28	13	105	>> POSITIVE ID ESTABLISHED <<
10	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	38	TRH	TEH	720-RB	MAI	TEH	2.66	.00	1	.89	22	105	>> POSITIVE ID ESTABLISHED <<
15	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	38	TRH	TEH	720-RB	MAI	TEH	2.71	.00	1	.28	34	105	>> POSITIVE ID ESTABLISHED <<
16	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	38	TRH	TEH	720-RB	MAI	TEH	2.70	.00	1	.93	20	103	>> POSITIVE ID ESTABLISHED <<
31	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

21-Sep-95 17: 8

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
32	38	TRH	TEH	720-RB MAI	TEH		2.13	.00	1	1.09	17	103	>> POSITIVE ID ESTABLISHED <<
32	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
39	38	TSH	TSH	720-ZC SAI	TSH		-1.18	.00	4	.36	45	119	>> POSITIVE ID ESTABLISHED <<
2	39	TRH	TEH	720-RB SAI	TEH		2.69	.00	1	.87	16	105	>> POSITIVE ID ESTABLISHED <<
2	39												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	39	TRH	TEH	720-RB SAI	TEH		2.65	.00	1	.91	13	105	>> POSITIVE ID ESTABLISHED <<
3	39												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	39	TRH	TEH	720-RB MAI	TEH		2.82	.00	1	.71	20	105	>> POSITIVE ID ESTABLISHED <<
7	39												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	39	TRH	TEH	720-RB SAI	TEH		2.66	.00	1	.38	23	105	>> POSITIVE ID ESTABLISHED <<
8	39												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	39	TRH	TEH	720-RB MAI	TEH		2.81	.00	1	.97	16	105	>> POSITIVE ID ESTABLISHED <<
9	39												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	39	TRH	TEH	720-RB MAI	TEH		1.74	.00	1	.61	41	105	>> POSITIVE ID ESTABLISHED <<
14	39												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	39	TRH	TEH	720-RB SAI	TEH		2.70	.00	1	.90	14	105	>> POSITIVE ID ESTABLISHED <<
15	39												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	39	TRH	TEH	720-RB MAI	TEH		2.49	.00	1	.20	30	103	>> POSITIVE ID ESTABLISHED <<
25	39												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	39	TRH	TEH	720-RB MAI	TEH		2.54	.00	1	2.65	29	103	>> POSITIVE ID ESTABLISHED <<
26	39												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	39	TRH	TEH	720-RB MAI	TEH		2.64	.00	1	1.88	11	103	>> POSITIVE ID ESTABLISHED <<
31	39												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	39	TRH	TEH	720-RB MAI	TEH		2.62	.00	1	1.77	10	103	>> POSITIVE ID ESTABLISHED <<
32	39												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	40	TRH	TEH	720-RB MAI	TEH		2.62	.00	1	.87	23	105	>> POSITIVE ID ESTABLISHED <<
1	40												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	40	TRH	TEH	720-RB MAI	TEH		2.53	.00	1	2.82	15	105	>> POSITIVE ID ESTABLISHED <<
4	40												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	40	TRH	TEH	720-RB SAI	TEH		2.67	.00	1	5.10	13	105	>> POSITIVE ID ESTABLISHED <<
9	40												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

21-Sep-95 17: 8

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
11	40	TRH	TEH	720-RB MAI TEH			2.52	.00	1	.49	20	105	>> POSITIVE ID ESTABLISHED <<
11	40												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	40	TRH	TEH	720-RB MAI TEH			2.67	.00	1	.51	25	105	>> POSITIVE ID ESTABLISHED <<
13	40												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	40	TRH	TEH	720-RB MAI TEH			2.44	.00	1	.71	21	105	>> POSITIVE ID ESTABLISHED <<
15	40												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	40	TRH	TEH	720-RB MAI TEH			1.97	.00	1	2.58	20	103	>> POSITIVE ID ESTABLISHED <<
24	40												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	40	TRH	TEH	720-RB MAI TEH			2.61	.00	1	1.38	17	103	>> POSITIVE ID ESTABLISHED <<
25	40												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	40	TRH	TEH	720-RB MAI TEH			2.50	.00	1	.79	16	103	>> POSITIVE ID ESTABLISHED <<
26	40												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	40	TRH	TEH	720-RB MAI TEH			2.75	.00	1	.45	23	103	>> POSITIVE ID ESTABLISHED <<
31	40												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	41	TRH	TEH	720-RB MAI TEH			2.46	.00	1	1.31	13	105	>> POSITIVE ID ESTABLISHED <<
1	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	41	TRH	TEH	720-RB MAI TEH			2.59	.00	1	.42	28	105	>> POSITIVE ID ESTABLISHED <<
2	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	41	TRH	TEH	720-RB MAI TEH			2.59	.00	1	2.78	15	105	>> POSITIVE ID ESTABLISHED <<
5	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	41	TRH	TEH	720-RB SAI TEH			2.75	.00	1	.22	42	105	>> POSITIVE ID ESTABLISHED <<
8	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	41	TRH	TEH	720-RB SAI TEH			2.79	.00	1	1.84	11	105	>> POSITIVE ID ESTABLISHED <<
9	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	41	TRH	TEH	720-RB MAI TEH			2.79	.00	1	.99	18	105	>> POSITIVE ID ESTABLISHED <<
11	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	41	TRH	TEH	720-RB SAI TEH			2.61	.00	1	2.02	17	105	>> POSITIVE ID ESTABLISHED <<
13	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	41	TRH	TEH	720-RB MAI TEH			2.74	.00	1	.69	14	103	>> POSITIVE ID ESTABLISHED <<
31	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	41	TRH	TEH	720-RB SAI TEH			2.48	.00	1	.35	26	103	>> POSITIVE ID ESTABLISHED <<
33	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

21-Sep-95 17: 8

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
2	42	TRH	TEH	720-RB SAI	TEH		2.79	.00	1	4.69	13	105	>> POSITIVE ID ESTABLISHED <<
2	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	42	TRH	TEH	720-RB MAI	TEH		2.63	.00	1	.50	31	105	>> POSITIVE ID ESTABLISHED <<
5	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	42	TRH	TEH	720-RB MAI	TEH		2.66	.00	1	1.29	16	105	>> POSITIVE ID ESTABLISHED <<
8	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	42	TRH	TEH	720-RB MAI	TEH		2.68	.00	1	.64	34	105	>> POSITIVE ID ESTABLISHED <<
10	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	42	TRH	TEH	720-RB MAI	TEH		2.78	.00	1	.89	33	105	>> POSITIVE ID ESTABLISHED <<
11	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	42	TRH	TEH	720-RB MAI	TEH		2.57	.00	1	.72	18	103	>> POSITIVE ID ESTABLISHED <<
20	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	42	TRH	TEH	720-RB MAI	TEH		2.81	.00	1	.95	10	117	>> POSITIVE ID ESTABLISHED <<
23	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	42	TRH	TEH	720-RB SAI	TEH		2.66	.00	1	1.05	18	103	>> POSITIVE ID ESTABLISHED <<
31	42												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	43	TRH	TEH	720-RB SAI	TEH		2.58	.00	1	2.81	17	105	>> POSITIVE ID ESTABLISHED <<
1	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	43	TRH	TEH	720-RB MAI	TEH		2.80	.00	1	2.91	13	105	>> POSITIVE ID ESTABLISHED <<
4	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	43	TRH	TEH	720-RB MAI	TEH		2.51	.00	1	.71	17	105	>> POSITIVE ID ESTABLISHED <<
15	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	43	TRH	TEH	720-RB SAI	TEH		2.54	.00	1	1.10	29	103	>> POSITIVE ID ESTABLISHED <<
21	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	43	TRH	TEH	720-RB SAI	TEH		2.82	.00	1	1.01	33	105	>> POSITIVE ID ESTABLISHED <<
21	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	43	TRH	TEH	720-RB MAI	TEH		2.78	.00	1	.75	16	105	>> POSITIVE ID ESTABLISHED <<
25	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	43	TRH	TEH	720-RB MAI	TEH		2.57	.00	1	.91	39	103	>> POSITIVE ID ESTABLISHED <<
30	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
35	43	TRH	TEH	720-RB SAI	TEH		2.57	.00	1	1.16	21	103	>> POSITIVE ID ESTABLISHED <<
35	43												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	44	TRH	TEH	720-RB MAI	TEH		2.60	.00	1	3.79	10	105	>> POSITIVE ID ESTABLISHED <<
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



D. C. Cook UIR95

AEP -13/51

INSPECTION: August 95

21-Sep-95 17: 8

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
4	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	44	TRH	TEH	720-RB SAI	TEH		2.75	.00	1	2.18	20	105	>> POSITIVE ID ESTABLISHED <<
7	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	44	TRH	TEH	720-RB MAI	TEH		2.88	.00	1	.54	25	105	>> POSITIVE ID ESTABLISHED <<
12	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	44	TRH	TEH	720-RB MAI	TEH		2.53	.00	1	.42	63	103	>> POSITIVE ID ESTABLISHED <<
20	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	44	TRH	TEH	720-RB MAI	TEH		2.65	.00	1	.64	41	103	>> POSITIVE ID ESTABLISHED <<
21	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	44	TRH	TEH	720-RB MAI	TEH		2.74	.00	1	1.09	24	105	>> POSITIVE ID ESTABLISHED <<
26	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	44	TRH	TEH	720-RB SAI	TEH		2.65	.00	1	.58	18	105	>> POSITIVE ID ESTABLISHED <<
27	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	44	TRH	TEH	720-RB MAI	TEH		2.38	.00	1	1.04	17	103	>> POSITIVE ID ESTABLISHED <<
32	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	44	TRH	TEH	720-RB MAI	TEH		2.41	.00	1	.66	26	103	>> POSITIVE ID ESTABLISHED <<
33	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	45	TRH	TEH	720-RB MAI	TEH		2.70	.00	1	3.16	13	105	>> POSITIVE ID ESTABLISHED <<
2	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	45	TRH	TEH	720-RB MAI	TEH		2.72	.00	1	.67	30	105	>> POSITIVE ID ESTABLISHED <<
3	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	45	TRH	TEH	720-RB MAI	TEH		2.36	.00	1	5.64	19	105	>> POSITIVE ID ESTABLISHED <<
4	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	45	TRH	TEH	720-RB MAI	TEH		2.86	.00	1	5.52	19	105	>> POSITIVE ID ESTABLISHED <<
7	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	45	TRH	TEH	720-RB MAI	TEH		2.60	.00	1	.50	21	105	>> POSITIVE ID ESTABLISHED <<
8	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	45	TRH	TEH	720-RB SAI	TEH		2.70	.00	1	2.98	13	105	>> POSITIVE ID ESTABLISHED <<
9	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	45	TRH	TEH	720-RB MAI	TEH		2.73	.00	4	.67	29	105	>> POSITIVE ID ESTABLISHED <<
11	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	45	TRH	TEH	720-RB MAI	TEH		1.70	.00	1	.42	46	105	>> POSITIVE ID ESTABLISHED <<
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

D. C. Cook UIR95

AEP -13/51

INSPECTION: August 95

21-Sep-95 17: 8

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
15	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	45	TRH	TEH	720-RB SAI	TEH		2.67	.00	1	.86	13	105	>> POSITIVE ID ESTABLISHED <<
27	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	45	TRH	TEH	720-RB MAI	TEH		2.55	.00	1	1.04	17	103	>> POSITIVE ID ESTABLISHED <<
30	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	46	TRH	TEH	720-RB SAI	TEH		2.68	.00	1	1.46	13	105	>> POSITIVE ID ESTABLISHED <<
9	46												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	46	TRH	TEH	720-RB MAI	TEH		2.68	.00	1	1.04	18	105	>> POSITIVE ID ESTABLISHED <<
20	46												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	46	TRH	TEH	720-RB MAI	TEH		2.66	.00	4	.98	10	105	>> POSITIVE ID ESTABLISHED <<
25	46												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	46	TRH	TEH	720-RB MAI	TEH		2.56	.00	1	1.07	24	103	>> POSITIVE ID ESTABLISHED <<
30	46												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	46	TRH	TEH	720-RB MAI	TEH		2.55	.00	1	.93	29	103	>> POSITIVE ID ESTABLISHED <<
30	46												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	47	TRH	TEH	720-RB MAI	TEH		2.54	.00	4	2.37	20	105	>> POSITIVE ID ESTABLISHED <<
2	47												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	47	TRH	TEH	720-RB MAI	TEH		2.65	.00	1	.61	19	105	>> POSITIVE ID ESTABLISHED <<
6	47												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	47	TRH	TEH	720-RB MAI	TEH		2.74	.00	4	.31	21	109	RESULT OF DISCREPANCY RESOLUTION
15	47												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	47	TRH	TEH	720-RB SAI	TEH		2.65	.00	4	1.09	23	109	>> POSITIVE ID ESTABLISHED <<
27	47												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	47	TRH	TEH	720-RB MAI	TEH		2.59	.00	4	1.08	14	109	>> POSITIVE ID ESTABLISHED <<
28	47												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	47	TRH	TEH	720-RB SAI	TEH		2.51	.00	4	.60	11	109	>> POSITIVE ID ESTABLISHED <<
31	47												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	48	TRH	TEH	720-RB SAI	TEH		2.87	.00	1	1.18	197	107	>> POSITIVE ID ESTABLISHED <<
8	48												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	48	TRH	TEH	720-RB SAI	TEH		2.34	.00	1	1.15	21	107	>> POSITIVE ID ESTABLISHED <<
9	48												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	48	TRH	TEH	720-RB SAI	TEH		2.55	.00	4	1.11	23	109	>> POSITIVE ID ESTABLISHED <<
26	48												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
27	48	TRH	TEH	720-RB SAI	TEH		2.60	.00	4	.65	68	109	>> POSITIVE ID ESTABLISHED <<
27	48												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	49	TRH	TEH	720-RB MAI	TEH		2.61	.00	1	2.43	25	105	>> POSITIVE ID ESTABLISHED <<
2	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	49	TRH	TEH	720-RB SAI	TEH		2.62	.00	1	3.17	26	107	>> POSITIVE ID ESTABLISHED <<
7	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	49	TRH	TEH	720-RB SAI	TEH		2.46	.00	4	1.44	21	109	>> POSITIVE ID ESTABLISHED <<
26	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	49	TRH	TEH	720-RB MAI	TEH		2.64	.00	4	.36	28	109	>> POSITIVE ID ESTABLISHED <<
27	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	49	TRH	TEH	720-RB SAI	TEH		2.49	.00	4	.54	22	109	>> POSITIVE ID ESTABLISHED <<
29	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	49	TRH	TEH	720-RB SAI	TEH		2.60	.00	4	1.71	25	109	>> POSITIVE ID ESTABLISHED <<
32	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	49	TRH	TEH	720-RB MAI	TEH		2.62	.00	4	1.61	7	109	>> POSITIVE ID ESTABLISHED <<
33	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	50	TRH	TEH	720-RB MAI	TEH		2.56	.00	1	5.58	22	107	>> POSITIVE ID ESTABLISHED <<
4	50												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	50	TRH	TEH	720-RB SAI	TEH		1.49	.00	4	2.87	18	109	>> POSITIVE ID ESTABLISHED <<
27	50												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	50	TRH	TEH	720-RB SAI	TEH		2.61	.00	4	1.88	9	109	>> POSITIVE ID ESTABLISHED <<
29	50												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	50	TRH	TEH	720-RB SAI	TEH		2.54	.00	4	1.23	12	109	>> POSITIVE ID ESTABLISHED <<
32	50												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	51	TRH	TEH	720-RB MAI	TEH		2.45	.00	1	2.57	18	105	>> POSITIVE ID ESTABLISHED <<
2	51												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	51	TRH	TEH	720-RB MAI	TEH		2.37	.00	4	4.13	5	107	RESULT OF DISCREPANCY RESOLUTION
3	51												>> POSITIVE ID ESTABLISHED <<
3	51												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	51	TRH	TEH	720-RB MAI	TEH		2.51	.00	4	3.02	26	107	RESULT OF DISCREPANCY RESOLUTION
6	51												>> POSITIVE ID ESTABLISHED <<
6	51												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

21-Sep-95 17: 8

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
8	51	TRH	TEH	720-RB MAI	TEH		2.52	.00	1	.68	14	107	>> POSITIVE ID ESTABLISHED <<
8	51												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	51	TRH	TEH	720-RB MAI	TEH		2.40	.00	4	.71	201	109	>> POSITIVE ID ESTABLISHED <<
26	51												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	52	TRH	TEH	720-RB MAI	TEH		2.49	.00	1	5.58	22	107	>> POSITIVE ID ESTABLISHED <<
3	52												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	52	TRH	TEH	720-RB MAI	TEH		2.35	.00	4	4.74	2	107	RESULT OF DISCREPANCY RESOLUTION
6	52												>> POSITIVE ID ESTABLISHED <<
6	52												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	52	TRH	TEH	720-RB MAI	TEH		2.43	.00	1	.28	37	107	>> POSITIVE ID ESTABLISHED <<
9	52												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	52	TRH	TEH	720-RB MAI	TEH		2.60	.00	4	3.56	21	109	>> POSITIVE ID ESTABLISHED <<
13	52	TRH	TEH	720-RB SAI	TEH		2.47	.00	4	.52	25	109	RESULT OF DISCREPANCY RESOLUTION
13	52												>> POSITIVE ID ESTABLISHED <<
28	52	TRH	TEH	720-RB SAI	TEH		2.49	.00	1	2.51	17	111	>> POSITIVE ID ESTABLISHED <<
28	52												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	53	TRH	TEH	720-RB SAI	TEH		3.13	.00	1	.68	31	107	>> POSITIVE ID ESTABLISHED <<
4	53												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	53	TRH	TEH	720-RB SAI	TEH		2.60	.00	1	1.51	20	111	>> POSITIVE ID ESTABLISHED <<
21	53												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	53	TRH	TEH	720-RB MAI	TEH		2.62	.00	1	2.08	21	111	>> POSITIVE ID ESTABLISHED <<
27	53												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
34	53	TRH	TEH	720-RB SAI	TEH		2.56	.00	1	1.14	18	111	>> POSITIVE ID ESTABLISHED <<
34	53												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	54	TRH	TEH	720-RB SAI	TEH		2.47	.00	1	.80	10	107	>> POSITIVE ID ESTABLISHED <<
5	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	54	TRH	TEH	720-RB MAI	TEH		2.47	.00	4	4.80	16	107	RESULT OF DISCREPANCY RESOLUTION
7	54												>> POSITIVE ID ESTABLISHED <<
7	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	54	TRH	TEH	720-RB SAI	TEH		2.63	.00	4	.28	76	109	>> POSITIVE ID ESTABLISHED <<
13	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	54	TRH	TEH	720-RB MAI	TEH		2.77	.00	4	1.90	25	109	>> POSITIVE ID ESTABLISHED <<
18	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
21	54	TRH	TEH	720-RB SAI	TEH		2.48	.00	1	1.63	196	111	>> POSITIVE ID ESTABLISHED <<
21	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	54	TRH	TEH	720-RB MAI	TEH		2.65	.00	1	1.17	18	111	>> POSITIVE ID ESTABLISHED <<
23	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	54	TRH	TEH	720-RB SAI	TEH		2.60	.00	1	1.81	10	111	>> POSITIVE ID ESTABLISHED <<
25	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	54	TRH	TEH	720-RB SAI	TEH		2.50	.00	1	1.20	23	111	>> POSITIVE ID ESTABLISHED <<
33	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	55	TRH	TEH	720-RB MAI	TEH		2.69	.00	1	1.72	204	111	>> POSITIVE ID ESTABLISHED <<
24	55												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	55	TRH	TEH	720-RB MAI	TEH		2.60	.00	1	1.49	18	111	>> POSITIVE ID ESTABLISHED <<
29	55												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	56	TRH	TEH	720-RB MAI	TEH		2.57	.00	4	.61	30	109	RESULT OF DISCREPANCY RESOLUTION
3	56												>> POSITIVE ID ESTABLISHED <<
3	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	56	TRH	TEH	720-RB MAI	TEH		2.57	.00	1	3.09	8	107	>> POSITIVE ID ESTABLISHED <<
4	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	56	TRH	TEH	720-RB MAI	TEH		2.51	.00	4	1.89	27	109	>> POSITIVE ID ESTABLISHED <<
5	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	56	TRH	TEH	720-RB SAI	TEH		2.63	.00	1	1.33	25	111	>> POSITIVE ID ESTABLISHED <<
26	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	57	TRH	TEH	720-RB SAI	TEH		2.63	.00	4	1.49	23	109	>> POSITIVE ID ESTABLISHED <<
3	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	57	TRH	TEH	720-RB SAI	TEH		2.55	.00	4	1.54	37	109	>> POSITIVE ID ESTABLISHED <<
4	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	57	TRH	TEH	720-RB SAI	TEH		2.60	.00	4	.60	200	109	>> POSITIVE ID ESTABLISHED <<
5	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	57	TRH	TEH	720-RB MAI	TEH		2.69	.00	4	1.40	200	109	>> POSITIVE ID ESTABLISHED <<
7	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	57	TRH	TEH	720-RB SAI	TEH		2.61	.00	4	.96	206	109	>> POSITIVE ID ESTABLISHED <<
8	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	57	TRH	TEH	720-RB MAI	TEH		2.55	.00	1	2.18	9	111	>> POSITIVE ID ESTABLISHED <<
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



SG - 13 LISTING OF SAI & MAI CALLS

D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

21-Sep-95 17: 8

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
26	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	57	TRH	TEH	720-RB	SAI	TEH	2.53	.00	1	1.72	15	111	>> POSITIVE ID ESTABLISHED <<
27	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	58	TRH	TEH	720-RB	MAI	TEH	2.55	.00	4	.63	22	109	>> POSITIVE ID ESTABLISHED <<
2	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	58	TRH	TEH	720-RB	MAI	TEH	2.60	.00	4	.91	22	109	>> POSITIVE ID ESTABLISHED <<
5	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	58	TRH	TEH	720-RB	MAI	TEH	2.51	.00	4	1.50	11	109	>> POSITIVE ID ESTABLISHED <<
11	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	58	TRH	TEH	720-RB	MAI	TEH	2.48	.00	1	1.94	12	111	>> POSITIVE ID ESTABLISHED <<
24	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	58	TRH	TEH	720-RB	SAI	TEH	2.57	.00	1	2.99	10	111	>> POSITIVE ID ESTABLISHED <<
26	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	58	TRH	TEH	720-RB	SAI	TEH	2.59	.00	1	.92	21	111	>> POSITIVE ID ESTABLISHED <<
28	58												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	59	TRH	TEH	720-RB	MAI	TEH	2.45	.00	4	1.64	18	109	>> POSITIVE ID ESTABLISHED <<
5	59												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	59	TRH	TEH	720-RB	SAI	TEH	2.64	.00	4	.64	22	109	>> POSITIVE ID ESTABLISHED <<
7	59												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	59	TRH	TEH	720-RB	MAI	TEH	2.43	.00	4	3.34	18	109	>> POSITIVE ID ESTABLISHED <<
10	59												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	59	TRH	TEH	720-RB	SAI	TEH	2.50	.00	1	1.59	14	111	>> POSITIVE ID ESTABLISHED <<
24	59												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	59	TRH	TEH	720-RB	SAI	TEH	2.42	.00	1	1.89	11	111	>> POSITIVE ID ESTABLISHED <<
26	59	1H	1H	720-ZC	SAI	1H	.00	.00	4	1.11	119	119	>> POSITIVE ID ESTABLISHED <<
28	59	TRH	TEH	720-RB	MAI	TEH	2.63	.00	1	1.27	20	111	>> POSITIVE ID ESTABLISHED <<
28	59												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	60	TRH	TEH	720-RB	MAI	TEH	2.46	.00	4	1.15	21	109	>> POSITIVE ID ESTABLISHED <<
2	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	60	TRH	TEH	720-RB	SAI	TEH	2.57	.00	1	3.81	15	111	>> POSITIVE ID ESTABLISHED <<
23	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	60	TRH	TEH	720-RB	SAI	TEH	2.64	.00	1	1.16	18	111	>> POSITIVE ID ESTABLISHED <<
24	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
24	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	60	TRH	TEH	720-RB SAI	TEH		2.47	.00	1	1.36	10	111	>> POSITIVE ID ESTABLISHED <<
28	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	60	TRH	TEH	720-RB MAI	TEH		2.62	.00	1	2.49	14	111	>> POSITIVE ID ESTABLISHED <<
29	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	60	TRH	TEH	720-RB SAI	TEH		2.56	.00	1	1.30	32	111	>> POSITIVE ID ESTABLISHED <<
30	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	60	TRH	TEH	720-RB MAI	TEH		2.54	.00	1	3.83	10	111	>> POSITIVE ID ESTABLISHED <<
33	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	61	TRH	TEH	720-RB MAI	TEH		2.42	.00	4	.92	8	107	RESULT OF DISCREPANCY RESOLUTION
1	61												>> POSITIVE ID ESTABLISHED <<
1	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	61	TRH	TEH	720-RB SAI	TEH		2.28	.00	1	1.53	7	115	>> POSITIVE ID ESTABLISHED <<
2	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	61	TRH	TEH	720-RB MAI	TEH		2.56	.00	1	1.08	17	115	>> POSITIVE ID ESTABLISHED <<
3	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	61	TRH	TEH	720-RB SAI	TEH		2.33	.00	1	.78	21	115	>> POSITIVE ID ESTABLISHED <<
7	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	61	TRH	TEH	720-RB SAI	TEH		1.88	.00	1	.90	7	115	>> POSITIVE ID ESTABLISHED <<
8	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	61	TRH	TEH	720-RB SAI	TEH		2.63	.00	1	3.26	9	111	>> POSITIVE ID ESTABLISHED <<
13	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	61	TRH	TEH	720-RB SAI	TEH		2.55	.00	1	1.53	6	111	>> POSITIVE ID ESTABLISHED <<
19	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	61	TRH	TEH	720-RB SAI	TEH		2.74	.00	1	.96	37	111	>> POSITIVE ID ESTABLISHED <<
23	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
28	61	TRH	TEH	720-RB SAI	TEH		2.50	.00	1	1.74	8	111	>> POSITIVE ID ESTABLISHED <<
28	61												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	62	TRH	TEH	720-RB MAI	TEH		2.41	.00	4	1.64	16	107	RESULT OF LAR
1	62												>> POSITIVE ID ESTABLISHED <<
1	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
23	62	TRH	TEH	720-RB SAI	TEH		2.68	.00	1	.21	72	113	>> POSITIVE ID ESTABLISHED <<
23	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
29	62	TRH	TEH	720-RB SAI	TEH		2.65	.00	1	.47	29	113	>> POSITIVE ID ESTABLISHED <<
29	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
32	62	TRH	TEH	720-RB SAI	TEH		2.48	.00	1	.72	185	113	>> POSITIVE ID ESTABLISHED <<
32	62												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	63	TRH	TEH	720-RB MAI	TEH		2.54	.00	1	1.65	20	113	>> POSITIVE ID ESTABLISHED <<
25	63												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	63	TRH	TEH	720-RB MAI	TEH		2.52	.00	4	3.84	10	113	RESULT OF DISCREPANCY RESOLUTION
30	63												>> POSITIVE ID ESTABLISHED <<
30	63												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	64	TRH	TEH	720-RB MAI	TEH		2.46	.00	1	.69	21	113	>> POSITIVE ID ESTABLISHED <<
27	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
31	64	TRH	TEH	720-RB SAI	TEH		2.58	.00	1	.72	26	113	>> POSITIVE ID ESTABLISHED <<
31	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	64	TRH	TEH	720-RB SAI	TEH		2.53	.00	1	.35	22	113	>> POSITIVE ID ESTABLISHED <<
33	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	65	TRH	TEH	720-RB SAI	TEH		2.57	.00	1	1.91	7	115	>> POSITIVE ID ESTABLISHED <<
1	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	65	TRH	TEH	720-RB SAI	TEH		2.61	.00	1	.81	16	115	>> POSITIVE ID ESTABLISHED <<
3	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	65	TRH	TEH	720-RB SAI	TEH		2.56	.00	1	2.88	4	115	>> POSITIVE ID ESTABLISHED <<
7	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	65	TRH	TEH	720-RB MAI	TEH		2.51	.00	4	1.03	12	113	RESULT OF DISCREPANCY RESOLUTION
25	65												>> POSITIVE ID ESTABLISHED <<
25	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	65	TRH	TEH	720-RB SAI	TEH		2.65	.00	1	.42	166	113	>> POSITIVE ID ESTABLISHED <<
26	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	65	TRH	TEH	720-RB MAI	TEH		2.50	.00	1	.84	188	113	>> POSITIVE ID ESTABLISHED <<
29	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	65	TRH	TEH	720-RB SAI	TEH		2.60	.00	1	.54	27	113	>> POSITIVE ID ESTABLISHED <<
30	65												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	66	TRH	TEH	720-RB SAI	TEH		2.59	.00	1	2.75	20	115	>> POSITIVE ID ESTABLISHED <<
2	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

21-Sep-95 17: 8

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
4	66	TRH	TEH	720-RB	MAI	TEH	2.77	.00	1	1.87	17	115	>> POSITIVE ID ESTABLISHED <<
4	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
26	66	TRH	TEH	720-RB	MAI	TEH	2.54	.00	1	.66	19	113	>> POSITIVE ID ESTABLISHED <<
26	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	66	TRH	TEH	720-RB	SAI	TEH	2.55	.00	1	.84	169	113	>> POSITIVE ID ESTABLISHED <<
29	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	66	TRH	TEH	720-RB	MAI	TEH	2.67	.00	1	1.73	17	113	>> POSITIVE ID ESTABLISHED <<
33	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	67	TRH	TEH	720-RB	MAI	TEH	2.85	.00	1	.81	38	115	>> POSITIVE ID ESTABLISHED <<
2	67												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	67	TRH	TEH	720-RB	MAI	TEH	2.81	.00	1	1.16	29	115	>> POSITIVE ID ESTABLISHED <<
3	67												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	67	TRH	TEH	720-RB	SAI	TEH	2.71	.00	1	.72	9	115	>> POSITIVE ID ESTABLISHED <<
7	67												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	68	TRH	TEH	720-RB	SAI	TEH	2.90	.00	1	3.20	11	115	>> POSITIVE ID ESTABLISHED <<
2	68												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	68	TRH	TEH	720-RB	SAI	TEH	2.68	.00	1	2.25	17	115	>> POSITIVE ID ESTABLISHED <<
3	68												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	68	TRH	TEH	720-RB	MAI	TEH	2.85	.00	1	.59	9	115	>> POSITIVE ID ESTABLISHED <<
10	68												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	68	TRH	TEH	720-RB	SAI	TEH	2.52	.00	1	.56	10	113	>> POSITIVE ID ESTABLISHED <<
25	68												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	68	TRH	TEH	720-RB	MAI	TEH	2.58	.00	1	.82	11	113	>> POSITIVE ID ESTABLISHED <<
27	68												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	69	TRH	TEH	720-RB	SAI	TEH	2.68	.00	1	1.42	9	115	>> POSITIVE ID ESTABLISHED <<
2	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	69	TRH	TEH	720-RB	SAI	TEH	2.72	.00	1	2.13	14	115	>> POSITIVE ID ESTABLISHED <<
3	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	69	TRH	TEH	720-RB	SAI	TEH	2.95	.00	1	1.49	6	115	>> POSITIVE ID ESTABLISHED <<
6	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	69	TRH	TEH	720-RB	SAI	TEH	2.76	.00	1	.57	28	115	>> POSITIVE ID ESTABLISHED <<
8	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

D. C. Cook U1R95

AEP -13/51

INSPECTION: August 95

21-Sep-95 17: 8

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
10	69	TRH	TEH	720-RB SAI	TEH		2.66	.00	1	.56	.42	115	>> POSITIVE ID ESTABLISHED <<
10	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	69	TRH	TEH	720-RB SAI	TEH		2.66	.00	1	1.25	15	113	>> POSITIVE ID ESTABLISHED <<
18	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	69	TRH	TEH	720-RB SAI	TEH		2.54	.00	1	.47	36	113	>> POSITIVE ID ESTABLISHED <<
29	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	70	TRH	TEH	720-RB MAI	TEH		2.66	.00	1	2.86	21	115	>> POSITIVE ID ESTABLISHED <<
3	70												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
24	70	TRH	TEH	720-RB MAI	TEH		2.54	.00	4	4.39	14	113	RESULT OF DISCREPANCY RESOLUTION
24	70												>> POSITIVE ID ESTABLISHED <<
24	70												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	70	TRH	TEH	720-RB SAI	TEH		2.60	.00	1	2.08	7	113	>> POSITIVE ID ESTABLISHED <<
27	70												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	71	TRH	TEH	720-RB MAI	TEH		3.14	.00	1	3.60	28	115	>> POSITIVE ID ESTABLISHED <<
4	71												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
5	71	TRH	TEH	720-RB MAI	TEH		3.00	.00	1	1.47	10	115	>> POSITIVE ID ESTABLISHED <<
5	71												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	71	TRH	TEH	720-RB SAI	TEH		2.67	.00	1	1.74	27	115	>> POSITIVE ID ESTABLISHED <<
9	71												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
27	71	TRH	TEH	720-RB MAI	TEH		2.65	.00	4	.34	16	113	RESULT OF DISCREPANCY RESOLUTION
27	71												>> POSITIVE ID ESTABLISHED <<
27	71												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	72	TRH	TEH	720-RB SAI	TEH		2.86	.00	1	.47	41	115	>> POSITIVE ID ESTABLISHED <<
9	72												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	73	TRH	TEH	720-RB MAI	TEH		3.02	.00	1	1.46	35	115	>> POSITIVE ID ESTABLISHED <<
4	73												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	73	TRH	TEH	720-RB MAI	TEH		2.83	.00	1	.98	21	115	>> POSITIVE ID ESTABLISHED <<
6	73												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	73	TRH	TEH	720-RB SAI	TEH		2.89	.00	1	1.05	19	115	>> POSITIVE ID ESTABLISHED <<
7	73												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	74	TRH	TEH	720-RB SAI	TEH		3.12	.00	1	3.66	8	115	>> POSITIVE ID ESTABLISHED <<
3	74												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	74	TRH	TEH	720-RB SAI	TEH		3.16	.00	1	2.28	8	115	>> POSITIVE ID ESTABLISHED <<
4	74												
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
4	74												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	75	TRH	TEH	720-RB SAI	TEH		3.13	.00	1	1.86	21	115	>> POSITIVE ID ESTABLISHED <<
4	75												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	75	TRH	TEH	720-RB SAI	TEH		3.01	.00	1	.32	44	115	>> POSITIVE ID ESTABLISHED <<
7	75												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	75	TRH	TEH	720-RB MAI	TEH		2.94	.00	4	2.11	16	113	RESULT OF DISCREPANCY RESOLUTION .
12	75												>> POSITIVE ID ESTABLISHED <<
12	75												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	76	TRH	TEH	720-RB SAI	TEH		3.26	.00	4	3.45	4	115	>> POSITIVE ID ESTABLISHED <<
2	76												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	76	TRH	TEH	720-RB MAI	TEH		2.53	.00	1	.42	10	117	RESULT OF DISCREPANCY RESOLUTION
3	76												>> POSITIVE ID ESTABLISHED <<
3	76												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	76	TRH	TEH	720-RB MAI	TEH		2.80	.00	4	2.73	17	113	RESULT OF LAR
13	76												>> POSITIVE ID ESTABLISHED <<
13	76												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
25	76	TRH	TEH	720-RB SAI	TEH		2.61	.00	1	.86	193	113	>> POSITIVE ID ESTABLISHED <<
25	76												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
29	76	TRH	TEH	720-RB SAI	TEH		2.51	.00	1	2.66	18	113	>> POSITIVE ID ESTABLISHED <<
29	76												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	77	TRH	TEH	720-RB SAI	TEH		3.16	.00	1	1.47	14	115	>> POSITIVE ID ESTABLISHED <<
2	77												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	77	TRH	TEH	720-RB SAI	TEH		3.01	.00	1	.23	47	115	>> POSITIVE ID ESTABLISHED <<
4	77	TSH	TSH	720-RB MAI	TSH		-2.09	.00	1	.87	115	117	>> POSITIVE ID ESTABLISHED <<
4	77	TSH	TSH	720-ZC MAI	TSH		-1.47	.00	4	1.11	86	119	RESULT OF DISCREPANCY RESOLUTION
4	77												>> POSITIVE ID ESTABLISHED <<
5	77	TRH	TEH	720-RB SAI	TEH		2.98	.00	1	3.27	10	115	>> POSITIVE ID ESTABLISHED <<
5	77												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	77	TRH	TEH	720-RB SAI	TEH		2.83	.00	1	.86	10	115	>> POSITIVE ID ESTABLISHED <<
7	77												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	77	TRH	TEH	720-RB SAI	TEH		3.06	.00	1	.30	14	115	>> POSITIVE ID ESTABLISHED <<
9	77												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	77	TRH	TEH	720-RB SAI	TEH		2.73	.00	1	.68	190	113	>> POSITIVE ID ESTABLISHED <<
12	77												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



D. C. Cook UIR95

AEP -13/51

INSPECTION: August 95

21-Sep-95 17: 8

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
29	77	TRH	TEH	720-RB SAI	TEH		2.59	.00	1	.80	13	113	>> POSITIVE ID ESTABLISHED <<
29	77												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	79	TRH	TEH	720-RB MAI	TEH		3.09	.00	1	1.21	22	115	>> POSITIVE ID ESTABLISHED <<
3	79												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	80	TRH	TEH	720-RB SAI	TEH		3.24	.00	1	7.86	3	115	>> POSITIVE ID ESTABLISHED <<
4	80												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	80	TRH	TEH	720-RB SAI	TEH		2.51	.00	1	.60	22	115	>> POSITIVE ID ESTABLISHED <<
10	80												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	80	TRH	TEH	720-RB MAI	TEH		2.49	.00	1	.71	22	115	>> POSITIVE ID ESTABLISHED <<
11	80												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	81	TRH	TEH	720-RB SAI	TEH		2.82	.00	1	.69	22	115	>> POSITIVE ID ESTABLISHED <<
1	81												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	81	TRH	TEH	720-RB SAI	TEH		1.77	.00	1	2.43	7	115	>> POSITIVE ID ESTABLISHED <<
2	81												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	81	TRH	TEH	720-RB SAI	TEH		1.93	.00	4	3.90	1	115	>> POSITIVE ID ESTABLISHED <<
3	81												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	81	TRH	TEH	720-RB SAI	TEH		2.55	.00	1	.60	35	115	>> POSITIVE ID ESTABLISHED <<
11	81												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



Attachment 2 TO AEP:NRC:1147F

ATTACHMENT 2
STEAM GENERATOR ANNUAL OPERATING REPORT

SECTION 2: Unit 1 Tube Repairs

d.1 New Plugs Installed in SG #14

D.C. COOK UNIT 1

SG - 14 U1R95

LIST OF TUBES PLUGGED IN HOT LEG

Row	Col	Plug Description
9	3	- Mech. Plug
16	10	- Mech. Plug
29	13	- Mech. Plug
8	18	- Mech. Plug
36	21	- Mech. Plug
19	28	- Mech. Plug
3	30	- Mech. Plug
42	30	- Mech. Plug
14	33	- Mech. Plug
44	35	- Mech. Plug
44	36	- Mech. Plug
45	37	- Mech. Plug
45	38	- Mech. Plug
45	41	- Mech. Plug
30	42	- Mech. Plug
8	50	- Mech. Plug
16	71	- Mech. Plug
39	73	- Mech. Plug
33	75	- Mech. Plug
29	81	- Mech. Plug
30	83	- Mech. Plug
26	85	- Mech. Plug
26	86	- Mech. Plug
24	87	- Mech. Plug
16	91	- Mech. Plug

>> Total Tubes = 25

END

D.C. COOK UNIT 1

SG - 14 U1R95

LIST OF TUBES PLUGGED IN COLD LEG

Row	Col	Plug Description
9	3	- Mech. Plug
16	10	- Mech. Plug
29	13	- Mech. Plug
8	18	- Mech. Plug
36	21	- Mech. Plug
19	28	- Mech. Plug
3	30	- Mech. Plug
42	30	- Mech. Plug
14	33	- Mech. Plug
44	35	- Mech. Plug
44	36	- Mech. Plug
45	37	- Mech. Plug
45	38	- Mech. Plug
45	41	- Mech. Plug
30	42	- Mech. Plug
8	50	- Mech. Plug
16	71	- Mech. Plug
39	73	- Mech. Plug
33	75	- Mech. Plug
29	81	- Mech. Plug
30	83	- Mech. Plug
26	85	- Mech. Plug
26	86	- Mech. Plug
24	87	- Mech. Plug
16	91	- Mech. Plug

>> Total Tubes = 25

END

D. C. Cook U1R95

AEP -14/51

INSPECTION: August 95

20-Sep-95 20:11

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
	9	3	TSH	TEH	720-WC	NDD				1		17		
	9	3	TEH	TEC	720-EL	42	1C	.02	.00	M1	3.13	105	68	RESULT OF DISCREPANCY RESOLUTION
	9	3												RETEST - RETEST FOR POSITIVE ID
	9	3	2C	TEC	720-EL	PID	1C	.02	.00	M1	2.75	109	136	>> POSITIVE ID ESTABLISHED <<
94-Feb	9	3	TSH	TSH	720-ZC	NDD				1		14		
94-Feb	9	3	TEH	TEC	720-EC	31	1C	.00	.00	M1	2.45	113	49	
	16	10	TSH	TEH	720-WC	CDI	TSH	-.91	.00	C8	5.69	66	21	RESULT OF DISCREPANCY RESOLUTION
	16	10												RETEST - RETEST FOR POSITIVE ID
	16	10	TEH	TEC	720-EL	DIC	TEH	20.33	.00	M1	2.16	66	64	RETEST - RETEST FOR POSITIVE ID
	16	10	TEH	TEC	720-EL	PI	2H	.00	.00	M1	1.00	86	64	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
	16	10	TSH	TSH	720-ZC	MAI	TSH	-1.10	.00	4	3.61	19	173	RESULT OF DISCREPANCY RESOLUTION
	16	10												>> POSITIVE ID ESTABLISHED <<
	16	10	TSH	TSH	720-ZC	DIM	TSH	760.00	.00	I	100.00	51	173	RESULT OF DISCREPANCY RESOLUTION
94-Feb	16	10	TSH	TSH	720-ZC	NDD				1		16		
94-Feb	16	10	TEH	TEC	720-EC	DI	TEH	20.16	.00	M1	.55	109	45	RESULT OF DISCREPANCY RESOLUTION
94-Feb	16	10	TEH	TEC	720-EC	PI	2H	.00	.00	M1	.76	85	45	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
	29	13	TSH	TEH	720-WC	NDD				1		23		
	29	13	TEH	TEC	720-EL	41	1C	.02	.00	M1	1.97	106	58	RESULT OF DISCREPANCY RESOLUTION
	29	13												RETEST - RETEST FOR POSITIVE ID
	29	13	TEH	TEC	720-EL	PID	1C	.02	.00	M1	1.76	107	134	>> POSITIVE ID ESTABLISHED <<
94-Feb	29	13	TSH	TSH	720-ZC	NDD				1		20		
94-Feb	29	13	TEH	TEC	720-EC	31	1C	.00	.00	M1	1.28	112	25	
	8	18	TSH	TEH	720-WC	CDI	TSH	-.47	.00	C6	3.38	33	25	RESULT OF LAR
	8	18												RETEST - RETEST FOR POSITIVE ID
	8	18	TEH	TEC	720-EL	DIC	TEH	20.65	.00	M1	2.08	29	66	RESULT OF DISCREPANCY RESOLUTION
	8	18												RETEST - RETEST FOR POSITIVE ID
	8	18	TEH	TEC	720-EL	PI	1H	.00	.00	M1	.58	53	66	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
	8	18	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.89	84	66	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
	8	18	TSH	TSH	720-ZC	MAI	TSH	-.88	.00	4	.73	14	173	RESULT OF DISCREPANCY RESOLUTION
	8	18												>> POSITIVE ID ESTABLISHED <<
	8	18	TSH	TSH	720-ZC	DIM	TSH	543.00	.00	I	100.00		173	RESULT OF DISCREPANCY RESOLUTION
94-Feb	8	18	TSH	TSH	720-ZC	NDD				1		22		
94-Feb	8	18	TEH	TEC	720-EC	PI	1H	.00	.00	M1	.62	67	23	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
94-Feb	8	18	TEH	TEC	720-EC	PIN	3H	.00	.00	M1	.84	76	23	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



D. C. Cook U1R95

AEP -14/51

INSPECTION: August 95

20-Sep-95 20:11

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
94-Feb	8	18	7H	TEH	640-ZU	PI	1H	.00	.00	M1	.49	64	98	RESULT OF DISCREPANCY RESOLUTION
94-Feb	8	18	7H	TEH	640-ZU	PIN	3H	.00	.00	M1	1.17	92	98	RESULT OF DISCREPANCY RESOLUTION
94-Feb	8	18	3H	3H	720-ZC	NDO				1			106	

	36	21	TSH	TEH	720-WC	NDO				1			29	
	36	21	TEH	TEC	720-EL	40	1C	.00	.00	M1	2.01	103	78	RESULT OF DISCREPANCY RESOLUTION
	36	21	-----											
	36	21	2C	TEC	720-EL	PID	1C	.00	.00	M1	1.79	119	134	RETEST - RETEST FOR POSITIVE ID
94-Feb	36	21	TEH	TEC	720-EC	15	1C	.00	.00	M1	1.13	122	21	>> POSITIVE ID ESTABLISHED <<
94-Feb	36	21	TSH	TSH	720-ZC	NDO				1			24	RESULT OF DISCREPANCY RESOLUTION

	19	28	TSH	TEH	720-WC	CRI	TRH	.00	.00	C22	6.24	43	129	RESULT OF DISCREPANCY RESOLUTION
	19	28	-----											
	19	28	TSH	TEH	720-WC	CDI	TSH	-1.00	.00	C8	1.02	81	129	RETEST - RETEST FOR POSITIVE ID
	19	28	-----											
	19	28	TSC	TEH	720-EL	DIC	TEH	20.40	.00	M1	.76	49	135	RESULT OF DISCREPANCY RESOLUTION
	19	28	TSC	TEH	720-EL	DNT	TSH	.05	.00	M1	4.05	184	135	RETEST - RETEST FOR POSITIVE ID
	19	28	TSH	TSH	720-ZC	MAI	TSH	-1.06	.00	4	.74	110	173	RETEST - RETEST FOR POSITIVE ID
	19	28	-----											
	19	28	TSH	TSH	720-ZC	DIM	TSH	1728.00	.00	0	100.00	58	173	>> POSITIVE ID ESTABLISHED <<
	19	28	1C	TEC	720-EL	NDO				1			174	RESULT OF DISCREPANCY RESOLUTION
	19	28	TSH	TSH	720-ZC	MAI	TSH	-1.02	.00	4	.69	98	177	RETEST - RETEST FOR POSITIVE ID
	19	28	TSH	TSH	720-ZC	DIM	TSH	1971.00	.00	0	100.00	57	177	>> POSITIVE ID ESTABLISHED <<
94-Feb	19	28			0	PLG	TEH	.00	.00				30	RESULT OF DISCREPANCY RESOLUTION
94-Feb	19	28			0	PLG	TEC	.00	.00				31	

	3	30	TSH	TEH	720-WC	CDI	TSH	.00	.00	C3	1.53	130	39	RESULT OF DISCREPANCY RESOLUTION
	3	30	-----											
	3	30	TEH	TEC	720-EL	NDO				1			88	RETEST - RETEST FOR POSITIVE ID
	3	30	TSH	TSH	720-ZC	SAI	TSH	-.95	.00	4	.27	82	173	RESULT OF DISCREPANCY RESOLUTION
	3	30	-----											
	3	30	TSH	TSH	720-ZC	DIM	TSH	1152.00	.00	0	100.00	42	173	>> POSITIVE ID ESTABLISHED <<
94-Feb	3	30	7C	TEH	720-EC	NDO				1			8	RESULT OF DISCREPANCY RESOLUTION
94-Feb	3	30	7C	TEC	720-EC	RST	UB	.00	.00	1			17	RETEST - RETEST FOR POSITIVE ID
94-Feb	3	30	TSH	TSH	720-ZC	NDO				1			32	RESULT OF DISCREPANCY RESOLUTION
94-Feb	3	30	7H	6C	680-EJ	NDO				1			85	

	42	30	TSH	TEH	720-WC	NDO				1			39	
	42	30	TEH	TEC	720-EL	51	1C	.07	.00	M1	4.01	106	92	RESULT OF DISCREPANCY RESOLUTION
	42	30	-----											
	42	30	-----											



D. C. Cook UIR95

AEP -14/51

INSPECTION: August 95

20-Sep-95 20:11

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
	42	30	2C	TEC	720-EL	PID	1C	.07	.00	M1	3.73	105	134	>> POSITIVE ID ESTABLISHED <<
94-Feb	42	30	TEH	TEC	720-EC	26	1C	.00	.00	M1	1.88	115	31	RESULT OF DISCREPANCY RESOLUTION
94-Feb	42	30	TSH	TSH	720-ZC	NDO				1			32	
	14	33	TSH	TEH	720-WC	CDI	TSH	-.03	.00	C18	6.35	81	41	RESULT OF DISCREPANCY RESOLUTION
	14	33												RETEST - RETEST FOR POSITIVE ID
	14	33	TEH	TEC	720-EL	NDO				1			104	
	14	33	TEH	TEC	720-EL	DNT	TSH	-.04	.00	M1	50.85	182	104	
	14	33	TSH	TSH	720-ZC	MAI	TSH	-.02	.00	4	.23	34	173	RESULT OF DISCREPANCY RESOLUTION
	14	33												>> POSITIVE ID ESTABLISHED <<
	14	33	TSH	TSH	720-ZC	DIW	TSH	338.00	.00	I	100.00	93	173	RESULT OF DISCREPANCY RESOLUTION
94-Feb	14	33	TEH	TEC	720-EC	NDO				1			33	
94-Feb	14	33	TEH	TEC	720-EC	DNT	TSH	.00	.00	M1	51.81	181	33	
94-Feb	14	33	TSH	TSH	720-ZC	NDO				1			34	
	44	35	TSH	TEH	720-WC	NDO				1			45	
	44	35	TEH	TEC	720-EL	52	1C	.00	.00	M1	4.78	98	46	RESULT OF DISCREPANCY RESOLUTION
	44	35												RETEST - RETEST FOR POSITIVE ID
	44	35	2C	TEC	720-EL	PID	1C	.00	.00	M1	4.19	108	134	>> POSITIVE ID ESTABLISHED <<
94-Feb	44	35	TSH	TSH	720-ZC	NDO				1			36	
94-Feb	44	35	TEH	TEC	720-EC	35	1C	.00	.00	M1	2.61	107	37	
	44	36	TSH	TEH	720-WC	NDO				1			45	
	44	36	TEH	TEC	720-EL	41	1C	-.07	.00	M1	2.39	107	46	RESULT OF DISCREPANCY RESOLUTION
	44	36												RETEST - RETEST FOR POSITIVE ID
	44	36	2C	TEC	720-EL	PID	1C	-.07	.00	M1	2.08	111	136	>> POSITIVE ID ESTABLISHED <<
94-Feb	44	36	TSH	TSH	720-ZC	NDO				1			36	
94-Feb	44	36	TEH	TEC	720-EC	26	1C	.00	.00	M1	1.54	113	37	
	45	37	TEH	TEC	720-EL	DNT	7H	.24	.00	M1	6.20	175	46	
	45	37	TEH	TEC	720-EL	31	2C	.00	.00	M1	2.74	114	46	
	45	37	TEH	TEC	720-EL	68	1C	.00	.00	M1	4.77	83	46	RESULT OF DISCREPANCY RESOLUTION
	45	37												RETEST - RETEST FOR POSITIVE ID
	45	37	TSH	TEH	720-WC	NDO				1			47	
	45	37	2C	TEC	720-EL	PID	1C	.00	.00	M1	4.23	92	136	>> POSITIVE ID ESTABLISHED <<
	45	37	7H	7H	720-ZC	NDO	7H	.00	.00	1			173	
94-Feb	45	37	TSH	TSH	720-ZC	NDO				1			36	
94-Feb	45	37	TSH	TEC	720-EC	DNT	7H	.21	.00	M1	5.88	175	39	
94-Feb	45	37	TSH	TEC	720-EC	15	2C	.00	.00	M1	1.68	122	39	
94-Feb	45	37	TSH	TEC	720-EC	35	1C	.13	.00	M1	1.88	109	39	RESULT OF DISCREPANCY RESOLUTION
DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



D. C. Cook UIR95

AEP -14/51

INSPECTION: August 95

20-Sep-95 20:11

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
94-Feb	45	37	1H	TEH	720-EC	NDD				1		92		
94-Feb	45	37	7H	7H	720-ZC	NDD				1		108		
	45	38	TSH	TEH	720-WC	NDD				1		47		
	45	38	TEH	TEC	720-EL	DIN	TEH	20.13	.00	M1	.26	52	98	RESULT OF DISCREPANCY RESOLUTION
	45	38	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.58	114	98	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
	45	38	TEH	TEC	720-EL	PI	3H	.00	.00	M1	.61	104	98	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
	45	38	TEH	TEC	720-EL	45	2C	.00	.00	M1	1.51	102	98	RETEST - RETEST FOR POSITIVE ID
	45	38	TEH	TEC	720-EL	37	1C	.00	.00	M1	1.01	108	98	
	45	38	3C	TEC	720-EL	PID	2C	.00	.00	M1	1.45	106	136	>> POSITIVE ID ESTABLISHED <<
94-Feb	45	38	TSH	TSH	720-ZC	NDD				1		36		
94-Feb	45	38	TEH	TEC	720-EC	PI	2H	.00	.00	M1	.49	111	39	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
94-Feb	45	38	TEH	TEC	720-EC	PI	3H	.00	.00	M1	.59	107	39	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
94-Feb	45	38	TEH	TEC	720-EC	22	2C	.00	.00	M1	.81	118	39	
94-Feb	45	38	TEH	TEC	720-EC	22	1C	.05	.00	M1	.72	118	39	RESULT OF DISCREPANCY RESOLUTION
	45	41	TSH	TEH	720-WC	NDD				1		51		
	45	41	TEH	TEC	720-EL	46	2C	.00	.00	M1	3.83	105	106	RESULT OF DISCREPANCY RESOLUTION
	45	41												RETEST - RETEST FOR POSITIVE ID
	45	41	3C	TEC	720-EL	PID	2C	.00	.00	M1	4.29	106	136	>> POSITIVE ID ESTABLISHED <<
Feb	45	41	TEH	TEC	720-EC	24	2C	.00	.00	M1	1.81	126	43	
Feb	45	41	TSH	TSH	720-ZC	NDD				1		78		
	30	42	TSH	TEH	720-WC	CDI	TEH	20.83	.00	C1	6.04	31	51	RESULT OF LAR
	30	42												RETEST - RETEST FOR POSITIVE ID
	30	42	TEH	TEC	720-EL	DIC	TEH	20.63	.00	M1	1.68	35	106	RETEST - RETEST FOR POSITIVE ID
	30	42	TSH	TSH	720-ZC	SAI	TSH	-.93	.00	4	1.06	40	173	RESULT OF DISCREPANCY RESOLUTION
	30	42												>> POSITIVE ID ESTABLISHED <<
	30	42	TSH	TSH	720-ZC	DIM	TSH	579.00	.00	I	100.00	38	173	RESULT OF DISCREPANCY RESOLUTION
94-Feb	30	42	TEH	TEC	720-EC	NDD				1		3		
94-Feb	30	42	TSH	TSH	720-ZC	NDD				1		40		
	8	50	TSH	TEH	720-WC	CDI	TEH	21.34	.00	C21	2.89	83	133	RESULT OF LAR
	8	50												RETEST - RETEST FOR POSITIVE ID
	8	50	TSH	TEH	720-WC	CRI	TRH	.00	.00	C14	9.69	33	133	RESULT OF DISCREPANCY RESOLUTION
	8	50												RETEST - RETEST FOR POSITIVE ID
	8	50	TSC	TEH	720-EL	DIC	TEH	21.06	.00	M1	3.65	76	135	RESULT OF DISCREPANCY RESOLUTION
	8	50												RETEST - RETEST FOR POSITIVE ID
	8	50	TSC	TEH	720-EL	PI	2H	.00	.00	M1	.67	90	135	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
	8	50	TSH	TSH	720-ZC	MAI	TSH	-.41	.00	4	.56	93	175	RESULT OF DISCREPANCY RESOLUTION
DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
	8	50												>> POSITIVE ID ESTABLISHED <<
	8	50	TSH	TSH	720-ZC	DIM	TSH	1295.00	.00	0	100.00	105	175	RESULT OF DISCREPANCY RESOLUTION
	8	50	TSH	TSH	720-ZC	MAI	TSH	.31	.00	4	1.28	107	177	>> POSITIVE ID ESTABLISHED <<
	8	50	TSH	TSH	720-ZC	DIM	TSH	1445.00	.00	0	100.00	130	177	
	8	50	1C	TEC	720-EL	NDO				1		178		RESULT OF DISCREPANCY RESOLUTION
94-Feb	8	50			0	PLG	TEC	.00	.00			15		
94-Feb	8	50			0	PLG	TEH	.00	.00			70		
	16	71	TEH	TEC	720-EL	DIC	TEH	20.44	.00	M1	1.18	31	12	RESULT OF DISCREPANCY RESOLUTION
	16	71												RETEST - RETEST FOR POSITIVE ID
	16	71	TEH	TEC	720-EL	DRI	TRH	.00	.00	M1	42.84	176	12	RESULT OF DISCREPANCY RESOLUTION
	16	71	TSH	TEH	720-WC	CRI	TRH	.00	.00	C9	3.09	133	77	RESULT OF DISCREPANCY RESOLUTION
	16	71												RETEST - RETEST FOR POSITIVE ID
	16	71	TSH	TEH	720-WC	COI	TSH	-.66	.00	C9	1.77	48	77	RESULT OF DISCREPANCY RESOLUTION
	16	71												RETEST - RETEST FOR POSITIVE ID
	16	71	TSH	TSH	720-ZC	MAI	TSH	-.73	.00	1	1.35	23	175	RESULT OF DISCREPANCY RESOLUTION
	16	71												>> POSITIVE ID ESTABLISHED <<
	16	71	TSH	TSH	720-ZC	DIM	TSH	1636.00	.00	1	100.00	58	175	RESULT OF DISCREPANCY RESOLUTION
	16	71	TSH	TSH	720-ZC	MAI	TSH	-.69	.00	4	1.07	43	177	>> POSITIVE ID ESTABLISHED <<
	16	71	TSH	TSH	720-ZC	DIM	TSH	1137.00	.00	0	100.00	48	177	
94-Feb	16	71	TSH	TSH	720-ZC	NDO				1		56		
94-Feb	16	71	TEH	TEC	720-EC	DI	TEH	19.53	.00	M1	.41	57	.73	RESULT OF DISCREPANCY RESOLUTION
94-Feb	16	71	TEH	TEC	720-EC	DI	TEH	20.44	.00	M1	.56	47	73	RESULT OF DISCREPANCY RESOLUTION
	39	73	TEH	TEC	720-EL	43	2C	.00	.00	M1	3.87	102	2	RESULT OF DISCREPANCY RESOLUTION
	39	73												RETEST - RETEST FOR POSITIVE ID
	39	73	TSH	TEH	720-WC	NDO				1		79		
	39	73	3C	TEC	720-EL	PID	2C	.00	.00	M1	3.78	109	134	>> POSITIVE ID ESTABLISHED <<
94-Feb	39	73	TSH	TSH	720-ZC	NDO				1		54		
94-Feb	39	73	TEH	TEC	720-EC	27	2C	.00	.00	M1	2.03	115	79	
	33	75	TSH	TEH	720-WC	COI	TSH	-.59	.00	C18	1.79	78	129	RESULT OF DISCREPANCY RESOLUTION
	33	75												RETEST - RETEST FOR POSITIVE ID
	33	75	TSC	TEH	720-EL	DIC	TEH	20.86	.00	M1	.67	49	137	RETEST - RETEST FOR POSITIVE ID
	33	75	TSC	TEH	720-EL	PI	1H	.00	.00	M1	1.27	75	137	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
	33	75	TSC	TEH	720-EL	PI	2H	.00	.00	M1	1.23	92	137	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
	33	75	1C	TEC	720-EL	NDO				1		174		
	33	75	TSH	TSH	720-ZC	MAI	TSH	-.55	.00	4	.25	125	175	>> POSITIVE ID ESTABLISHED <<
	33	75	TSH	TSH	720-ZC	DIM	TSH	1105.00	.00	0	100.00	68	175	
94-Feb	33	75			0	PLG	TEH	.00	.00			52		
94-Feb	33	75			0	PLG	TEC	.00	.00			79		

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
------	-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------

D. C. Cook U1R95

AEP -14/51

INSPECTION: August 95

20-Sep-95 20:11

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
	29	81	TEH	TEC	720-EL	55	2C	.00	.00	M1	3.56	91	22	RESULT OF DISCREPANCY RESOLUTION
	29	81												RETEST - RETEST FOR POSITIVE ID
	29	81	TSH	TEH	720-WC	NDD				1			85	
	29	81	TEH	TEC	720-EL	PID	2C	.00	.00	M1	3.83	96	136	>> POSITIVE ID ESTABLISHED <<
94-Feb	29	81	TSH	TSH	720-ZC	NDD				1			48	
94-Feb	29	81	TEC	TEH	720-EC	38	2C	.00	.00	M1	2.02	105	86	RESULT OF DISCREPANCY RESOLUTION
	30	83	TEH	TEC	720-EL	51	2C	.09	.00	M1	4.56	97	24	RESULT OF DISCREPANCY RESOLUTION
	30	83												RETEST - RETEST FOR POSITIVE ID
	30	83	TSH	TEH	720-WC	NDD				1			87	
	30	83	3C	TEC	720-EL	PID	2C	.06	.00	M1	4.95	95	134	>> POSITIVE ID ESTABLISHED <<
94-Feb	30	83	TSH	TSH	720-ZC	NDD				1			48	
94-Feb	30	83	TEC	TEH	720-EC	37	2C	.00	.00	M1	1.98	106	86	RESULT OF DISCREPANCY RESOLUTION
	26	85	TEH	TEC	720-EL	45	1C	.00	.00	M1	1.66	98	30	RETEST - RETEST FOR POSITIVE ID
	26	85	TSH	TEH	720-WC	NDD				1			87	
	26	85	2C	TEC	720-EL	PID	1C	.00	.00	M1	1.75	106	134	>> POSITIVE ID ESTABLISHED <<
94-Feb	26	85	TSH	TSH	720-ZC	NDD				1			46	
94-Feb	26	85	TEC	TEH	720-EC	NDD				1			88	
94-Feb	26	85	7H	TEH	640-ZU	NDD				1			100	
	26	86	TEH	TEC	720-EL	PI	2H	.00	.00	M1	.73	63	30	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
	26	86	TEH	TEC	720-EL	48	2C	.00	.00	M1	3.48	95	30	RETEST - RETEST FOR POSITIVE ID
	26	86	TSH	TEH	720-WC	NDD				1			89	
	26	86	3C	TEC	720-EL	PID	2C	.00	.00	M1	3.30	105	134	>> POSITIVE ID ESTABLISHED <<
94-Feb	26	86	TSH	TSH	720-ZC	NDD				1			46	
94-Feb	26	86	TEC	TEH	720-EC	PIN	2H	.00	.00	M1	1.03	68	88	VOLTAGE VALUE ADDED FROM GROWTH RATE RE-ANALYSIS
94-Feb	26	86	TEC	TEH	720-EC	38	2C	.00	.00	M1	2.28	105	88	
94-Feb	26	86	7H	TEH	640-ZU	PIN	2H	.00	.00	P1	.88	62	100	VOLTAGE TAKEN FROM CONAM DATA RECORD
94-Feb	26	86	2H	2H	720-ZC	NDD				1			106	
	24	87	TEH	TEC	720-EL	17	AV2	.00	.00	M2	.41		34	
	24	87	TEH	TEC	720-EL	25	2C	-.27	.00	M1	1.57	120	34	
	24	87	TEH	TEC	720-EL	47	1C	-.18	.00	M1	1.68	103	34	RESULT OF DISCREPANCY RESOLUTION
	24	87												RETEST - RETEST FOR POSITIVE ID
	24	87	TSH	TEH	720-WC	NDD				1			89	
	24	87	2C	TEC	720-EL	PID	1C	-.18	.00	M1	1.62	106	134	>> POSITIVE ID ESTABLISHED <<
94-Feb	24	87	TSH	TSH	720-ZC	NDD				1			46	
94-Feb	24	87	TEC	TEH	720-EC	18	AV2	.00	.00	M2	.38		88	
94-Feb	24	87	TEC	TEH	720-EC	8	2C	.00	.00	M1	.92	124	88	
DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



D. C. Cook U1R95

AEP -14/51

INSPECTION: August 95

20-Sep-95 20:11

DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
	16	91	TEH	TEC	720-EL	47	2C	-.09	.00	M1	3.33	102	38	RETEST - RETEST FOR POSITIVE ID
	16	91	TEH	TEC	720-EL	45	1C	.00	.00	M1	1.51	104	38	RESULT OF DISCREPANCY RESOLUTION
	16	91												RETEST - RETEST FOR POSITIVE ID
	16	91	TSH	TEH	720-WC	NDD				1			95	
	16	91	3C	TEC	720-EL	PID	2C	-.09	.00	M1	3.15	100	134	>> POSITIVE ID ESTABLISHED <<
	16	91	3C	TEC	720-EL	PID	1C	.00	.00	M1	1.37	114	134	>> POSITIVE ID ESTABLISHED <<
94-Feb	16	91	TSH	TSH	720-ZC	NDD				1			46	
94-Feb	16	91	TEC	TEH	720-EC	28	2C	.08	.00	M1	1.63	111	90	
94-Feb	16	91	TEC	TEH	720-EC	23	1C	.00	.00	M1	.89	114	90	
DATE	ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

PAGE 7

TOTAL TUBES 25

ATTACHMENT 2
STEAM GENERATOR ANNUAL OPERATING REPORT

SECTION 2: Unit 1 Tube Repairs

d.2 Tubes Repaired Using F* Reroll Technique in SG #14

SG - 14

Row Col

TUBES RECOVERED VIA RE-ROLL

7	8
7	9
1	11
7	11
14	11
13	12
15	13
12	14
19	14
1	15
2	15
7	16
14	17
18	17
22	17
3	18
15	18
17	18
3	19
7	19
16	19
17	19
19	20
20	20
22	20
34	20
35	20
13	21
17	21
21	21
22	21
3	22
11	22
17	22
7	23
15	23
17	23
3	24
9	24
16	24
21	24
15	25
19	25
20	25
22	25
38	25
12	26
14	26
15	26
20	26



09-18-1995 13:51:59

SG - 14

Row	Col	TUBES RECOVERED VIA RE-ROLL
6	28	
21	29	
16	30	
21	30	
2	31	
6	31	
18	31	
10	32	
13	32	
15	32	
20	32	
21	32	
35	32	
8	33	
3	34	
15	34	
4	35	
10	35	
13	35	
16	35	
34	35	
20	36	
9	37	
8	38	
4	40	
22	40	
14	41	
12	44	
19	44	
15	45	
15	46	
35	47	
7	48	
18	48	
3	49	
7	49	
15	50	
12	51	
13	51	
18	52	
22	53	
7	54	
13	54	
18	54	
46	54	
13	55	
14	56	
22	56	
7	57	
35	60	

SG -- 14

Row Col

TUBES RECOVERED VIA RE-ROLL

18	64
22	66
3	67
14	68
20	69
12	70
12	74
7	81
4	94

>> Total Tubes = 109

D. C. Cook U1R95

AEP -14/51

INSPECTION: August 95

21-Sep-95 17:15

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
7	8	TRH	TEH	720-RB MAI	TEH		2.38	.00	1	.79	17	147	-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	9	TRH	TEH	720-RB SAI	TEH		2.50	.00	1	.34	24	147	>> POSITIVE ID ESTABLISHED <<
7	9												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	10	TSH	TSH	720-ZC MAI	TSH		-1.10	.00	4	3.61	19	173	RESULT OF DISCREPANCY RESOLUTION
16	10												>> POSITIVE ID ESTABLISHED <<
1	11	TRH	TEH	720-RB MAI	TEH		2.29	.00	1	.54	143	147	>> POSITIVE ID ESTABLISHED <<
1	11												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	11	TRH	TEH	720-RB MAI	TEH		1.96	.00	1	.67	24	147	>> POSITIVE ID ESTABLISHED <<
7	11												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	11	TRH	TEH	720-RB MAI	TEH		2.18	.00	1	3.07	18	147	>> POSITIVE ID ESTABLISHED <<
14	11												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	12	TRH	TEH	720-RB MAI	TEH		2.21	.00	1	1.07	7	147	>> POSITIVE ID ESTABLISHED <<
13	12												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	13	TRH	TEH	720-RB MAI	TEH		2.15	.00	1	1.02	8	147	RESULT OF LAR
15	13												>> POSITIVE ID ESTABLISHED <<
15	13												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	14	TRH	TEH	720-RB MAI	TEH		2.41	.00	1	.93	20	147	>> POSITIVE ID ESTABLISHED <<
12	14												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	14	TRH	TEH	720-RB MAI	TEH		2.20	.00	1	1.72	14	147	>> POSITIVE ID ESTABLISHED <<
19	14												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
1	15	TRH	TEH	720-RB MAI	TEH		.89	.00	1	4.23	19	147	>> POSITIVE ID ESTABLISHED <<
1	15												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	15	TRH	TEH	720-RB MAI	TEH		1.08	.00	1	.35	46	147	>> POSITIVE ID ESTABLISHED <<
2	15												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	16	TRH	TEH	720-RB SAI	TEH		2.54	.00	1	.55	22	147	>> POSITIVE ID ESTABLISHED <<
7	16												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	17	TRH	TEH	720-RB MAI	TEH		2.46	.00	1	2.06	10	147	>> POSITIVE ID ESTABLISHED <<
14	17												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	17	TRH	TEH	720-RB MAI	TEH		2.53	.00	1	.76	7	147	>> POSITIVE ID ESTABLISHED <<
18	17												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	17	TRH	TEH	720-RB MAI	TEH		2.25	.00	1	.83	188	147	>> POSITIVE ID ESTABLISHED <<
22	17												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
3	18	TRH	TEH	720-RB	SAI	TEH	2.39	.00	1	1.28	12	147	>> POSITIVE ID ESTABLISHED <<
3	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	18	TSH	TSH	720-ZC	MAI	TSH	-.88	.00	4	.73	14	173	RESULT OF DISCREPANCY RESOLUTION
8	18												>> POSITIVE ID ESTABLISHED <<
15	18	TRH	TEH	720-RB	SAI	TEH	2.51	.00	1	.54	14	147	>> POSITIVE ID ESTABLISHED <<
15	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	18	TRH	TEH	720-RB	MAI	TEH	2.46	.00	1	1.13	15	147	RESULT OF DISCREPANCY RESOLUTION
17	18												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	19	TRH	TEH	720-RB	MAI	TEH	2.31	.00	1	.99	23	147	>> POSITIVE ID ESTABLISHED <<
3	19												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	19	TRH	TEH	720-RB	MAI	TEH	2.62	.00	1	.29	29	147	>> POSITIVE ID ESTABLISHED <<
7	19												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	19	TRH	TEH	720-RB	MAI	TEH	2.65	.00	1	1.21	17	147	>> POSITIVE ID ESTABLISHED <<
16	19												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	19	TRH	TEH	720-RB	MAI	TEH	2.80	.00	1	.76	5	147	>> POSITIVE ID ESTABLISHED <<
17	19												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	20	TRH	TEH	720-RB	MAI	TEH	2.82	.00	1	.81	11	147	>> POSITIVE ID ESTABLISHED <<
19	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	20	TRH	TEH	720-RB	MAI	TEH	2.77	.00	1	1.52	14	147	>> POSITIVE ID ESTABLISHED <<
20	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	20	TRH	TEH	720-RB	SAI	TEH	2.02	.00	1	1.38	8	147	>> POSITIVE ID ESTABLISHED <<
22	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
34	20	TRH	TEH	720-RB	MAI	TEH	2.20	.00	1	1.61	14	147	>> POSITIVE ID ESTABLISHED <<
34	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
35	20	TRH	TEH	720-RB	MAI	TEH	2.16	.00	1	2.23	13	147	>> POSITIVE ID ESTABLISHED <<
35	20												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	21	TRH	TEH	720-RB	MAI	TEH	2.53	.00	1	2.17	25	147	RESULT OF DISCREPANCY RESOLUTION
13	21												>> POSITIVE ID ESTABLISHED <<
13	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	21	TRH	TEH	720-RB	MAI	TEH	2.62	.00	1	1.96	21	147	>> POSITIVE ID ESTABLISHED <<
17	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	21	TRH	TEH	720-RB	SAI	TEH	2.70	.00	1	.74	20	147	>> POSITIVE ID ESTABLISHED <<
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
21	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	21	TRH	TEH	720-RB	MAI	TEH	2.75	.00	1	.94	16	147	>> POSITIVE ID ESTABLISHED <<
22	21												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	22	TRH	TEH	720-RB	SAI	TEH	2.34	.00	1	.20	55	147	>> POSITIVE ID ESTABLISHED <<
3	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
11	22	TRH	TEH	720-RB	SAI	TEH	2.83	.00	1	.72	15	147	>> POSITIVE ID ESTABLISHED <<
11	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	22	TRH	TEH	720-RB	MAI	TEH	2.64	.00	1	1.50	23	147	>> POSITIVE ID ESTABLISHED <<
17	22												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	23	TRH	TEH	720-RB	SAI	TEH	2.68	.00	1	.67	21	147	>> POSITIVE ID ESTABLISHED <<
7	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	23	TRH	TEH	720-RB	MAI	TEH	2.84	.00	1	1.70	24	147	>> POSITIVE ID ESTABLISHED <<
15	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
17	23	TRH	TEH	720-RB	MAI	TEH	2.76	.00	1	3.41	19	147	>> POSITIVE ID ESTABLISHED <<
17	23												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	24	TRH	TEH	720-RB	MAI	TEH	2.55	.00	1	.45	40	147	>> POSITIVE ID ESTABLISHED <<
3	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	24	TRH	TEH	720-RB	MAI	TEH	2.69	.00	1	.91	19	147	>> POSITIVE ID ESTABLISHED <<
9	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	24	TRH	TEH	720-RB	MAI	TEH	2.58	.00	1	.87	20	147	>> POSITIVE ID ESTABLISHED <<
16	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	24	TRH	TEH	720-RB	MAI	TEH	2.55	.00	1	.68	20	147	>> POSITIVE ID ESTABLISHED <<
21	24												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	25	TRH	TEH	720-RB	SAI	TEH	2.70	.00	1	.54	14	147	>> POSITIVE ID ESTABLISHED <<
15	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	25	TRH	TEH	720-RB	MAI	TEH	2.49	.00	1	1.93	27	147	RESULT OF LAR
19	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	25	TRH	TEH	720-RB	MAI	TEH	2.69	.00	1	3.64	16	147	>> POSITIVE ID ESTABLISHED <<
20	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	25	TRH	TEH	720-RB	MAI	TEH	2.79	.00	1	1.09	15	147	>> POSITIVE ID ESTABLISHED <<
22	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
38	25	TRH	TEH	720-RB	MAI	TEH	2.16	.00	1	1.08	190	147	>> POSITIVE ID ESTABLISHED <<
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



D. C. Cook U1R95

AEP -14/51

INSPECTION: August 95

21-Sep-95 17:15

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
38	25												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	26	TRH	TEH	720-RB MAI TEH			2.49	.00	1	1.55	17	147	>> POSITIVE ID ESTABLISHED <<
12	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	26	TRH	TEH	720-RB MAI TEH			2.74	.00	1	.18	43	147	>> POSITIVE ID ESTABLISHED <<
14	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	26	TRH	TEH	720-RB MAI TEH			2.66	.00	1	1.81	24	147	>> POSITIVE ID ESTABLISHED <<
15	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	26	TRH	TEH	720-RB SAI TEH			2.39	.00	1	1.10	15	151	>> POSITIVE ID ESTABLISHED <<
20	26												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	28	TRH	TEH	720-RB MAI TEH			2.59	.00	1	1.10	27	147	>> POSITIVE ID ESTABLISHED <<
6	28												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	28	TSH	TSH	720-ZC MAI TSH			-1.06	.00	4	.74	110	173	RESULT OF DISCREPANCY RESOLUTION
19	28												>> POSITIVE ID ESTABLISHED <<
19	28	TSH	TSH	720-ZC MAI TSH			-1.02	.00	4	.69	98	177	>> POSITIVE ID ESTABLISHED <<
21	29	TRH	TEH	720-RB SAI TEH			2.18	.00	1	.58	22	145	>> POSITIVE ID ESTABLISHED <<
21	29												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	30	TSH	TSH	720-ZC SAI TSH			-.95	.00	4	.27	82	173	RESULT OF DISCREPANCY RESOLUTION
3	30												>> POSITIVE ID ESTABLISHED <<
16	30	TRH	TEH	720-RB SAI TEH			2.30	.00	1	5.02	12	145	>> POSITIVE ID ESTABLISHED <<
16	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	30	TRH	TEH	720-RB SAI TEH			2.72	.00	1	4.16	20	147	>> POSITIVE ID ESTABLISHED <<
16	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	30	TRH	TEH	720-RB MAI TEH			2.61	.00	1	.95	14	145	>> POSITIVE ID ESTABLISHED <<
21	30												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
2	31	TRH	TEH	720-RB MAI TEH			2.33	.00	1	1.14	25	147	>> POSITIVE ID ESTABLISHED <<
2	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
6	31	TRH	TEH	720-RB SAI TEH			2.49	.00	1	1.04	15	147	>> POSITIVE ID ESTABLISHED <<
6	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	31	TRH	TEH	720-RB SAI TEH			2.70	.00	1	1.15	177	181	>> POSITIVE ID ESTABLISHED <<
18	31												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	32	TRH	TEH	720-RB MAI TEH			2.57	.00	1	.29	21	147	>> POSITIVE ID ESTABLISHED <<
10	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	32	TRH	TEH	720-RB MAI TEH			2.30	.00	1	1.04	10	147	>> POSITIVE ID ESTABLISHED <<
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

D. C. Cook U1R95

AEP -14/51

INSPECTION: August 95

21-Sep-95 17:15

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
13	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	32	TRH	TEH	720-RB	SAI	TEH	2.31	.00	1	.34	15	147	>> POSITIVE ID ESTABLISHED <<
15	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	32	TRH	TEH	720-RB	MAI	TEH	2.96	.00	1	1.75	17	181	>> POSITIVE ID ESTABLISHED <<
20	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
21	32	TRH	TEH	720-RB	MAI	TEH	2.48	.00	1	2.53	14	145	>> POSITIVE ID ESTABLISHED <<
21	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
35	32	TRH	TEH	720-RB	MAI	TEH	2.50	.00	1	1.17	13	147	>> POSITIVE ID ESTABLISHED <<
35	32												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	33	TRH	TEH	720-RB	SAI	TEH	2.30	.00	1	.72	10	147	>> POSITIVE ID ESTABLISHED <<
8	33												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	33	TSH	TSH	720-ZC	MAI	TSH	-.02	.00	4	.23	34	173	RESULT OF DISCREPANCY RESOLUTION
14	33												>> POSITIVE ID ESTABLISHED <<
3	34	TRH	TEH	720-RB	SAI	TEH	2.63	.00	1	1.72	12	147	>> POSITIVE ID ESTABLISHED <<
3	34												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	34	TRH	TEH	720-RB	MAI	TEH	2.44	.00	1	.93	12	147	>> POSITIVE ID ESTABLISHED <<
15	34												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	35	TRH	TEH	720-RB	MAI	TEH	2.31	.00	1	.49	22	147	>> POSITIVE ID ESTABLISHED <<
4	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
10	35	TRH	TEH	720-RB	SAI	TEH	2.49	.00	1	.99	9	147	>> POSITIVE ID ESTABLISHED <<
10	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	35	TRH	TEH	720-RB	MAI	TEH	2.57	.00	1	4.54	9	147	>> POSITIVE ID ESTABLISHED <<
13	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	35	TRH	TEH	720-RB	MAI	TEH	2.71	.00	1	3.65	22	147	>> POSITIVE ID ESTABLISHED <<
16	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
34	35	TRH	TEH	720-RB	MAI	TEH	2.74	.00	1	1.28	18	147	>> POSITIVE ID ESTABLISHED <<
34	35												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
20	36	TRH	TEH	720-RB	MAI	TEH	2.63	.00	1	.78	13	147	>> POSITIVE ID ESTABLISHED <<
20	36												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
9	37	TRH	TEH	720-RB	MAI	TEH	2.67	.00	1	1.10	11	147	>> POSITIVE ID ESTABLISHED <<
9	37												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	38	TRH	TEH	720-RB	MAI	TEH	2.54	.00	1	2.25	12	147	>> POSITIVE ID ESTABLISHED <<
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



D. C. Cook U1R95

AEP -14/51

INSPECTION: August 95

21-Sep-95 17:15

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
8	38												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	40	TRH	TEH	720-RB	MAI	TEH	2.55	.00	1	.67	14	147	>> POSITIVE ID ESTABLISHED <<
4	40												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	40	TRH	TEH	720-RB	MAI	TEH	2.30	.00	1	.43	18	147	>> POSITIVE ID ESTABLISHED <<
22	40												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	41	TRH	TEH	720-RB	MAI	TEH	2.76	.00	1	1.61	20	147	>> POSITIVE ID ESTABLISHED <<
14	41												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
30	42	TSH	TSH	720-ZC	SAI	TSH	-.93	.00	4	1.06	40	173	RESULT OF DISCREPANCY RESOLUTION
30	42												>> POSITIVE ID ESTABLISHED <<
12	44	TRH	TEH	720-RB	MAI	TEH	2.67	.00	1	.97	13	147	>> POSITIVE ID ESTABLISHED <<
12	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
19	44	TRH	TEH	720-RB	MAI	TEH	2.62	.00	1	3.19	192	147	>> POSITIVE ID ESTABLISHED <<
19	44												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	45	TRH	TEH	720-RB	MAI	TEH	2.58	.00	1	2.65	20	147	>> POSITIVE ID ESTABLISHED <<
15	45												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
15	46	TRH	TEH	720-RB	MAI	TEH	2.34	.00	1	2.59	20	147	>> POSITIVE ID ESTABLISHED <<
15	46												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
35	47	TRH	TEH	720-RB	MAI	TEH	2.53	.00	1	2.28	18	149	>> POSITIVE ID ESTABLISHED <<
35	47												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	48	TRH	TEH	720-RB	SAI	TEH	2.39	.00	1	1.37	20	145	>> POSITIVE ID ESTABLISHED <<
7	48												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	48	TRH	TEH	720-RB	MAI	TEH	2.49	.00	1	1.72	4	145	>> POSITIVE ID ESTABLISHED <<
18	48												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	49	TRH	TEH	720-RB	MAI	TEH	2.40	.00	1	1.26	26	145	>> POSITIVE ID ESTABLISHED <<
3	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	49	TRH	TEH	720-RB	SAI	TEH	2.39	.00	1	2.00	14	145	>> POSITIVE ID ESTABLISHED <<
7	49												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
8	50	TSH	TSH	720-ZC	MAI	TSH	-.41	.00	4	.58	93	175	RESULT OF DISCREPANCY RESOLUTION
8	50												>> POSITIVE ID ESTABLISHED <<
8	50	TSH	TSH	720-ZC	MAI	TSH	-.31	.00	4	1.28	107	177	>> POSITIVE ID ESTABLISHED <<
15	50	TRH	TEH	720-RB	MAI	TEH	2.43	.00	1	1.49	10	145	>> POSITIVE ID ESTABLISHED <<
15	50												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
12	51	TRH	TEH	720-RB	SAI	TEH	2.42	.00	1	.90	10	145	>> POSITIVE ID ESTABLISHED <<
12	51												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	51	TRH	TEH	720-RB	MAI	TEH	2.56	.00	1	1.76	26	145	>> POSITIVE ID ESTABLISHED <<
13	51												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	52	TRH	TEH	720-RB	MAI	TEH	2.36	.00	1	2.71	13	145	>> POSITIVE ID ESTABLISHED <<
18	52												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	53	TRH	TEH	720-RB	SAI	TEH	2.59	.00	1	2.36	19	145	>> POSITIVE ID ESTABLISHED <<
22	53												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	54	TRH	TEH	720-RB	SAI	TEH	2.43	.00	1	1.33	10	145	>> POSITIVE ID ESTABLISHED <<
13	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	54	TRH	TEH	720-RB	MAI	TEH	2.39	.00	1	2.65	13	145	>> POSITIVE ID ESTABLISHED <<
18	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
46	54	TRH	TEH	720-RB	MAI	TEH	1.24	.00	1	8.99	201	145	>> POSITIVE ID ESTABLISHED <<
46	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
13	55	TRH	TEH	720-RB	MAI	TEH	2.32	.00	1	1.20	9	145	>> POSITIVE ID ESTABLISHED <<
13	55												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	56	TRH	TEH	720-RB	MAI	TEH	2.34	.00	1	2.68	11	145	>> POSITIVE ID ESTABLISHED <<
14	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	56	TRH	TEH	720-RB	MAI	TEH	2.32	.00	1	2.65	18	145	>> POSITIVE ID ESTABLISHED <<
22	56												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
7	57	TRH	TEH	720-RB	MAI	TEH	2.23	.00	1	1.73	18	145	>> POSITIVE ID ESTABLISHED <<
7	57												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
35	60	TRH	TEH	720-RB	MAI	TEH	2.56	.00	1	.86	20	145	>> POSITIVE ID ESTABLISHED <<
35	60												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
18	64	TRH	TEH	720-RB	MAI	TEH	2.50	.00	1	1.37	16	145	>> POSITIVE ID ESTABLISHED <<
18	64												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
22	66	TRH	TEH	720-RB	MAI	TEH	2.53	.00	1	1.92	13	145	>> POSITIVE ID ESTABLISHED <<
22	66												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
3	67	TRH	TEH	720-RB	SAI	TEH	2.41	.00	1	1.16	11	145	>> POSITIVE ID ESTABLISHED <<
3	67												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
14	68	TRH	TEH	720-RB	MAI	TEH	2.26	.00	1	.86	16	145	>> POSITIVE ID ESTABLISHED <<
14	68												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS



ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
20	69	TRH	TEH	720-RB MAI	TEH		2.22	.00	1	2.31	11	145	>> POSITIVE ID ESTABLISHED <<
20	69												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
12	70	TRH	TEH	720-RB SAI	TEH		2.50	.00	1	.82	10	145	>> POSITIVE ID ESTABLISHED <<
12	70												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
16	71	TSH	TSH	720-ZC MAI	TSH		-.73	.00	1	1.35	23	175	RESULT OF DISCREPANCY RESOLUTION
16	71												>> POSITIVE ID ESTABLISHED <<
16	71	TSH	TSH	720-ZC MAI	TSH		-.69	.00	4	1.07	43	177	>> POSITIVE ID ESTABLISHED <<
12	74	TRH	TEH	720-RB MAI	TEH		2.15	.00	1	1.76	15	145	>> POSITIVE ID ESTABLISHED <<
12	74												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
33	75	TSH	TSH	720-ZC MAI	TSH		-.55	.00	4	.25	125	175	>> POSITIVE ID ESTABLISHED <<
7	81	TRH	TEH	720-RB SAI	TEH		2.71	.00	1	2.42	10	181	>> POSITIVE ID ESTABLISHED <<
7	81												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
4	94	TRH	TEH	720-RB MAI	TEH		2.74	.00	1	1.13	12	153	>> POSITIVE ID ESTABLISHED <<
4	94												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
-----	-----	-----	-----	-------	-----	-----	-------	-------	------	-------	-----	------	----------



D. C. Cook U1R95

AEP -14/51

INSPECTION: August 95

21-Sep-95 17:17

ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
7	54	TRH	TEH	720-RB	COI	TEH	2.45	.00	1	1.24	25	145	>> POSITIVE ID ESTABLISHED <<
7	54												-1995 REROLL SUCCESSFUL - REMOVED FROM PLUG LIST
ROW	COL	CEB	CEE	PROBE	IND	LOC	INCH1	INCH2	CHAN	VOLTS	DEG	TAPE	COMMENTS
PAGE 1													TOTAL TUBES 1

